



Test Report N° 200611-04.TR38

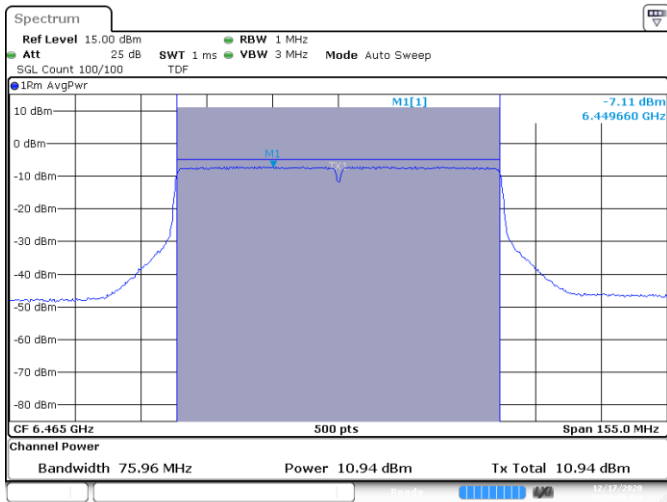


Date: 17 DEC 2010 10:50:10

SISO A-802.11ac-80MHz-Ch103-6465MHz-VHT0

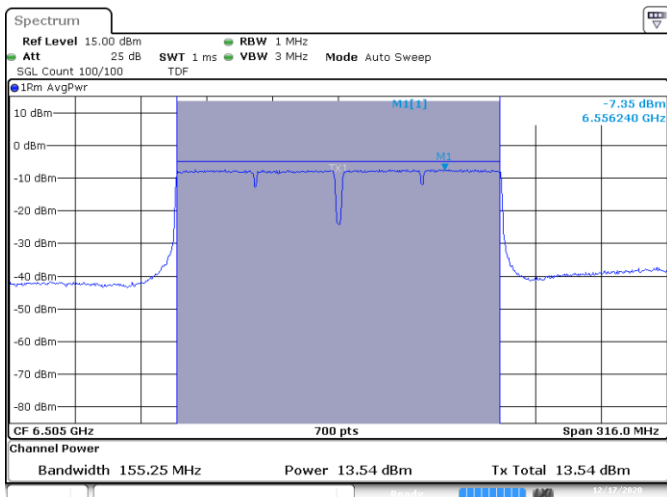


Date: 17 DEC 2010 10:51:22

SISO A-802.11ac-160MHz-Ch111-6505MHz-VHT0

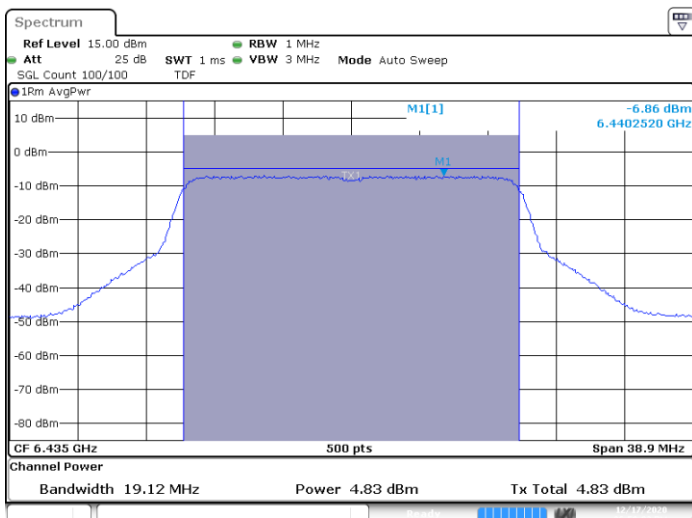


SISO B-802.11ax-20MHz-Ch97-6435MHz-HE0

Test Report N° 200611-04.TR38

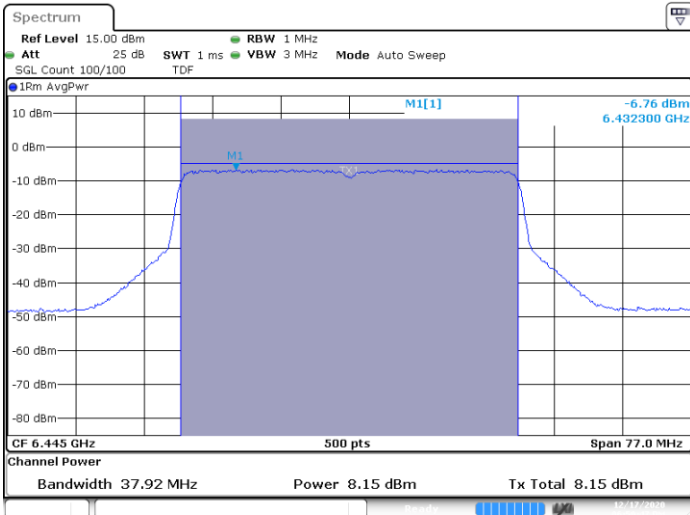


SISO B-802.11ax-40MHz-Ch99-6445MHz-HE0

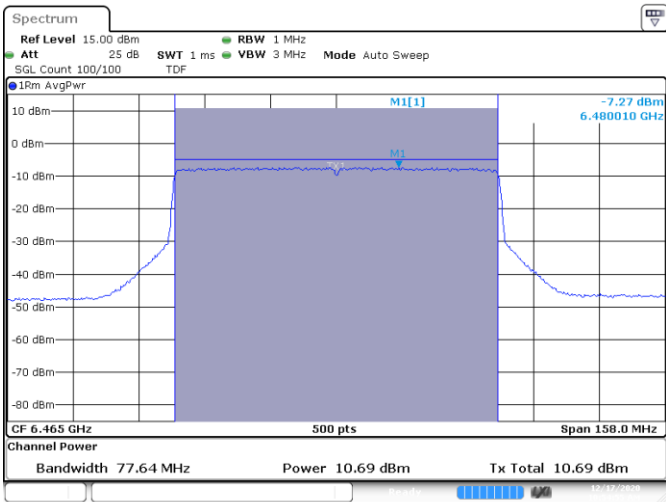


Date: 17.DEC.2020 10:54:55

SISO A-802.11ax-80MHz-Ch103-6465MHz-HE0

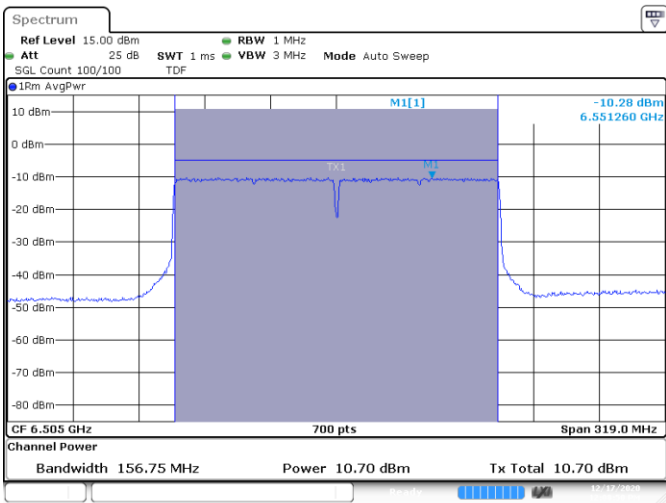


Date: 17.DEC.2020 12:08:50


MIMO A-802.11ax-160MHz-Ch111-6505MHz-HE0

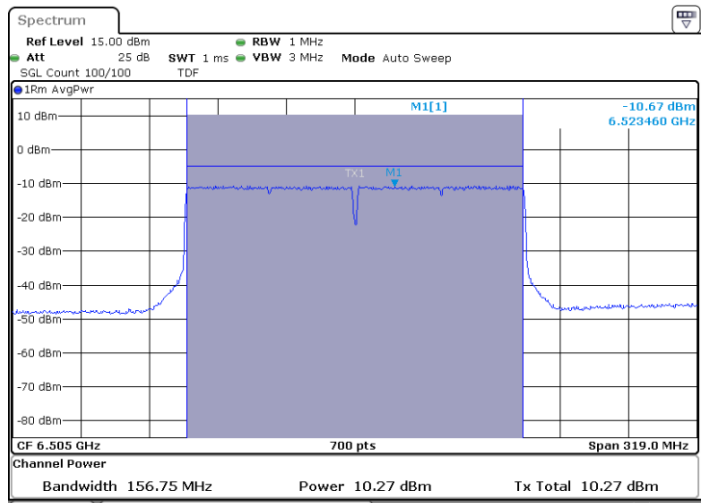


MIMO B-802.11ax-160MHz-Ch111-6505MHz-HE0

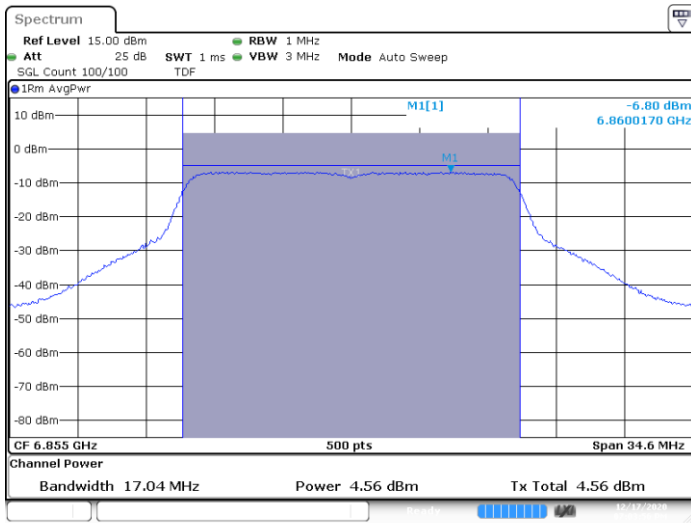UNI17

SISO B-802.11a-20MHz-Ch181-6855MHz-6

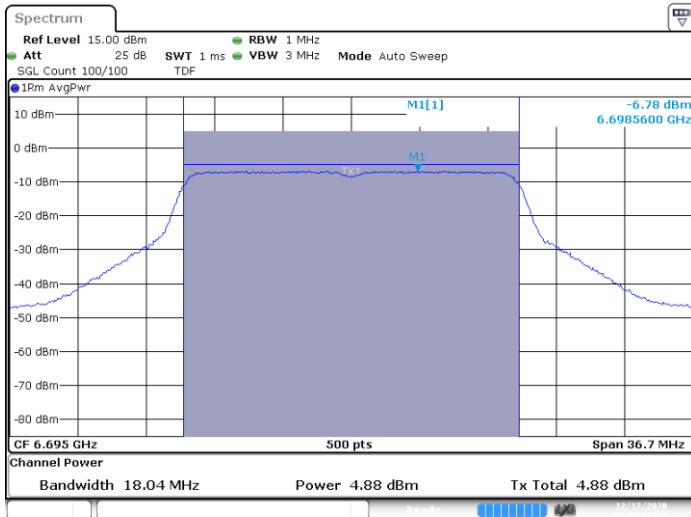


SISO B-802.11n-20MHz-Ch149-6695MHz-HT0

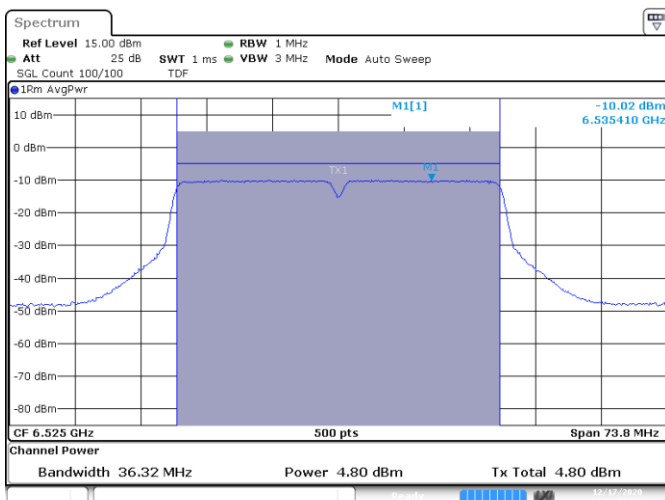


Date: 17 DEC 2010 12:11:13

MIMO A-802.11n-40MHz-Ch115-6525MHz-HT8

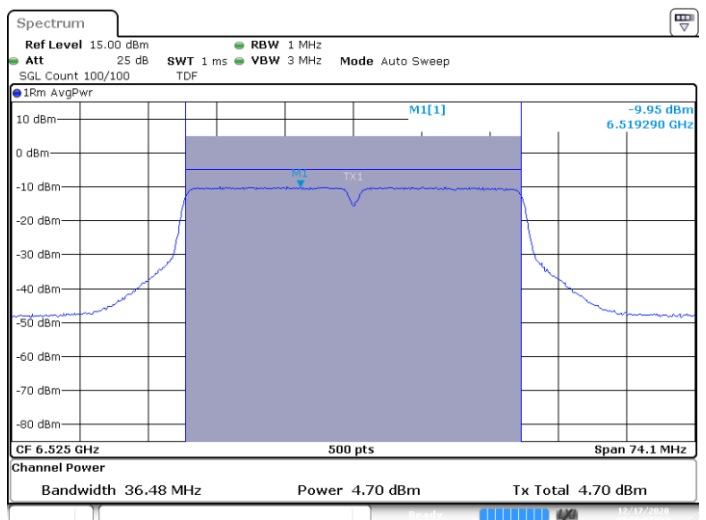


MIMO B-802.11n-40MHz-Ch115-6525MHz-HT8

Test Report N° 200611-04.TR38

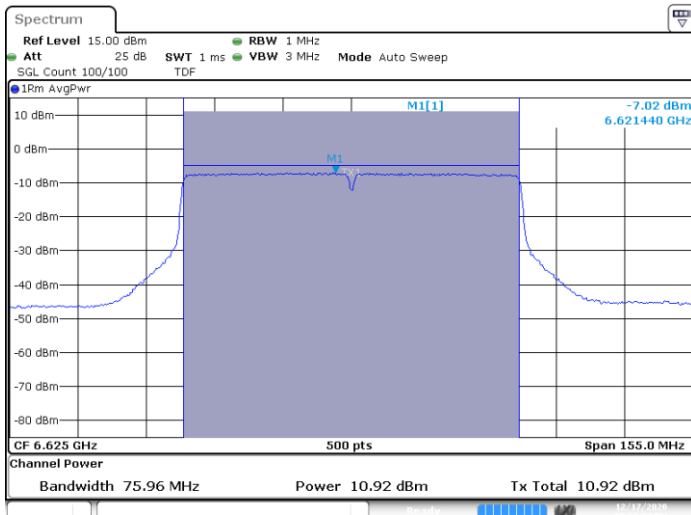


SISO B-802.11ac-80MHz-Ch135-6625MHz-VHT0

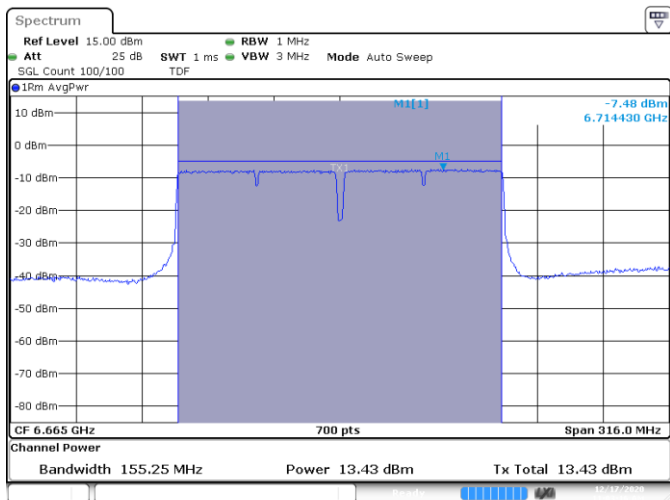


Date: 17 DEC 2020 11:03:16

SISO A-802.11ac-160MHz-Ch143-6665MHz-VHT0

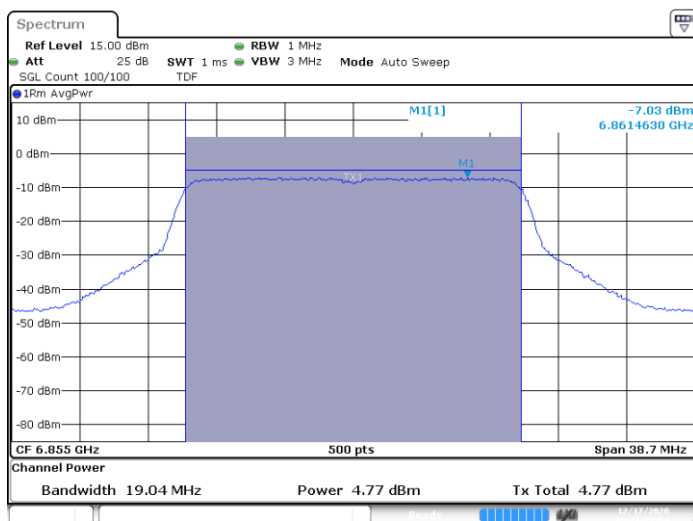


SISO B-802.11ax-20MHz-Ch181-6855MHz-HE0


Test Report N° 200611-04.TR38

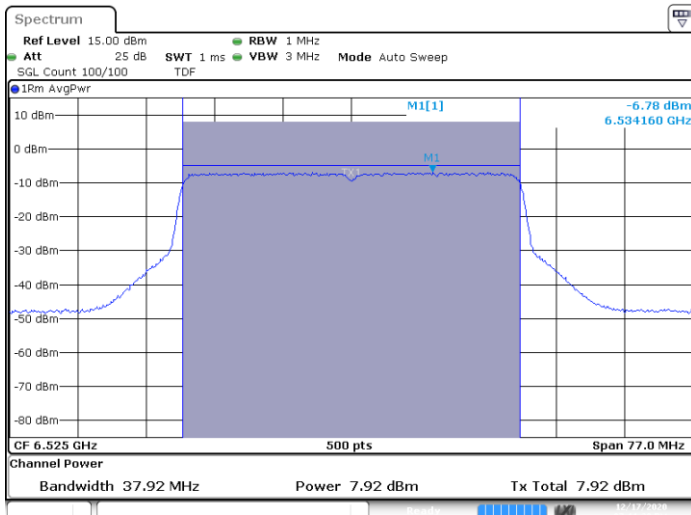


SISO B-802.11ax-40MHz-Ch115-6525MHz-HE0

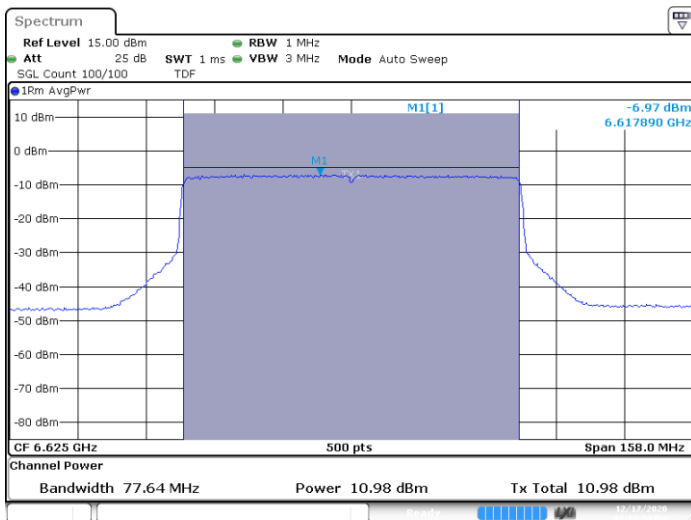

SISO A-802.11ax-80MHz-Ch135-6625MHz-HE0

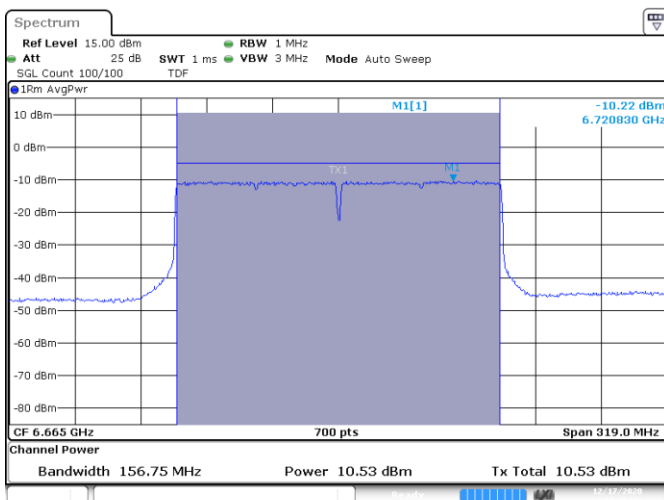


MIMO A-802.11ax-160MHz-Ch143-6665MHz-HE0

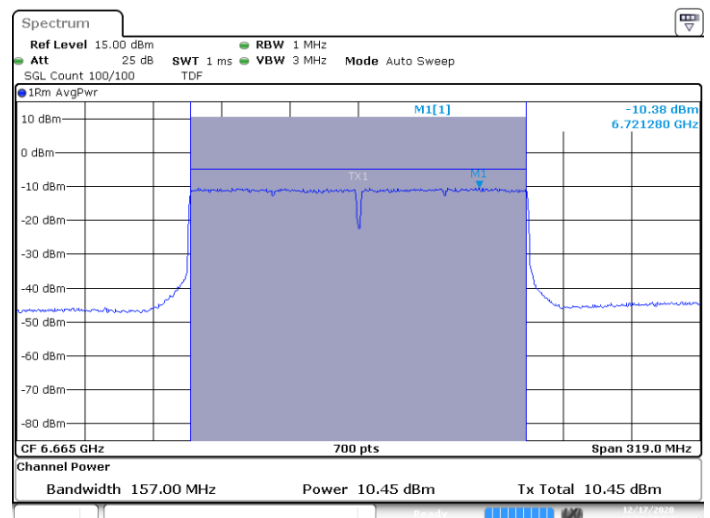


MIMO B-802.11ax-160MHz-Ch143-6665MHz-HE0

Date: 17 DEC 2020 12:19:36


Test Report N° 200611-04.TR38

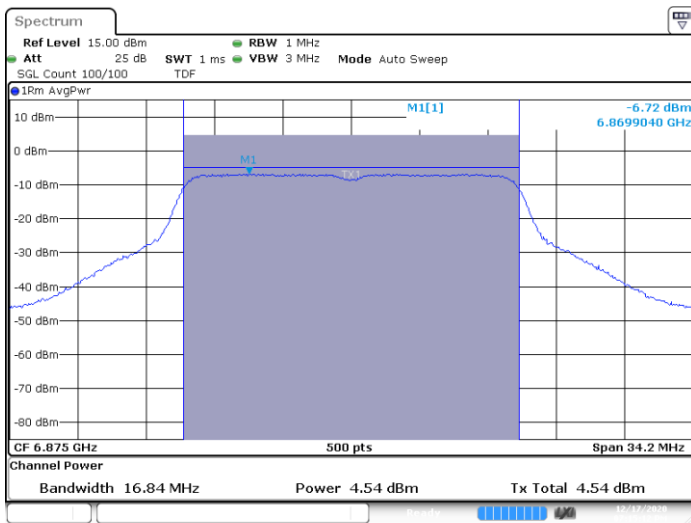UNI18

SISO B-802.11a-20MHz-Ch185-6875MHz-6

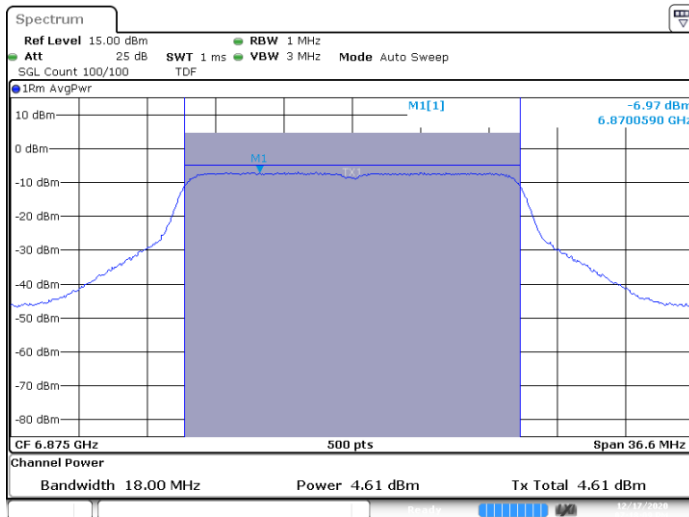


SISO B-802.11n-20MHz-Ch185-6875MHz-HT0

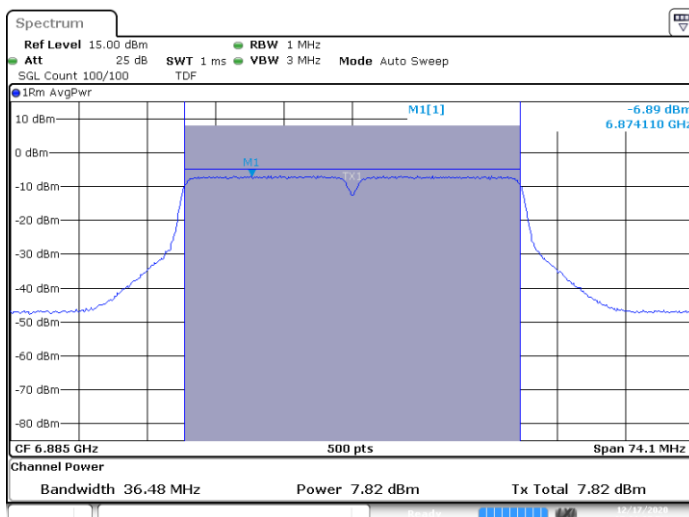


SISO B-802.11n-40MHz-Ch187-6885MHz-HT0

Test Report N° 200611-04.TR38

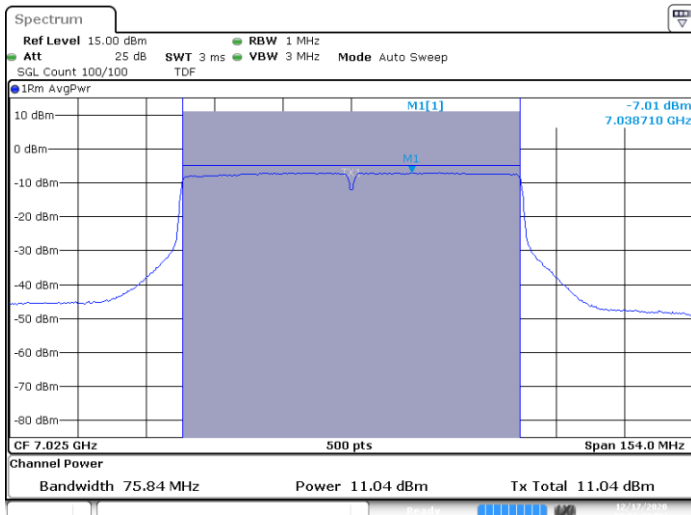


SISO B-802.11ac-80MHz-Ch215-7025MHz-VHT0

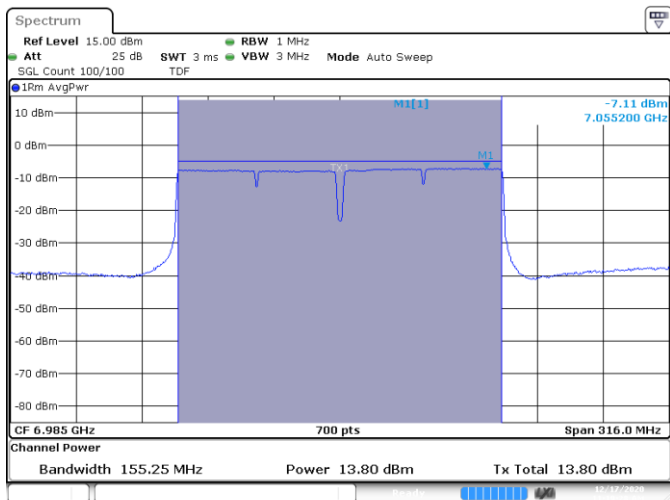


Date: 17 DEC 2020 11:19:28

SISO A-802.11ac-160MHz-Ch207-6985MHz-VHT0

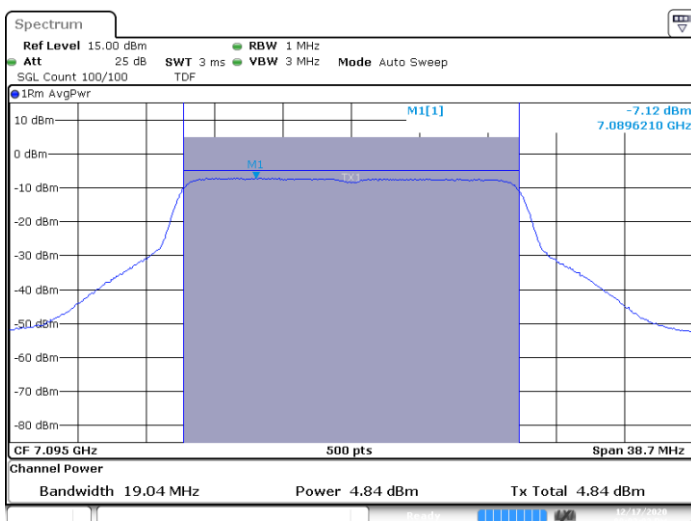


SISO B-802.11ax-20MHz-Ch229-7095MHz-HE0

Test Report N° 200611-04.TR38

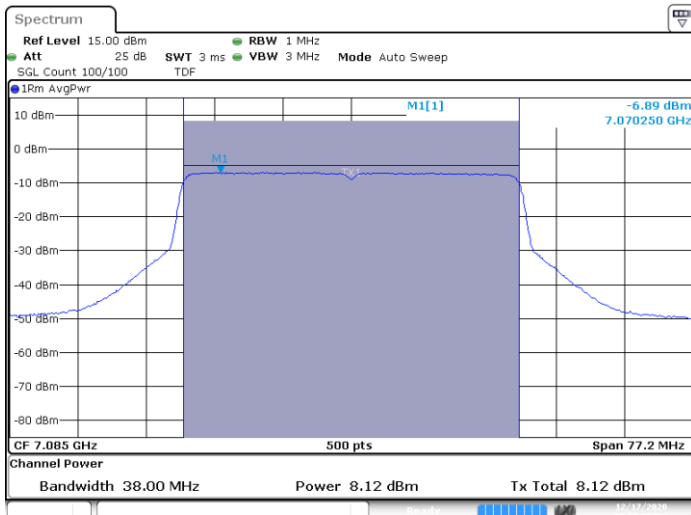


SISO B-802.11ax-40MHz-Ch227-7085MHz-HE0

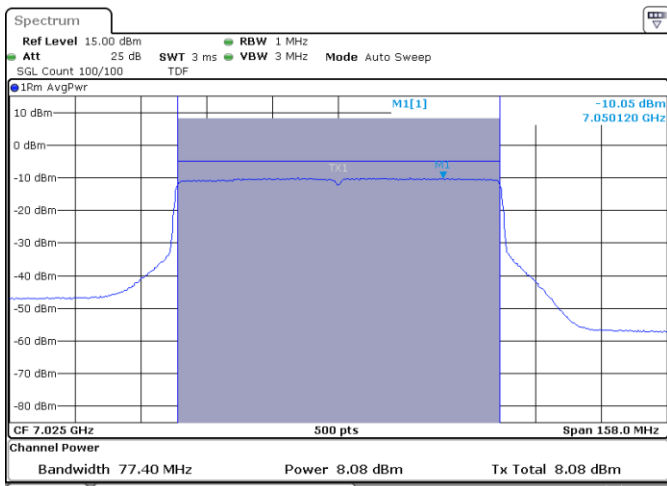


Date: 17.DEC.2020 13:35:29

MIMO A-802.11ax-80MHz-Ch215-7025MHz-HE0

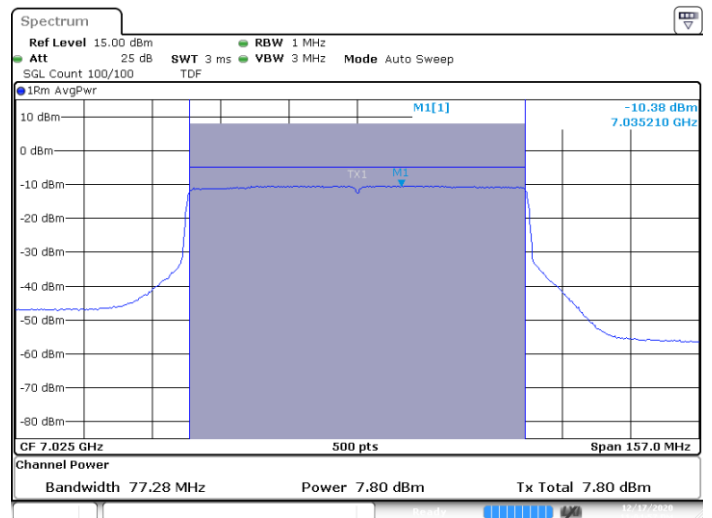

MIMO B-802.11ax-80MHz-Ch215-7025MHz-HE0

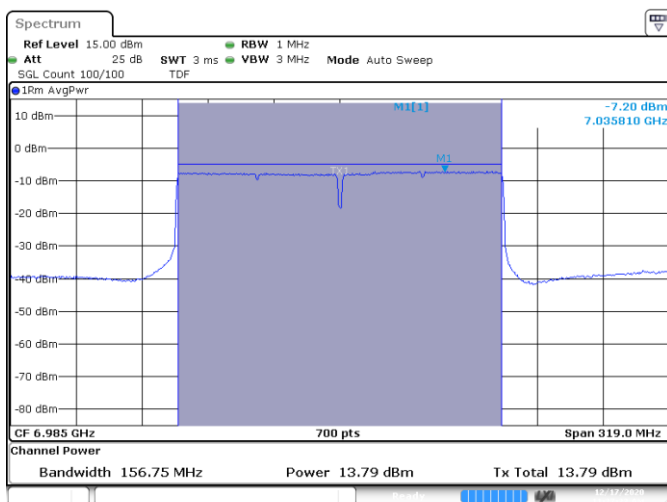


Date: 17.DEC.2020 11:27:34

SISO A-802.11ax-160MHz-Ch207-6985MHz-HE0


C.1.3 In-Band Emissions (Mask)

SISO-A, 802.11a, 6Mbps

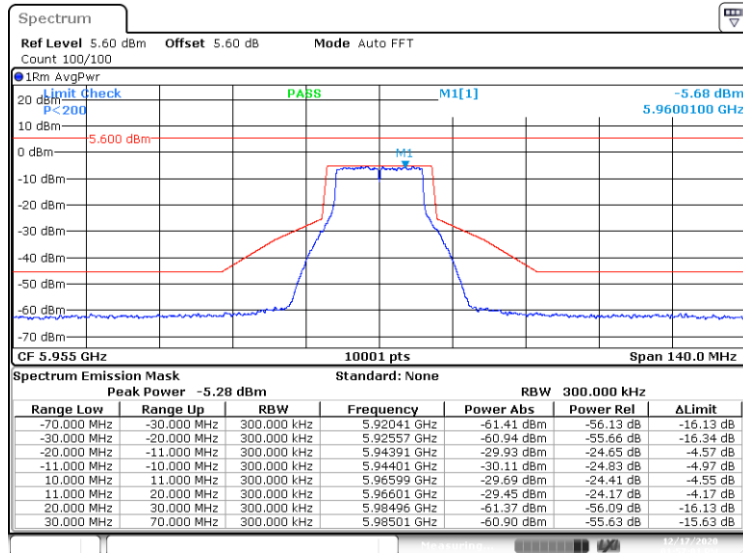


Channel 1

SISO-B, 802.11n20, HT0

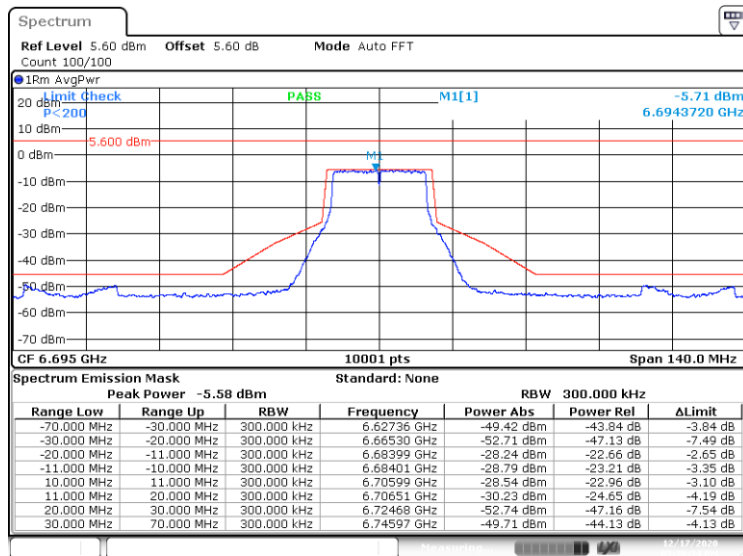


Channel 149

SISO-B, 802.11n40, HT0

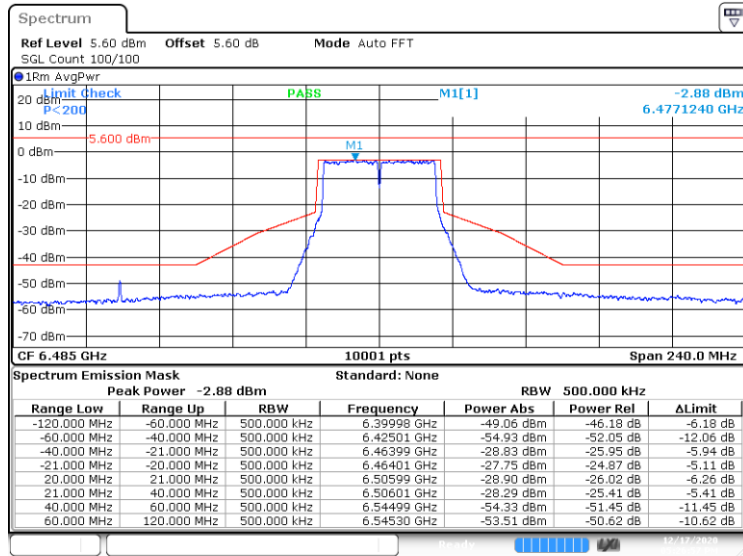


Channel 107

SISO-B, 802.11ac80, VHT0

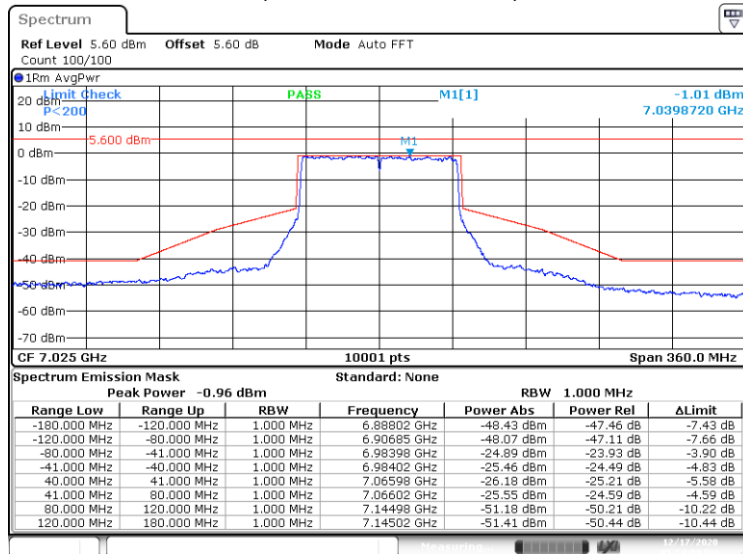


Channel 215

SISO-A, 802.11ac160, VHT0

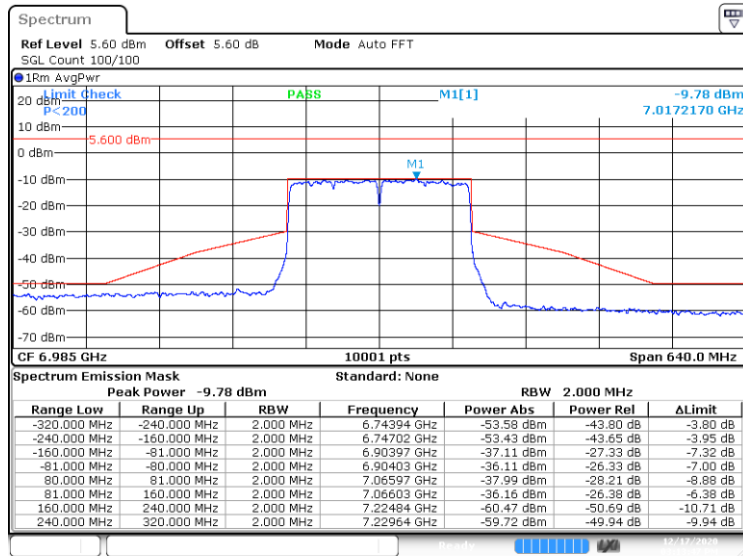


Channel 207

SISO-A, 802.11ax20, HE0

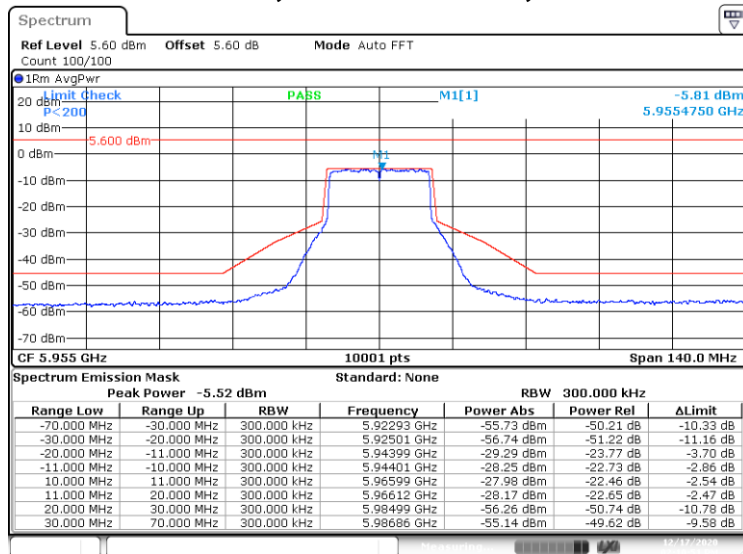


Channel 1

SISO-B, 802.11ax40, HE0

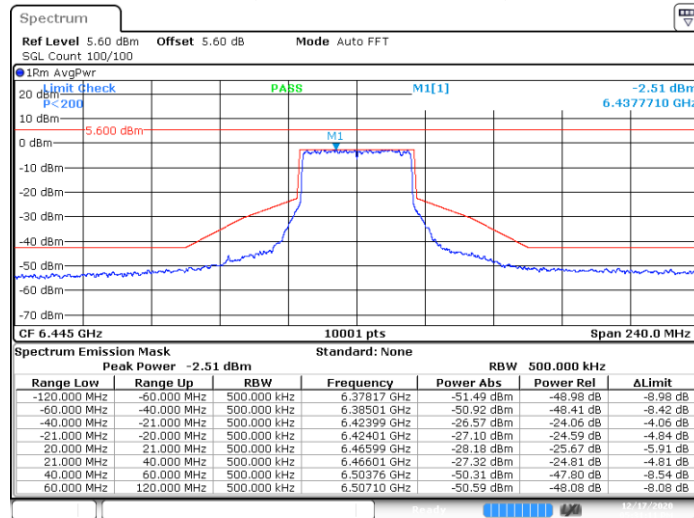


Channel 99

SISO-B, 802.11ax80, HE0

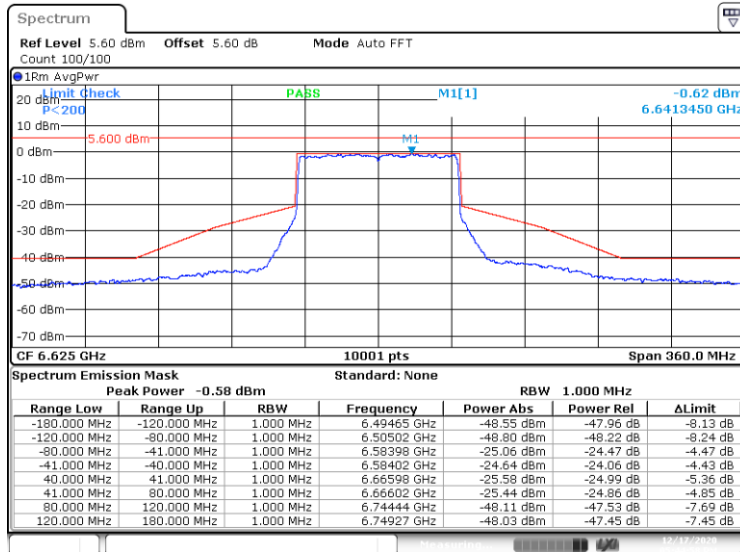


Channel 135

SISO-A, 802.11ax160, HE0

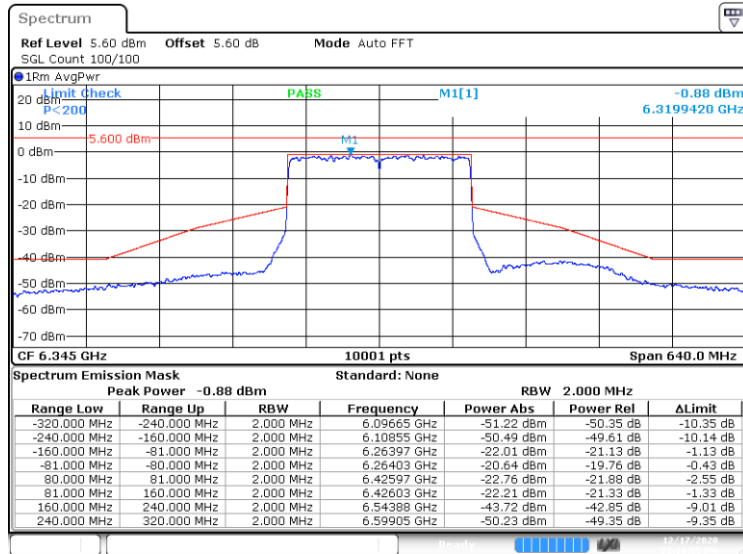


Channel 79

C.1.4 Contention-based protocol

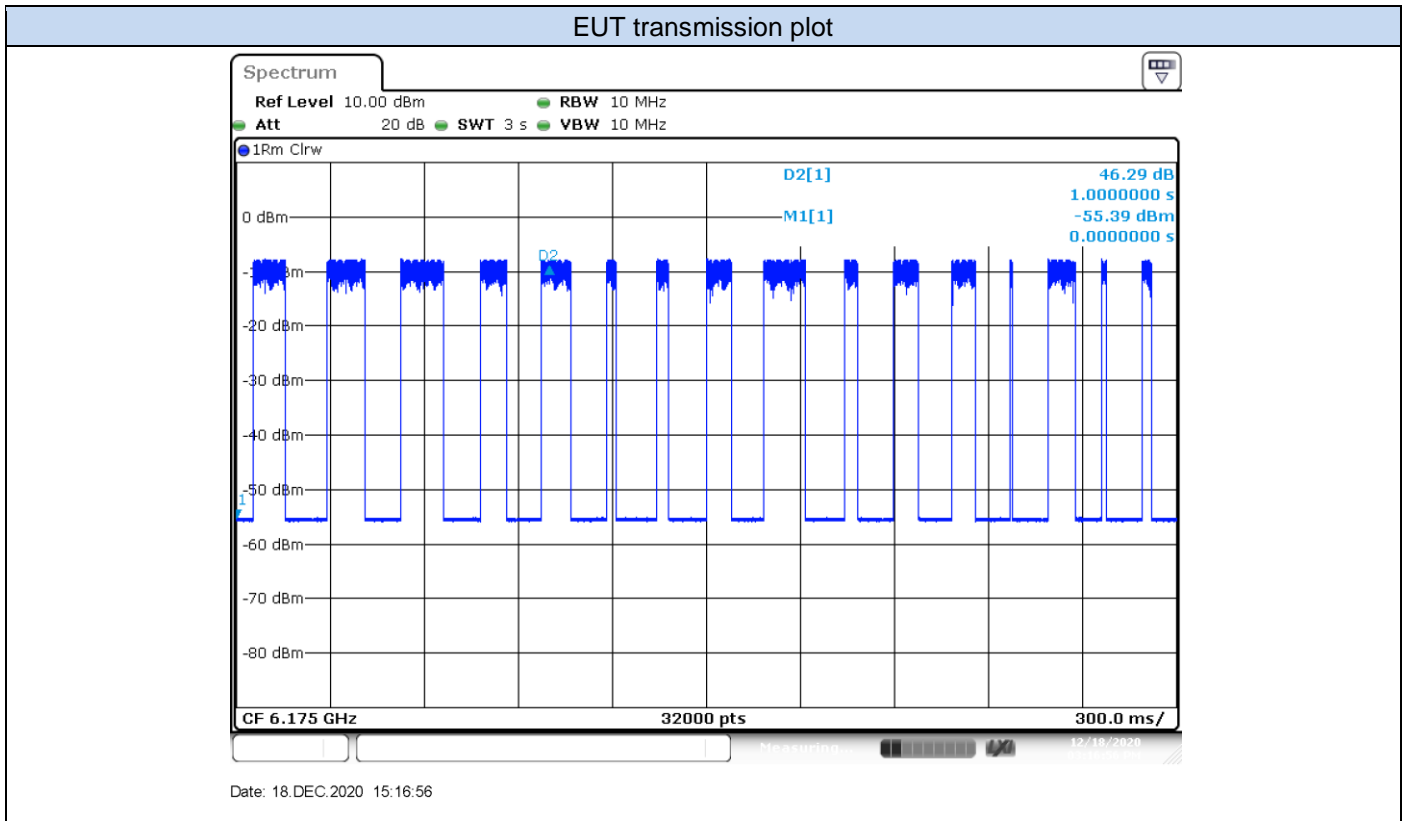


Channel 45 – Incumbent signal 6175 MHz

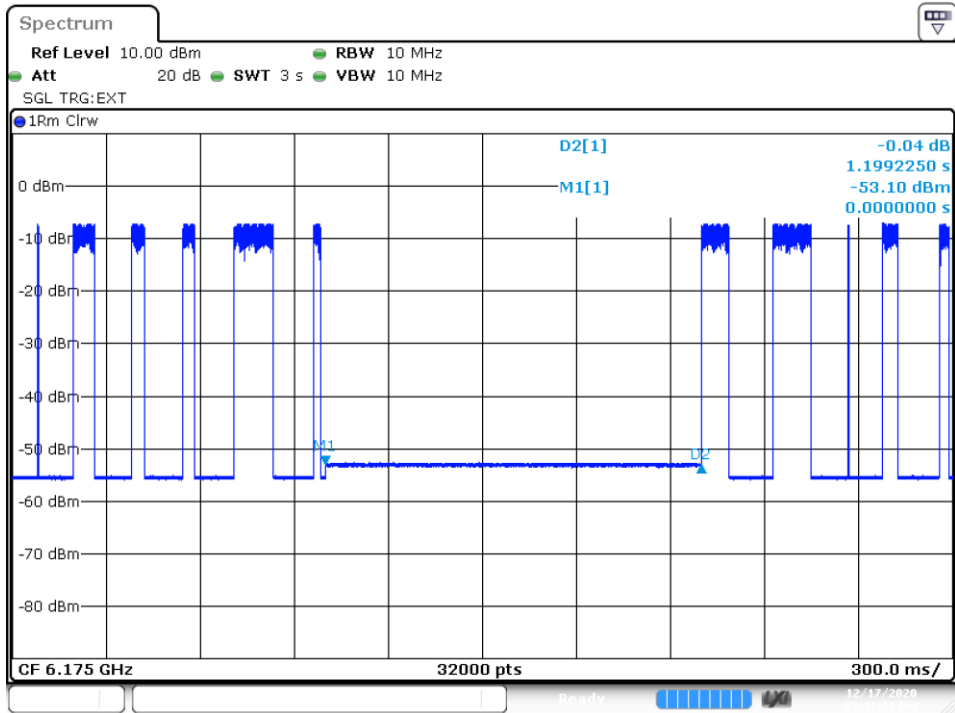

Date: 17.DEC.2020 17:41:30

Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal


Channel 105 - Incumbent signal 6475 MHz

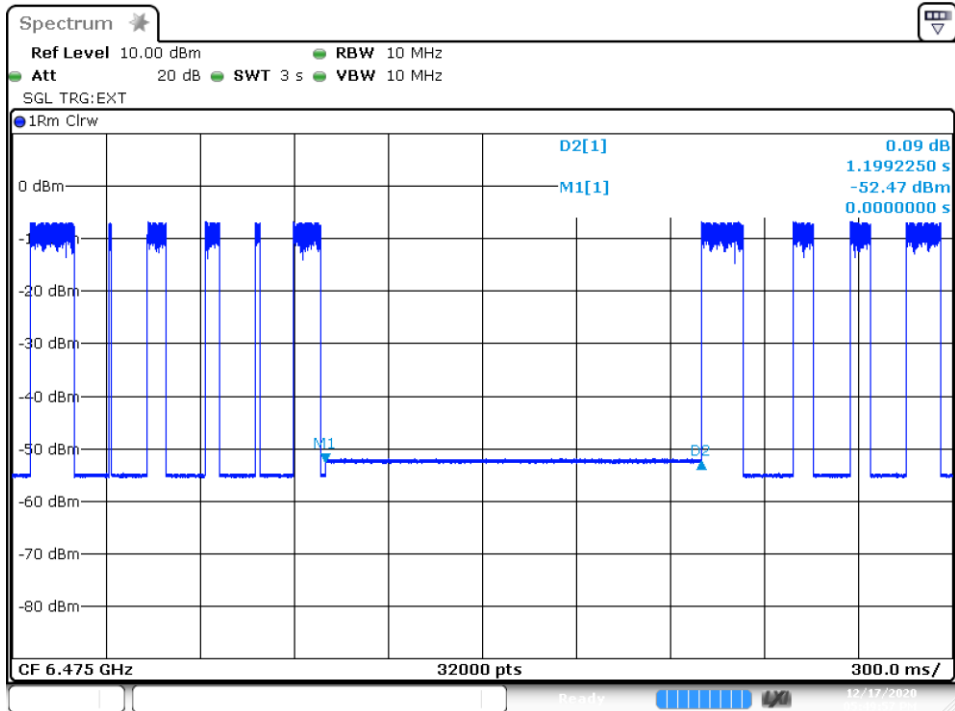

Date: 17.DEC.2020 17:49:57

Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal


Channel 149 - Incumbent signal 6695 MHz

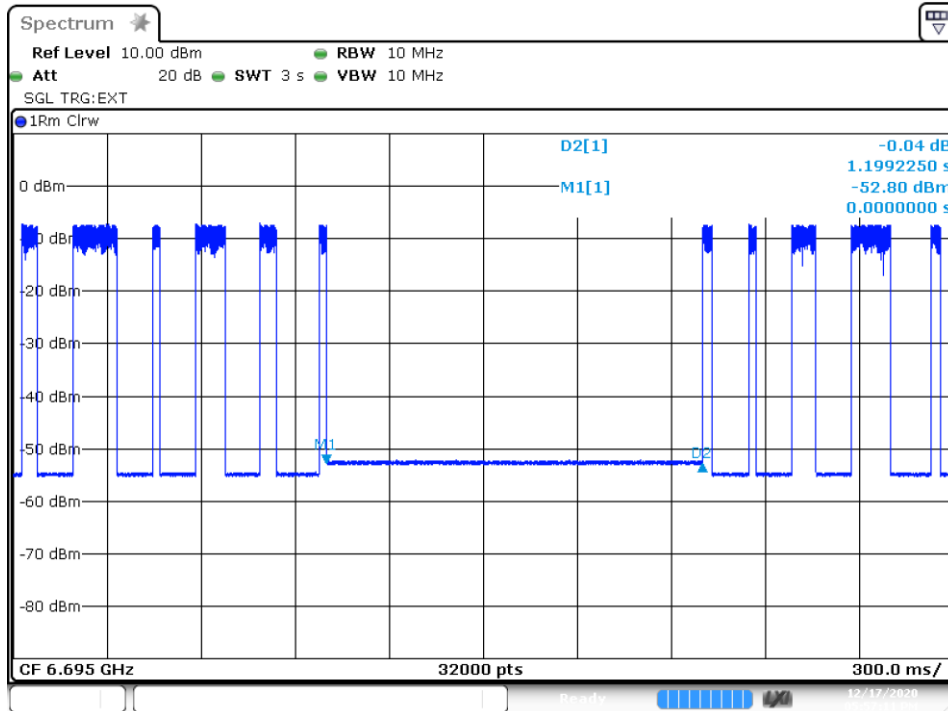

Date: 17.DEC.2020 17:57:11

Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal


Channel 209 - Incumbent signal 6995 MHz

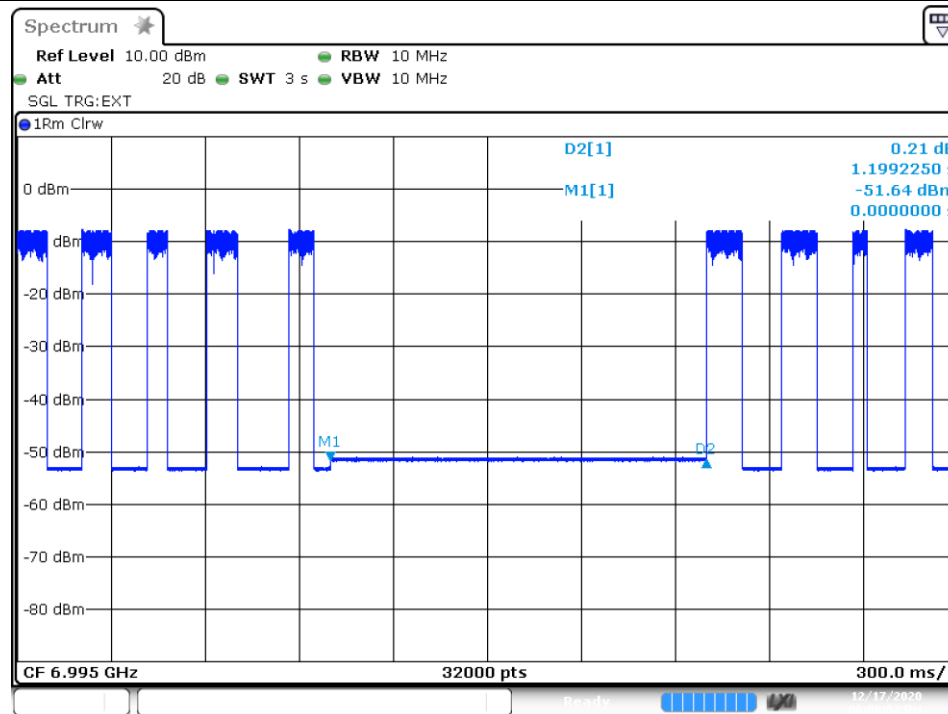

Date: 17.DEC.2020 18:06:53

Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal


Channel 15 - Incumbent signal 5950 MHz

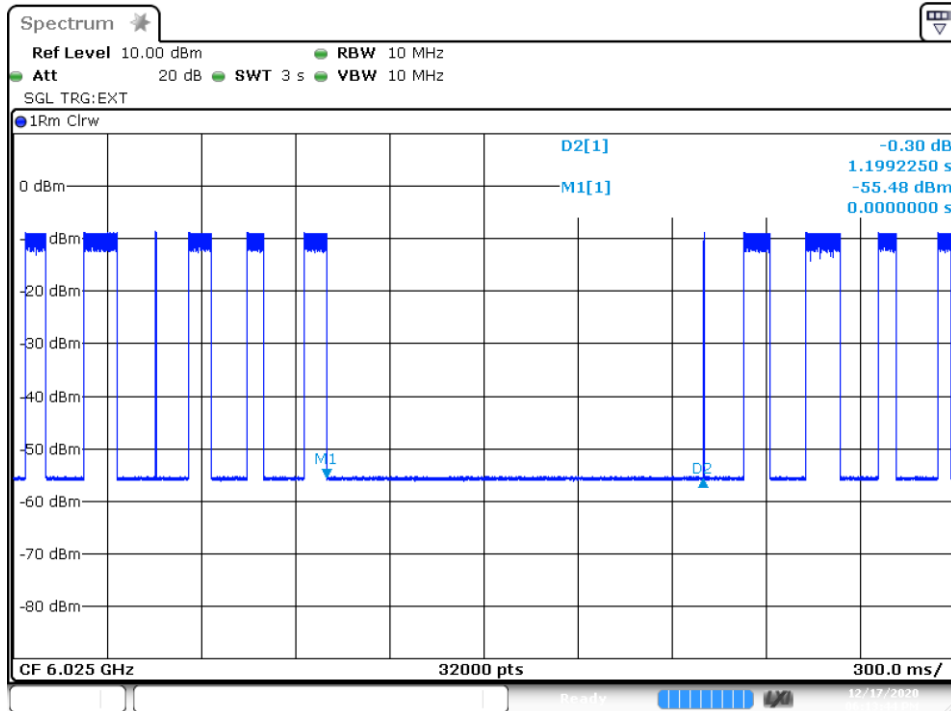

Date: 17.DEC.2020 18:13:44


Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal

Channel 15 - Incumbent signal 6025 MHz

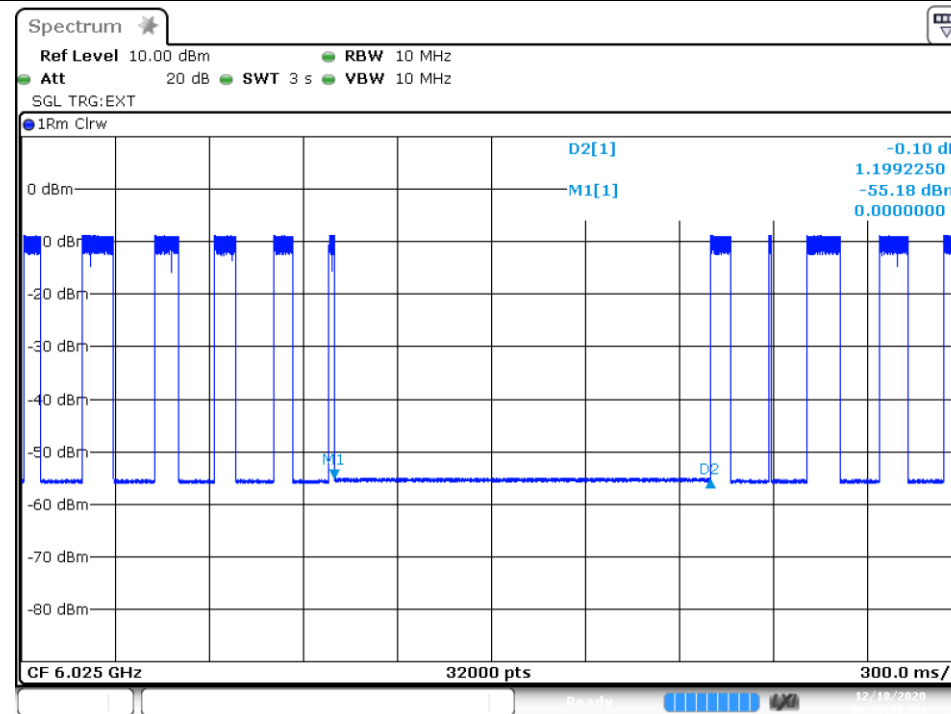


Date: 18.DEC.2020 08:55:33

Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal

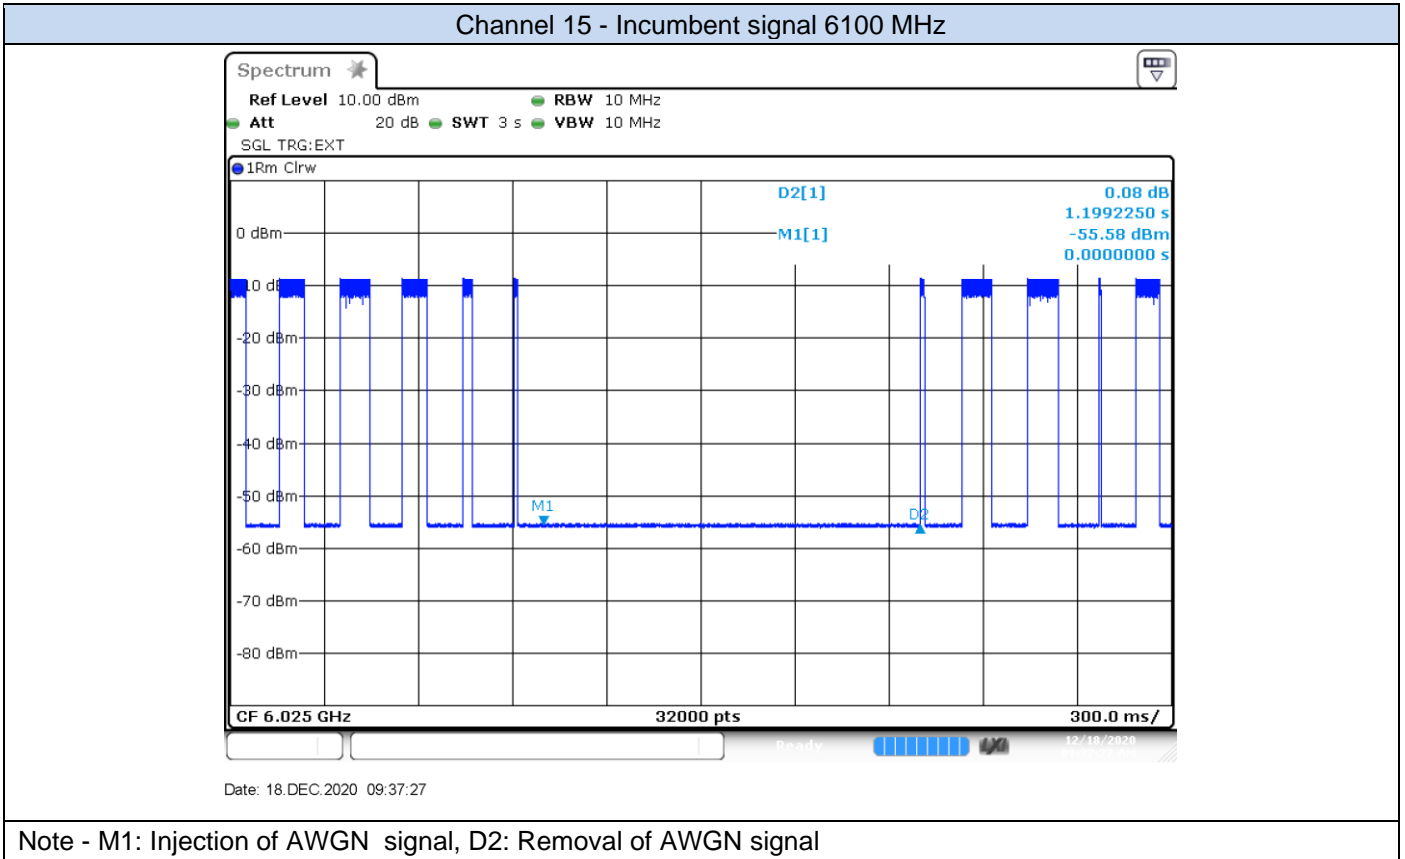


Channel 111 - Incumbent signal 6430 MHz

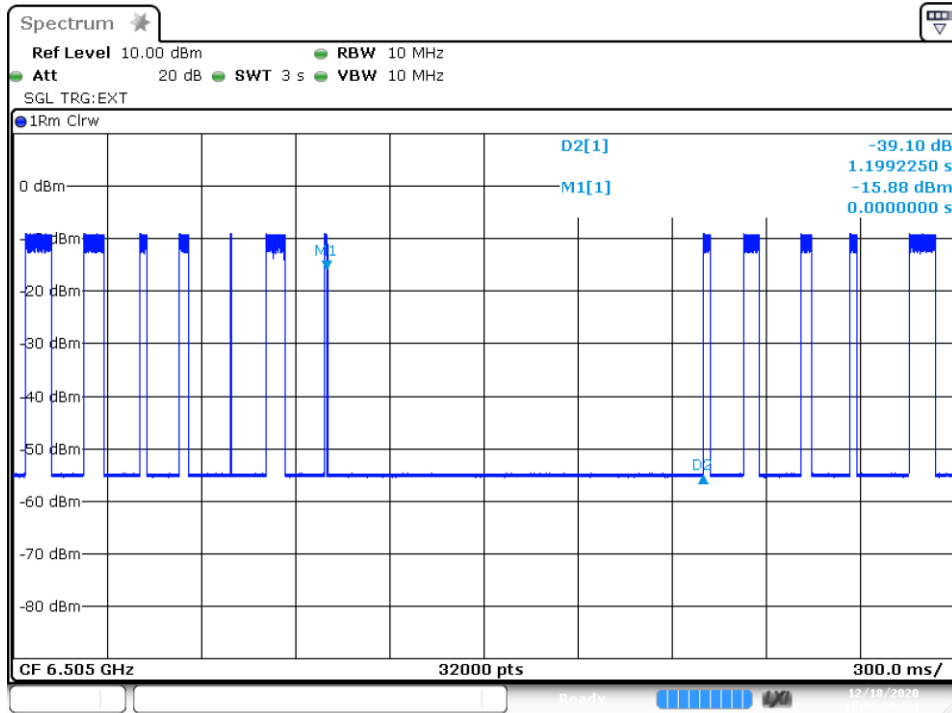


Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal


Channel 111 - Incumbent signal 6505 MHz

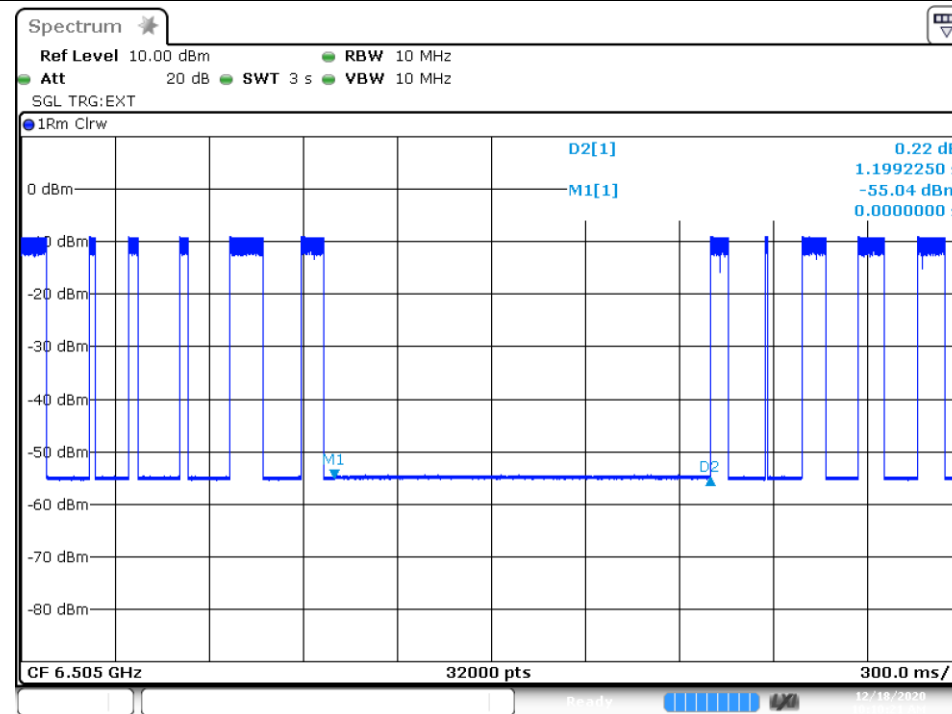

Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal

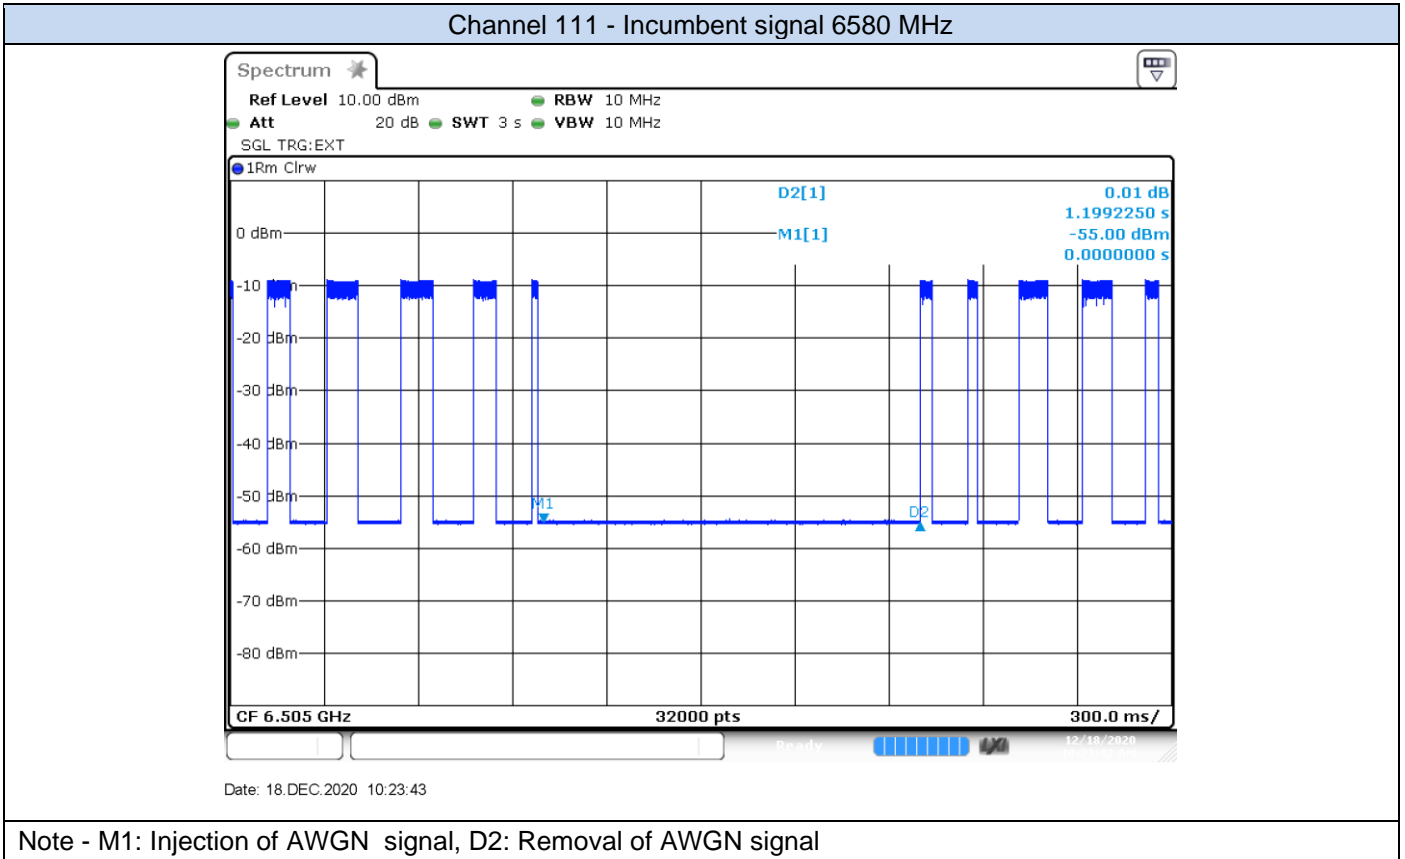


Channel 143 - Incumbent signal 6590 MHz

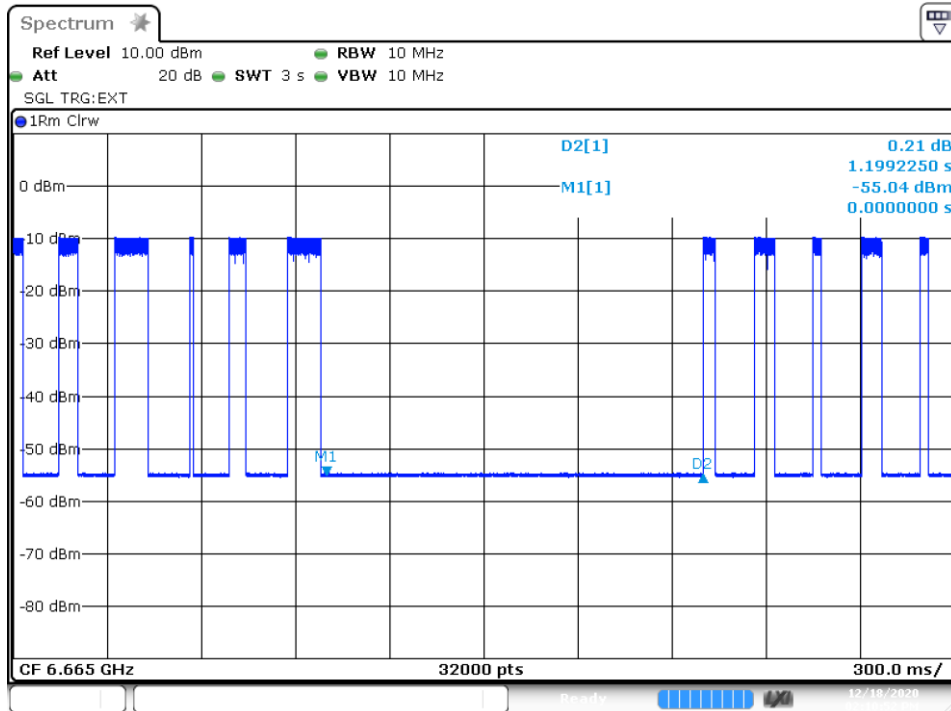

Date: 18.DEC.2020 14:10:53


Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal

Channel 143 - Incumbent signal 6665 MHz

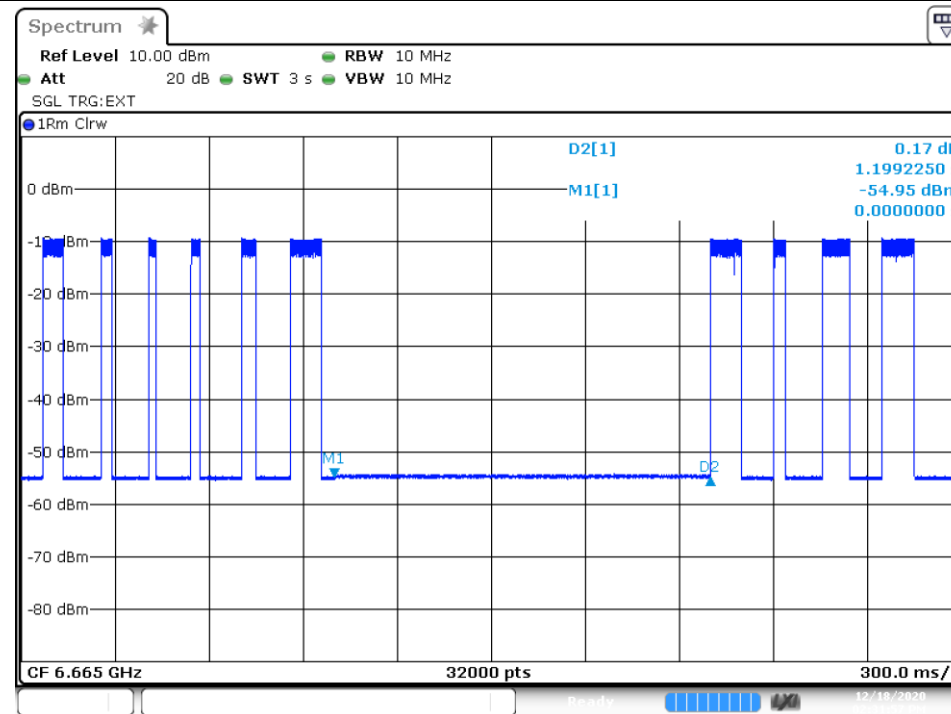


Date: 18.DEC.2020 14:31:57

Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal

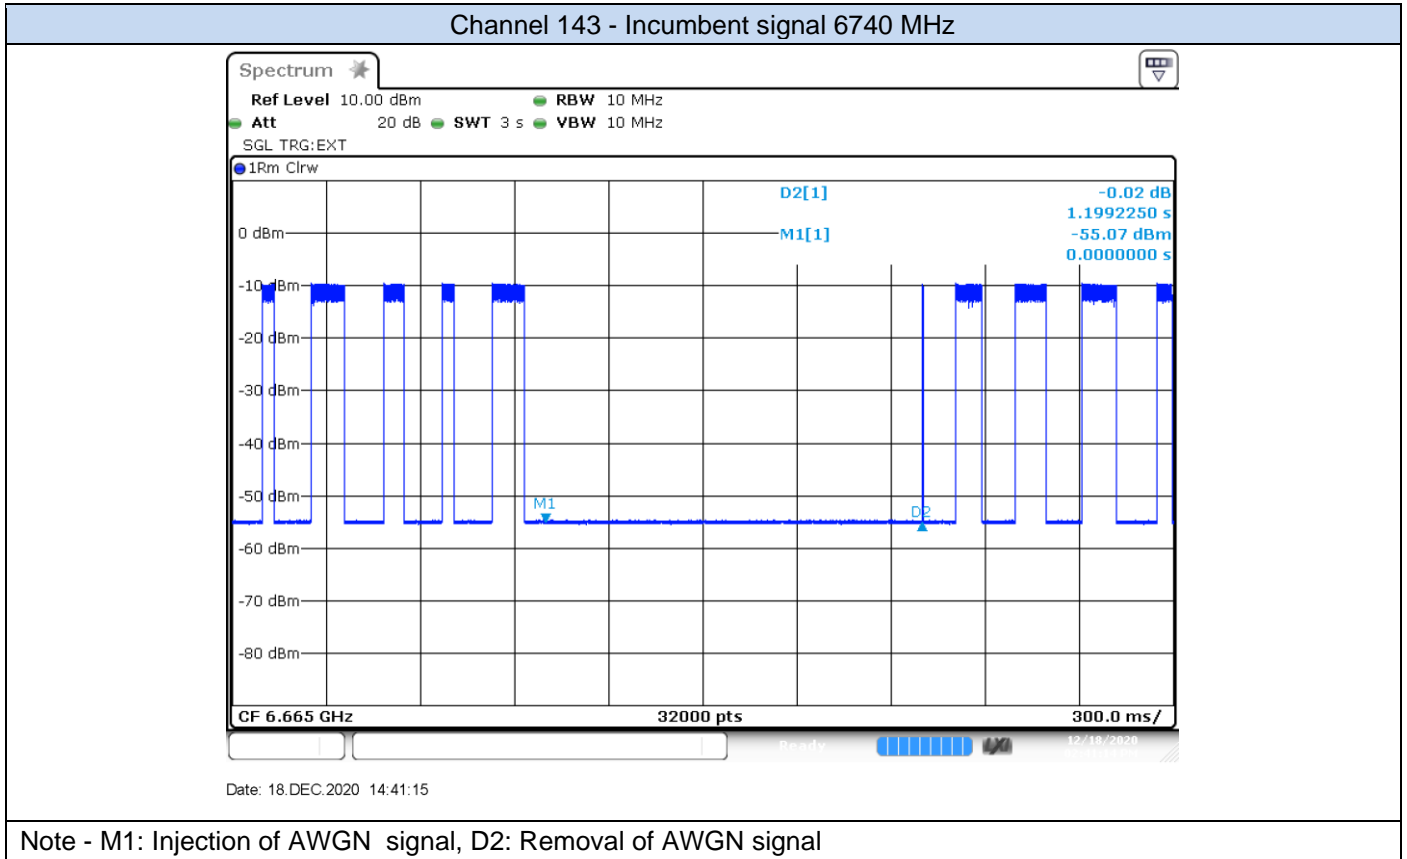


Channel 207 - Incumbent signal 6910 MHz

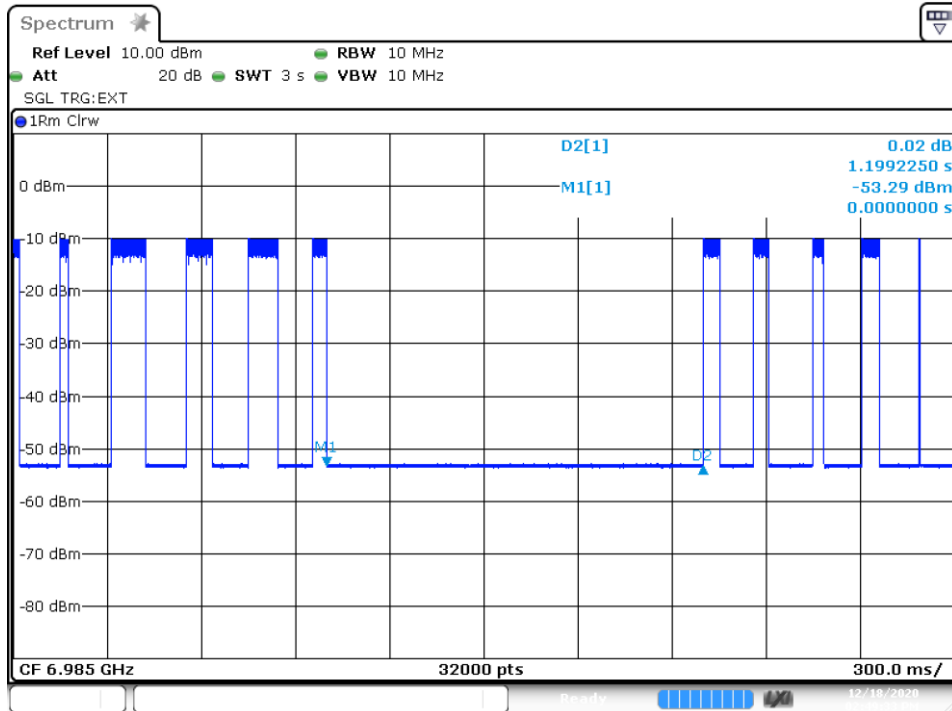

Date: 18.DEC.2020 14:49:33


Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal

Channel 207 - Incumbent signal 6985 MHz

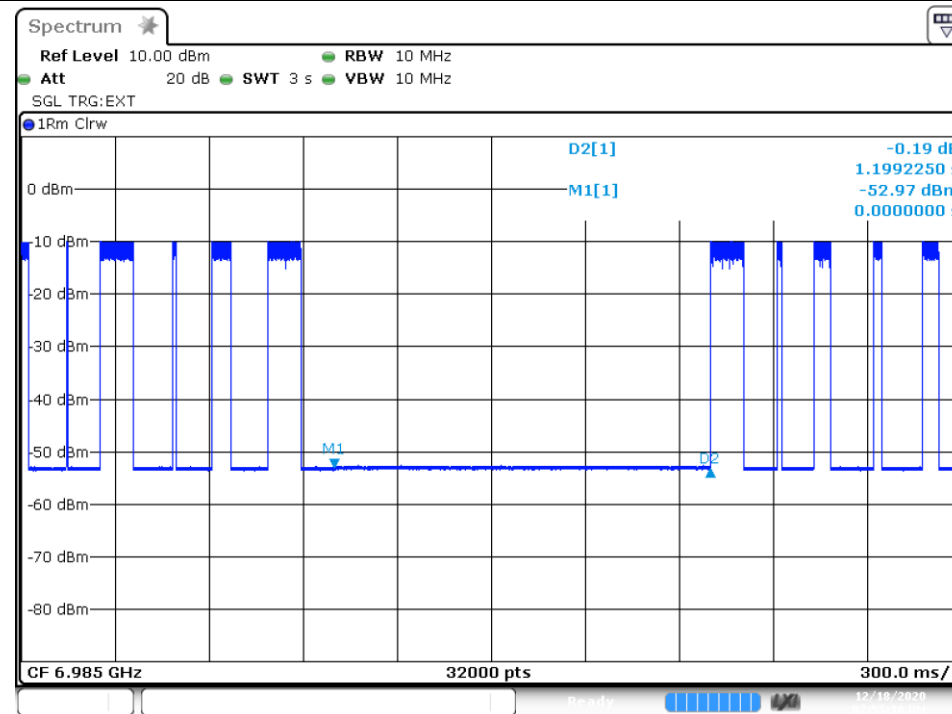


Date: 18.DEC.2020 14:55:17

Note - M1: Injection of AWGN signal, D2: Removal of AWGN signal

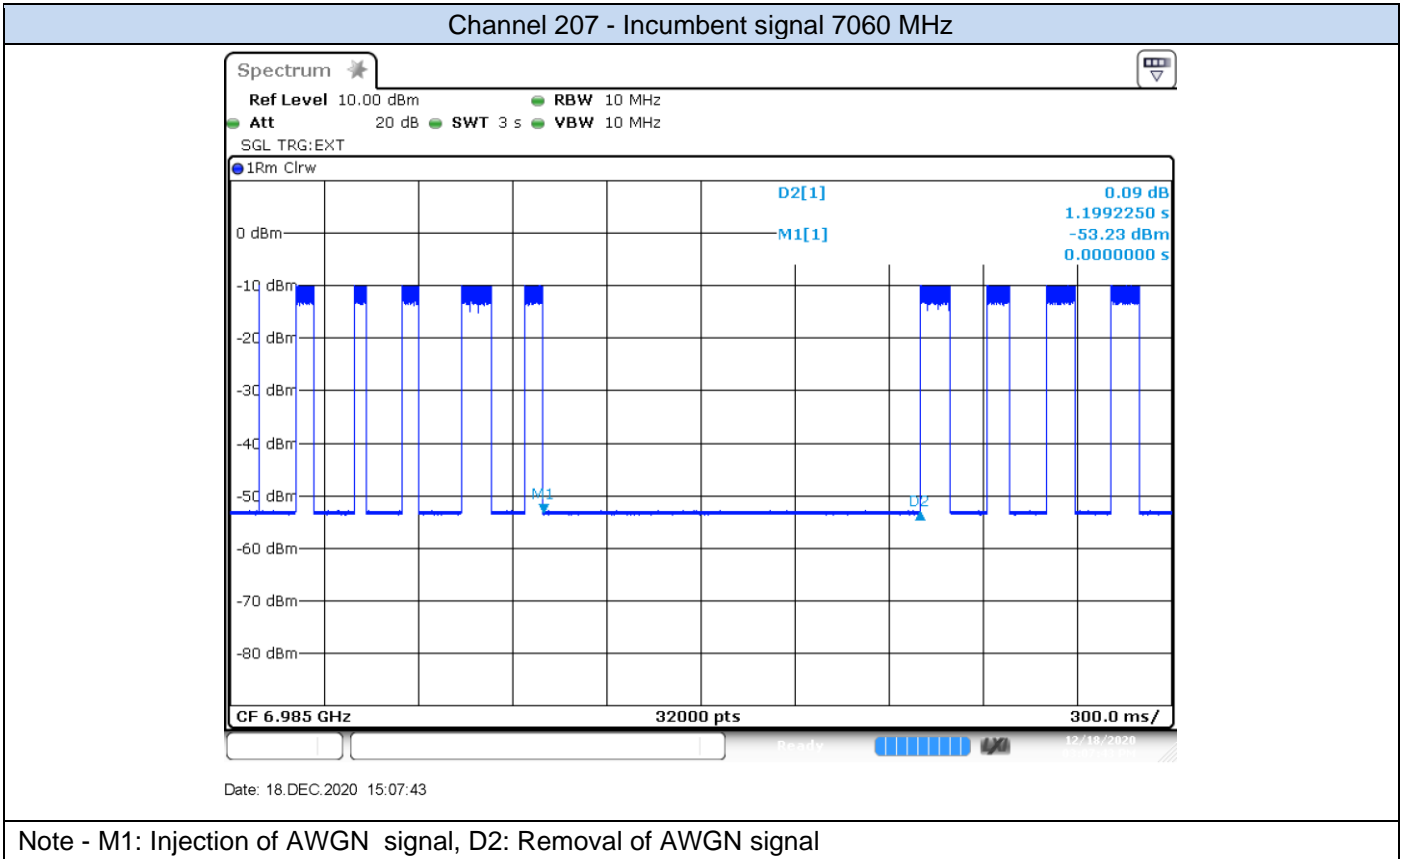


C.1.5 Undesirable emission limits : out of band (Conducted)

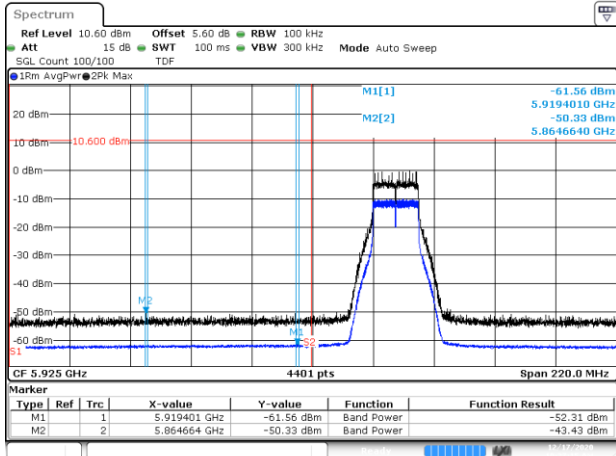


Date: 17 DEC 2020 10:27:16

BE-NR-LOW, SISO-A, 802.11a-6Mbps, Ch1

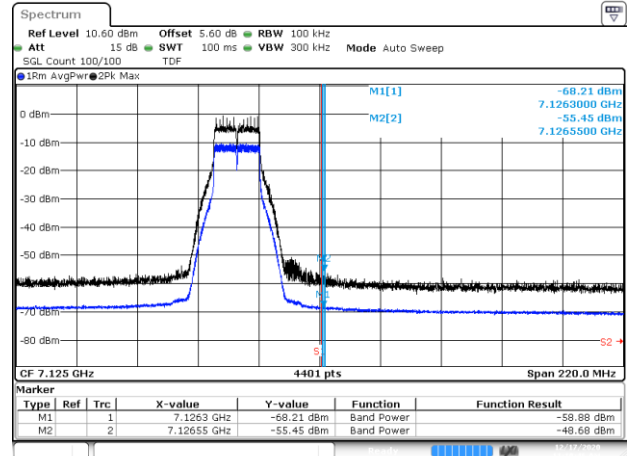


Date: 17 DEC 2020 11:10:47

BE-NR-HIGH, SISO-A, 802.11a-6Mbps, Ch229

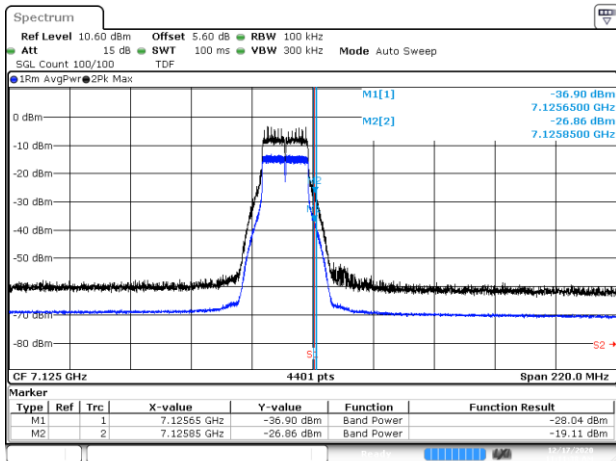


Date: 17 DEC 2020 11:11:38

BE-NR-HIGH, SISO-A, 802.11a-6Mbps, Ch233

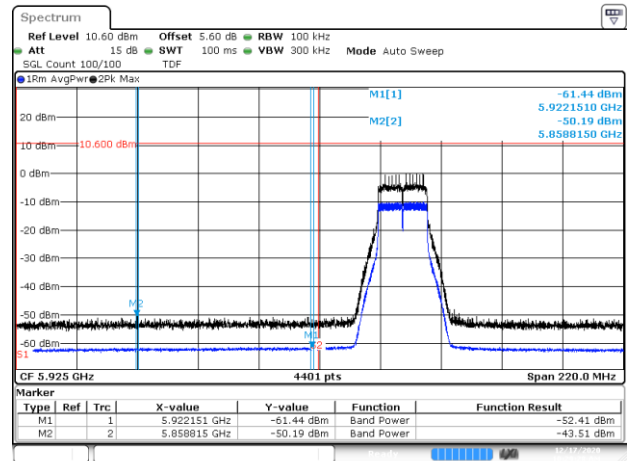


Date: 17 DEC 2020 10:29:29

BE-NR-LOW, SISO-A, 802.11n20-HT0, Ch1

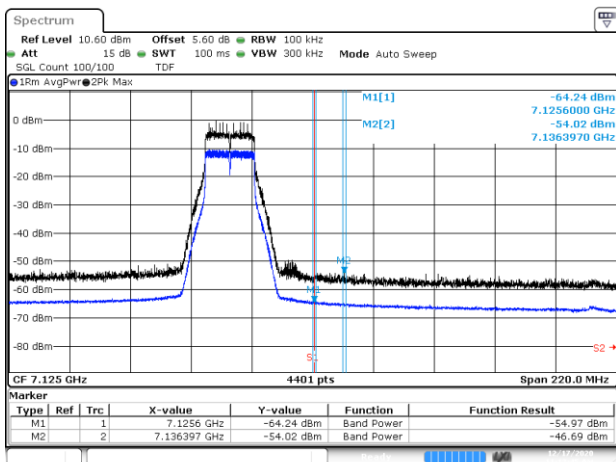


Date: 17 DEC 2020 11:13:45

BE-NR-HIGH, SISO-A, 802.11n20-HT0, Ch229

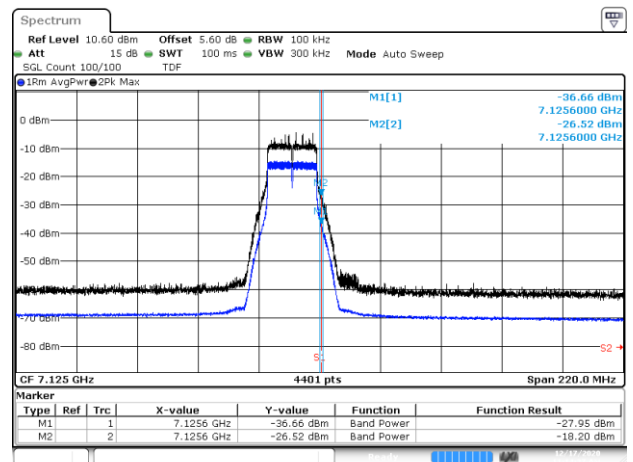


Date: 17 DEC 2020 11:14:37

BE-NR-HIGH, SISO-A, 802.11n20-HT0, Ch233

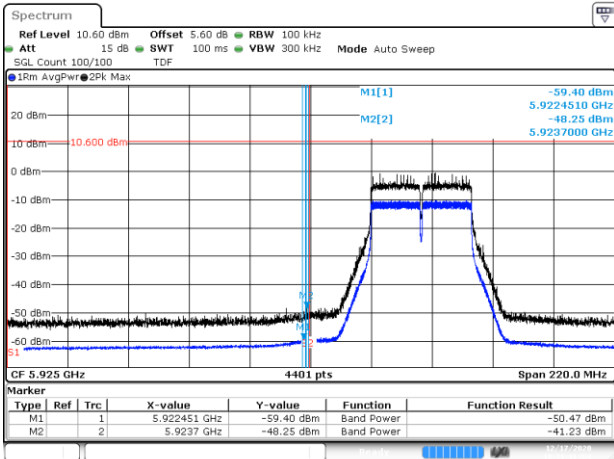


Date: 17 DEC 2020 10:31:42

BE-NR-LOW, SISO-A, 802.11n40-HT0, Ch3

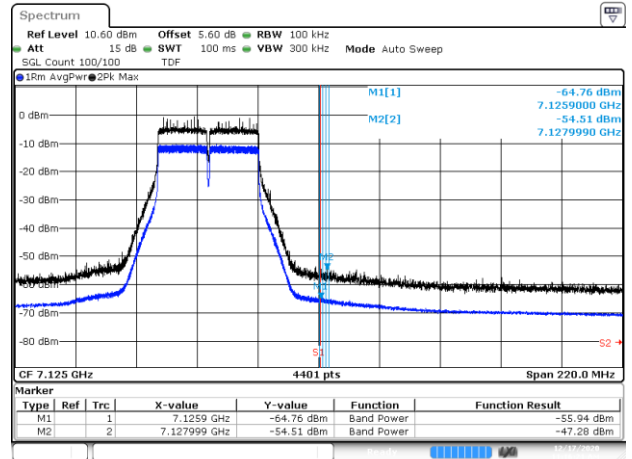


Date: 17 DEC 2020 11:16:21

BE-NR-HIGH, SISO-A, 802.11n40-HT0, Ch227

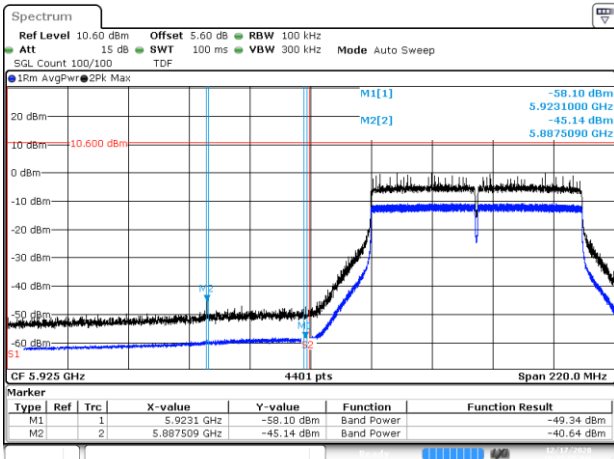


Date: 17 DEC 2020 10:33:55

BE-NR-LOW, SISO-A, 802.11ac80-VHT0, Ch7

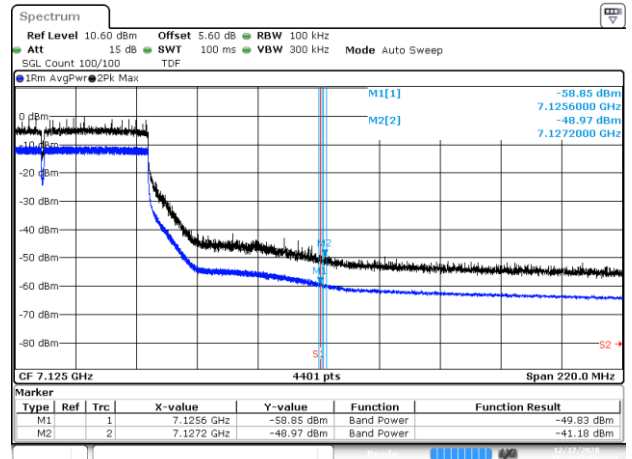


Date: 17 DEC 2020 11:18:48

BE-NR-HIGH, SISO-A, 802.11ac80-VHT0, Ch215

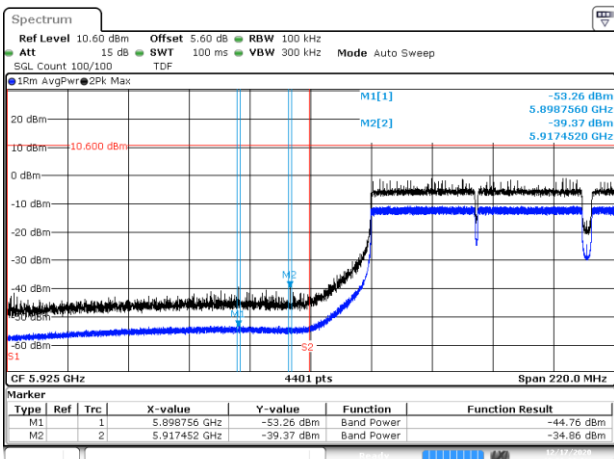


Date: 17 DEC 2020 10:38:09

BE-NR-LOW, SISO-A, 802.11ac160-VHT0, Ch15

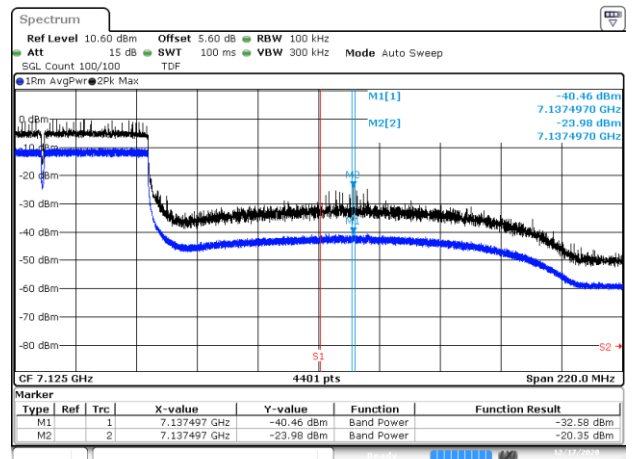


Date: 17 DEC 2020 11:19:44

BE-NR-HIGH, SISO-A, 802.11ac160-VHT0, Ch207

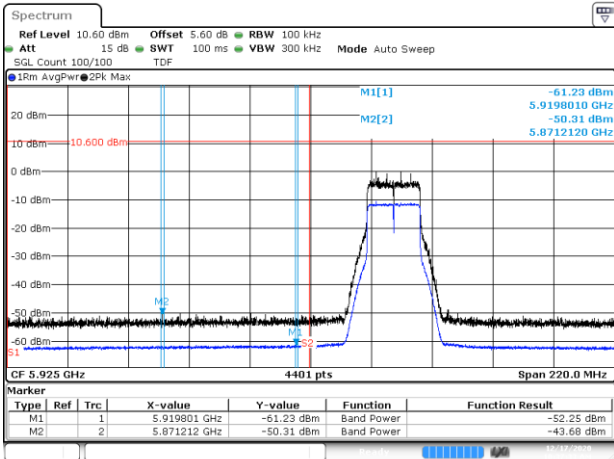


Date: 17.DEC.2020 10:37:33

BE-NR-LOW, SISO-A, 802.11ax20-HE0, Ch1

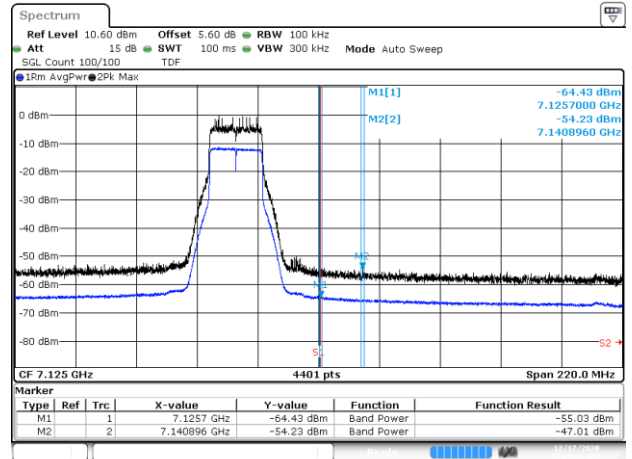


Date: 17.DEC.2020 11:21:51

BE-NR-HIGH, SISO-A, 802.11ax20-HE0, Ch229

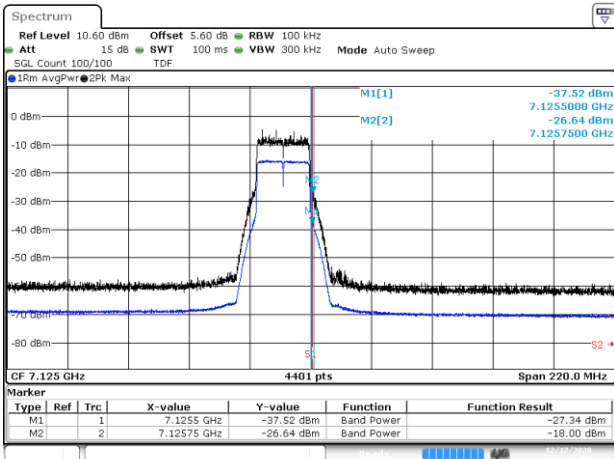


Date: 17.DEC.2020 11:22:42

BE-NR-HIGH, SISO-A, 802.11ax20-HE0, Ch233

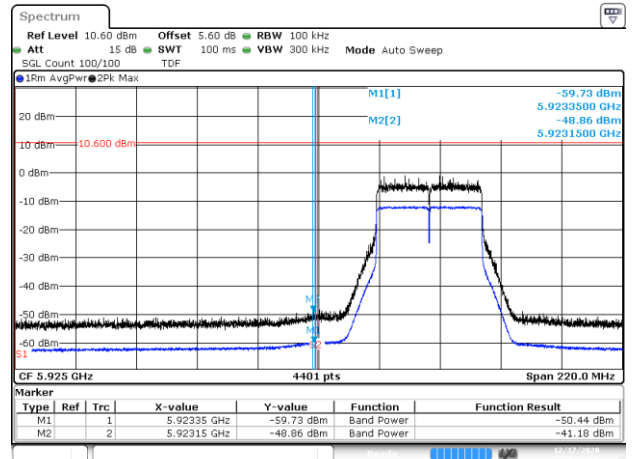


Date: 17.DEC.2020 10:39:46

BE-NR-LOW, SISO-A, 802.11ax40-HE0, Ch3

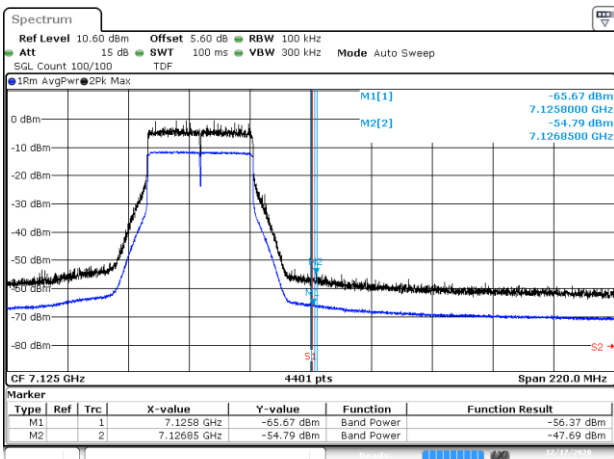


Date: 17.DEC.2020 11:24:27

BE-NR-HIGH, SISO-A, 802.11ax40-HE0, Ch227

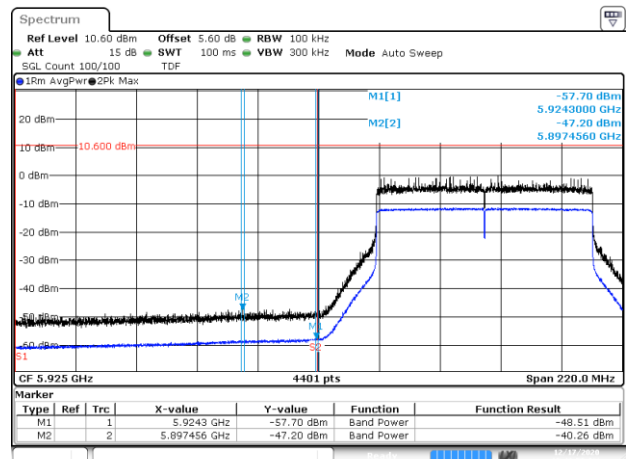


Date: 17.DEC.2020 10:41:59

BE-NR-LOW, SISO-A, 802.11ac80-HE0, Ch7

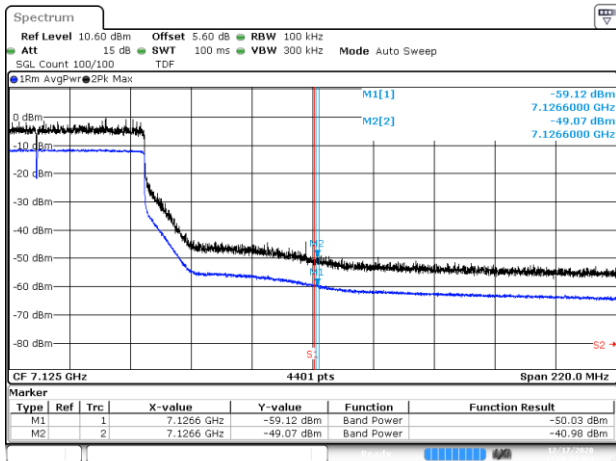


Date: 17.DEC.2020 11:28:54

BE-NR-HIGH, SISO-A, 802.11ac80-HE0, Ch215

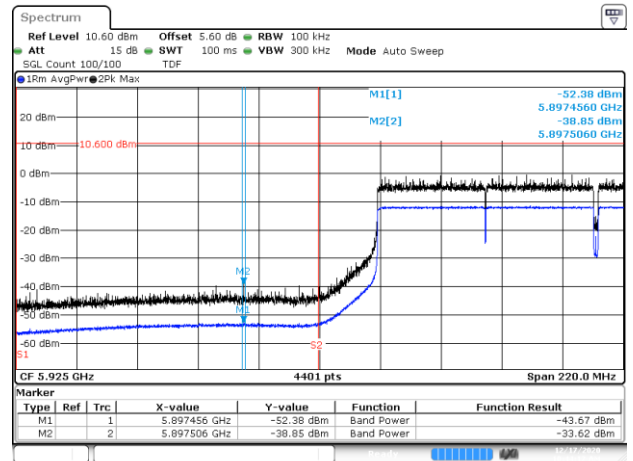


Date: 17.DEC.2020 10:44:13

BE-NR-LOW, SISO-A, 802.11ac160-HE0, Ch15

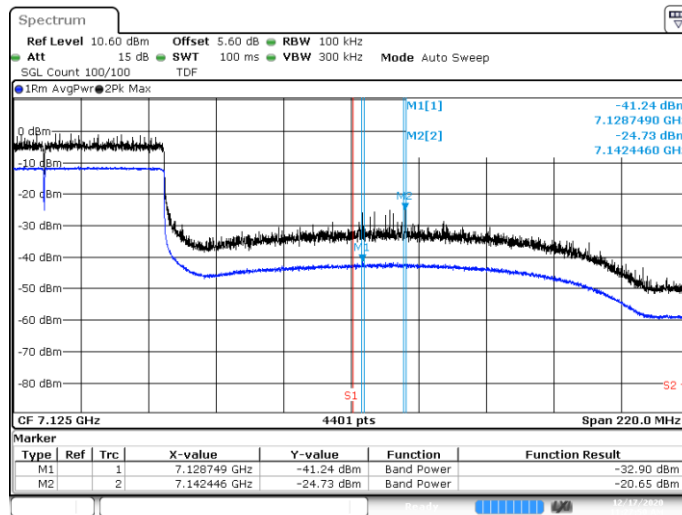


Date: 17.DEC.2020 11:27:49


BE-NR-HIGH, SISO-A, 802.11ac160-HE0, Ch207

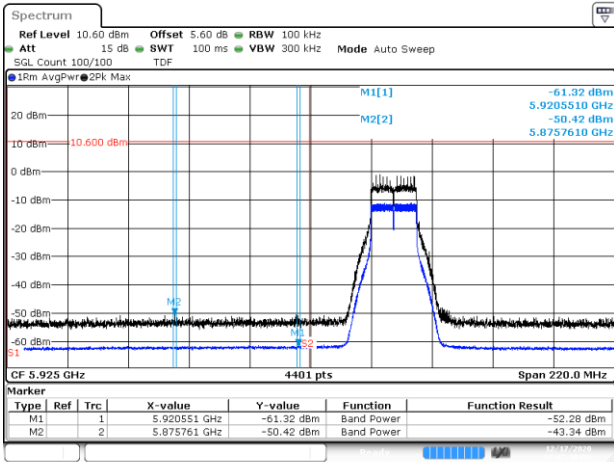


BE-NR-LOW, SISO-B, 802.11a-6Mbps, Ch1

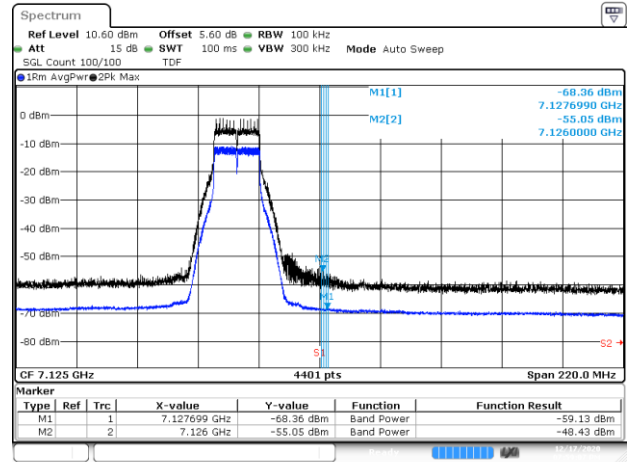


BE-NR-HIGH, SISO-B, 802.11a-6Mbps, Ch229

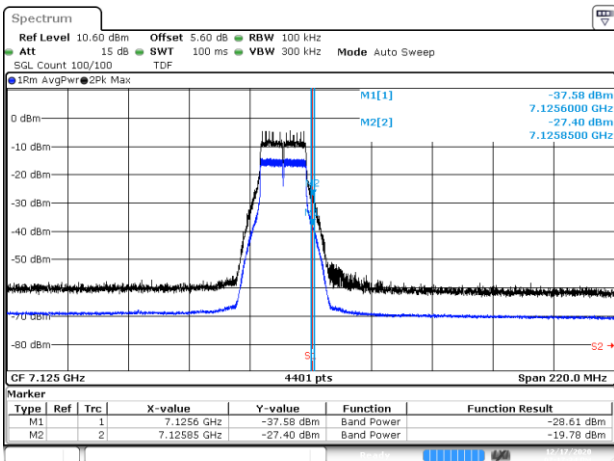


BE-NR-HIGH, SISO-B, 802.11a-6Mbps, Ch233

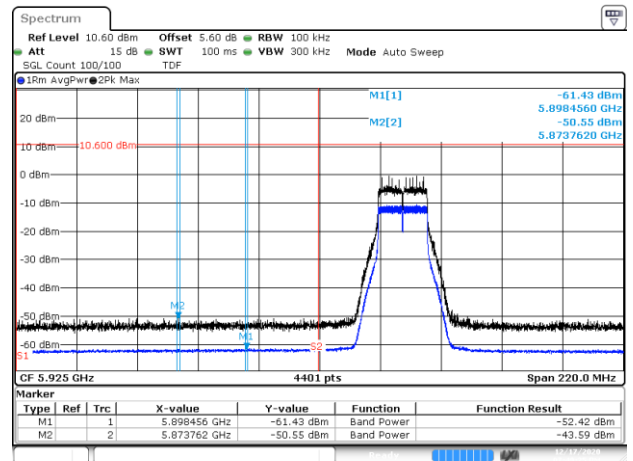

BE-NR-LOW, SISO-B, 802.11n20-HT0, Ch1

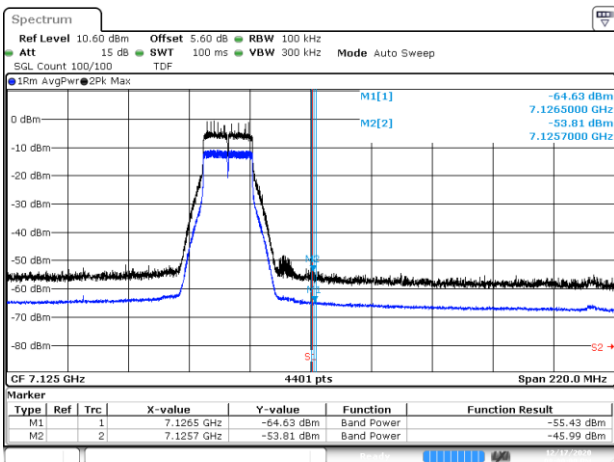

BE-NR-HIGH, SISO-B, 802.11n20-HT0, Ch229

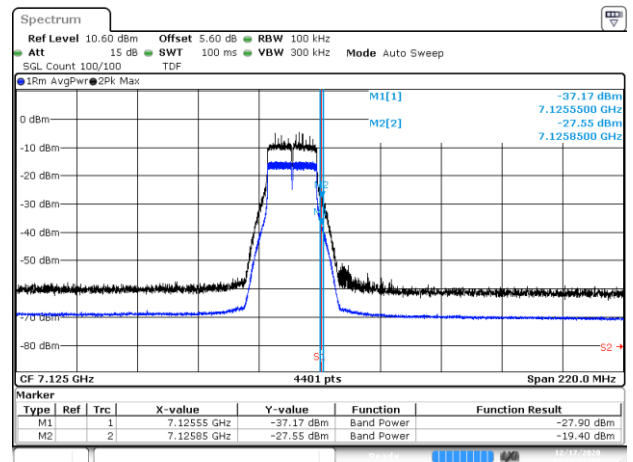

BE-NR-HIGH, SISO-B, 802.11n20-HT0, Ch233