FCC RF Test Report

APPLICANT : Sony Mobile Communications Inc. EQUIPMENT : GSM/WCDMA/LTE Phone+Bluetooth,

DTS/UNII a/b/g/n and NFC

BRAND NAME : Sony

FCC ID : PY7-32032B

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION: (DTS) Digital Transmission System

This is a variant report which is only valid together with the original test report. The product was received on May 01, 2017 and testing was completed on Jun. 04, 2017. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 1 of 17
Report Issued Date : Jul. 27, 2017

1190

: Rev. 01

Report No.: FR742207-01B

Report Template No.: BU5-FR15CBT4.0 Version 1.3

Report Version

TABLE OF CONTENTS

RE	VISIO	N HISTORY	3
SU	MMAR	RY OF TEST RESULT	4
1	GENE	ERAL DESCRIPTION	5
	1.1 1.2 1.3 1.4	Applicant Manufacturer Product Feature of Equipment Under Test Modification of EUT	5 5 5
2	1.5 1.6 TEST	Testing Location Applicable Standards CONFIGURATION OF EQUIPMENT UNDER TEST	6
3	2.1 2.2 2.3 2.4 2.5 TEST	Carrier Frequency Channel Descriptions of Test Mode Test Mode Connection Diagram of Test System EUT Operation Test Setup	8 9
4	3.1 3.2 LIST	Radiated Band Edges and Spurious Emission Measurement Antenna Requirements	14
5	UNCE	ERTAINTY OF EVALUATION	17
AP	PENDI	IX A. RADIATED SPURIOUS EMISSION	
ΑP	PENDI	IX B. RADIATED SPURIOUS EMISSION PLOTS	
AP	PENDI	IX C. DUTY CYCLE PLOTS	
AP	PENDI	IX D. ORIGINAL REPORT	

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 2 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No. : FR742207-01B

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR742207-01B	Rev. 01	Initial issue of report	Jul. 27, 2017

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 3 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No. : FR742207-01B

SUMMARY OF TEST RESULT

Report Section	FCC Rule	Description	Limit	Result	Remark
3.1	15.247(d)	Radiated Band Edges and Spurious Emission	15.209(a) & 15.247(d)	Pass	Under limit 3.67 dB at 86.160 MHz
3.2	15.203 & 15.247(b)	Antenna Requirement	N/A	Pass	-

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 4 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No. : FR742207-01B

1 General Description

1.1 Applicant

Sony Mobile Communications Inc.

4-12-3 Higashi-Shinagawa, Shinagawa-ku, Tokyo, 140-0002, Japan

1.2 Manufacturer

Sony Mobile Communications Inc.

4-12-3 Higashi-Shinagawa, Shinagawa-ku, Tokyo, 140-0002, Japan

1.3 Product Feature of Equipment Under Test

GSM/WCDMA/LTE, Bluetooth, DTS/UNII, a/b/g/n, NFC, and GPS

Standards-related Product Specification			
Antenna Type / Gain	PIFA Antenna type with gain -2.2 dBi		

Report No.: FR742207-01B

Remark: This is a variant report. All the test cases were performed on original report which can be referred to Sporton Report Number FR742206-01B.

EUT Information List					
HW Version SW Version		S/N	Performed Test Item		
^	0.22	RQ3004V84T	RF conducted measurement		
A	0.32	RQ3004V84Y	Radiated Spurious Emission		

Accessory List			
AC Ademies 4	Model No. : UCH20		
AC Adapter 1	S/N: 1215W48600059		
Formbono 1	Model No. : MH410c		
Earphone 1	S/N: 1632A86600000E0		
USD Cable	Model No. : UCB20		
USB Cable	S/N: 1625A9110003BFA		

Note:

- 1. Above EUT list and accessory list used are electrically identical per declared by manufacturer.
- 2. Above the accessories list are used to exercise the EUT during test.
- 3. For other wireless features of this EUT, test report will be issued separately.

1.4 Modification of EUT

No modifications are made to the EUT during all test items.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 5 of 17

 TEL: 886-3-327-3456
 Report Issued Date
 : Jul. 27, 2017

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

FCC ID : PY7-32032B Report Template No.: BU5-FR15CBT4.0 Version 1.3

1.5 Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW0007 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC Test.

Report No.: FR742207-01B

: 6 of 17

Test Site	SPORTON INTERNATIONAL INC.
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park,
Test Site Location	Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.
rest Site Location	TEL: +886-3-327-3456
	FAX: +886-3-328-4978
Took Site No	Sporton Site No.
Test Site No.	TH05-HY

Note: The test site complies with ANSI C63.4 2014 requirement.

Test Site	SPORTON INTERNATIONAL INC.
	No.58, Aly. 75, Ln. 564, Wenhua 3rd Rd. Guishan Dist,
Test Site Location	Taoyuan City, Taiwan (R.O.C.)
rest Site Location	TEL: +886-3-327-0868
	FAX: +886-3-327-0855
Toot Site No	Sporton Site No.
Test Site No.	03CH13-HY

Note: The test site complies with ANSI C63.4 2014 requirement.

1.6 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- FCC KDB Publication No. 558074 D01 DTS Meas. Guidance v04
- ANSI C63.10-2013

Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

SPORTON INTERNATIONAL INC. Page Number
TEL: 886-3-327-3456 Report Issued

 TEL: 886-3-327-3456
 Report Issued Date : Jul. 27, 2017

 FAX: 886-3-328-4978
 Report Version : Rev. 01

 FCC ID: PY7-32032B
 Report Template No.: BU5-FR15CBT4.0 Version 1.3

2 Test Configuration of Equipment Under Test

2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	21	2444
	1	2404	22	2446
	2	2406	23	2448
	3	2408	24	2450
	4	2410	25	2452
	5	2412	26	2454
	6	2414	27	2456
	7	2416	28	2458
	8	2418	29	2460
	9	2420	30	2462
2400-2483.5 MHz	10	2422	31	2464
	11	2424	32	2466
	12	2426	33	2468
	13	2428	34	2470
	14	2430	35	2472
	15	2432	36	2474
	16	2434	37	2476
	17	2436	38	2478
	18	2438	39	2480
	19	2440	-	-
	20	2442	-	-

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 7 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No. : FR742207-01B

2.2 Descriptions of Test Mode

The RF output power was recorded in the following table:

	nnel Frequency	Bluetooth – LE RF Output Power	
Channal		Data Rate / Modulation	
Chamilei		GFSK	
		1Mbps	
Ch00	2402MHz	-0.66 dBm	
Ch19	2440MHz	0.75 dBm	
Ch39	2480MHz	-1.51 dBm	

a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: radiation (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). Pre-scanned tests, X, Y, Z in three orthogonal panels to determine the final configuration (X plane as worst plane) from all possible combinations.

2.3 Test Mode

The following summary table is showing all test modes to demonstrate in compliance with the standard.

	Summary table of Test Cases
Took Itom	Data Rate / Modulation
Test Item	Bluetooth – LE / GFSK
Radiated	Made 1: Plusteeth Tx CH10, 2440 MHz, 1Mbps
TCs	Mode 1: Bluetooth Tx CH19_2440 MHz_1Mbps


SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 8 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No.: FR742207-01B

2.4 Connection Diagram of Test System

<Bluetooth - LE Tx Mode>

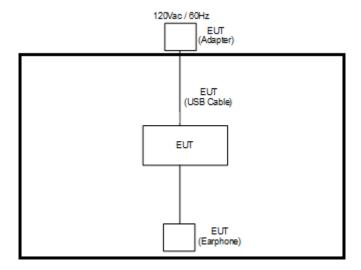

2.5 EUT Operation Test Setup

For RF test items, an engineering test program was provided and enabled to make EUT transmitting signals.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 9 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No.: FR742207-01B

3 Test Result

3.1 Radiated Band Edges and Spurious Emission Measurement

3.1.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. If the output power of this device was measured by spectrum analyzer, the attenuation under this paragraph shall be 30 dB instead of 20 dB. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.1.2 Measuring Instruments

The section 4.0 of List of Measuring Equipment of this test report is used for test.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 10 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No.: FR742207-01B

3.1.3 Test Procedures

- 1. The testing follows FCC KDB Publication No. 558074 D01 DTS Meas. Guidance v04.
- 2. The EUT was arranged to its worst case and then tune the antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level.
- The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 4. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 5. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- For testing below 1GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 7. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than average limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.
- 8. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold;
 - (3) Set RBW = 1 MHz, VBW= 3MHz for $f \ge 1$ GHz for peak measurement. For average measurement:
 - VBW = 10 Hz, when duty cycle is no less than 98 percent.
 - VBW ≥ 1/T, when duty cycle is less than 98 percent where T is the minimum transmission duration over which the transmitter is on and is transmitting at its maximum power control level for the tested mode of operation.


SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 11 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01


Report No.: FR742207-01B

3.1.4 Test Setup

For radiated emissions below 30MHz

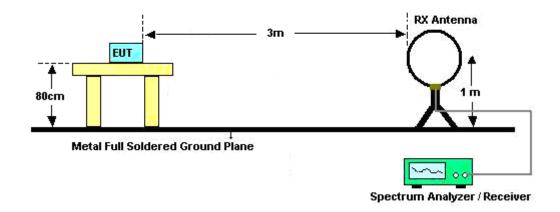


For radiated emissions from 30MHz to 1GHz

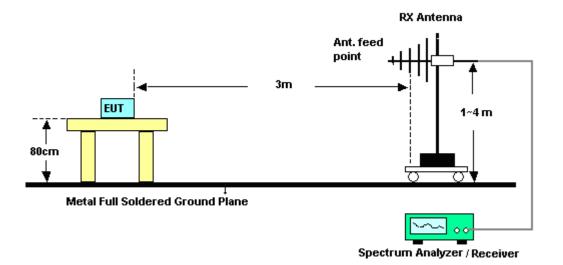

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 12 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No.: FR742207-01B

For radiated emissions above 1GHz

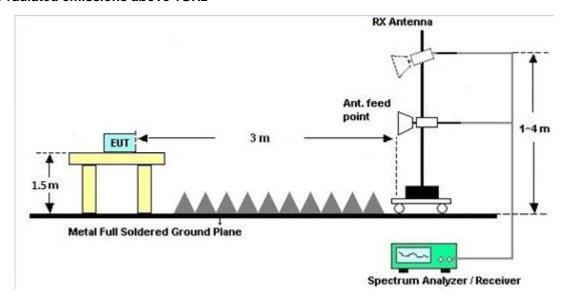

3.1.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

3.1.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix A and B.

3.1.7 Duty Cycle

Please refer to Appendix C.

3.1.8 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic)

Please refer to Appendix A and B.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 13 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No.: FR742207-01B

3.2 Antenna Requirements

3.2.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

3.2.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

3.2.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 14 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No.: FR742207-01B

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Power Meter	Agilent	E4416A	GB41292344	300MHz~40GH z	Dec. 26, 2016	May 16, 2017~ May 25, 2017	Dec. 25, 2017	Conducted (TH05-HY)
Power Sensor	Agilent	E9327A	US40441548	300MHz~40GH z	Dec. 26, 2016	May 16, 2017~ May 25, 2017	Dec. 25, 2017	Conducted (TH05-HY)
Hygrometer	Testo	608-H2	41410069	N/A	Aug. 28, 2016	May 16, 2017~ May 25, 2017	Aug. 27, 2017	Conducted (TH05-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY84209521	1GHz~26GHz	Dec. 02, 2016	May 16, 2017~ May 25, 2017	Dec. 01, 2017	Conducted (TH05-HY)
Loop Antenna	Rohde & Schwarz	HFH2-Z2	100315	9 kHz~30 MHz	May 15, 2017	Jun. 01, 2017~ Jun. 04, 2017	May 14, 2019	Radiation (03CH13-HY)
Amplifier	Sonoma-Instru ment	310 N	187282	9KHz~1GHz	Dec. 21, 2016	Jun. 01, 2017~ Jun. 04, 2017	Dec. 20, 2017	Radiation (03CH13-HY)
Bilog Antenna	TESEQ	CBL 6111D&00800 N1D01N-06	40103&04	30MHz to 1GHz	Jan. 07, 2017	Jun. 01, 2017~ Jun. 04, 2017	Jan. 06, 2018	Radiation (03CH13-HY)
Horn Antenna	SCHWARZBE CK	BBHA 9120 D	9120D-1522	1GHz ~ 18GHz	May 17, 2017	Jun. 01, 2017~ Jun. 04, 2017	May 16, 2018	Radiation (03CH13-HY)
SHF-EHF Horn Antenna	SCHWARZBE CK	BBHA 9170	BBHA9170584	18GHz- 40GHz	Nov. 08, 2016	Jun. 01, 2017~ Jun. 04, 2017	Nov. 07, 2017	Radiation (03CH13-HY)
EMI Test Receiver	Agilent	N9038A (MXE)	MY53290053	20Hz to 26.5GHz	Jan. 12, 2017	Jun. 01, 2017~ Jun. 04, 2017	Jan. 11, 2018	Radiation (03CH13-HY)
Spectrum Analyzer	Keysight	N9010A	MY55370526	N/A	Mar. 15, 2017	Jun. 01, 2017~ Jun. 04, 2017	Mar. 14, 2018	Radiation (03CH13-HY)
Spectrum Analyzer	Keysight	N9010A	MY55370526	N/A	Mar. 15, 2017	Jun. 01, 2017~ Jun. 04, 2017	Mar. 14, 2018	Radiation (03CH13-HY)
Spectrum Analyzer	Keysight	N9010A	MY55370526	N/A	Mar. 15, 2017	Jun. 01, 2017~ Jun. 04, 2017	Mar. 14, 2018	Radiation (03CH13-HY)
Spectrum Analyzer	Keysight	N9010A	MY55370526	N/A	Mar. 15, 2017	Jun. 01, 2017~ Jun. 04, 2017	Mar. 14, 2018	Radiation (03CH13-HY)
Hygrometer	TECPEL	DTM-303B	TP140349	N/A	Nov. 14, 2016	Jun. 01, 2017~ Jun. 04, 2017	Nov. 13, 2017	Radiation (03CH13-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY24958/4,M Y28653/4,MY9 839/4PE	9K~30MHz	Jan. 10, 2017	Jun. 01, 2017~ Jun. 04, 2017	Jan. 09, 2018	Radiation (03CH13-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY335041/4M Y9840/4 MY9838/4	30M~1GHz	Jan. 27, 2017	Jun. 01, 2017~ Jun. 04, 2017	Jan. 26, 2018	Radiation (03CH13-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY335041/4M Y9840/4 MY9838/4	1G~26GHz	Jan. 27, 2017	Jun. 01, 2017~ Jun. 04, 2017	Jan. 26, 2018	Radiation (03CH13-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY335041/4M Y9840/4 MY9838/4	26G~40GHz	Mar. 27, 2017	Jun. 01, 2017~ Jun. 04, 2017	Mar. 26, 2018	Radiation (03CH13-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 15 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No. : FR742207-01B

Instrument	Manufacturer	cturer Model No. Serial No. Characteristics		Calibration Date	Test Date	Due Date	Remark	
Controller	EMEC	EM1000	N/A	N/A Control Turn table & Ant Mast		Jun. 01, 2017~ Jun. 04, 2017	N/A	Radiation (03CH13-HY)
Antenna Mast	EMEC	AM-BS-4500- B	N/A	1m~4m	N/A	Jun. 01, 2017~ Jun. 04, 2017	N/A	Radiation (03CH13-HY)
Turn Table	EMEC	TT2000	N/A	0~360 Degree	N/A	Jun. 01, 2017~ Jun. 04, 2017	N/A	Radiation (03CH13-HY)
Test Software	Audix	E3	6.2009-8-24c	N/A	N/A	Jun. 01, 2017~ Jun. 04, 2017	N/A	Radiation (03CH13-HY)
Filter	Wainwright	WLKS1200-1 2SS	SN2	1.2G Low Pass	Sep. 19, 2016	Jun. 01, 2017~ Jun. 04, 2017	Sep. 18, 2017	Radiation (03CH13-HY)
Filter	Wainwright	WHKX12-270 0-3000-18000 -60SS	SN2	3G High Pass	Sep. 20, 2016	Jun. 01, 2017~ Jun. 04, 2017	Sep. 19, 2017	Radiation (03CH13-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 16 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No. : FR742207-01B

5 Uncertainty of Evaluation

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of Confidence	5.10
of 95% (U = 2Uc(y))	5.10

Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.20
of 95% (U = 2Uc(y))	5.20

Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)

Measuring Uncertainty for a Level of Confidence	4.70
of 95% (U = 2Uc(y))	4.70

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : 17 of 17
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report No. : FR742207-01B

Appendix A. Radiated Spurious Emission

Test Engineer :	Alex Jheng, Bill Chang, and Wilson Wu	Temperature :	24.5~24.6°C
rest Eligilieer .		Relative Humidity :	55~57%

2.4GHz 2400~2483.5MHz

BLE (Band Edge @ 3m)

Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
	(MHz)	(dBµV/m)	Limit (dB)	Line (dBµV/m)	Level (dBµV)	Factor (dB/m)	Loss (dB)	Factor (dB)	Pos (cm)	Pos (deg)	Avg. (P/A)	
*	2480	90.37	-	-	78.85	27.64	4.92	30.97	108	78	Р	Н
*	2480	89.84	-	-	78.32	27.64	4.92	30.97	108	78	Α	Н
	2487.8	52.68	-21.32	74	41.08	27.7	4.93	30.96	108	78	Р	Н
	2494.76	43.35	-10.65	54	31.75	27.7	4.93	30.96	108	78	Α	Н
												Н
												Н
*	2480	88.46	-	-	76.94	27.64	4.92	30.97	370	260	Р	V
*	2480	87.77	-	-	76.25	27.64	4.92	30.97	370	260	Α	V
	2496.52	52.25	-21.75	74	40.65	27.7	4.93	30.96	370	260	Р	V
	2489.72	43.32	-10.68	54	31.72	27.7	4.93	30.96	370	260	Α	V
												V
												V
	*	* 2480 * 2480 2487.8 2494.76 * 2480 * 2480 2496.52	(MHz) (dBμV/m) * 2480 90.37 * 2480 89.84 2487.8 52.68 2494.76 43.35 * 2480 88.46 * 2480 87.77 2496.52 52.25	(MHz) (dBμV/m) Limit (dB) * 2480 90.37 - * 2480 89.84 - 2487.8 52.68 -21.32 2494.76 43.35 -10.65 * 2480 88.46 - * 2480 87.77 - 2496.52 52.25 -21.75	(MHz) (dBμV/m) Limit (dB) Line (dBμV/m) * 2480 90.37 - - * 2480 89.84 - - 2487.8 52.68 -21.32 74 2494.76 43.35 -10.65 54 * 2480 88.46 - - * 2480 87.77 - - 2496.52 52.25 -21.75 74	(MHz) (dBμV/m) Limit (dB) Line (dBμV/m) Level (dBμV) * 2480 90.37 - - 78.85 * 2480 89.84 - - 78.32 2487.8 52.68 -21.32 74 41.08 2494.76 43.35 -10.65 54 31.75 * 2480 88.46 - - 76.94 * 2480 87.77 - - 76.25 2496.52 52.25 -21.75 74 40.65	(MHz) (dBμV/m) Limit (dB) Line (dBμV/m) Level (dBμV) Factor (dB/m) * 2480 90.37 - - 78.85 27.64 * 2480 89.84 - - 78.32 27.64 2487.8 52.68 -21.32 74 41.08 27.7 2494.76 43.35 -10.65 54 31.75 27.7 * 2480 88.46 - - 76.94 27.64 * 2480 87.77 - - 76.25 27.64 2496.52 52.25 -21.75 74 40.65 27.7	(MHz) (dBμV/m) Limit (dB) Line (dBμV/m) Level (dBμV) Factor (dB/m) Loss (dB) * 2480 90.37 - - 78.85 27.64 4.92 * 2480 89.84 - - 78.32 27.64 4.92 2487.8 52.68 -21.32 74 41.08 27.7 4.93 2494.76 43.35 -10.65 54 31.75 27.7 4.93 * 2480 88.46 - - 76.94 27.64 4.92 * 2480 87.77 - - 76.25 27.64 4.92 2496.52 52.25 -21.75 74 40.65 27.7 4.93	(MHz) (dBμV/m) Limit (dB) Line (dBμV/m) Level (dBμV) Factor (dB/m) Loss (dB) Factor (dB) * 2480 90.37 - - 78.85 27.64 4.92 30.97 * 2480 89.84 - - 78.32 27.64 4.92 30.97 2487.8 52.68 -21.32 74 41.08 27.7 4.93 30.96 2494.76 43.35 -10.65 54 31.75 27.7 4.93 30.96 * 2480 88.46 - - 76.94 27.64 4.92 30.97 * 2480 87.77 - - 76.25 27.64 4.92 30.97 2496.52 52.25 -21.75 74 40.65 27.7 4.93 30.96	(MHz) (dBμV/m) Limit (dB) Line (dBμV/m) Level (dBμV) Factor (dB/m) Loss (dB) Factor (dB) Pos (cm) * 2480 90.37 - - 78.85 27.64 4.92 30.97 108 * 2480 89.84 - - 78.32 27.64 4.92 30.97 108 2487.8 52.68 -21.32 74 41.08 27.7 4.93 30.96 108 2494.76 43.35 -10.65 54 31.75 27.7 4.93 30.96 108 * 2480 88.46 - - 76.94 27.64 4.92 30.97 370 * 2480 87.77 - - 76.25 27.64 4.92 30.97 370 2496.52 52.25 -21.75 74 40.65 27.7 4.93 30.96 370	(MHz) (dBμV/m) Limit (dB) Line (dBμV/m) Level (dBμV) Factor (dB/m) Loss (dB) Factor (dB) Pos (deg) * 2480 90.37 - - 78.85 27.64 4.92 30.97 108 78 * 2480 89.84 - - 78.32 27.64 4.92 30.97 108 78 2487.8 52.68 -21.32 74 41.08 27.7 4.93 30.96 108 78 2494.76 43.35 -10.65 54 31.75 27.7 4.93 30.96 108 78 * 2480 88.46 - - 76.94 27.64 4.92 30.97 370 260 * 2480 87.77 - - 76.25 27.64 4.92 30.97 370 260 2496.52 52.25 -21.75 74 40.65 27.7 4.93 30.96 370 260	(MHz) Limit (dBμV/m) Line (dBμV/m) Level (dBμV) Factor (dB/m) Loss (dB/m) Factor (dB) Pos (deg) Avg. (deg) (P/A) * 2480 90.37 - - 78.85 27.64 4.92 30.97 108 78 P * 2480 89.84 - - 78.32 27.64 4.92 30.97 108 78 A 2487.8 52.68 -21.32 74 41.08 27.7 4.93 30.96 108 78 P 2494.76 43.35 -10.65 54 31.75 27.7 4.93 30.96 108 78 A * 2480 88.46 - - 76.94 27.64 4.92 30.97 370 260 P * 2480 87.77 - - 76.25 27.64 4.92 30.97 370 260 A 2496.52 52.25 -21.75 74 40.65

Remark

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: A1 of A5

^{1.} No other spurious found.

^{2.} All results are PASS against Peak and Average limit line.

2.4GHz 2400~2483.5MHz

BLE (Harmonic @ 3m)

BLE	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V
		4960	39.51	-34.49	74	56.44	32.04	7.59	57.05	100	0	Р	Н
		7440	45.1	-28.9	74	55.31	37.56	9.21	57.44	100	0	Р	Н
													Н
BLE													Н
CH 39 2480MHz		4960	40.31	-33.69	74	57.24	32.04	7.59	57.05	100	0	Р	V
240UNITI2		7440	44.35	-29.65	74	54.56	37.56	9.21	57.44	100	0	Р	V
													V
													V

Remark 2.

. No other spurious found.

2. All results are PASS against Peak and Average limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: A2 of A5

Emission below 1GHz 2.4GHz BLE (LF)

(dB) 0.59 1 1.53 2.17 2.57	Factor (dB) 32.34 32.29 32.23 32.19 32.18 31.53	Pos (cm)	Pos (deg)	Avg. (P/A) P P P P	H H H H H H H
0.59 1 1.53 2.17 2.57	32.34 32.29 32.23 32.19 32.18			P P P	H H H H H
1 1.53 2.17 2.57	32.29 32.23 32.19 32.18	100	0	P P P	H H H H
1.53 2.17 2.57	32.23 32.19 32.18	100	0	P P	H H H H
2.17 2.57	32.19 32.18	100	0	P P	H H H
2.57	32.18	100	0	Р	H H H
		100	0		H H
2.94	31.53	100	0	P	Н
					Н
					Н
					Н
					Н
					Н
0.95	32.3	100	0	Р	V
1.09	32.29			Р	V
1.59	32.2			Р	V
2.36	32.21			Р	V
2.68	32.09			Р	V
3.06	31.02			Р	V
					V
					V
					V
					V
					V
					V
	2.68	2.68 32.09	2.68 32.09	2.68 32.09	2.68 32.09 P

No other spurious found.

Remark 2. All results are PASS against limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: A3 of A5

Note symbol

Report No. : FR742207-01B

*	Fundamental Frequency which can be ignored. However, the level of any
	unwanted emissions shall not exceed the level of the fundamental frequency.
!	Test result is over limit line.
P/A	Peak or Average
H/V	Horizontal or Vertical

SPORTON INTERNATIONAL INC. Page Number : A4 of A5

TEL: 886-3-327-3456 FAX: 886-3-328-4978

A calculation example for radiated spurious emission is shown as below:

Report No.: FR742207-01B

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

SPORTON INTERNATIONAL INC. Page Number : A5 of A5

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Appendix B. Radiated Spurious Emission

Test Engineer :	Alex Jheng, Bill Chang, and Wilson Wu	Temperature :	24.5~24.6°C
rest Eligilieer .	Alex sherig, bill offarig, and wilson wu	Relative Humidity :	55~57%

Report No. : FR742207-01B

Note symbol


-L	Low channel location
-R	High channel location

SPORTON INTERNATIONAL INC. Page Number : B1 of B5


TEL: 886-3-327-3456 FAX: 886-3-328-4978

2.4GHz 2400~2483.5MHz

BLE (Band Edge @ 3m)

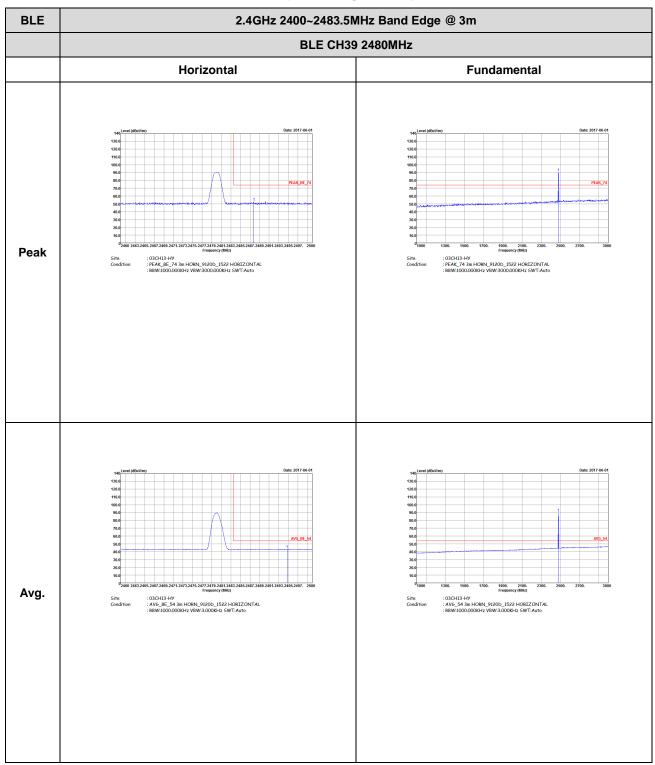


TEL: 886-3-327-3456 FAX: 886-3-328-4978

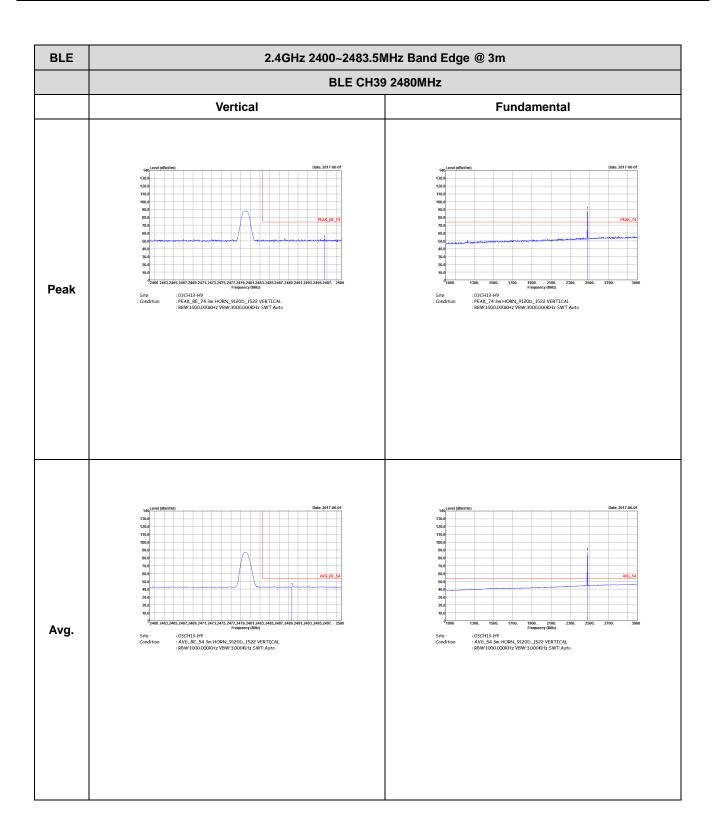

TEL: 886-3-327-3456 FAX: 886-3-328-4978


2.4GHz 2400~2483.5MHz

BLE (Harmonic @ 3m)

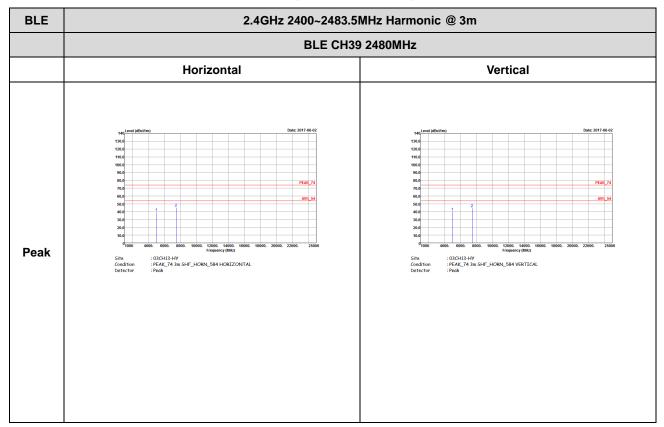

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Emission below 1GHz 2.4GHz BLE (LF)

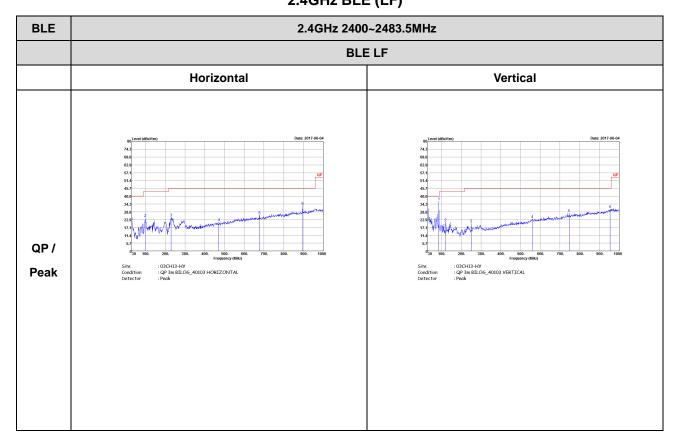


TEL: 886-3-327-3456 FAX: 886-3-328-4978



Appendix C. Duty Cycle Plots

Band	Duty Cycle(%)	T(us)	1/T(kHz)	VBW Setting
Bluetooth -LE	60.32	380	2.63	3kHz

Bluetooth - LE

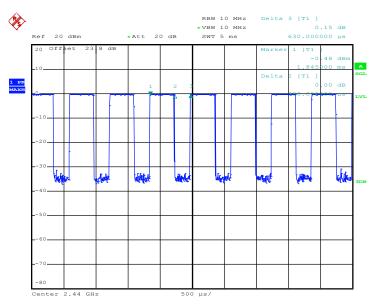

Date: 17.MAY.2017 01:43:31

Appendix D. Original Report

Please refer to Sporton report number FR742206-01B

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-32032B Page Number : D1 of D1
Report Issued Date : Jul. 27, 2017
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT4.0 Version 1.3