# FCC RADIO TEST REPORT

FCC ID : PY7-81713C

Equipment : GSM/WCDMA/LTE Phone with BT, DTS/UNII

a/b/g/n/ac, NFC, FM receiver and GNSS

Brand Name : SONY

Applicant : Sony Corporation

1-7-1 Konan Minato-ku Tokyo, 108-0076 Japan

Report No.: FR1D0403A

Manufacturer : Sony Corporation

1-7-1 Konan Minato-ku Tokyo, 108-0076 Japan

Standard : FCC Part 15 Subpart C §15.247

Test Date(s) : Dec. 24, 2021

We, Sporton International Inc. (Kunshan), would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. (Kunshan), the test report shall not be reproduced except in full.

Reviewed by: Jason Jia / Supervisor

JasonJia

Approved by: Alex Wang / Manager

Sporton International Inc. (Kunshan)

No. 1098, Pengxi North Road, Kunshan Economic Development Zone Jiangsu Province 215300

People's Republic of China

 Sporton International Inc. (Kunshan)
 Page Number
 : 1 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

## **Table of Contents**

His	tory o	of this test report	3	
Su	mmar	y of Test Result	4	
1	Gene	eral Description	5	
	1.1	Product Feature of Equipment Under Test	5	
	1.2	Modification of EUT	5	
	1.3	Testing Location	5	
	1.4	Applicable Standards	5	
2	Test	Configuration of Equipment Under Test	6	
	2.1	Test Mode	6	
	2.2	Connection Diagram of Test System	6	
	2.3	EUT Operation Test Setup	6	
3	Spot Check Evaluation			
	3.1	Introduction Section	7	
	3.2	Difference Section	7	
	3.3	Spot Check Verification Data Section	7	
	3.4	Reference detail Section	7	
4	Test	Result	8	
	4.1	Output Power Measurement	8	
	4.2	Radiated Band Edges and Spurious Emission Measurement	9	
	4.3	Antenna Requirements	12	
5	List	of Measuring Equipment	13	
6	Unce	ertainty of Evaluation	14	
Ap	pendi	x A. Conducted Test Results		
Ap	pendi	x B. Radiated Spurious Emission		
Ap	pendi	x C. Radiated Spurious Emission Plots		
Ap	pendi	x D. Duty Cycle Plots		

TEL: +86-512-57900158 FAX: +86-512-57900958 Page Number : 2 of 14
Issued Date : Feb. 18, 2022

Report No.: FR1D0403A

Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

# History of this test report

Report No.	Version	Description	Issued Date
FR1D0403A	01	Initial issue of report	Feb. 18, 2022

 Sporton International Inc. (Kunshan)
 Page Number
 : 3 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

## **Summary of Test Result**

Report Clause	Ref Std. Clause	Test Items	Result (PASS/FAIL)	Remark
-	15.247(a)(1)	Number of Channels	-	See Note
-	15.247(a)(1)	Hopping Channel Separation	-	See Note
-	15.247(a)(1)	Dwell Time of Each Channel	-	See Note
-	15.247(a)(1)	20dB Bandwidth	-	See Note
-	2.1049	99% Occupied Bandwidth	-	See Note
4.1	15.247(b)(1)	Peak Output Power	Pass	-
-	15.247(d)	Conducted Band Edges	-	See Note
-	15.247(d)	Conducted Spurious Emission	-	See Note
4.2	15.247(d)	Radiated Band Edges and Radiated Spurious Emission	Pass	Under limit 16.00 dB at 2485.42 MHz
-	15.207	AC Conducted Emission	-	See Note
4.3	15.203 & 15.247(b)	Antenna Requirement	Pass	-

Note: Refer to information of Section 3 Spot Check Evaluation.

#### Declaration of Conformity:

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

#### Comments and Explanations:

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification.

 Sporton International Inc. (Kunshan)
 Page Number
 : 4 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

# 1 General Description

## 1.1 Product Feature of Equipment Under Test

GSM/WCDMA/LTE, Bluetooth, DTS/UNII a/b/g/n/ac, NFC, FM Receiver, and GNSS

Standards-related Product Specification					
Antenna Type / Gain	Ant. 6: PIFA Antenna with gain 2.3 dBi				

**Remark:** The above EUT's information was declared by manufacturer. Please refer to Comments and Explanations in report summary.

## 1.2 Modification of EUT

No modifications are made to the EUT during all test items.

## 1.3 Testing Location

Sporton International Inc. (Kunshan) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.02.

Test Firm	Sporton International Inc. (Kunshan)						
	No. 1098, Pengxi North	n Road, Kunshan Econom	c Development Zone				
Test Site Location	Jiangsu Province 2153	00 People's Republic of C	hina				
rest Site Location	TEL: +86-512-57900158						
	FAX: +86-512-57900958						
	Sporton Site No.	FCC Designation No.	FCC Test Firm				
Test Site No.	Sporton Site No.	rec besignation No.	Registration No.				
	03CH06-KS TH01-KS	CN1257	314309				

## 1.4 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- FCC KDB Publication No. 558074 D01 DTS Meas. Guidance v05r02
- FCC KDB 414788 D01 Radiated Test Site v01r01
- + ANSI C63.10-2013

#### Remark:

- 1. All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

 Sporton International Inc. (Kunshan)
 Page Number
 : 5 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

## 2 Test Configuration of Equipment Under Test


#### 2.1 Test Mode

The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: radiation emission(1GHz to the 10<sup>th</sup> harmonic). For radiated measurement, the measured emission level of the EUT was maximized by rotating the EUT on a turntable, adjusting the orientation of the EUT and EUT antenna in three orthogonal axis (X: flat, Y: portrait, Z: landscape), and adjusting the measurement antenna orientation, following C63.10 exploratory test procedures and find Z plane as worst plane, and the worst mode of radiated spurious emissions is Bluetooth 3Mbps mode, and recorded in this report. The worst case position of the EUT was investigated under two configurations: EUT with AC adapter and earphone, EUT with standalone. The EUT with standalone configuration was determined to be worst-case configurations; therefore, all final tests were performed on the EUT with standalone.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

Radiated	Bluetooth EDR 3Mbps 8-DPSK
Test Cases	Mode 1: CH78_2480 MHz for 3Mbps

## 2.2 Connection Diagram of Test System

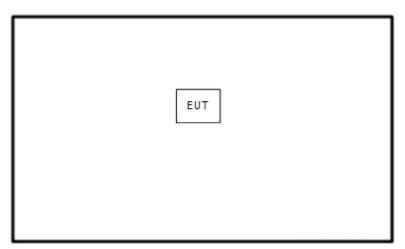

## 2.3 EUT Operation Test Setup

The RF test items, utility "FTM" was installed in Notebook which was programmed in order to make the EUT get into the engineering modes to provide channel selection, power level, data rate and the application type and for continuous transmitting signals.

 Sporton International Inc. (Kunshan)
 Page Number
 : 6 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

## 3 Spot Check Evaluation

#### 3.1 Introduction Section

Sony Corporation, hereby declares that the WLAN and Bluetooth hardware of PY7-81713C (this model) are HW identical to PY7-34943G (lead). In addition, PY7-81713C (this model) digital circuit is identical to PY7-34943G (lead). Therefore the following report of PY7-34943G (lead) may be used as reference test data for PY7-81713C (this model), along with the spot check verification data following the FCC KDB 484596 D01 v01, and takes full responsibility that the test data as referenced in this report represent compliance for the new FCC ID PY7-81713C.

## 3.2 Difference Section

Difference between PY7-34943G (lead) and PY7-81713C (this model):

Sony Corporation, hereby declares the differences between PY7-34943G (lead) and PY7-81713C (this model) are related only to the cellular part and NFC, other functions are not affected. Therefore the WLAN and Bluetooth report/data of PY7-34943G (lead) may represent for PY7-81713C (this model).

## 3.3 Spot Check Verification Data Section

Conducted power test and radiated spurious emission test against the variant model based on the worst-case condition from the original model was performed in this filing and the verification test results similar to the original FCC ID. All tests meet FCC technical limits. Detail spot check test result can be found in the variant model report, please refer to the detail section table in section 3.4.

Summary of the spot check:

Test Item	Mode	PY7-34943G Worst Result	PY7-81713C Worst Result	Difference (dB)
Conducted Power (dBm)	BT BR/EDR	10.24	10.06	0.18
Radiated Spurious Emission (dBuV/m) @ 3m	BT BR/EDR	55.07	58.00	2.93

### 3.4 Reference detail Section

Rule Part	Equipment Class	Wireless Technology	Frequency Band (MHz)	Original FCC ID	Original Report	Variant Model FCC ID	Variant Model Report
15C	DSS	Bluetooth BR/EDR	2400~2483.5	PY7-34943G	Part 15C (FR1D0310A)	PY7-81713C	Part 15C (FR1D0403A)

 Sporton International Inc. (Kunshan)
 Page Number
 : 7 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

## 4 Test Result

## 4.1 Output Power Measurement

## 4.1.1 Limit of Output Power

The maximum peak conducted output power of the intentional radiator shall not exceed the following: For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts.


## 4.1.2 Measuring Instruments

See list of measuring equipment of this test report.

#### 4.1.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 1. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 2. Set the maximum power setting and enable the EUT to transmit continuously.
- 3. Measure the conducted output power with cable loss and record the results in the test report.
- 4. Measure and record the results in the test report.

### 4.1.4 Test Setup

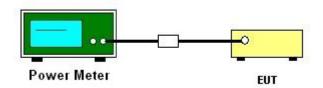

## 4.1.5 Test Result of Peak Output Power

Please refer to Appendix A.

 Sporton International Inc. (Kunshan)
 Page Number
 : 8 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

## 4.2 Radiated Band Edges and Spurious Emission Measurement

## 4.2.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics / spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

## 4.2.2 Measuring Instruments

See list of measuring equipment of this test report.

 Sporton International Inc. (Kunshan)
 Page Number
 : 9 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : :

Report Template No.: BU5-FR15CBT Version 2.4

## 4.2.3 Test Procedures

- 1. The EUT was placed on a turntable with 1.5 meter for frequency above 1 GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set the maximum power setting and enable the EUT to transmit continuously.
- 5. Use the following spectrum analyzer settings:
  - (1) Span shall wide enough to fully capture the emission being measured;
  - (2) Set RBW = 1 MHz for f>1 GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
  - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time =  $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ 

Where  $N_1$  is number of type 1 pulses,  $L_1$  is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20\*log(Duty cycle)

- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 7. For testing above 1 GHz, the emission level of the EUT in peak mode was 20 dB lower than average limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.

Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.79dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

 Sporton International Inc. (Kunshan)
 Page Number
 : 10 of 14


 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

## 4.2.4 Test Setup

#### For radiated test above 1GHz

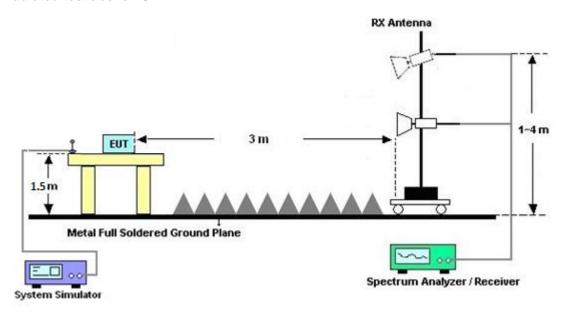

## 4.2.5 Test Result of Radiated Spurious Emissions

Please refer to Appendix B and C.

## 4.2.6 Duty Cycle

Please refer to Appendix D.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 Page Number : 11 of 14
Issued Date : Feb. 18, 2022

Report No.: FR1D0403A

Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

# 4.3 Antenna Requirements

## 4.3.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6 dBi, the power shall be reduced by the same level in dB comparing to gain minus 6 dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

## 4.3.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

#### 4.3.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

 Sporton International Inc. (Kunshan)
 Page Number
 : 12 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

# 5 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Pulse Power Senor	Anritsu	MA2411B	0917070	300MHz~40GH z	Jan. 07, 2021	Dec. 24, 2021	Jan. 06, 2022	Conducted (TH01-KS)
Power Meter	Anritsu	ML2495A	1005002	50MHz Bandwidth	Jan. 07, 2021	Dec. 24, 2021	Jan. 06, 2022	Conducted (TH01-KS)
EMI Test Receiver	Keysight	N9038A	MY564000 04	3Hz~8.5GHz;M ax 30dBm	Oct. 16, 2021	Feb. 06, 2022	Oct. 15, 2022	Radiation (03CH06-KS)
EXA Spectrum Analyzer	Keysight	N9010A	MY551502 08	10Hz-44GHz	Apr. 12, 2021	Feb. 06, 2022	Apr. 11, 2022	Radiation (03CH06-KS)
Double Ridge Horn Antenna	ETS-Lindgren	3117	00218652	1GHz~18GHz	Apr. 25, 2021	Feb. 06, 2022	Apr. 24, 2022	Radiation (03CH06-KS)
SHF-EHF Horn	Com-power	AH-840	101093	18GHz~40GHz	Jan 05, 2022	Feb. 06, 2022	Jan. 04 2023	Radiation (03CH06-KS)
high gain Amplifier	MITEQ	AMF-7D-0010 1800-30-10P	2025788	1Ghz-18Ghz	Jul. 30, 2021	Feb. 06, 2022	Jul. 29, 2022	Radiation (03CH06-KS)
Amplifier	MITEQ	EM18G40GG A	060728	18~40GHz	Jan 05, 2022	Feb. 06, 2022	Jan. 04 2023	Radiation (03CH06-KS)
AC Power Source	Chroma	61601	F1040900 04	N/A	NCR	Feb. 06, 2022	NCR	Radiation (03CH06-KS)
Turn Table	ChamPro	EM 1000-T	060762-T	0~360 degree	NCR	Feb. 06, 2022	NCR	Radiation (03CH06-KS)
Antenna Mast	ChamPro	EM 1000-A	060762-A	1 m~4 m	NCR	Feb. 06, 2022	NCR	Radiation (03CH06-KS)

NCR: No Calibration Required

 Sporton International Inc. (Kunshan)
 Page Number
 : 13 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version :

Report Template No.: BU5-FR15CBT Version 2.4

# 6 Uncertainty of Evaluation

Uncertainty of Radiated Emission Measurement (1000 MHz ~ 40000 MHz)

Measuring Uncertainty for a Level of Confidence	5.0dB
of 95% (U = 2Uc(y))	5.UGB

 Sporton International Inc. (Kunshan)
 Page Number
 : 14 of 14

 TEL: +86-512-57900158
 Issued Date
 : Feb. 18, 2022

FAX: +86-512-57900958 Report Version : 01

Report Template No.: BU5-FR15CBT Version 2.4

# **Appendix A. Conducted Test Results**

Test Engineer:	Smile Wang	Temperature:	20~26	ç
Test Date:	2021/12/24	Relative Humidity:	40~51	%

Report No.: FR1D0403A

DH	CH.	NTX	Peak Power (dBm)	Test Result	
	0	1	10.06	20.97	Pass
DH1	39	1	10.05	20.97	Pass
	78	1	9.98	20.97	Pass
2DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	9.48	20.97	Pass
2DH1	39	1	9.38	20.97	Pass
	78	1	9.42	20.97	Pass
3DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	9.64	20.97	Pass
3DH1	39	1	9.67	20.97	Pass
	78	1	9.69	20.97	Pass

Sporton International Inc. (Kunshan) Page Number : A1 of A1

TEL: +86-512-57900158 FAX: +86-512-57900958

# Appendix B. Radiated Spurious Emission

Toot Engineer	Henzy Li	Temperature :	22~23°C
Test Engineer :		Relative Humidity :	41~42%

#### 2.4GHz 2400~2483.5MHz

## BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
ANT				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
6		(MHz)	( dBµV/m )	(dB)	(dBµV/m)	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	(deg)	(P/A)	(H/V)
		2485.42	58.00	-16.00	74	52.2	31.17	7.27	32.64	114	136	Р	Н
		2485.42	33.21	-20.79	54	-	-	-	-	-	-	Α	Н
DT		2480	101.50	-	-	95.74	31.13	7.27	32.64	114	136	Р	Н
BT CH 78		2480	76.71	-	-	-	-	-	-	-	-	Α	Н
2480MHz		2485.48	57.96	-16.04	74	52.16	31.17	7.27	32.64	319	100	Р	V
2400WII 12		2485.48	33.17	-20.83	54	-	-	-	-	-	-	Α	٧
		2480	103.15	-	1	97.39	31.13	7.27	32.64	319	100	Р	V
		2480	78.36	-	-	-	-	-	-	-	-	Α	V
Remark		o other spurio I results are P		st Peak	and Averag	je limit lin	e.						

### 2.4GHz 2400~2483.5MHz

## BT (Harmonic @ 3m)

					•								
ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
ANT				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
6		(MHz)	( dBµV/m )	(dB)	(dBµV/m)	(dB <sub>µ</sub> V)	( dB/m )	( dB )	( dB )	( cm )	(deg)	(P/A)	(H/V)
		4965	41.64	-32.36	74	56.41	34.81	10.43	60.01	300	0	Р	Н
BT		7440	44.34	-29.66	74	55.41	36.59	12.88	60.54	300	0	Р	Н
CH 78 2480MHz		4965	42.02	-31.98	74	56.79	34.81	10.43	60.01	100	0	Р	V
240UIVITI2		7440	44.48	-29.52	74	55.55	36.59	12.88	60.54	100	0	Р	V

#### Remark

- 1. No other spurious found.
- 2. All results are PASS against Peak and Average limit line.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 Page Number

: B1 of B3

## Note symbol

Report No. : FR1D0403A

*	Fundamental Frequency which can be ignored. However, the level of any
	unwanted emissions shall not exceed the level of the fundamental frequency.
!	Test result is <b>over limit</b> line.
P/A	Peak or Average
H/V	Horizontal or Vertical

Sporton International Inc. (Kunshan) Page Number : B2 of B3

TEL: +86-512-57900158 FAX: +86-512-57900958

## A calculation example for radiated spurious emission is shown as below:

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	(dBµV/m)	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	(deg)	(P/A)	(H/V)
вт		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 00													
2402MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

- 1. Path Loss(dB) = Cable loss(dB) + Filter loss(dB) + Attenuator loss(dB)
- 2. Level( $dB\mu V/m$ ) =

Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

3. Over Limit(dB) = Level(dB $\mu$ V/m) – Limit Line(dB $\mu$ V/m)

#### For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

#### For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

**Sporton International Inc. (Kunshan)**TEL: +86-512-57900158
FAX: +86-512-57900958

# **Appendix C. Radiated Spurious Emission Plots**

## Note symbol

Report No.: FR1D0403A

-L	Low channel location
-R	High channel location


Sporton International Inc. (Kunshan) Page Number

TEL: +86-512-57900158 FAX: +86-512-57900958




## 2.4GHz 2400~2483.5MHz

## BT (Band Edge @ 3m)

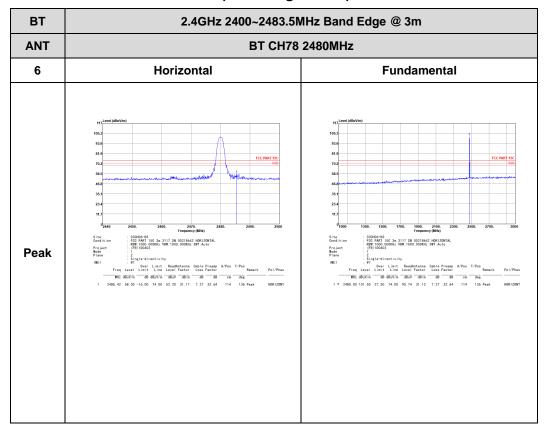

TEL: +86-512-57900158 FAX: +86-512-57900958

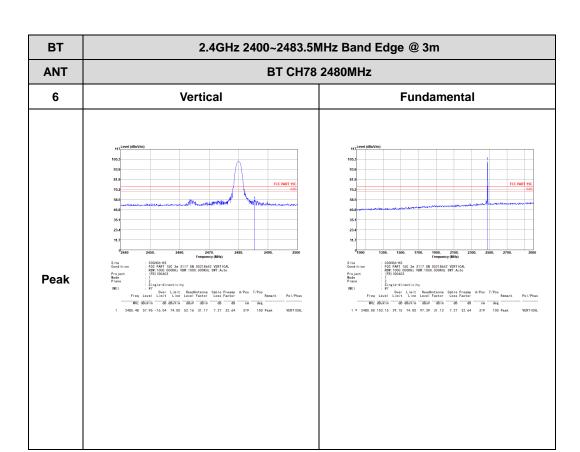




Report No.: FR1D0403A

#### 2.4GHz 2400~2483.5MHz


## BT (Harmonic @ 3m)

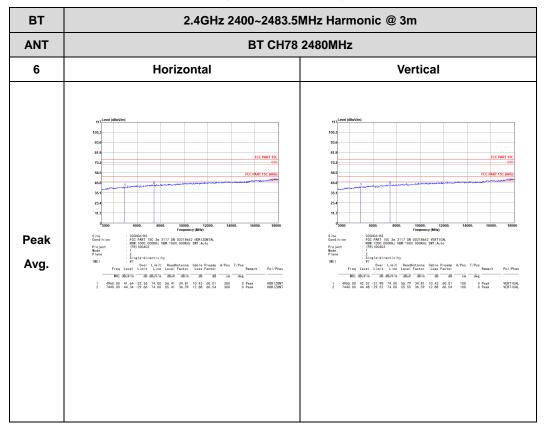

TEL: +86-512-57900158 FAX: +86-512-57900958

# Appendix D. Duty Cycle Plots

## <3Mbps>

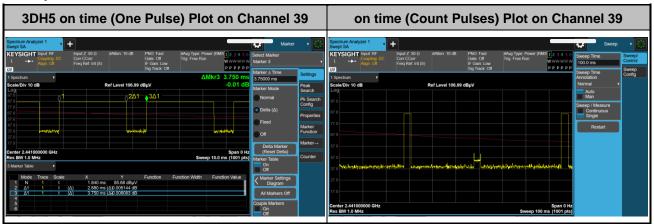

#### Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = 2 \* 2.880 / 100 = 5.76 %
- 2. Worst case Duty cycle correction factor = 20\*log(Duty cycle) = -24.79 dB
- 3. 3DH5 has the highest duty cycle worst case and is reported.



TEL: +86-512-57900158 FAX: +86-512-57900958