FCC RF Test Report

APPLICANT : Sony Mobile Communications Inc. EQUIPMENT : GSM/WCDMA/LTE Phone+Bluetooth,

DTS/UNII a/b/g/n and NFC

BRAND NAME : Sony

FCC ID : PY7-87507S

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

This is a variant report which is only valid together with the original test report. The product was received on Aug. 22, 2017 and testing was completed on Sep. 05, 2017. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 1 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

1190

Report No.: FR782203A

TABLE OF CONTENTS

RE	VISIO	N HISTORY	3
SUI	MMAR	Y OF TEST RESULT	4
1	GENE	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Modification of EUT	5
	1.5	Testing Location	6
	1.6	Applicable Standards	6
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	7
	2.1	Carrier Frequency Channel	7
	2.2	Descriptions of Test Mode	8
	2.3	Test Mode	8
	2.4	Connection Diagram of Test System	9
	2.5	Support Unit used in test configuration and system	9
	2.6	EUT Operation Test Setup	9
3	TEST	RESULT	10
	3.1	Radiated Band Edges and Spurious Emission Measurement	10
	3.2	Antenna Requirements	14
4	LIST	OF MEASURING EQUIPMENT	15
5	UNC	ERTAINTY OF EVALUATION	17
API	PENDI	IX A. RADIATED SPURIOUS EMISSION	
API	PENDI	IX B. RADIATED SPURIOUS EMISSION PLOTS	
API	PENDI	IX C. DUTY CYCLE PLOTS	
ΔРІ	DENIDI	IY D ORIGINAL REPORT	

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 2 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No. : FR782203A

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR782203A	Rev. 01	Initial issue of report	Oct. 30, 2017

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 3 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No. : FR782203A

SUMMARY OF TEST RESULT

Report Section	FCC Rule	Description	Limit	Result	Remark
		Radiated Band Edges			Under limit
3.1	15.247(d)	and Radiated Spurious	15.209(a) & 15.247(d)	Pass	3.39 dB at
		Emission			42.690 MHz
3.2	15.203 & 15.247(b)	Antenna Requirement	N/A	Pass	-

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 4 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No. : FR782203A

1 General Description

1.1 Applicant

Sony Mobile Communications Inc.

4-12-3 Higashi-Shinagawa, Shinagawa-ku, Tokyo, 140-0002, Japan

1.2 Manufacturer

Sony Mobile Communications Inc.

4-12-3 Higashi-Shinagawa, Shinagawa-ku, Tokyo, 140-0002, Japan

1.3 Product Feature of Equipment Under Test

GSM/WCDMA/LTE, Bluetooth, DTS/UNII a/b/g/n, FM Receiver, NFC, and GPS.

Standards-related Product Specification			
Antenna Type / Gain	PIFA Antenna type with gain -1.20 dBi		

Report No.: FR782203A

Remark: This is a variant report. All the test cases were performed on original report which can be referred to Sporton Report Number FR782113A.

EUT Information List				
HW Version SW Version		S/N	Performed Test Item	
	1.8	WUJ01Q22RY	RF conducted measurement	
A		WUJ01Q23X7	Radiated Spurious Emission	

Accessory List		
AC Adoptor	Model Name: EP800	
AC Adapter	S/N: 2916W46610569	
Гатра	Model Name: MH410c	
Earphone	S/N: N/A	
HCD Coble	Model Name: UCB20	
USB Cable	S/N: 1635A91C00314D8	

Note:

- 1. Above EUT list and accessory list used are electrically identical per declared by manufacturer.
- 2. Above the accessories list are used to exercise the EUT during test.
- 3. For other wireless features of this EUT, test report will be issued separately.

1.4 Modification of EUT

No modifications are made to the EUT during all test items.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 5 of 17

 TEL: 886-3-327-3456
 Report Issued Date
 : Oct. 30, 2017

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

FCC ID: PY7-87507S Report Template No.: BU5-FR15CBT Version 2.0

1.5 Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 and TW0007 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC Test.

Test Site	SPORTON INTERNATIONAL INC.	
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park,	
Test Site Location	Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.	
rest Site Location	TEL: +886-3-327-3456	
	FAX: +886-3-328-4978	
Took Site No	Sporton Site No.	
Test Site No.	TH05-HY	

Note: The test site complies with ANSI C63.4 2014 requirement.

Test Site SPORTON INTERNATIONAL INC.	
	No.58, Aly. 75, Ln. 564, Wenhua 3rd Rd. Guishan Dist,
Took Cita Lagation	Taoyuan City, Taiwan (R.O.C.)
Test Site Location	TEL: +886-3-327-0868
	FAX: +886-3-327-0855
Took Site No.	Sporton Site No.
Test Site No.	03CH10-HY

Note: The test site complies with ANSI C63.4 2014 requirement.

1.6 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- ANSI C63.10-2013

Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 6 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No.: FR782203A

2 Test Configuration of Equipment Under Test

2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 7 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No.: FR782203A

2.2 Descriptions of Test Mode

Preliminary tests were performed in different data rates and recorded the RF output power in the following table:

		Blue	tooth RF Output Peak Po	ower
Channel	nel Frequency	Data Rate / Modulation		
Chamilei		GFSK	π/4-DQPSK	8-DPSK
		1Mbps	2Mbps	3Mbps
Ch00	2402MHz	7.15 dBm	6.23 dBm	6.28 dBm
Ch39	2441MHz	<mark>8.18</mark> dBm	7.31 dBm	7.44 dBm
Ch78	2480MHz	7.32 dBm	6.35 dBm	6.56 dBm

	nnel Frequency	Bluetooth RF Output Average Power					
Channal			Data Rate / Modulation				
Channel		rrequency	GFSK	π/4-DQPSK	8-DPSK		
							1Mbps
Ch00	2402MHz	6.15 dBm	3.86 dBm	3.81 dBm			
Ch39	2441MHz	<mark>6.98</mark> dBm	4.98 dBm	4.99 dBm			
Ch78	2480MHz	6.73 dBm	4.56 dBm	4.52 dBm			

a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). Pre-scanned tests, X, Y, Z in three orthogonal panels, and different data rates were conducted to determine the final configuration (X plane as worst plane) from all possible combinations.

2.3 Test Mode

The following summary table is showing all test modes to demonstrate in compliance with the standard.

	Summary table of Test Cases				
Took Itam	Data Rate / Modulation				
Test Item	Bluetooth EDR 3Mbps 8-DPSK				
Radiated	Mada 4, CUZO 2400 MUL				
Test Cases	Mode 1: CH78_2480 MHz				


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 8 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No.: FR782203A

2.4 Connection Diagram of Test System

<Bluetooth Tx Mode>

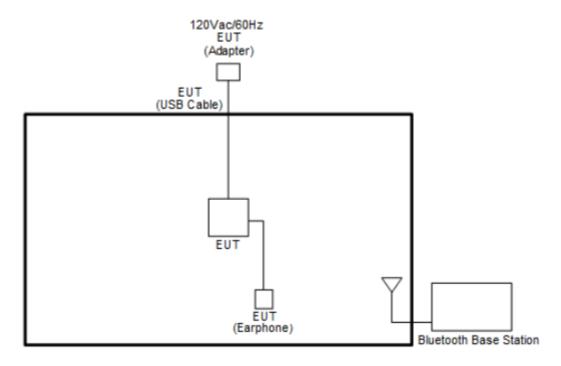

2.5 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	Bluetooth Base Station	R&S	CBT32	N/A	N/A	Unshielded, 1.8 m

2.6 EUT Operation Test Setup

The RF test items utility, an engineering test program was programmed in order to make the EUT get into the engineering modes to contact with base station for continuous transmitting.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 9 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No.: FR782203A

3 Test Result

3.1 Radiated Band Edges and Spurious Emission Measurement

3.1.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 - 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 10 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No.: FR782203A

3.1.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time = $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$

Where N_1 is number of type 1 pulses, L_1 is length of type 1 pulses, etc.


Average Emission Level = Peak Emission Level + 20*log(Duty cycle)

- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 7. For testing below 1GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 8. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than average limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.


Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.79dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

3.1.4 Test Setup

For radiated emissions below 30MHz

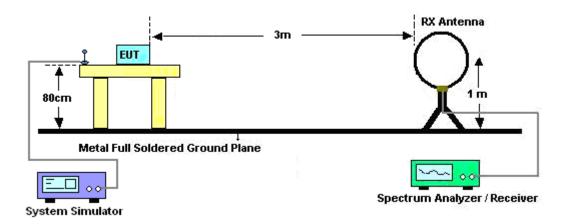

For radiated emissions from 30MHz to 1GHz

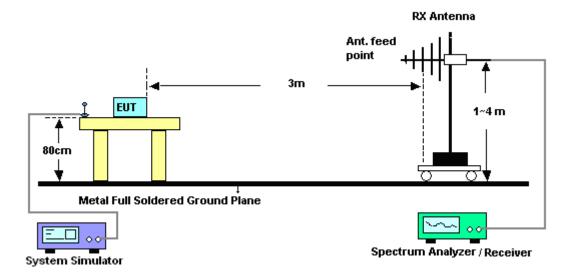


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 12 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No.: FR782203A

For radiated emissions above 1GHz

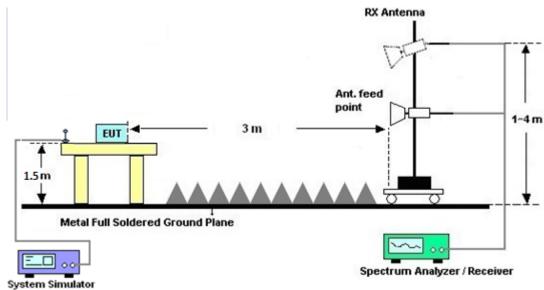

3.1.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

3.1.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix A and B.

3.1.7 Duty Cycle

Please refer to Appendix C.

3.1.8 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic)

Please refer to Appendix A and B.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 13 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No.: FR782203A

3.2 Antenna Requirements

3.2.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

3.2.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

3.2.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 14 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No.: FR782203A

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark	
Power Meter	Anritsu	ML2495A	0932001	N/A	Sep. 29, 2016	9, 2016 Aug. 23, 2017 Sep. 28, 2017		Conducted (TH05-HY)	
Power Sensor	Anritsu	MA2411B	0846202	300MHz~40GH z	Sep. 29, 2016	Aug. 23, 2017	Sep. 28, 2017	Conducted (TH05-HY)	
Spectrum Analyzer	Rohde & Schwarz	FSP30	101067	9kHz ~ 30GHz	Nov. 17, 2016	Aug. 23, 2017	Nov. 16, 2017	Conducted (TH05-HY)	
Hygrometer	TECPEL	DTM-303B	TP157151	N/A	Mar. 20, 2017	Aug. 23, 2017	Mar. 19, 2018	Conducted (TH05-HY)	
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY842095 21	1GHz~26GHz	Dec. 02, 2016	Aug. 23, 2017	Dec. 01, 2017	Conducted (TH05-HY)	
Loop Antenna	Rohde & Schwarz	HFH2-Z2	100315	9 kHz~30 MHz	May 15, 2017	Aug. 29, 2017~ Sep. 05, 2017	May 14, 2019	Radiation (03CH10-HY)	
Bilog Antenna	TESEQ	CBL 6111D&00800 N1D01N-06	35413&02	30MHz~1GHz	Jan. 07, 2017	Aug. 29, 2017~ Sep. 05, 2017	Jan. 06, 2018	Radiation (03CH10-HY)	
Horn Antenna	SCHWARZBE CK	BBHA 9120 D	9120D-132 5	1GHz ~ 18GHz	Sep. 30, 2016	Aug. 29, 2017~ Sep. 05, 2017	Sep. 29, 2017	Radiation (03CH10-HY)	
SHF-EHF Horn Antenna	SCHWARZBE CK	BBHA 9170	BBHA9170 584	18GHz- 40GHz	Nov. 08, 2016	Aug. 29, 2017~ Sep. 05, 2017	Nov. 07, 2017	Radiation (03CH10-HY)	
Spectrum Analyzer	Keysight	N9010A	MY542004 85	10Hz ~ 44GHz	Oct. 17, 2016	Aug. 29, 2017~ Sep. 05, 2017	Oct. 16, 2017	Radiation (03CH10-HY)	
EMI Test Receiver	Agilent	N9038A(MXE)	MY532900 45	20Hz to 8.4GHz	Jan. 19, 2017	Aug. 29, 2017~ Sep. 05, 2017	Jan. 18, 2018	Radiation (03CH10-HY)	
Amplifier	SONOMA	310N	187311	9kHz~1GHz	Oct. 26, 2016	Aug. 29, 2017~ Sep. 05, 2017	Oct. 25, 2017	Radiation (03CH10-HY)	
Preamplifier	Keysight	83017A	MY532700 78	1GHz~26.5GHz	Oct. 26, 2016	Aug. 29, 2017~ Sep. 05, 2017	Oct. 25, 2017	Radiation (03CH10-HY)	
Preamplifier	MITEQ	TTA1840-35- HG	1871923	18GHz~40GHz, VSWR : 2.5:1 max	Jul. 21, 2017	Aug. 29, 2017~ Sep. 05, 2017	Jul. 20, 2018	Radiation (03CH10-HY)	
Preamplifier	MITEQ	AMF-7D-0010 1800-30-10P	1815698	1GHz~18GHz	Dec. 01, 2016	Aug. 29, 2017~ Sep. 05, 2017	Nov. 30, 2018	Radiation (03CH10-HY)	

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 15 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No. : FR782203A

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Hygrometer	TECPEL	DTM-303B	TP140320	N/A	Nov. 14, 2016	Aug. 29, 2017~ Sep. 05, 2017	Nov. 13, 2017	Radiation (03CH10-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY249564 MY249524 MY283184	25GHz~40GHz	Sep. 30, 2016	Aug. 29, 2017~ Sep. 05, 2017	Sep. 29, 2017	Radiation (03CH10-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY249564 MY249524 MY283184	30MHz~1GHz	Sep. 30, 2016	Aug. 29, 2017~ Sep. 05, 2017	Sep. 29, 2017	Radiation (03CH10-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY249564 MY249524 MY283184	1GHz~25GHz	Sep. 30, 2016	Aug. 29, 2017~ Sep. 05, 2017	Sep. 29, 2017	Radiation (03CH10-HY)
Controller	EMEC	EM 1000	N/A	Control Turn table & Ant Mast	N/A	Aug. 29, 2017~ Sep. 05, 2017	N/A	Radiation (03CH10-HY)
Antenna Mast	EMEC	AM-BS-450 0-B	N/A	1~4m	N/A	Aug. 29, 2017~ Sep. 05, 2017	N/A	Radiation (03CH10-HY)
Turn Table	EMEC	TT 2200	N/A	0~360 Degree	N/A	Aug. 29, 2017~ Sep. 05, 2017	N/A	Radiation (03CH10-HY)
Test Software	Audix	E3	6.2009-8-24	N/A	N/A	Aug. 29, 2017~ Sep. 05, 2017	N/A	Radiation (03CH10-HY)
Filter	Wainwright	WLKS1200- 12SS	SN2	1.2G Low Pass	Sep. 19, 2016	Aug. 29, 2017~ Sep. 05, 2017	Sep. 18, 2017	Radiation (03CH10-HY)
Filter	Wainwright	WHKX12-27 00-3000-18 000-60SS	SN2	3G High Pass	Sep. 20, 2016	Aug. 29, 2017~ Sep. 05, 2017	Sep. 19, 2017	Radiation (03CH10-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 16 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No. : FR782203A

5 Uncertainty of Evaluation

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of Confidence	5.60
of 95% (U = 2Uc(y))	3.00

Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.90
of 95% (U = 2Uc(y))	0.50

Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)

Measuring Uncertainty for a Level of Confidence	5.20
of 95% (U = 2Uc(y))	5.20

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-87507S Page Number : 17 of 17
Report Issued Date : Oct. 30, 2017
Report Version : Rev. 01

Report No.: FR782203A

Appendix A. Radiated Spurious Emission

Toot Engineer	Tsung Li , Stan Hsieh and Kyle Chuang	Temperature :	22~24°C
Test Engineer :		Relative Humidity :	43~44%

2.4GHz 2400~2483.5MHz

BT (3M) (Band Edge @ 3m)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
	*	2480	99.84	-	-	101.26	27.24	4.51	33.17	100	76	Р	Н
	*	2480	75.05	-	-							Α	Н
		2484.88	42.89	-31.11	74	44.29	27.24	4.53	33.17	100	76	Р	Н
		2484.88	18.1	-35.9	54							Α	Н
													Н
BT													Н
CH 78 2480MHz	*	2480	97.46	-	-	98.88	27.24	4.51	33.17	367	49	Р	V
2460WIF12	*	2480	72.67	-	-							Α	V
		2483.72	42.26	-31.74	74	43.66	27.24	4.53	33.17	367	49	Р	V
		2483.72	17.47	-36.53	54							Α	V
													V
													V

Remark

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: A1 of A5

^{1.} No other spurious found.

^{2.} All results are PASS against Peak and Average limit line.

2.4GHz 2400~2483.5MHz

BT (3M) (Harmonic @ 3m)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dB _µ V)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		4960	39.27	-34.73	74	57.67	32.42	6.86	58.14	100	0	Р	Н
		4960	14.48	-39.52	54							Α	Н
		7440	41.33	-32.67	74	54.33	37.32	8.5	59.17	100	0	Р	Н
BT		7440	16.54	-37.46	54							Α	Н
CH 78 2480MHz		4960	37.73	-36.27	74	56.13	32.42	6.86	58.14	100	0	Р	V
2400WITI2		4960	12.94	-41.06	54							Α	V
		7440	41.59	-32.41	74	54.59	37.32	8.5	59.17	100	0	Р	V
		7440	16.8	-37.2	54							Α	V

Remark

. No other spurious found.

2. All results are PASS against Peak and Average limit line.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Emission below 1GHz

2.4GHz BT (LF)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	
		43.23	25	-15	40	39.62	17.33	0.69	32.75	-	-	Р	Н
		105.06	29.98	-13.52	43.5	45.01	16.53	0.97	32.77	-	-	Р	Н
		130.71	25.59	-17.91	43.5	39.4	17.54	1.12	32.76	-	-	Р	Н
		308.4	25.37	-20.63	46	36.74	19.3	1.65	32.71	-	-	Р	Н
		773.2	29.9	-16.1	46	31.33	28.33	2.54	32.92	-	-	Р	Н
		942.6	32.87	-13.13	46	30.65	30.47	2.78	31.83	100	0	Р	Н
													Н
													Н
													Н
													Н
													Н
2.4GHz													Н
BT		42.69	36.61	-3.39	40	50.71	17.85	0.69	32.75	100	0	Р	V
LF		100.47	26.62	-16.88	43.5	42.03	16.15	0.97	32.77	-	-	Р	V
		210.09	17.28	-26.22	43.5	33.12	15.08	1.44	32.75	-	-	Р	V
		419.7	23.79	-22.21	46	31.59	22.62	1.93	32.78	-	-	Р	V
		640.9	27.43	-18.57	46	30.95	26.57	2.32	33	-	-	Р	V
		946.8	32.86	-13.14	46	30.45	30.61	2.78	31.78	-	-	Р	V
													V
													V
													V
													V
													V
													V
		<u> </u>			1		1				1		1

Remark

- 1. No other spurious found.
- 2. All results are PASS against limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Note symbol

Report No. : FR782203A

*	Fundamental Frequency which can be ignored. However, the level of any
	unwanted emissions shall not exceed the level of the fundamental frequency.
!	Test result is over limit line.
P/A	Peak or Average
H/V	Horizontal or Vertical

SPORTON INTERNATIONAL INC. Page Number : A4 of A5

A calculation example for radiated spurious emission is shown as below:

Report No.: FR782203A

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

SPORTON INTERNATIONAL INC. Page Number : A5 of A5

Appendix B. Radiated Spurious Emission Plots

Took Fundinger .	Tauran I : Chan I laich and Kula Churana	Temperature :	22~24°C	
Test Engineer :	Tsung Li , Stan Hsieh and Kyle Chuang	Relative Humidity :	43~44%	


Report No.: FR782203A

Note symbol

-L	Low channel location
-R	High channel location


SPORTON INTERNATIONAL INC. Page Number : B1 of

2.4GHz 2400~2483.5MHz BT (3M) (Band Edge @ 3m)

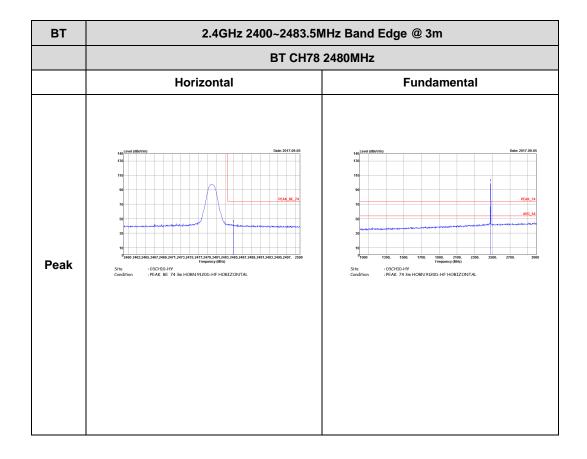


TEL: 886-3-327-3456 FAX: 886-3-328-4978



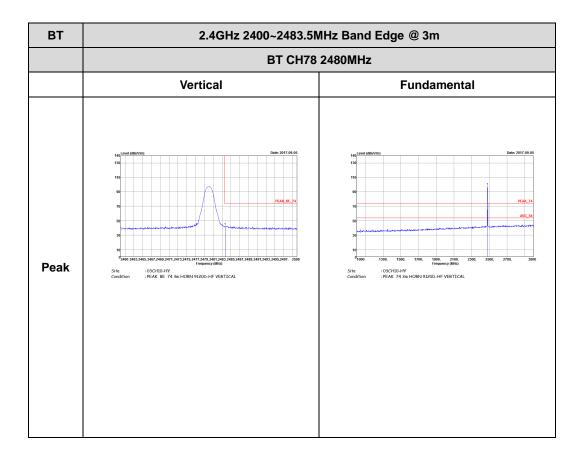


TEL: 886-3-327-3456 FAX: 886-3-328-4978

2.4GHz 2400~2483.5MHz BT (3M) (Harmonic @ 3m)

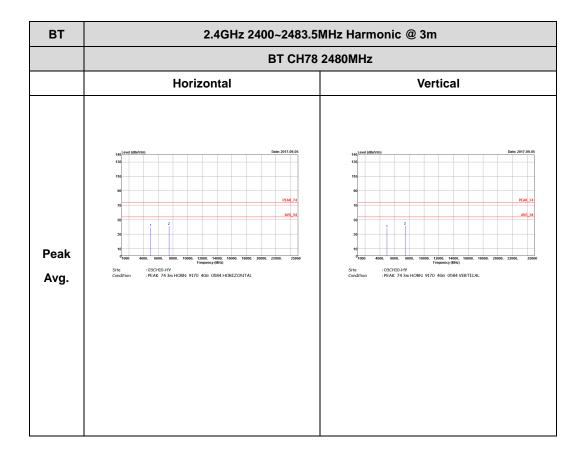

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Emission below 1GHz 2.4GHz BT (LF)

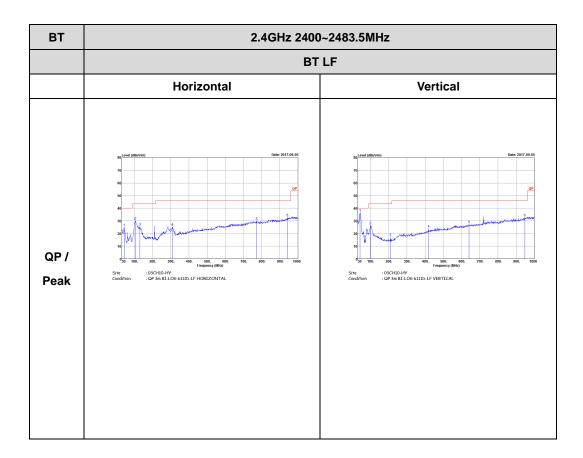


TEL: 886-3-327-3456 FAX: 886-3-328-4978



Report No.: FR782203A

Appendix C. Duty Cycle Plots

3DH5 on time (One Pulse) Plot on Channel 39

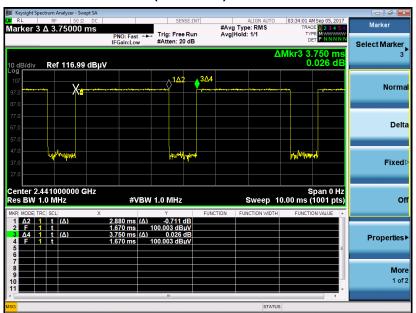

on time (Count Pulses) Plot on Channel 39



Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = 2 * 2.88 / 100 = 5.76 %
- 2. Worst case Duty cycle correction factor = 20*log(Duty cycle) = -24.79 dB
- **3DH5** has the highest duty cycle worst case and is reported.

FAX: 886-3-328-4978



FCC RF Test Report

Duty Cycle Correction Factor Consideration for AFH mode:

Bluetooth normal hopping rate is 1600Hz and reduced to 800Hz in AFH mode; due to the reduced number of hopping frequencies, with the same packet configuration the dwell time in each channel frequency within 100msec period is longer in AFH mode than normal mode.

In AFH mode, the minimum hopping frequencies are 20, to get the longest dwell time DH5 packet is observed; the period to have DH5 packet completing one hopping sequence is

2.88 ms x 20 channels = 57.6 ms

There cannot be 2 complete hopping sequences within 100ms period, considering the random hopping behavior, maximum 2 hops can be possibly observed within the period. [100ms / 57.6ms] = 2 hops

Thus, the maximum possible ON time:

2.88 ms x 2 = 5.76 ms

Worst case Duty Cycle Correction factor, which is derived from the maximum possible ON time,

 $20 \times log(5.76 \text{ ms}/100\text{ms}) = -24.79 \text{ dB}$

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Appendix D. Original Report

Please refer to Sporton report number FR782113A

Report No.: FR782203A

SPORTON INTERNATIONAL INC. Page Number : D1 of D1