# FCC RF TEST REPORT

47 CFR FCC Part 15 Subpart C § 15.249

GSM/WCDMA/LTE Phone + Bluetooth, DTS/UNII a/b/g/n/ac, ANT+, and NFC **Equipment** 

**BRAND NAME** Sony

FCC ID : PY7-PM0903

We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager



No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.

Testing Laboratory 1190

Report No.: FR571615E

## **Table of Contents**

1. S	SUMMARY OF THE TEST RESULT	2
2. G	SENERAL INFORMATION	3
	2.1 Applicant	
2	2.2 Manufacturer	3
2.	2.3 Product Details	
2.	2.4 Table for Test Modes	4
2.	2.5 Table for Testing Locations	5
2.	2.6 Table for Supporting Units	5
2.	2.7 Test Configurations	6
3. T	EST RESULT	7
	3.1 AC Power Line Conducted Emissions Measurement	7
3.	3.2 20dB and & 99% Occupied Bandwidth	12
3.	3.3 Field Strength of Fundamental Emissions and Radiated Spurious Emissions	15
3.	3.4 Antenna Requirements	
4. LI	IST OF MEASURING EQUIPMENT	29

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page No. : i of i

Issued Date : Sep. 14, 2015 FCC ID : PY7-PM0903

Report No.: FR571615E

## **REVISION HISTORY**

Report No.: FR571615E

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR571615E	Rev. 01	Initial issue of report	Sep. 14, 2015

 SPORTON INTERNATIONAL INC.
 Page Number
 : 1 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

## 1. SUMMARY OF THE TEST RESULT

	Applied Standard:						
Part	FCC Rule	Description of Test	Result	Under Limit			
3.1	15.207	AC Power Line Conducted	Complies	20.30 dB at			
3.1	15.207	Emissions	Compiles	0.502MHz			
3.2	2.1049	20dB & 99% Occupied Bandwidth	Complies	-			
3.3	15 240(a)	Field Strength of Fundamental	Complies	19.05 dB at			
3.3	15.249(a)	Emissions	Complies	2480.000MHz			
3.3	15 240(a)(d)	Redicted Spurious Emissions	Complies	5.77 dB at			
3.3	15.249(a)(d)	Radiated Spurious Emissions	Complies	45.390MHz			
3.4	15.203	Antenna Requirements	Complies	-			

Report No.: FR571615E

**Remark:** The FR571615E report reuses test data from the FR571610E report.

## <u>Uncertainty of Conducted Emission Measurement (150kHz ~ 30MHz)</u>

Measuring Uncertainty for a Level of	
Confidence of 95% (U = 2Uc(y))	2.26

## Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of	4.90
Confidence of 95% (U = 2Uc(y))	4.30

 SPORTON INTERNATIONAL INC.
 Page Number
 : 2 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

## 2. GENERAL INFORMATION

## 2.1 Applicant

### **Sony Mobile Communications Inc.**

Nya Vattentornet, 22188 Lund, Sweden

### 2.2 Manufacturer

## Sony Mobile Communications Inc.

1-8-15 Konan, Minato-ku, Tokyo, 108-0075, Japan

#### 2.3 Product Details

For more detailed features description, please refer to the manufacturer's specifications or user's manual.

Report No.: FR571615E

Items	Description
Modulation	GFSK
Channel Bandwidth (99%)	1.026MHz
Max. Field Strength (Peak)	94.95dBµV/m
Max. Field Strength (Average)	68.21dBµV/m
ANT+ Channel Number	78
ANT+ Frequency Range	2403-2480MHz

EUT Information List					
IMEI	HW Version	SW Version	S/N	Performed Test Item	
IMEI: 004402455309058			CB5A276KW9	RF conducted measurement	
IMEI: 004402455308407	А	32.0.A.0.323	CB5A27412G	Radiated Spurious Emission	
IMEI: 004402455306211			CB5A2741RU	Conducted Emission	

 SPORTON INTERNATIONAL INC.
 Page Number
 : 3 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

Accessory List				
	Model No. : UCH20			
	Type No. : AC-0061-US			
AC Adapter	S/N:			
	5815W22500081 (for radiated spurious emission)			
	2115W15500021 (for conducted emission)			
Earphone	Model No. : MDR-NC31E			
arpnone	Type No. : AG-1110			
	Model No. : UCB11			
	Type No. : AI-0120			
USB Cable	S/N:			
	10115W02400028C (for radiated spurious emission)			
	1522A73000065C4(for conducted emission)			

Report No.: FR571615E

#### Note:

- 1. Above EUT list and accessory list used are electrically identical per declared by manufacturer.
- 2. Above the accessories list are used to exercise the EUT during test.
- 3. For other wireless features of this EUT, test report will be issued separately.

#### 2.4 Table for Test Modes

Investigation has been done on all the possible configurations for searching the worst cases. The following table is a list of the test modes shown in this test report.

Test Items	Mode
AC Power Line Conducted Emissions	CTX
Field Strength of Fundamental Emissions	CTX
Bandwidth	CTX
Radiated Emissions	CTX

#### Note:

- 1. CTX=continuously transmitting.
- 2. The programmed RF utility, "CMD" installed in the notebook to make the EUT get into the engineering modes to continuously transmit.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 4 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

## 2.5 Table for Testing Locations

Test Site	SPORTON INTERNATIONAL INC.		
	No. 52, Hwa Ya 1 <sup>st</sup> Rd., Hwa Ya Technology Park,		
Test Site Location	Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.		
lest Site Location	TEL: +886-3-327-3456		
	FAX: +886-3-328-4978		
Toot Site No	Sporton Site No.		
Test Site No.	TH05-HY		

Report No.: FR571615E

Note: The test site complies with ANSI C63.4 2009 requirement.

Test Site	SPORTON INTERNATIONAL INC.		
	No.58, Aly. 75, Ln. 564, Wenhua 3rd Rd.		
Test Site Location	Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.		
	TEL: +886-3-327-0855		
Took Cita No	Sporton Site No.		
Test Site No.	03CH10-HY		

**Note:** The test site complies with ANSI C63.4 2009 requirement.

## 2.6 Table for Supporting Units

I	Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
I	1.	SD Card	SanDisk	MicroSD HC	FCC DoC	N/A	N/A


 SPORTON INTERNATIONAL INC.
 Page Number
 : 5 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015


 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

## 2.7 Test Configurations

### <AC Conducted Emissions>

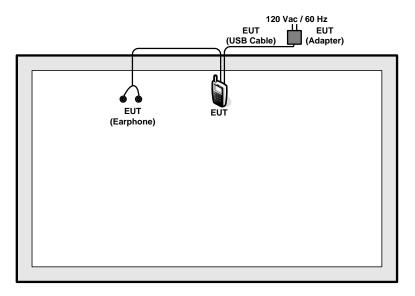

## <Radiated Spurious Emissions>

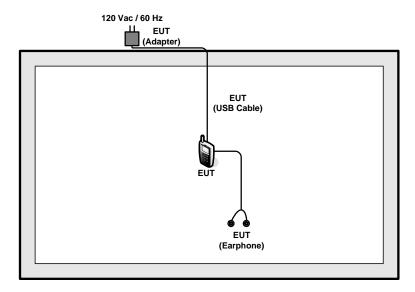

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-PM0903 Page Number : 6 of 30
Report Issued Date : Sep. 14, 2015
Report Version : Rev. 01

Report No.: FR571615E

### 3. TEST RESULT

## 3.1 AC Power Line Conducted Emissions Measurement

#### 3.1.1 Limit

For a Low-power Radio-frequency device which is designed to be connected to the AC power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed below limits table.

Report No.: FR571615E

Frequency (MHz)	QP Limit (dBμV)	AV Limit (dBμV)
0.15~0.5	66~56	56~46
0.5~5	56	46
5~30	60	50

#### 3.1.2 Measuring Instruments

Please refer to section 4 of equipment list in this report.

#### 3.1.3 Test Procedures


- Configure the EUT according to ANSI C63.4. The EUT or host of EUT has to be placed 0.4 meter far from the conducting wall of the shielding room and at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT or host of EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connected to the other LISNs. The LISN should provide 50uH/50ohms coupling impedance.
- 4. The frequency range from 150 kHz to 30 MHz was searched.
- 5. Set the test-receiver system to Peak Detect Function and Specified Bandwidth (IF bandwidth = 9kHz) with Maximum Hold Mode.
- 6. The measurement has to be done between each power line and ground at the power terminal.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 7 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

#### 3.1.4 Test Setup Layout

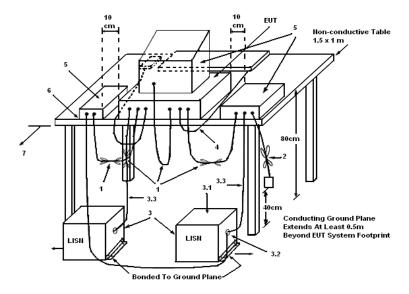

#### LEGEND:

- (1) Interconnecting cables that hang closer than 40 cm to the ground plane shall be folded back and forth in the center forming a bundle 30 to 40 cm long.
- (2) I/O cables that are not connected to a peripheral shall be bundled in the center. The end of the cable may be terminated, if required, using the correct terminating impedance. The overall length shall not exceed 1 m.
- (3) EUT connected to one LISN. Unused LISN measuring port connectors shall be terminated in 50  $\Omega$ . LISN can be placed on top of, or immediately beneath, reference ground plane.
- (3.1) All other equipment powered from additional LISN(s).
- (3.2) Multiple outlet strip can be used for multiple power cords of non-EUT equipment.
- (3.3) LISN at least 80 cm from nearest part of EUT chassis.
- (4) Cables of hand-operated devices, such as keyboards, mice, etc., shall be placed as for normal use.
- (5) Non-EUT components of EUT system being tested.
- (6) Rear of EUT, including peripherals, shall all be aligned and flush with rear of tabletop.
- (7) Rear of tabletop shall be 40 cm removed from a vertical conducting plane that is bonded to the ground plane.

#### 3.1.5 Test Deviation

There is no deviation with the original standard.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-PM0903 Page Number : 8 of 30 Report Issued Date : Sep. 14, 2015

: Rev. 01

Report No.: FR571615E

Report Template No.: BU5-FR15CANT Version 1.0

Report Version

## 3.1.6 EUT Operation during Test


The EUT was placed on the test table and programmed in transmitting function.

## 3.1.7 Results of AC Power Line Conducted Emissions Measurement

Test Date	Aug. 15, 2015	Test Site No.	CO05-HY		
Temperature	23~25°C	Humidity	58~61%		
Test Engineer	Eric Jeng				
Mode	ANT+ Tx (2441 MHz) + Earphone + USB Cable (Charging from Adapter)				

Report No.: FR571615E

Line

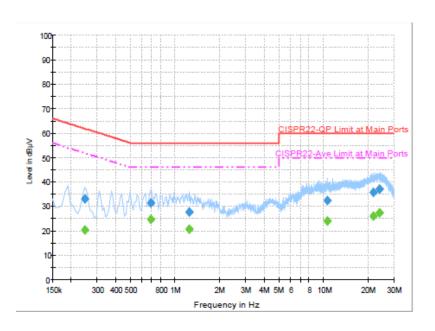

Final Result: Quasi-Peak

	. mar Roodii. Quaoi i ouk						
F	requency	Quasi-Peak	Filter	Line	Corr.	Margin	Limit
	(MHz)	(dBµV)	Filler	Lille	(dB)	(dB)	(dBµV)
	0.246000	33.0	Off	L1	19.5	28.9	61.9
	0.686000	31.4	Off	L1	19.6	24.6	56.0
	1.246000	27.8	Off	L1	19.6	28.2	56.0
1	0.606000	32.5	Off	L1	19.8	27.5	60.0
2	21.670000	35.9	Off	L1	20.1	24.1	60.0
2	23.950000	37.0	Off	L1	20.0	23.0	60.0


 SPORTON INTERNATIONAL INC.
 Page Number
 : 9 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

Test Date	Aug. 15, 2015	Test Site No.	CO05-HY	
Temperature	23~25°C	Humidity	58~61%	
Test Engineer	Eric Jeng			
Mode	ANT+ Tx (2441 MHz) + Earphone + USB Cable (Charging from Adapter)			

#### Line

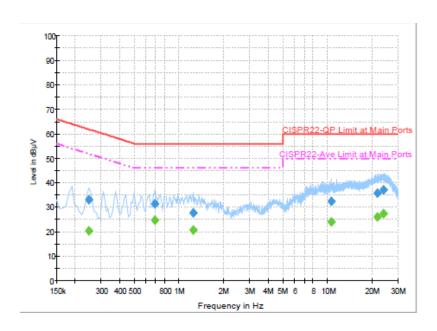

### **Final Result: Average**

Frequency	Average	Filter	Lina	Corr.	Margin	Limit
(MHz)	(dBµV)	Filter	Line	(dB)	(dB)	(dBµV)
0.246000	20.6	Off	L1	19.5	31.3	51.9
0.686000	24.8	Off	L1	19.6	21.2	46.0
1.246000	20.7	Off	L1	19.6	25.3	46.0
10.606000	24.2	Off	L1	19.8	25.8	50.0
21.670000	26.2	Off	L1	20.1	23.8	50.0
23.950000	27.5	Off	L1	20.0	22.5	50.0


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-PM0903 Page Number : 10 of 30
Report Issued Date : Sep. 14, 2015
Report Version : Rev. 01

Report No.: FR571615E

Test Date	Aug. 15, 2015	Test Site No.	CO05-HY	
Temperature	23~25°C	Humidity	58~61%	
Test Engineer	Eric Jeng			
Mode	ANT+ Tx (2441 MHz) + Earphone + USB Cable (Charging from Adapter)			

#### Neutral

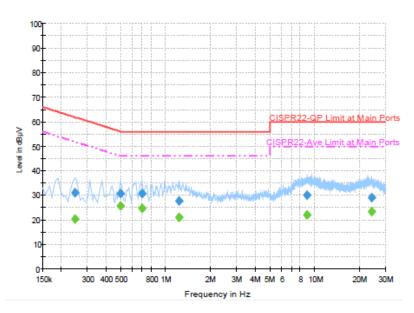

### Final Result: Quasi-Peak

Frequency (MHz)	Quasi-Peak (dBµV)	Filter	Line	Corr. (dB)	Margin (dB)	Limit (dBµV)
0.246000	31.0	Off	N	19.5	30.9	61.9
0.502000	30.9	Off	N	19.4	25.1	56.0
0.694000	30.8	Off	N	19.6	25.2	56.0
1.238000	27.8	Off	N	19.6	28.2	56.0
8.910000	30.2	Off	N	19.9	29.8	60.0
24.270000	29.2	Off	N	20.1	30.8	60.0

Final Result: Average

Frequency (MHz)	Average (dBµV)	Filter	Line	Corr. (dB)	Margin (dB)	Limit (dBµV)
0.246000	20.3	Off	N	19.5	31.6	51.9
0.502000	25.7	Off	N	19.4	20.3	46.0
0.694000	24.6	Off	N	19.6	21.4	46.0
1.238000	21.2	Off	N	19.6	24.8	46.0
8.910000	22.0	Off	N	19.9	28.0	50.0
24.270000	23.6	Off	N	20.1	26.4	50.0

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-PM0903 Page Number : 11 of 30
Report Issued Date : Sep. 14, 2015
Report Version : Rev. 01

Report No.: FR571615E

## 3.2 20dB and & 99% Occupied Bandwidth

#### 3.2.1 Limit

Intentional radiators must be designed to ensure that the 20 dB bandwidth of the emissions in the specific band.

Report No.: FR571615E


### 3.2.2 Measuring Instruments

Please refer to section 4 of equipment list in this report.

### 3.2.3 Test Procedures

- 1. The transmitter output port was connected to the spectrum analyzer.
- 2. Measured the spectrum width with highest power setting.

## 3.2.4 Test Setup Layout



#### 3.2.5 Test Deviation

There is no deviation with the original standard.

## 3.2.6 EUT Operation during Test

The EUT was programmed to be in continuously transmitting mode.

## 3.2.7 Test Result of 20dB Spectrum Bandwidth


Final Test Date	Jul. 21, 2015~ Jul. 22, 2015	Test Site No.	TH05-HY
Temperature	22~25°C	Humidity	51~55%
Test Engineer	osolemio Chang		


F	20dB BW	99% OBW
Frequency	(MHz)	(MHz)
2403MHz	1.056	1.026
2441MHz	1.050	1.026
2480MHz	1.056	1.026

#### 20 dB Bandwidth Plot on 2403MHz

#### 99% Bandwidth Plot on 2403MHz

Report No.: FR571615E

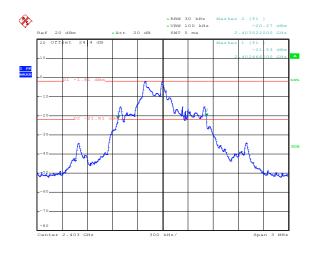

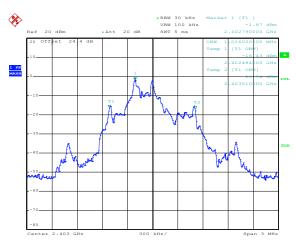

Date: 22.JUL.2015 20:23:25


Date: 22.JUL.2015 20:49:42

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-PM0903 Page Number : 13 of 30
Report Issued Date : Sep. 14, 2015


Report Version : Rev. 01

#### 20 dB Bandwidth Plot on 2441MHz

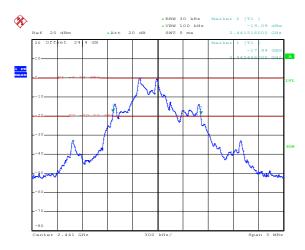

Date: 22.JUL.2015 19:55:29


### 20 dB Bandwidth Plot on 2480MHz

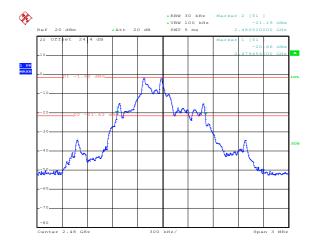

Date: 22.JUL.2015 20:11:55

#### 99% Bandwidth Plot on 2441MHz

Report No.: FR571615E

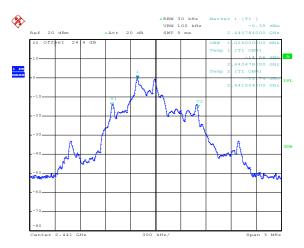

Date: 22.JUL.2015 20:52:35

#### 99% Bandwidth Plot on 2480MHz



Date: 22.JUL.2015 20:55:27

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-PM0903 Page Number : 14 of 30
Report Issued Date : Sep. 14, 2015
Report Version : Rev. 01

## 3.3 Field Strength of Fundamental Emissions and Radiated Spurious Emissions

#### 3.3.1 Limit

The field strength measured at 3 meters shall not exceed the limits in the following table:

Fundamental	Field Strength(millivolts/m)		
Frequencies(MHz)	Fundamental	Harmonics	
902~928	50	0.5	
2400~2483.5	50	0.5	
5725~5875	50	0.5	

Report No.: FR571615E

**Note:** The limits shown in the above table are based on measurements using an average detector, except for the fundamental emission in the frequency band 902-928 MHz, which is based on measurements using a CISPR quasi-peak detector.

Emissions radiated outside of the specified frequency bands, except for harmonics, shall be attenuated by at least 50 dB below the level of the fundamental or to the general field strength limits listed in 15.209 as below, whichever is less stringent.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

 SPORTON INTERNATIONAL INC.
 Page Number
 : 15 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

#### 3.3.2 Measuring Instruments

Please refer to section 4 of equipment list in this report.

#### 3.3.3 Test Procedures

 The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.

Report No.: FR571615E

- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.

#### Remark:

- 1. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 2. For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time = N1\*L1+N2\*L2+...+Nn-1\*LNn-1+Nn\*Ln

Where N1 is number of type 1 pulses, L1 is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20\*log(Duty cycle)

 SPORTON INTERNATIONAL INC.
 Page Number
 : 16 of 30


 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01


CC TEST REPORT Report No. : FR571615E

## 3.3.4 Test Setup Layout

### For radiated emissions below 30MHz

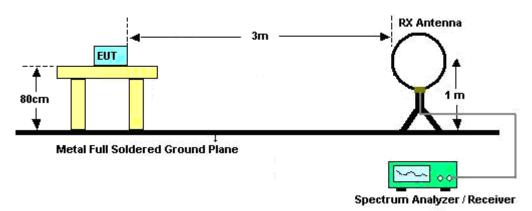


#### For radiated emissions from 30MHz to 1GHz

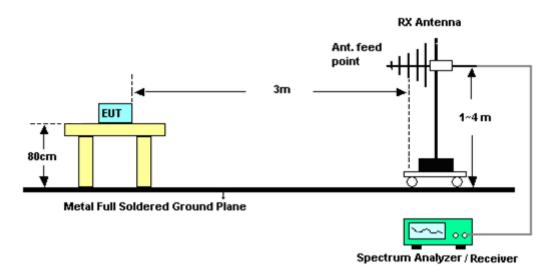

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-PM0903 Page Number : 17 of 30
Report Issued Date : Sep. 14, 2015
Report Version : Rev. 01

#### For radiated emissions above 1GHz

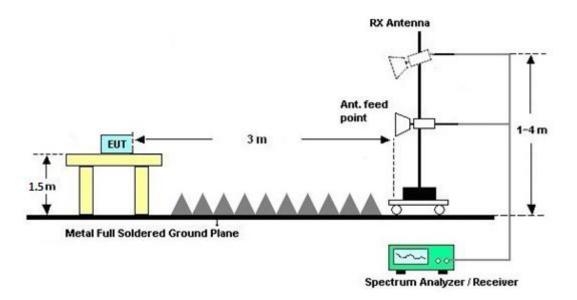

#### 3.3.5 Test Deviation

There is no deviation with the original standard.

## 3.3.6 EUT Operation during Test

The EUT was programmed to be in continuously transmitting mode.

## 3.3.7 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line per 15.31(o) was not reported.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-PM0903 Page Number : 18 of 30
Report Issued Date : Sep. 14, 2015
Report Version : Rev. 01

Report No.: FR571615E


### 3.3.8 Duty cycle correction factor for average measurement

### On time (One Pulse) Plot on 2441MHz

Report No.: FR571615E

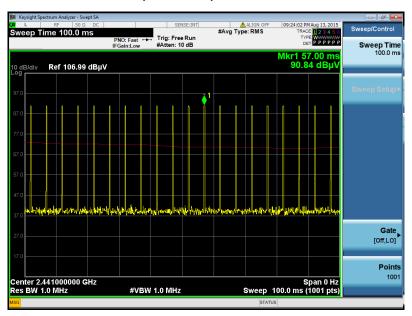

### On time (Count Pulses) Plot on 2441MHz

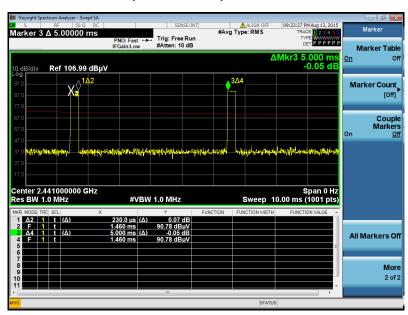

#### Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = 10  $^{\circ}$  0.23 / 100 = 4.60  $^{\circ}$
- 2. Worst case Duty cycle correction factor = 20\*log(Duty cycle) = -26.74 dB

 SPORTON INTERNATIONAL INC.
 Page Number : 19 of 30

 TEL: 886-3-327-3456
 Report Issued Date : Sep. 14, 2015


 FAX: 886-3-328-4978
 Report Version : Rev. 01

## 3.3.9 Test Result of Field Strength of Fundamental Emissions and Spurious Emissions

Test Date	Aug.11, 201~ Aug. 13, 2015	Test Engineer	Stan Hsieh
Temperature	24~26°C	Humidity	44~46%

Report No.: FR571615E

## <30MHz ~ 1GHz>

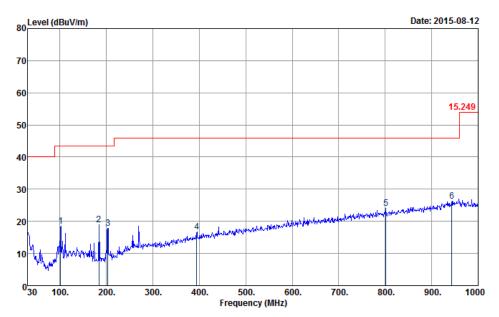

Site : 03CH10-HY

Condition : 15.249 3m BI-LOG 6111D-LF HORIZONTAL

Detector : Peak


			0ver	Limit	Read/	Antenna	Cable	Preamp	A/Pos	T/Pos	
	Freq	Level	Limit	Line	Level	Factor	Loss	Factor			Remark
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB	Cm	deg	
1	101.28	18.60	-24.90	43.50	39.59	10.50	1.14	32.63			Peak
2	184.17	18.94	-24.56	43.50	40.77	9.40	1.48	32.71			Peak
3	202.80	17.93	-25.57	43.50	39.00	10.18	1.48	32.73			Peak
4	394.50	16.71	-29.29	46.00	31.04	16.37	2.13	32.83			Peak
5	801.20	24.10	-21.90	46.00	31.89	22.11	2.97	32.87			Peak
6	943.30	26.38	-19.62	46.00	30.76	24.17	3.29	31.84	236	32	Peak

 SPORTON INTERNATIONAL INC.
 Page Number
 : 20 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01



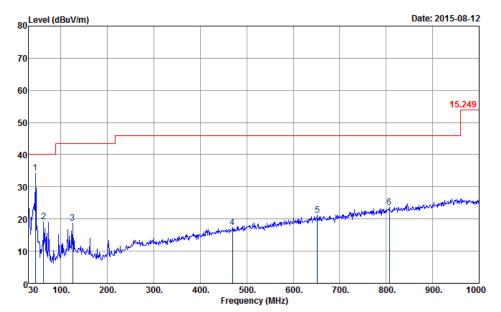

Site : 03CH10-HY

Condition : 15.249 3m BI-LOG 6111D-LF VERTICAL

Detector : Peak


	Frea	Level		Limit Line						T/Pos	Remark	
		dBuV/m		dBuV/m			dB			deg		
	11112	ubuv/III	ub	ubuv/III	ubuv	ub/III	ub	ub	CIII	ueg		
1	45.39	34.23	-5.77	40.00	54.81	11.28	0.93	32.79	152	225	Peak	
2	62.40	19.14	-20.86	40.00	44.73	6.22	0.93	32.74			Peak	
3	125.58	18.62	-24.88	43.50	37.99	11.96	1.33	32.66			Peak	
4	469.40	17.29	-28.71	46.00	30.24	17.65	2.30	32.90			Peak	
5	652.10	21.18	-24.82	46.00	31.30	20.22	2.67	33.01			Peak	
6	806.80	23.68	-22.32	46.00	31.30	22.15	3.07	32.84			Peak	

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: PY7-PM0903 Page Number : 21 of 30
Report Issued Date : Sep. 14, 2015
Report Version : Rev. 01

## <1GHz ~ 25GHz>

### 2403MHz

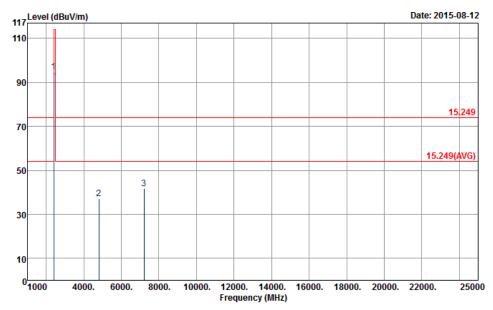

Report No.: FR571615E

Site : 03CH10-HY

Condition : 15.249 3m HORN\_9170\_406\_1404 HORIZONTAL

Detector : Peak

			0ver	Limit	ReadA	ntenna	Cable	Preamp	A/Pos	T/Pos	
	Freq	Level	Limit	Line	Level	Factor	Loss	Factor			Remark
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg	
1	2403.00	94.86	-19.14	114.00	95.41	27.28	5.39	33.22	253	37	Peak
2	4806.00	37.16	-36.84	74.00	58.80	31.42	7.58	60.64	100	0	Peak
3	7212.00	41.84	-32.16	74.00	57.06	35.96	9.44	60.62	100	0	Peak

Frequency ( MHz )	Level ( dBµV/m )	Over Limit ( dB )	Limit Line ( dBµV/m )	Read Level (dBµV)	Antenna Factor ( dB )	Cable Loss ( dB )	Preamp Factor ( dB )	Ant Pos ( cm )	Table Pos ( deg )	Remark
2403	94.86	-19.14	114	95.41	27.28	5.39	33.22	253	37	Peak
2403	68.12	-25.88	94	-	-	-	-	-	-	Average

Note: For average measurement: use duty cycle correction factor method per 15.35(c).


Average measurement was not performed if peak level went lower than the average limit.

Test result of emissions which are 20 dB lower than the limit is not reported per15.31.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 22 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

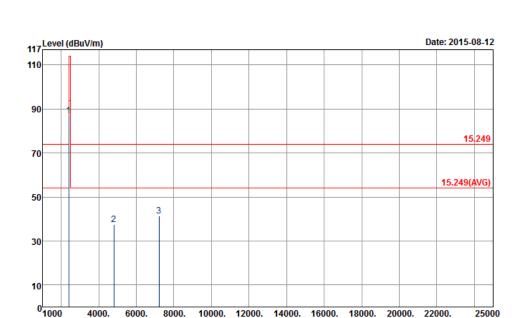

Report No.: FR571615E

Site : 03CH10-HY

Condition : 15.249 3m HORN\_9170\_406\_1404 VERTICAL

Detector : Peak

			0ver	Limit	Read <i>A</i>	Intenna	Cable	Preamp	A/Pos	T/Pos	
	Freq	Level	Limit	Line	Level	Factor	Loss	Factor			Remark
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg	
1	2403.00	86.95	-27.05	114.00	87.50	27.28	5.39	33.22	368	118	Peak
2	4806.00	37.52	-36.48	74.00	59.16	31.42	7.58	60.64	100	0	Peak
3	7212.00	41.53	-32.47	74.00	56.75	35.96	9.44	60.62	100	0	Peak

Frequency (MHz)

Frequency ( MHz )	Level ( dBµV/m )	Over Limit ( dB )	Limit Line ( dBµV/m )	Read Level (dBµV)	Antenna Factor ( dB )	Cable Loss (dB)	Preamp Factor ( dB )	Ant Pos ( cm )	Table Pos ( deg )	Remark
2403	86.95	-27.05	114	87.5	27.28	5.39	33.22	368	118	Peak
2403	60.21	-33.79	94	1	-	1	-	1	1	Average

Note: For average measurement: use duty cycle correction factor method per 15.35(c).

Average measurement was not performed if peak level went lower than the average limit.


Test result of emissions which are 20 dB lower than the limit is not reported per15.31.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 23 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

#### 2441MHz

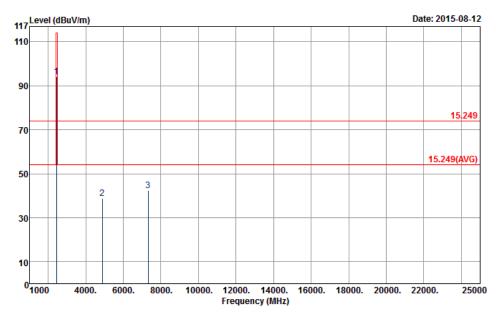

Report No.: FR571615E

Site : 03CH10-HY

Condition : 15.249 3m HORN\_9170\_406\_1404 HORIZONTAL

Detector : Peak

		0ver	Limit	Read#	Intenna	Cable	Preamp	A/Pos	T/Pos	
Freq	Level	Limit	Line	Level	Factor	Loss	Factor			Remark
MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg	
									_	
2441.00	94.32	-19.68	114.00	94.73	27.37	5.42	33.20	198	39	Peak
4884.00	38.93	-35.07	74.00	60.07	31.56	7.82	60.52	100	0	Peak
7320.00	42.27	-31.73	74.00	57.54	36.22	9.49	60.98	100	0	Peak
	MHz 2441.00 4884.00	MHz dBuV/m 2441.00 94.32 4884.00 38.93	Freq Level Limit  MHz dBuV/m dB  2441.00 94.32 -19.68 4884.00 38.93 -35.07	Freq Level Limit Line  MHz dBuV/m dB dBuV/m  2441.00 94.32 -19.68 114.00 4884.00 38.93 -35.07 74.00	Freq Level Limit Line Level  MHz dBuV/m dB dBuV/m dBuV  2441.00 94.32 -19.68 114.00 94.73 4884.00 38.93 -35.07 74.00 60.07	Freq Level Limit Line Level Factor  MHz dBuV/m dB dBuV/m dBuV dB/m  2441.00 94.32 -19.68 114.00 94.73 27.37 4884.00 38.93 -35.07 74.00 60.07 31.56	Freq Level Limit Line Level Factor Loss  MHz dBuV/m dB dBuV/m dBuV dB/m dB  2441.00 94.32 -19.68 114.00 94.73 27.37 5.42 4884.00 38.93 -35.07 74.00 60.07 31.56 7.82	Freq Level Limit Line Level Factor Loss Factor	Freq         Level         Limit         Line         Level         Factor         Loss         Factor           MHz         dBuV/m         dB         dBuV/m         dBuV         dB/m         dB         dB         cm           2441.00         94.32         -19.68         114.00         94.73         27.37         5.42         33.20         198           4884.00         38.93         -35.07         74.00         60.07         31.56         7.82         60.52         100	MHz dBuV/m dB dBuV/m dBuV dB/m dB dB cm deg 2441.00 94.32 -19.68 114.00 94.73 27.37 5.42 33.20 198 39 4884.00 38.93 -35.07 74.00 60.07 31.56 7.82 60.52 100 0

Frequency (MHz)	Level ( dBµV/m )	Over Limit ( dB )	Limit Line ( dBµV/m )	Read Level (dBµV)	Antenna Factor ( dB )	Cable Loss ( dB )	Preamp Factor ( dB )	Ant Pos ( cm )	Table Pos ( deg )	Remark
2441	94.32	-19.68	114	94.73	27.37	5.42	33.2	198	39	Peak
2441	67.58	-26.42	94	-	-	-	-	-	-	Average

Note: For average measurement: use duty cycle correction factor method per 15.35(c).


Average measurement was not performed if peak level went lower than the average limit.

Test result of emissions which are 20 dB lower than the limit is not reported per15.31.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 24 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

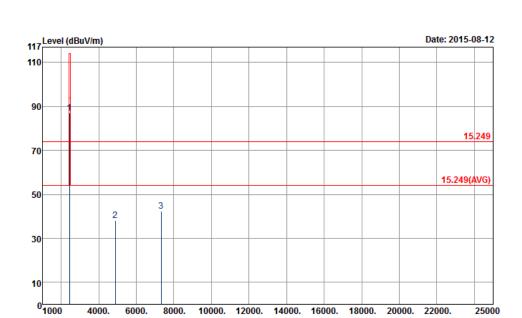

Report No.: FR571615E

Site : 03CH10-HY

Condition : 15.249 3m HORN\_9170\_406\_1404 VERTICAL

Detector : Peak

			0ver	Limit	ReadA	Intenna	Cable	Preamp	A/Pos	T/Pos	
	Freq	Level	Limit	Line	Level	Factor	Loss	Factor			Remark
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg	
1	2441.00	86.87	-27.13	114.00	87.28	27.37	5.42	33.20	100	265	Peak
2	4884.00	38.23	-35.77	74.00	59.37	31.56	7.82	60.52	100	0	Peak
3	7320.00	42.35	-31.65	74.00	57.62	36.22	9.49	60.98	100	0	Peak

Frequency (MHz)

Frequency (MHz)	Level ( dBµV/m )	Over Limit ( dB )	Limit Line ( dBµV/m )	Read Level (dBµV)	Antenna Factor ( dB )	Cable Loss ( dB )	Preamp Factor ( dB )	Ant Pos ( cm )		Remark
2441	86.87	-27.13	114	87.28	27.37	5.42	33.2	100	265	Peak
2441	60.13	-33.87	94	1	-	1	-	ı	1	Average

Note: For average measurement: use duty cycle correction factor method per 15.35(c).

Average measurement was not performed if peak level went lower than the average limit.


Test result of emissions which are 20 dB lower than the limit is not reported per15.31.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 25 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

### 2480MHz

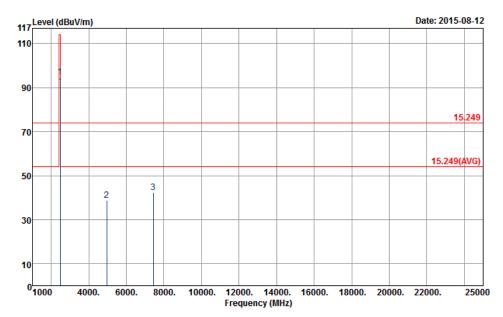

Report No.: FR571615E

Site : 03CH10-HY

Condition : 15.249 3m HORN\_9170\_406\_1404 HORIZONTAL

Detector : Peak

			0ver	Limit	ReadA	ntenna	Cable	Preamp	A/Pos	T/Pos	
	Freq	Level	Limit	Line	Level	Factor	Loss	Factor			Remark
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg	
1	2480.00	94.95	-19.05	114.00	95.23	27.46	5.44	33.18	141	155	Peak
2	4962.00	38.82	-35.18	74.00	59.40	31.73	8.05	60.36	100	0	Peak
3	7440.00	42.28	-31.72	74.00	57.52	36.49	9.61	61.34	100	0	Peak

Frequency ( MHz )	Level ( dBµV/m )	Over Limit ( dB )	Limit Line ( dBµV/m )	Read Level (dBµV)	Antenna Factor ( dB )	Cable Loss ( dB )	Preamp Factor ( dB )	Ant Pos ( cm )	Table Pos ( deg )	Remark
2480	94.95	-19.05	114	95.23	27.46	5.44	33.18	141	155	Peak
2480	68.21	-25.79	94	-	-	-	-	-	-	Average

Note: For average measurement: use duty cycle correction factor method per 15.35(c).


Average measurement was not performed if peak level went lower than the average limit.

Test result of emissions which are 20 dB lower than the limit is not reported per15.31.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 26 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

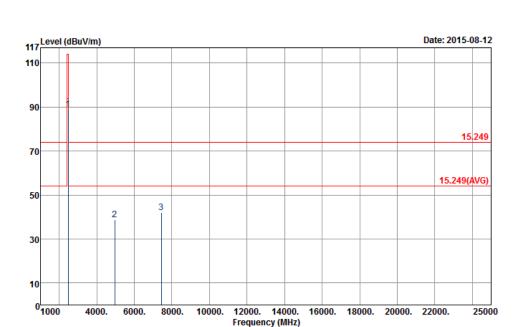

Report No.: FR571615E

Site : 03CH10-HY

Condition : 15.249 3m HORN\_9170\_406\_1404 VERTICAL

Detector : Peak

			0ver	Limit	Read#	Intenna	Cable	Preamp	A/Pos	T/Pos		
	Freq	Level	Limit	Line	Level	Factor	Loss	Factor			Remark	
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB		deg		
1	2480.00	88.90	-25.10	114.00	89.18	27.46	5.44	33.18	100	318	Peak	
2	4962.00	38.72	-35.28	74.00	59.30	31.73	8.05	60.36	100	0	Peak	
3	7440.00	42.09	-31.91	74.00	57.33	36.49	9.61	61.34	100	0	Peak	

Frequency ( MHz )	Level ( dBµV/m )	Over Limit ( dB )	Limit Line ( dBµV/m )	Read Level (dBµV)	Antenna Factor ( dB )	Cable Loss ( dB )	Preamp Factor ( dB )	Ant Pos ( cm )		Remark
2480	88.9	-25.1	114	89.18	27.46	5.44	33.18	100	318	Peak
2480	62.16	-31.84	94	-	-	1	-	ı	-	Average

Note: For average measurement: use duty cycle correction factor method per 15.35(c).

Average measurement was not performed if peak level went lower than the average limit.

Test result of emissions which are 20 dB lower than the limit is not reported per15.31.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 27 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

## 3.4 Antenna Requirements

#### 3.4.1 Limit

Except for special regulations, the Low-power Radio-frequency Devices must not be equipped with any jacket for installing an antenna with extension cable. An intentional radiator shall be designed to ensure that no antenna other than that furnished by the responsible party shall be used with the device. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the provisions of this Section. The manufacturer may design the unit so that the user can replace a broken antenna, but the use of a standard antenna jack or electrical connector is prohibited.

Report No.: FR571615E

#### 3.4.2 Antenna Connector Construction

Enbedded in Antenna.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 28 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

## 4. LIST OF MEASURING EQUIPMENT

Instrument	strument Manufacturer Model N		Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark	
Power Meter	Agilent	E4416A	GB41292344	300MHz~40GHz	Jan. 14, 2015	Jul. 21, 2015~ Jul. 22, 2015	Jan. 13, 2016	Conducted (TH05-HY)	
Power Sensor	Agilent	E9327A	US40441548	300MHz~40GHz	Jan. 14, 2015	Jul. 21, 2015~ Jul. 22, 2015	Jan. 13, 2016	Conducted (TH05-HY)	
Spectrum Analyzer	Rohde & Schwarz	FSP40	100055	9kHz-40GHz	Jun. 18, 2015	Jul. 21, 2015~ Jul. 22, 2015	Jun. 17, 2016	Conducted (TH05-HY)	
Hygrometer	Testo	608-H1	34897199	N/A	May 04, 2015	Jul. 21, 2015~ Jul. 22, 2015	May 03, 2016	Conducted (TH05-HY)	
RF Cable	HARBOUR INDUSTRIES	LL142	Infinet CA3601-3601 -DLL	0.1MHz~40GHz	Mar. 06, 2015	Jul. 21, 2015~ Jul. 22, 2015	Mar. 05, 2016	Conducted (TH05-HY)	
EMI Test Receiver	Rohde & Schwarz	ESCS 30	100356	9kHz – 2.75GHz	Dec. 01, 2014	Aug. 15, 2015	Nov. 30, 2015	Conduction (CO05-HY)	
Hygrometer	Testo	608-H1	34913912	N/A	Apr. 20, 2015	Aug. 15, 2015	Apr. 19, 2016	Conduction (CO05-HY)	
LISN	Rohde & Schwarz	ENV216	100080	9kHz~30MHz	Dec. 02, 2014	Aug. 15, 2015	Dec. 01, 2015	Conduction (CO05-HY)	
AC Power Source()	ChainTek	APC-1000W	N/A	N/A	N/A	Aug. 15, 2015	N/A	Conduction (CO05-HY)	
LF Cable	HUBER + SUHNER	RG-214/U	LF01	N/A	Jan. 07, 2015	Aug. 15, 2015	Jan. 06, 2016	Conduction (CO05-HY)	
Test Software	N/A	EMC32	8.40.0	N/A	N/A	Aug. 15, 2015	N/A	Conduction (CO05-HY)	
Horn Antenna	SCHWARZBE CK	BBHA 9170	BBHA917058 4	18GHz- 40GHz	Nov. 03, 2014	Aug. 11, 2015~ Aug. 13, 2015	Nov. 02, 2015	Radiation (03CH10-HY)	
Loop Antenna	TESEQ	HLA 6120	31244	9kHZ~30MHz	Feb. 02, 2015	Aug. 11, 2015~ Aug. 13, 2015	Feb. 01, 2016	Radiation (03CH10-HY)	
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY84209521	9kHz~1GHz	Dec. 04, 2014	Aug. 11, 2015~ Aug. 13, 2015	Dec. 03, 2015	Radiation (03CH10-HY)	
Amplifier	SONOMA	310N	187311	9kHz~1GHz	Nov. 24, 2014	Aug. 11, 2015~ Aug. 13, 2015	Nov. 23, 2015	Radiation (03CH10-HY)	
Bilog Antenna	TESEQ	CBL 6111D	35413	30MHz~1GHz	Oct. 24, 2014	Aug. 11, 2015~ Aug. 13, 2015	Oct. 23, 2015	Radiation (03CH10-HY)	
EMI Test Receiver	Keysight	N9038A	MY54130085	20Hz ~ 8.4GHz	Nov. 05, 2014	Aug. 11, 2015~ Aug. 13, 2015	Nov. 04, 2015	Radiation (03CH10-HY)	
Horn Antenna	SCHWARZBE CK	BBHA 9120 D	9120D-1325	1GHz ~ 18GHz	Oct. 03, 2014	Aug. 11, 2015~ Aug. 13, 2015	Oct. 02, 2015	Radiation (03CH10-HY)	
Hygrometer	TECPEL	DTM-303B	TP140320	N/A	Nov. 17, 2014	Aug. 11, 2015~ Aug. 13, 2015	Nov. 16, 2015	Radiation (03CH10-HY)	
Preamplifier	Keysight	83017A	MY53270078	1GHz~26.5GHz	Nov. 20, 2014	Aug. 11, 2015~ Aug. 13, 2015	Nov. 19, 2015	Radiation (03CH10-HY)	
Preamplifier	MITEQ	AMF-7D-001 01800-30-10 P	1902246	1GHz~18GHz	Nov. 25, 2014	Aug. 11, 2015~ Aug. 13, 2015	Nov. 24, 2015	Radiation (03CH10-HY)	
Spectrum Analyzer	Keysight	N9010A	MY54200485	10Hz ~ 44GHZ	Oct. 14, 2014	Aug. 11, 2015~ Aug. 13, 2015	Oct. 13, 2015	Radiation (03CH10-HY)	
Test Software	N/A	E3	6.2009-8-24	N/A	N/A	Aug. 11, 2015~ Aug. 13, 2015	N/A	Radiation (03CH10-HY)	

Report No.: FR571615E

 SPORTON INTERNATIONAL INC.
 Page Number
 : 29 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY249564 MY249524 MY283184	25GHz~40GHz	Nov. 06, 2014	Aug. 11, 2015~ Aug. 13, 2015	Nov. 05, 2015	Radiation (03CH10-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY249564 MY249524 MY283184	30MHz~1GHz	Nov. 06, 2014	Aug. 11, 2015~ Aug. 13, 2015	Nov. 05, 2015	Radiation (03CH10-HY)
RF Cable	HUBER + SUHNER	SUCOFLEX 104	MY249564 MY249524 MY283184	1GHz~25GHz	Nov. 06, 2014	Aug. 11, 2015~ Aug. 13, 2015	Nov. 05, 2015	Radiation (03CH10-HY)
Controller	EMEC	EM 1000	N/A	Control Turn table & Ant Mast	N/A	Aug. 11, 2015~ Aug. 13, 2015	N/A	Radiation (03CH10-HY)
Antenna Mast	EMEC	AM-BS-4500 -B	N/A	1~4m	N/A	Aug. 11, 2015~ Aug. 13, 2015	N/A	Radiation (03CH10-HY)
Turn Table	EMEC	TT 2200	N/A	0-360 degree	N/A	Aug. 11, 2015~ Aug. 13, 2015	N/A	Radiation (03CH10-HY)
Preamplifier	MITEQ	JS44-18004 000-33-8P	1840917	18GHz ~ 40GHz	Jun. 02, 2015	Aug. 11, 2015~ Aug. 13, 2015	Jun. 01, 2016	Radiation (03CH10-HY)

Report No.: FR571615E

Note: Test equipment calibration is traceable to the procedure of ISO17025.

 SPORTON INTERNATIONAL INC.
 Page Number : 30 of 30

 TEL: 886-3-327-3456
 Report Issued Date : Sep. 14, 2015

 FAX: 886-3-328-4978
 Report Version : Rev. 01