



Test report No. : 4790091528-US-R1-V0
Page : 77 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11a	Channel	60
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	97.06	13.21	110.27	N/A	N/A	PK
	@	5300	88.9	13.21	102.11	N/A	N/A	AVG
		5357.4	40.82	13.28	54.1	74	-19.9	PK
		5357.7	31.61	13.29	44.9	54	-9.1	AVG
	*	10600	30.5	17.73	48.23	68.2	-19.97	PK
Vertical	@	5300	94.74	13.21	107.95	N/A	N/A	PK
	@	5300	85.65	13.21	98.86	N/A	N/A	AVG
		5357.7	29.3	13.29	42.59	54	-11.41	AVG
		5439.9	39.96	13.63	53.59	74	-20.41	PK
	*	10600	31.65	17.73	49.38	68.2	-18.82	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

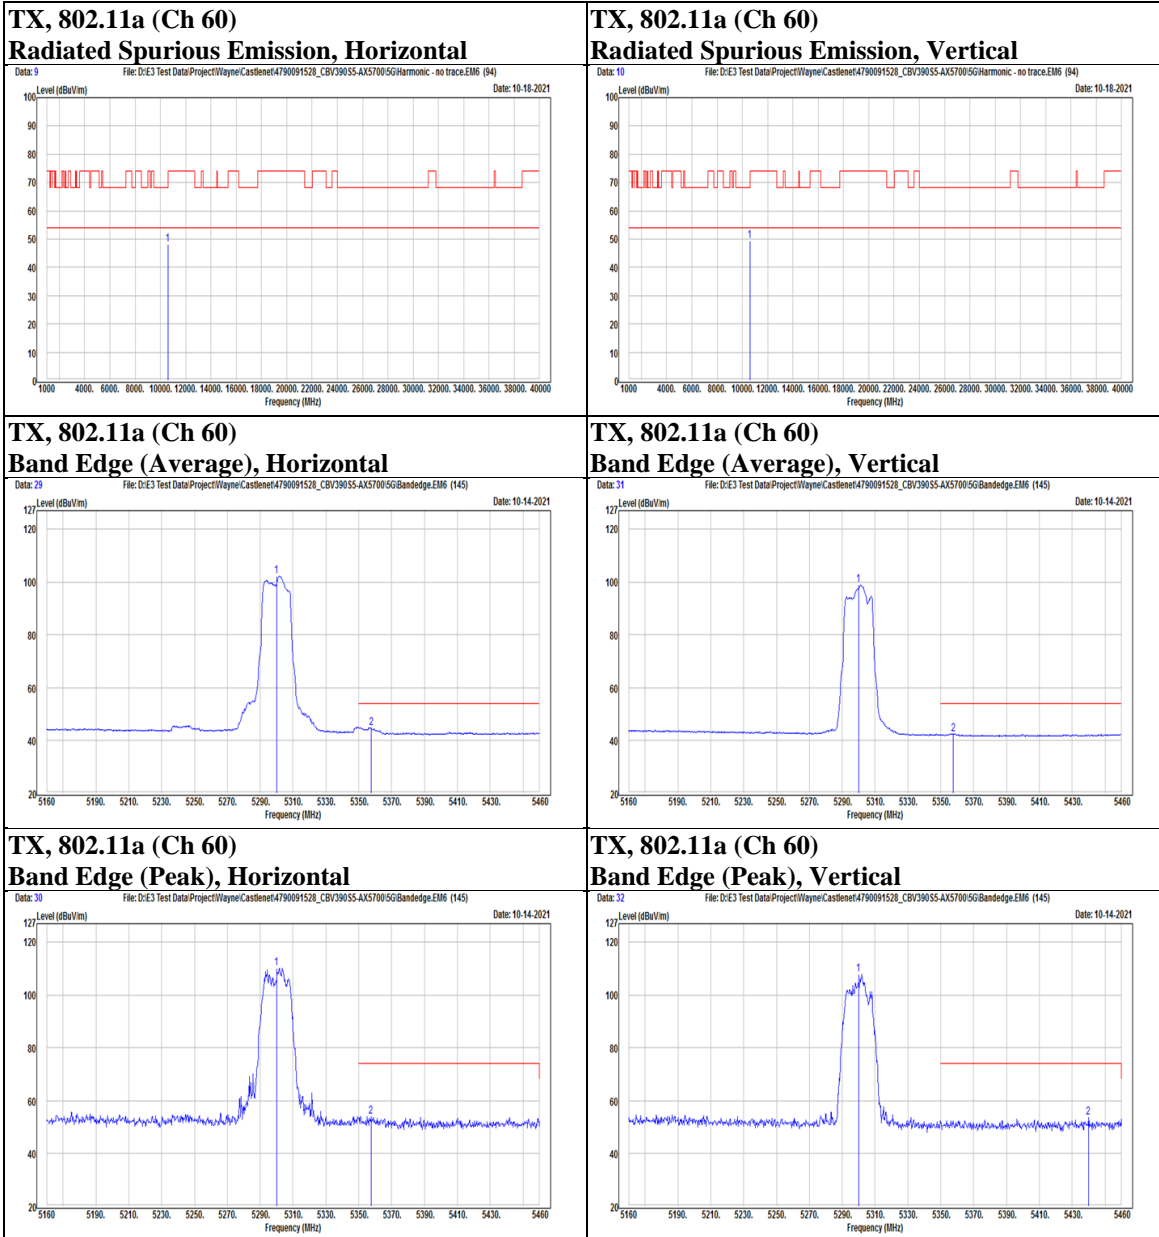



Test report No. : 4790091528-US-R1-V0
Page : 79 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11a	Channel	64
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	96.34	13.23	109.57	N/A	N/A	PK
	@	5320	88.95	13.23	102.18	N/A	N/A	AVG
		5369.4	41.85	13.33	55.18	74	-18.82	PK
		5369.7	32.06	13.33	45.39	54	-8.61	AVG
	*	10640	31.05	17.82	48.87	74	-25.13	PK
Vertical	@	5320	93.81	13.23	107.04	N/A	N/A	PK
	@	5320	85.57	13.23	98.8	N/A	N/A	AVG
		5400	29.48	13.42	42.9	54	-11.1	AVG
		5455.8	40.39	13.69	54.08	74	-19.92	PK
	*	10640	31.33	17.82	49.15	74	-24.85	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948





Doc No: 17-EM-F0878 / 6.0

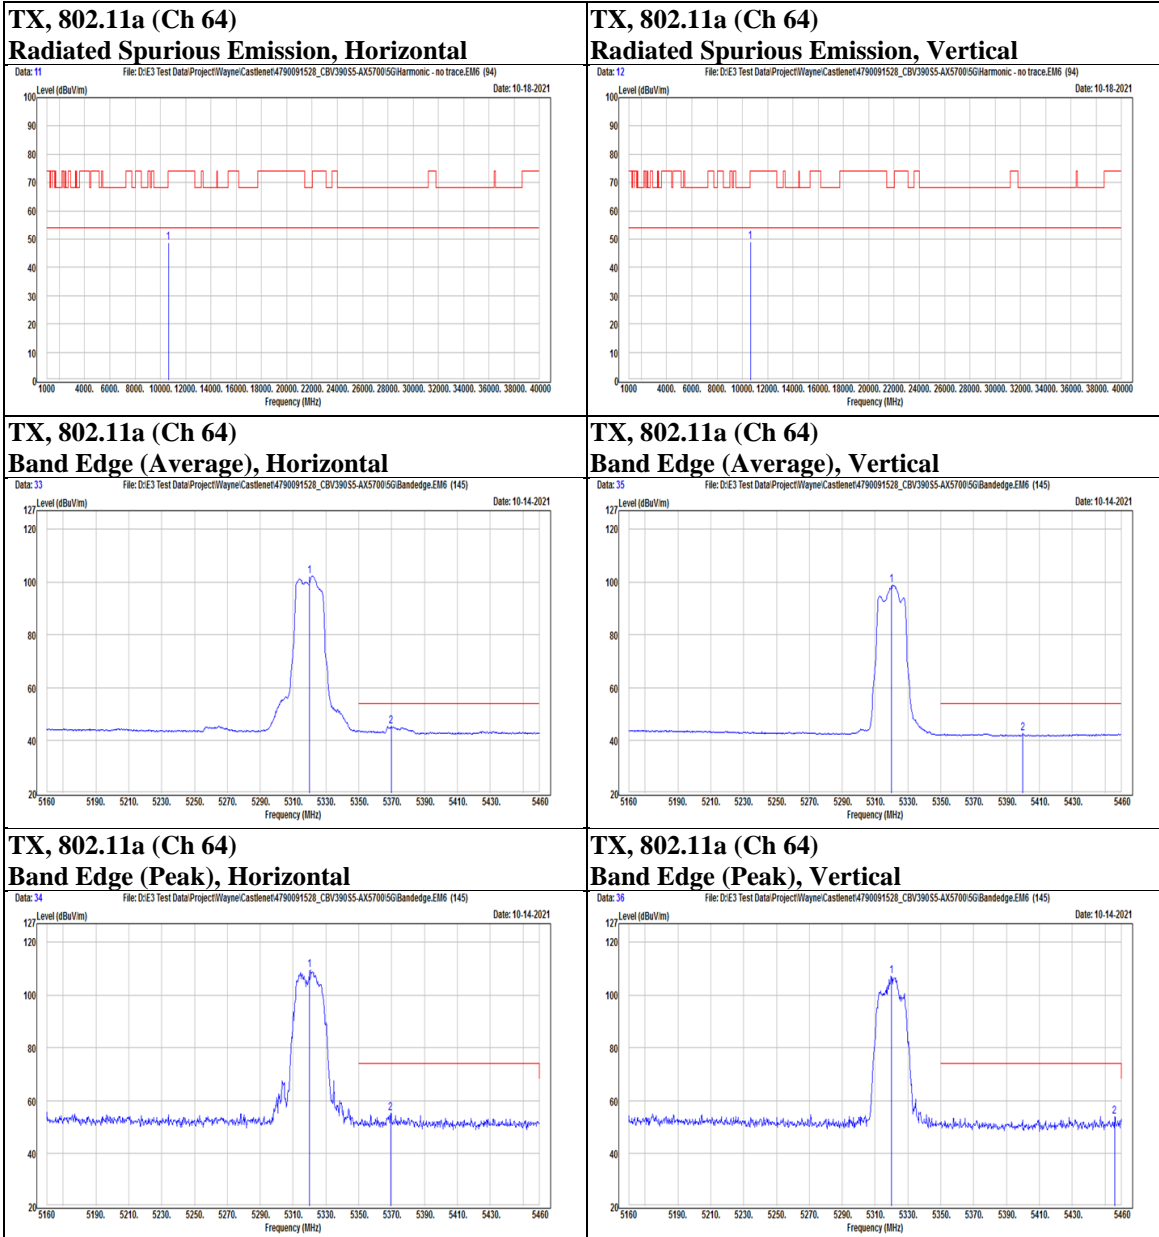



Mode	802.11a	Channel	100
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBUV/m)	(dBUV/m)	(dB)	
Horizontal		5437.45	42.12	13.61	55.73	74	-18.27	PK
		5437.45	31.96	13.61	45.57	54	-8.43	AVG
		5468.95	40.05	13.74	53.79	68.2	-14.41	PK
	@	5500	95.04	13.83	108.87	N/A	N/A	PK
	@	5500	87.13	13.83	100.96	N/A	N/A	AVG
	*	11000	30.76	18.28	49.04	74	-24.96	PK
Vertical		5439.2	40.57	13.62	54.19	74	-19.81	PK
		5439.2	29.24	13.62	42.86	54	-11.14	AVG
		5465.45	40.44	13.72	54.16	68.2	-14.04	PK
	@	5500	93.98	13.83	107.81	N/A	N/A	PK
	@	5500	85.05	13.83	98.88	N/A	N/A	AVG
	*	11000	31.27	18.28	49.55	74	-24.45	PK

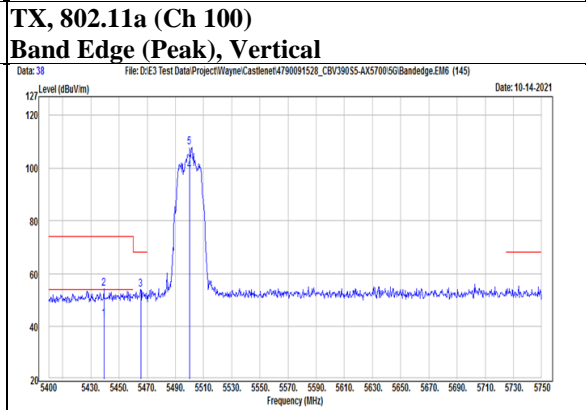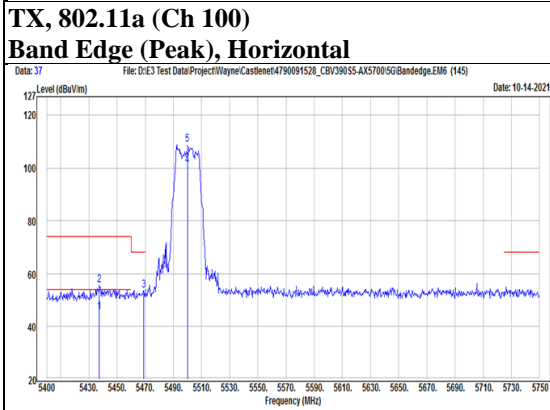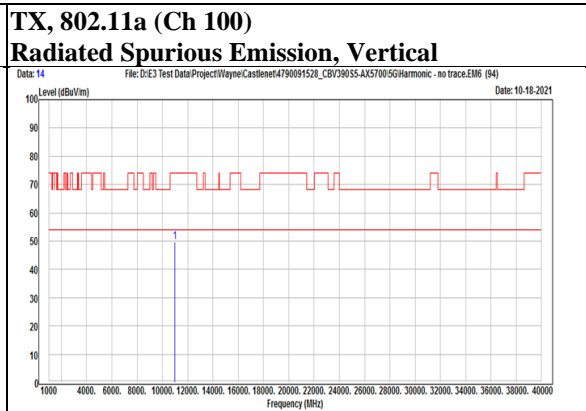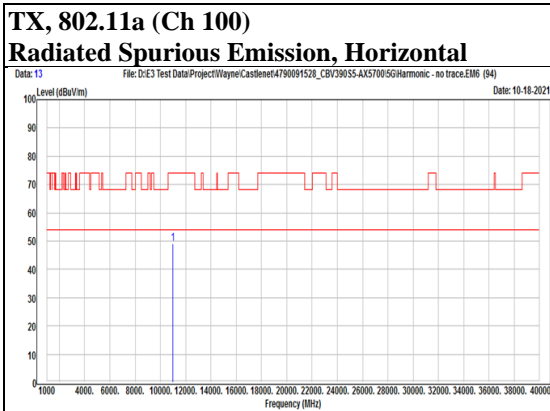

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	116
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5432.9	40.9	13.59	54.49	74	-19.51	PK
		5432.9	30.42	13.59	44.01	54	-9.99	AVG
		5466.85	40.57	13.72	54.29	68.2	-13.91	PK
	@	5580	95.76	13.98	109.74	N/A	N/A	PK
	@	5580	87.17	13.98	101.15	N/A	N/A	AVG
	*	5731.8	40.53	14.21	54.74	68.2	-13.46	PK
Vertical		11160	30.54	18.32	48.86	74	-25.14	PK
		5440.95	40.24	13.63	53.87	74	-20.13	PK
		5440.95	29.02	13.63	42.65	54	-11.35	AVG
		5464.05	39.54	13.72	53.26	68.2	-14.94	PK
	@	5580	92.86	13.98	106.84	N/A	N/A	PK
	@	5580	84.06	13.98	98.04	N/A	N/A	AVG
	5742.65	40.22	14.27	54.49	68.2	-13.71	PK	
	* 11160	30.85	18.32	49.17	74	-24.83	PK	

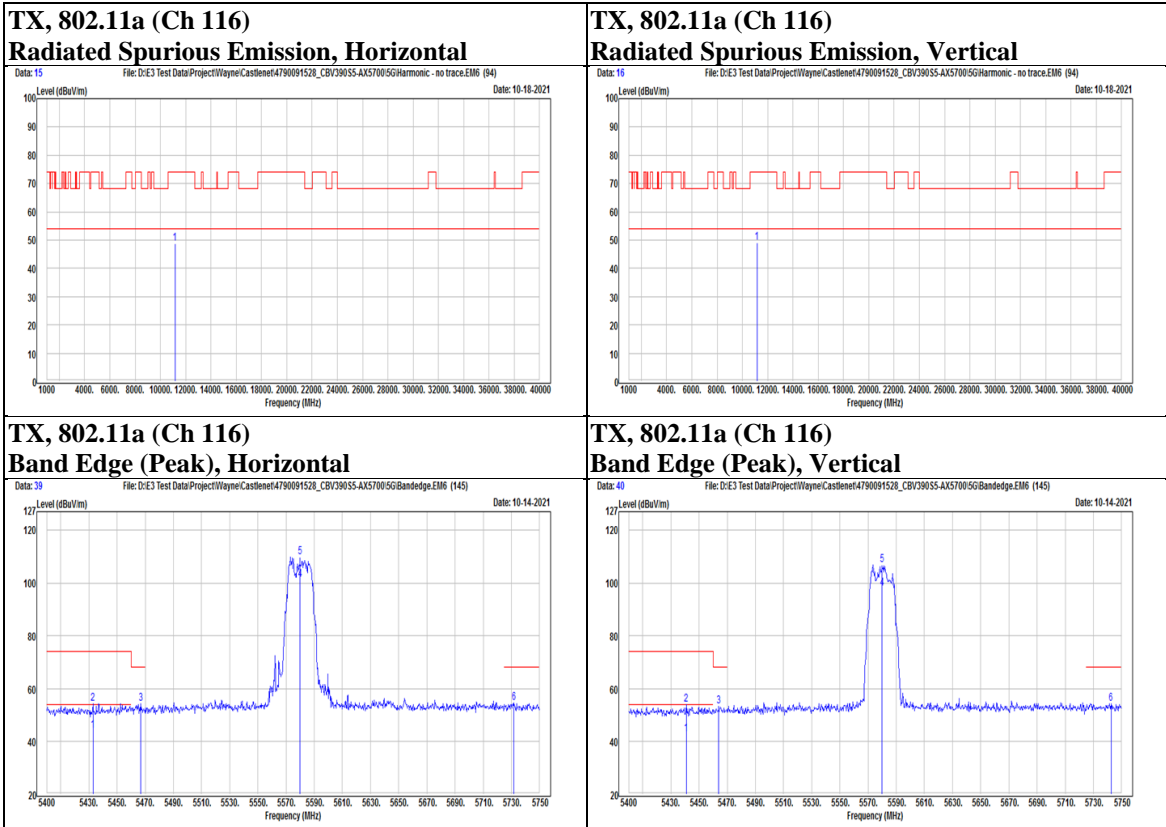

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000





Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	140
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5700	94.42	14.05	108.47	N/A	N/A	PK
	@	5700	85.66	14.05	99.71	N/A	N/A	AVG
	*	5738.45	41.43	14.24	55.67	68.2	-12.53	PK
Vertical	*	11400	30.08	18.74	48.82	74	-25.18	PK
	@	5700	93.97	14.05	108.02	N/A	N/A	PK
	@	5700	85.13	14.05	99.18	N/A	N/A	AVG
	*	5749.65	40.52	14.31	54.83	68.2	-13.37	PK
	*	11400	30.29	18.74	49.03	74	-24.97	PK

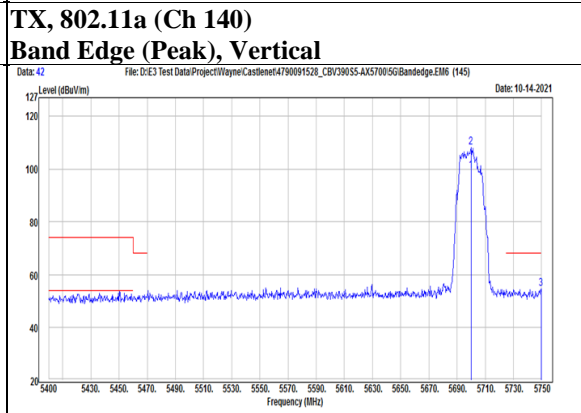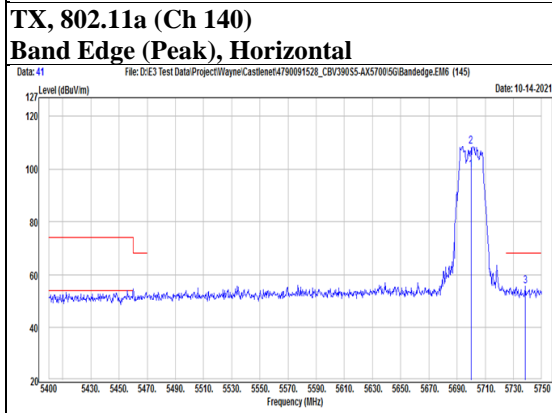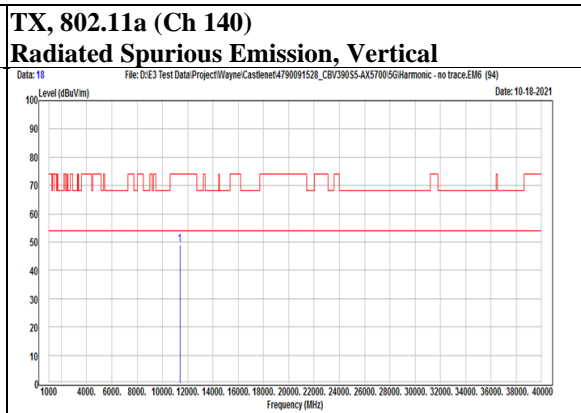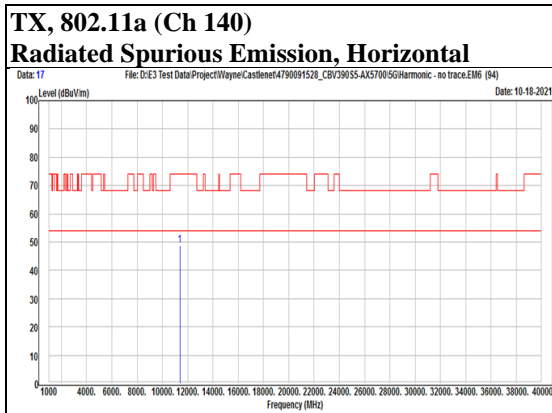

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	144
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11440	30.11	18.86	48.97	74	-25.03	PK
Vertical	*	11440	30.63	18.86	49.49	74	-24.51	PK

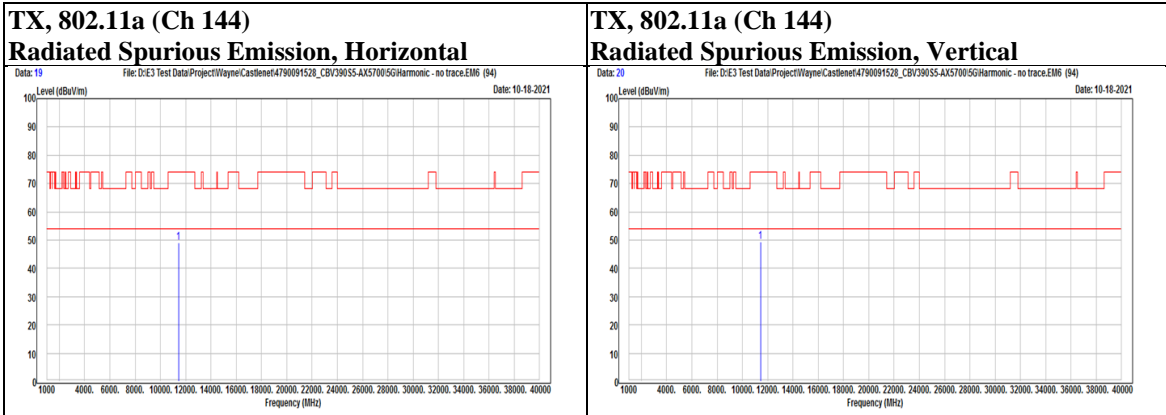

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan





Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5601.5	45.23	14.04	59.27	68.2	-8.93	PK
		5699	54.8	14.05	68.85	104.46	-35.61	PK
		5745	106.04	14.28	120.32	N/A	N/A	PK
		11490	44.39	19.02	63.41	74	-10.59	PK
		11490	34.16	19.02	53.18	54	-0.82	AVG
Vertical	@	5587	43.36	14	57.36	68.2	-10.84	PK
		5695.5	51.01	14.05	65.06	101.88	-36.82	PK
		5745	103.47	14.28	117.75	N/A	N/A	PK
		11490	41.9	19.02	60.92	74	-13.08	PK
		11490	31.7	19.02	50.72	54	-3.28	AVG

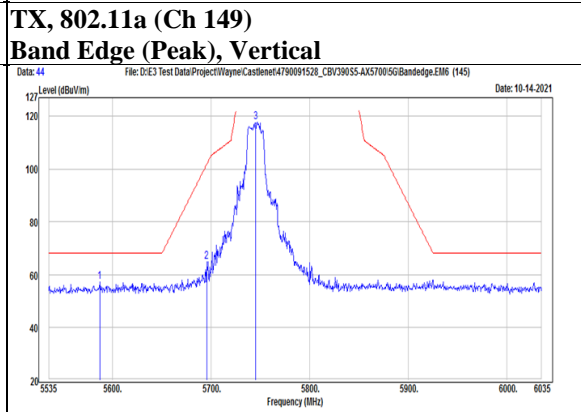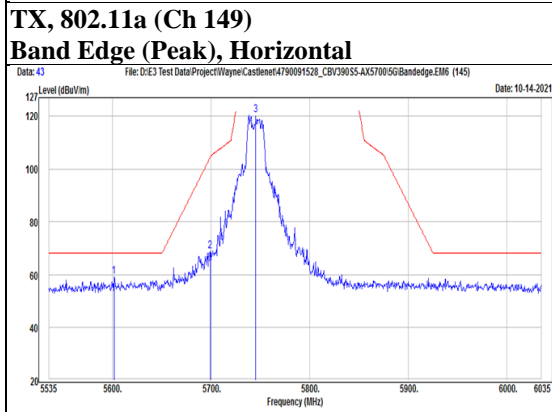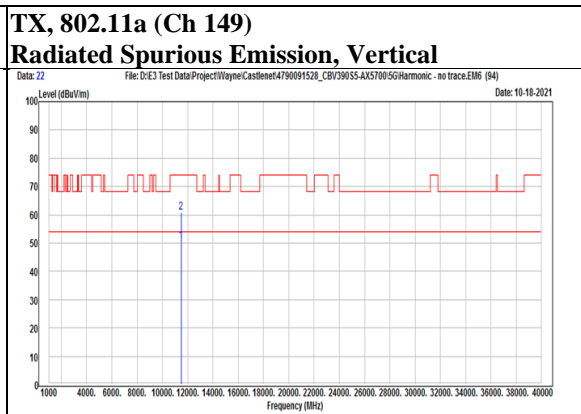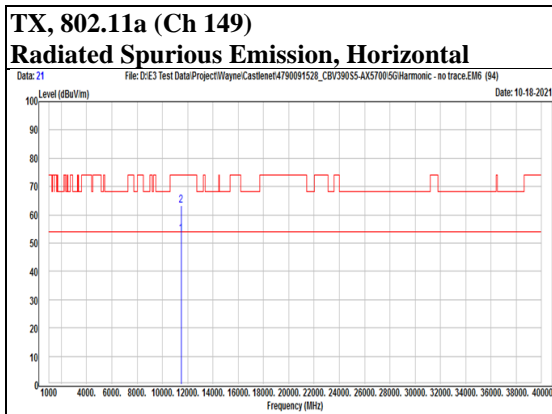

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan





Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5621	43.9	14.03	57.93	68.2	-10.27	PK
		5667	44.52	14.01	58.53	80.82	-22.29	PK
		5785	105.49	14.48	119.97	N/A	N/A	PK
		11570	44.51	18.88	63.39	74	-10.61	PK
		11570	34.23	18.88	53.11	54	-0.89	AVG
Vertical	@	5565.5	42.34	13.93	56.27	68.2	-11.93	PK
		5696	43.09	14.05	57.14	102.25	-45.11	PK
		5785	103.82	14.48	118.3	N/A	N/A	PK
		11570	41.43	18.88	60.31	74	-13.69	PK
		11570	31.21	18.88	50.09	54	-3.91	AVG

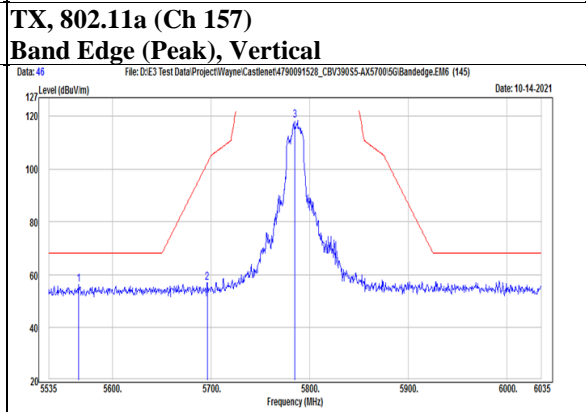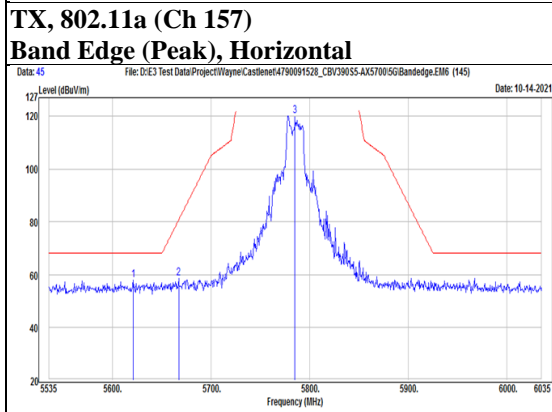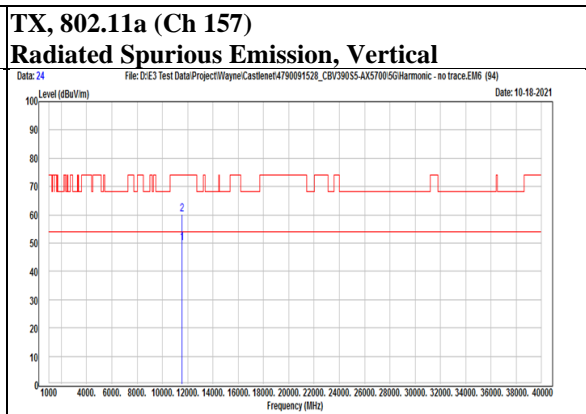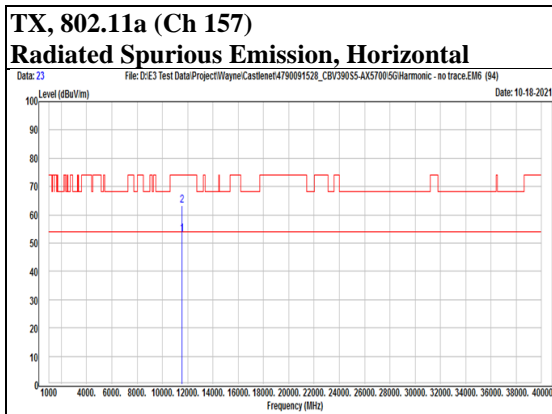

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000





Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	104.33	14.69	119.02	N/A	N/A	PK
		5875	54.47	14.89	69.36	105.2	-35.84	PK
		5925	43.96	14.99	58.95	68.2	-9.25	PK
		11650	44.73	18.63	63.36	74	-10.64	PK
		11650	34.41	18.63	53.04	54	-0.96	AVG
Vertical	@	5825	103.52	14.69	118.21	N/A	N/A	PK
		5877	51.65	14.89	66.54	103.71	-37.17	PK
		5972.5	42.97	15.08	58.05	68.2	-10.15	PK
		11650	41.95	18.63	60.58	74	-13.42	PK
		11650	31.72	18.63	50.35	54	-3.65	AVG

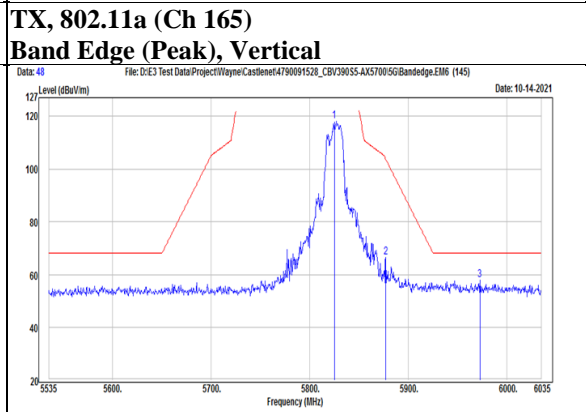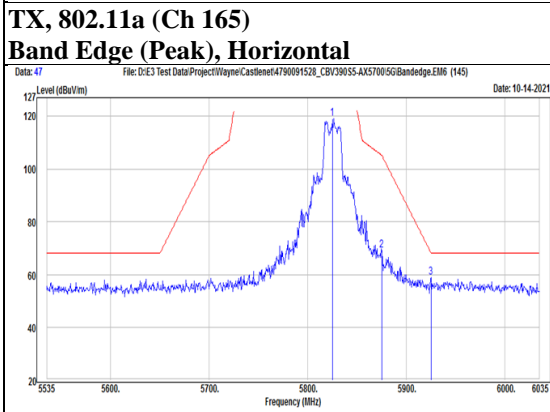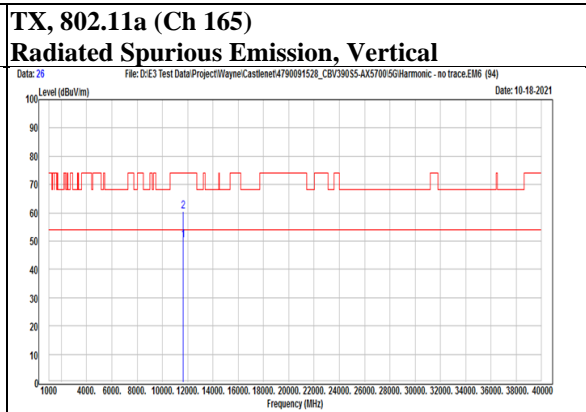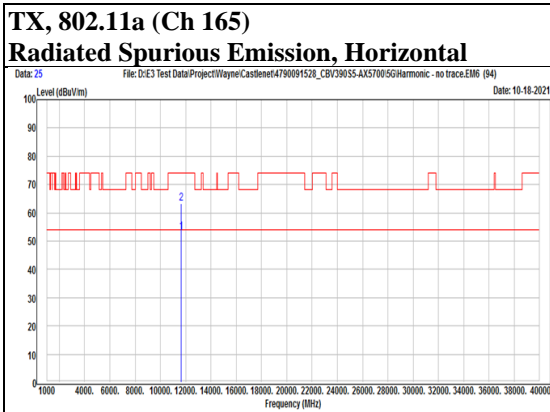

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790091528-US-R1-V0
Page : 88 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11ax(HE20)	Channel	36
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5149.1	53.47	13.43	66.9	74	-7.1	PK
		5149.8	39.95	13.43	53.38	54	-0.62	AVG
	@	5180	103.12	13.4	116.52	N/A	N/A	PK
	@	5180	93.06	13.4	106.46	N/A	N/A	AVG
	*	10360	30.64	17.39	48.03	68.2	-20.17	PK
Vertical		5134.05	44.31	13.43	57.74	74	-16.26	PK
		5149.45	32.7	13.43	46.13	54	-7.87	AVG
	@	5180	98.62	13.4	112.02	N/A	N/A	PK
	@	5180	88.8	13.4	102.2	N/A	N/A	AVG
	*	10360	31.74	17.39	49.13	68.2	-19.07	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

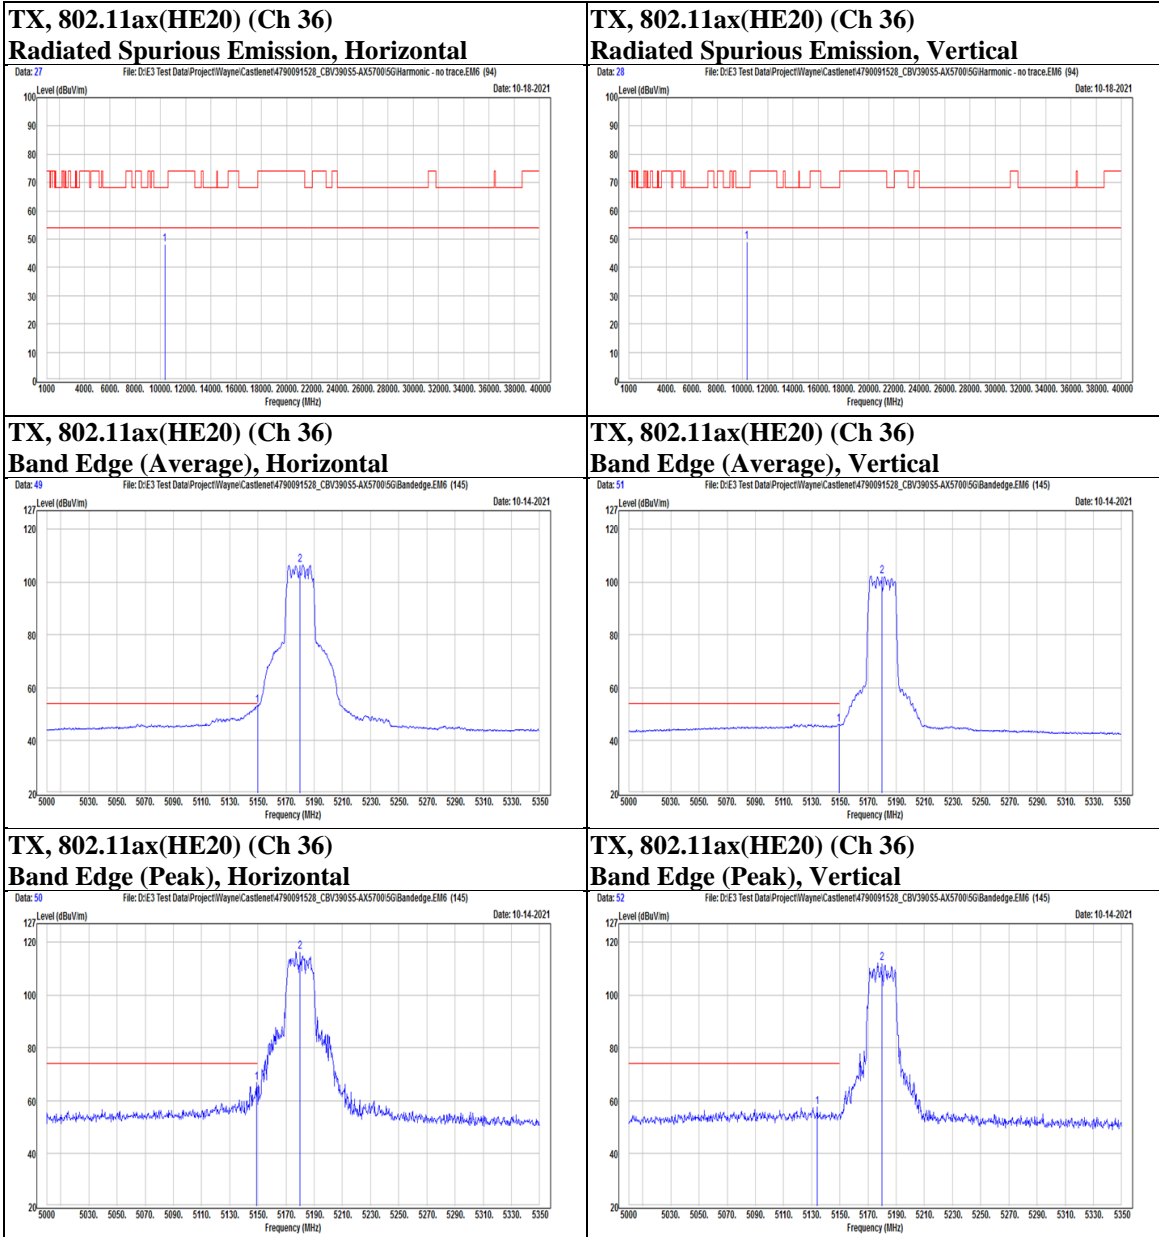



Test report No. : 4790091528-US-R1-V0
Page : 90 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11ax(HE20)	Channel	44
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5131.25	44.6	13.44	58.04	74	-15.96	PK
		5143.85	32.74	13.43	46.17	54	-7.83	AVG
	@	5220	103.22	13.33	116.55	N/A	N/A	PK
	@	5220	93.55	13.33	106.88	N/A	N/A	AVG
	*	10440	30.47	17.63	48.1	68.2	-20.1	PK
Vertical		5107.8	31.61	13.45	45.06	54	-8.94	AVG
		5143.15	43.75	13.43	57.18	74	-16.82	PK
	@	5220	99.57	13.33	112.9	N/A	N/A	PK
	@	5220	88.68	13.33	102.01	N/A	N/A	AVG
	*	10440	31.48	17.63	49.11	68.2	-19.09	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

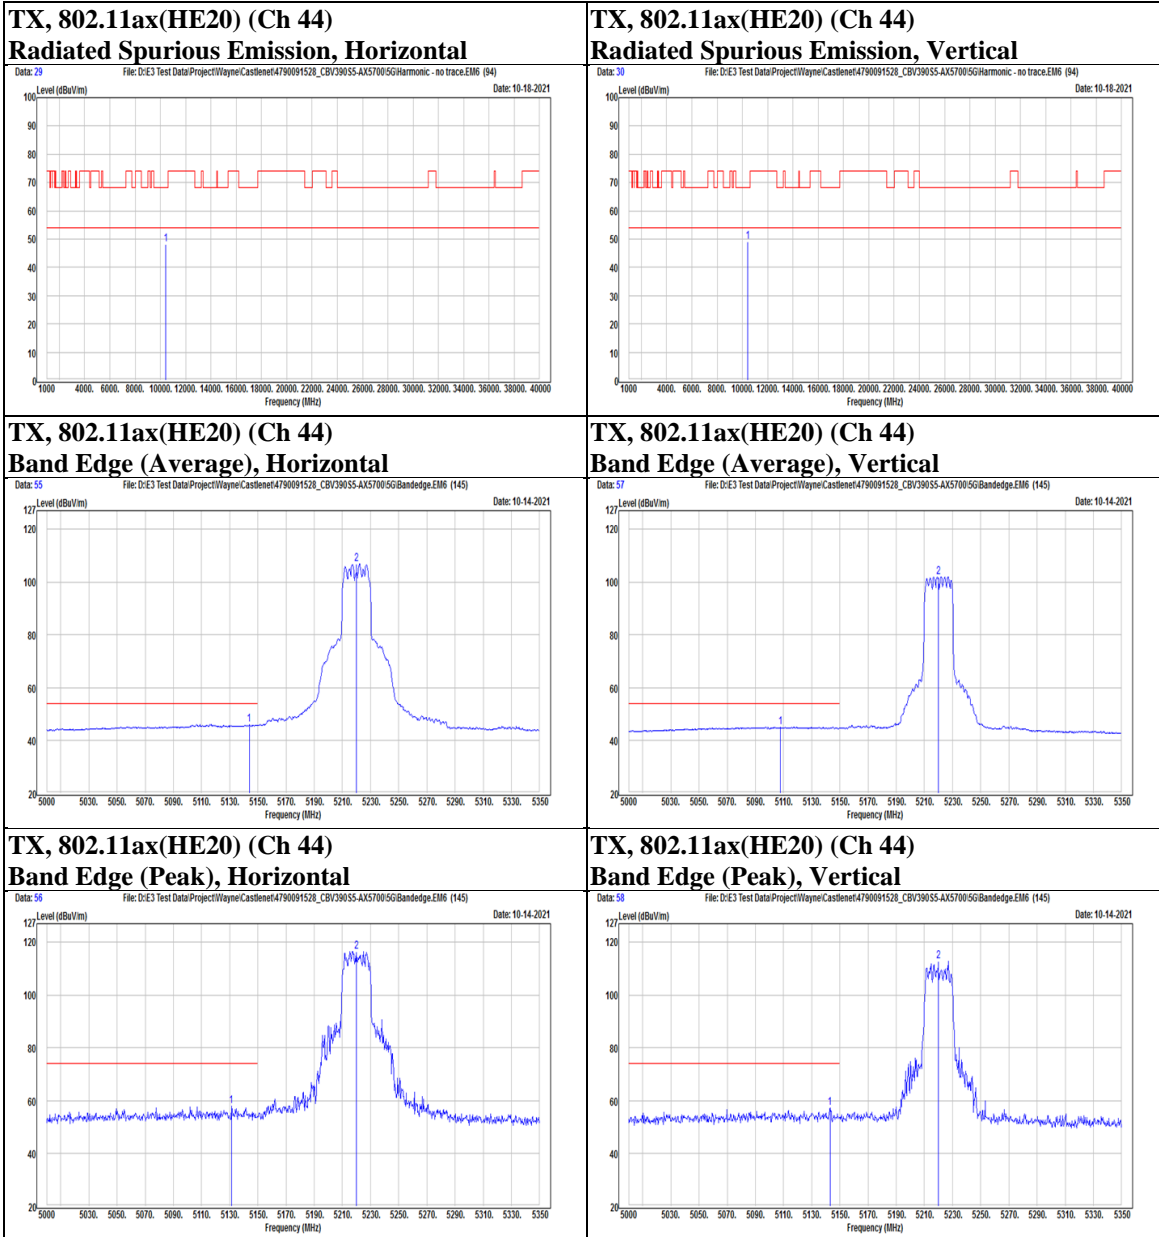



Mode	802.11ax(HE20)	Channel	48
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5127.75	32.76	13.43	46.19	54	-7.81	AVG
		5135.45	43.13	13.43	56.56	74	-17.44	PK
	@	5240	103.5	13.27	116.77	N/A	N/A	PK
	@	5240	93.54	13.27	106.81	N/A	N/A	AVG
	*	10480	30.43	17.69	48.12	68.2	-20.08	PK
Vertical		5117.6	42.8	13.45	56.25	74	-17.75	PK
		5124.95	31.6	13.45	45.05	54	-8.95	AVG
	@	5240	100.01	13.27	113.28	N/A	N/A	PK
	@	5240	89.88	13.27	103.15	N/A	N/A	AVG
	*	10480	31.25	17.69	48.94	68.2	-19.26	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

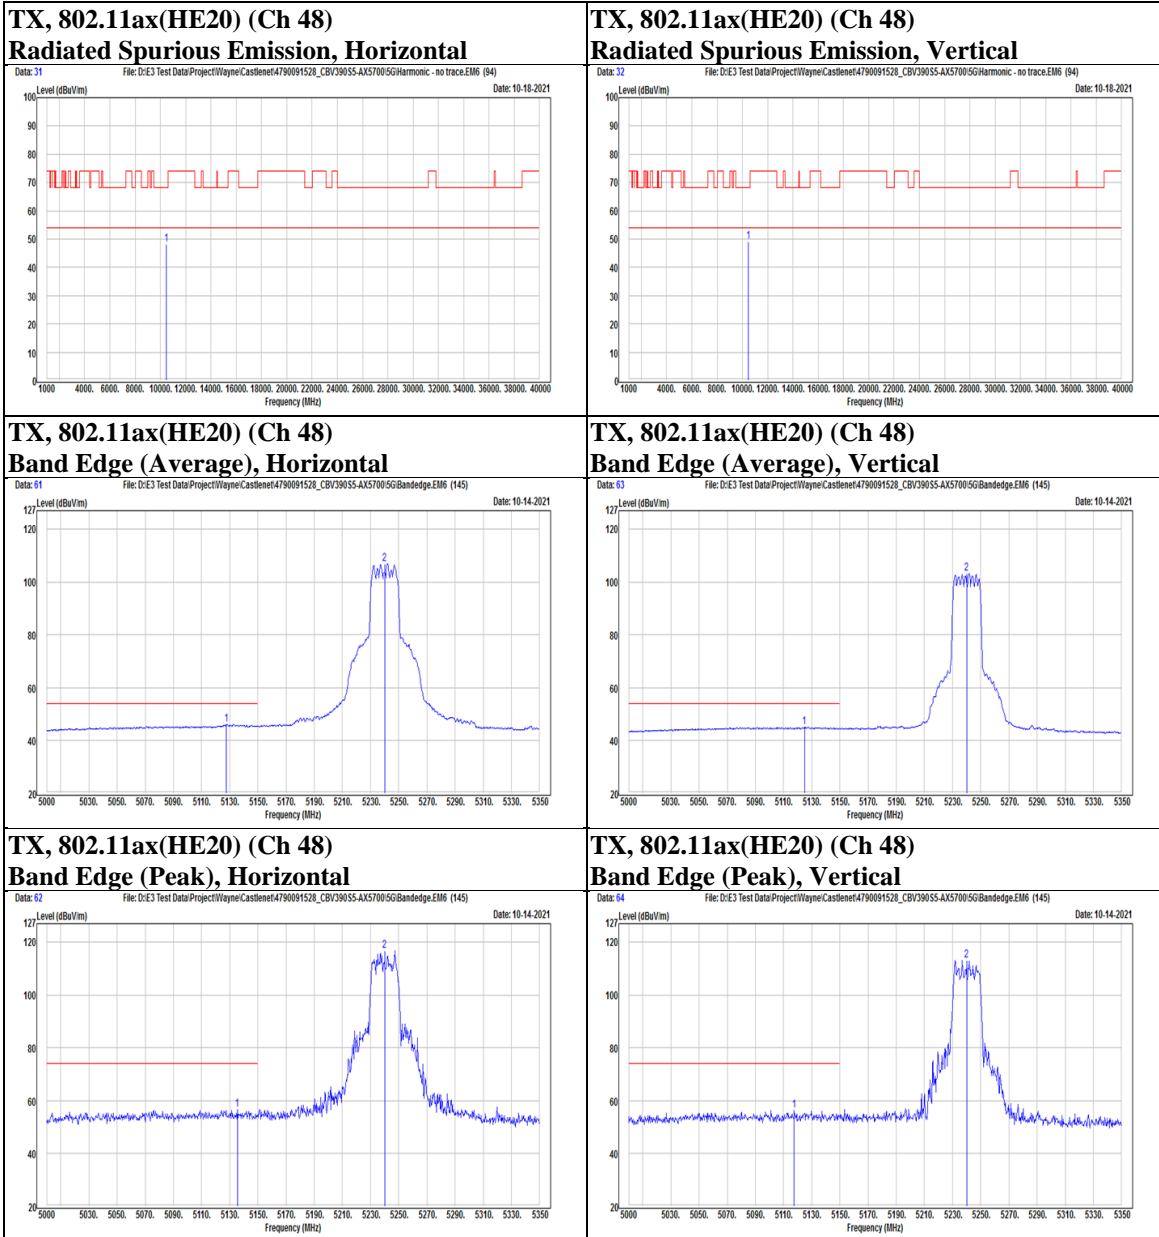



Test report No. : 4790091528-US-R1-V0
Page : 94 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11ax(HE20)	Channel	52
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	96.71	13.24	109.95	N/A	N/A	PK
	@	5260	87.93	13.24	101.17	N/A	N/A	AVG
		5368.2	41.09	13.32	54.41	74	-19.59	PK
		5372.4	29.76	13.33	43.09	54	-10.91	AVG
	*	10520	31.16	17.73	48.89	68.2	-19.31	PK
Vertical	@	5260	93.93	13.24	107.17	N/A	N/A	PK
	@	5260	84.83	13.24	98.07	N/A	N/A	AVG
		5400	40.27	13.42	53.69	74	-20.31	PK
		5458.2	28.68	13.7	42.38	54	-11.62	AVG
	*	10520	31.84	17.73	49.57	68.2	-18.63	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

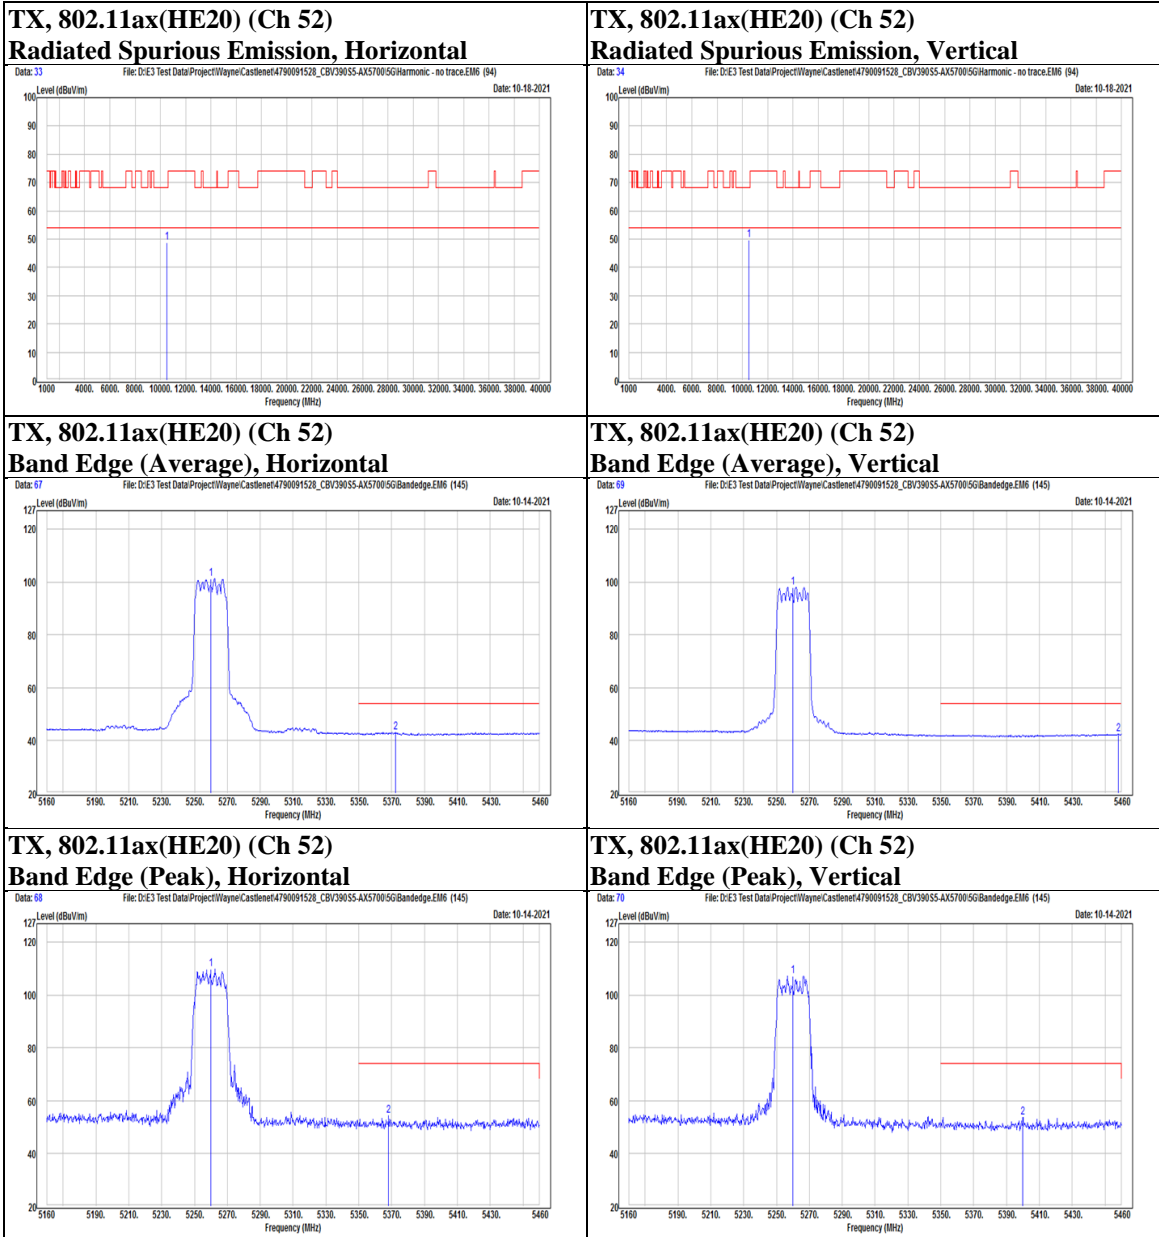



Test report No. : 4790091528-US-R1-V0
Page : 96 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11ax(HE20)	Channel	60
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	97.76	13.21	110.97	N/A	N/A	PK
	@	5300	87.58	13.21	100.79	N/A	N/A	AVG
		5352.3	31.38	13.26	44.64	54	-9.36	AVG
		5362.2	41.12	13.3	54.42	74	-19.58	PK
	*	10600	30.85	17.73	48.58	68.2	-19.62	PK
Vertical	@	5300	93.12	13.21	106.33	N/A	N/A	PK
	@	5300	85.3	13.21	98.51	N/A	N/A	AVG
		5357.1	29.52	13.28	42.8	54	-11.2	AVG
		5388.3	41.52	13.38	54.9	74	-19.1	PK
	*	10600	31.18	17.73	48.91	68.2	-19.29	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

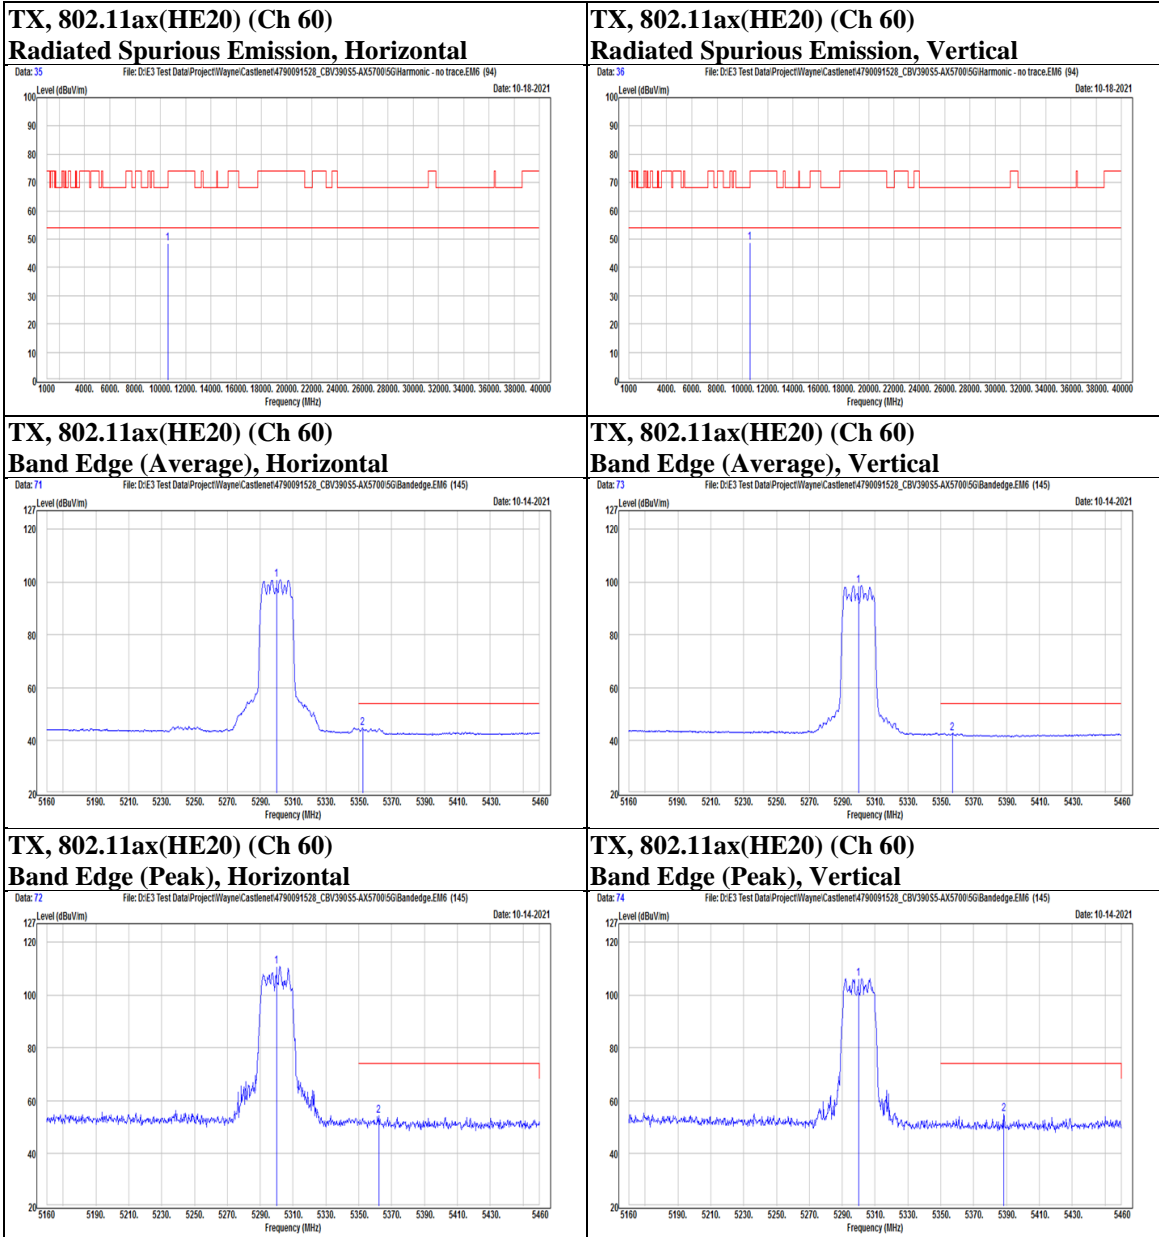



Test report No. : 4790091528-US-R1-V0
Page : 98 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11ax(HE20)	Channel	64
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	96.62	13.23	109.85	N/A	N/A	PK
	@	5320	87.83	13.23	101.06	N/A	N/A	AVG
		5350.8	42.24	13.26	55.5	74	-18.5	PK
		5372.4	31.87	13.33	45.2	54	-8.8	AVG
	*	10640	30.86	17.82	48.68	74	-25.32	PK
Vertical	@	5320	93.45	13.23	106.68	N/A	N/A	PK
	@	5320	85.51	13.23	98.74	N/A	N/A	AVG
		5367.6	29.85	13.32	43.17	54	-10.83	AVG
		5368.8	40.81	13.33	54.14	74	-19.86	PK
	*	10640	31.64	17.82	49.46	74	-24.54	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948





Doc No: 17-EM-F0878 / 6.0

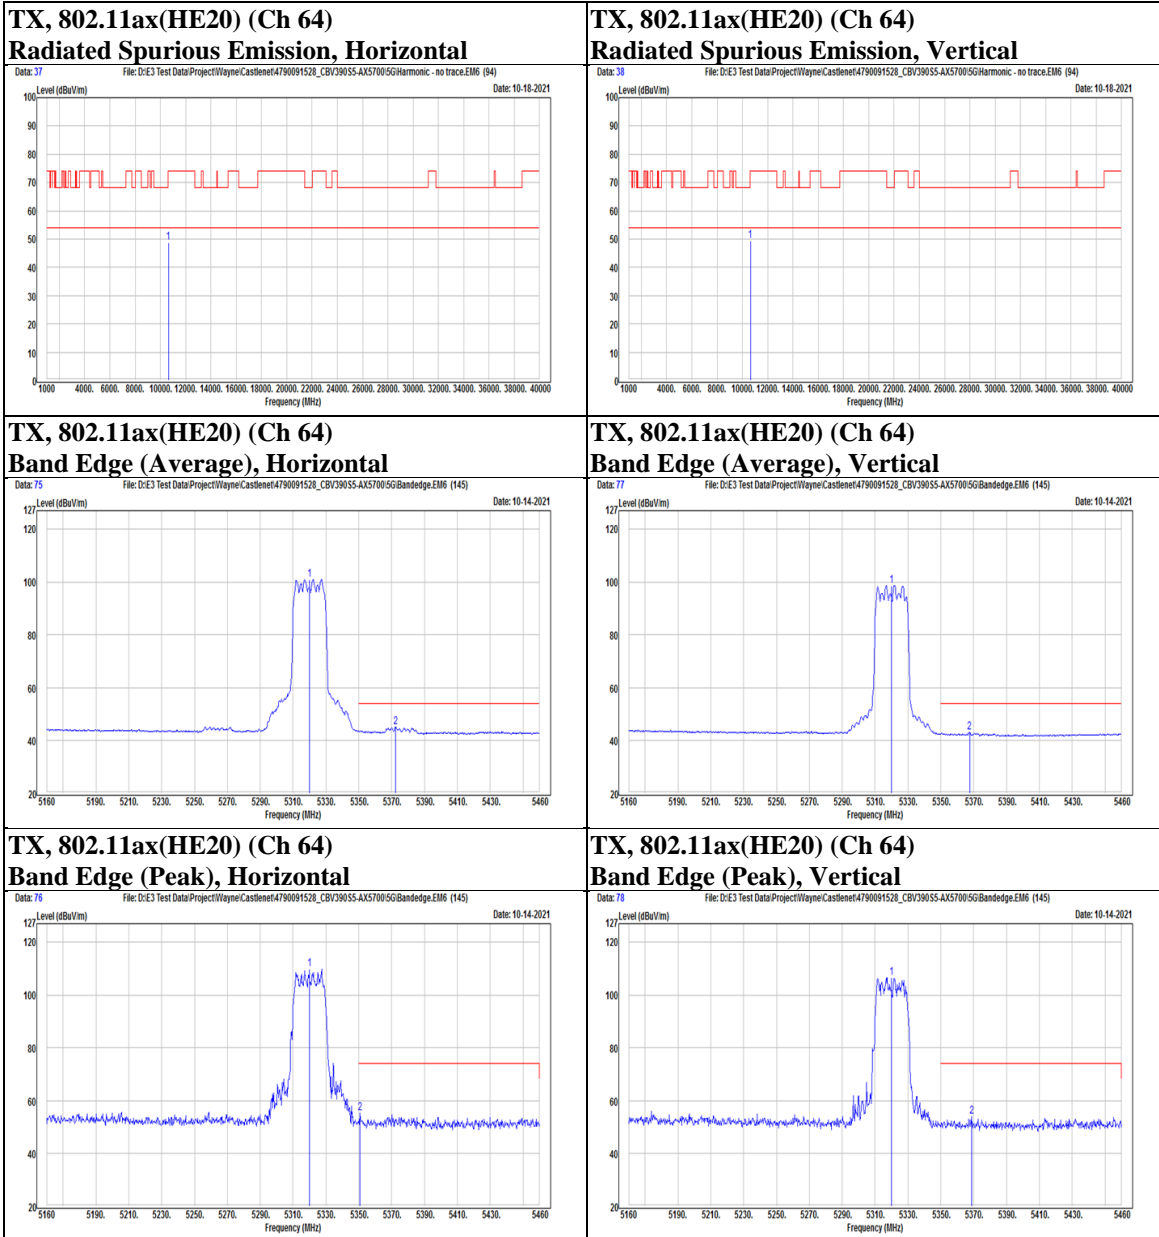



Mode	802.11ax(HE20)	Channel	100
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBUV)	(dB/m)	(dBUV/m)	(dBUV/m)	(dB)	
Horizontal		5447.95	41.15	13.66	54.81	74	-19.19	PK
		5447.95	31.44	13.66	45.1	54	-8.9	AVG
		5469.3	40.13	13.74	53.87	68.2	-14.33	PK
	@	5500	95.61	13.83	109.44	N/A	N/A	PK
	@	5500	86.54	13.83	100.37	N/A	N/A	AVG
Vertical	*	11000	30.21	18.28	48.49	74	-25.51	PK
		5426.95	40.14	13.56	53.7	74	-20.3	PK
		5426.95	29.96	13.56	43.52	54	-10.48	AVG
		5467.55	40.15	13.73	53.88	68.2	-14.32	PK
	@	5500	92.61	13.83	106.44	N/A	N/A	PK
	@	5500	85.31	13.83	99.14	N/A	N/A	AVG
	*	11000	31.51	18.28	49.79	74	-24.21	PK

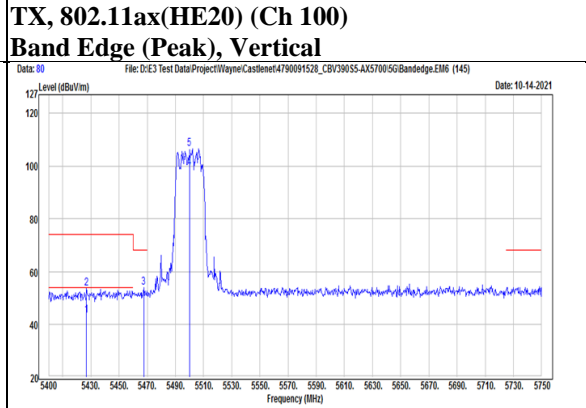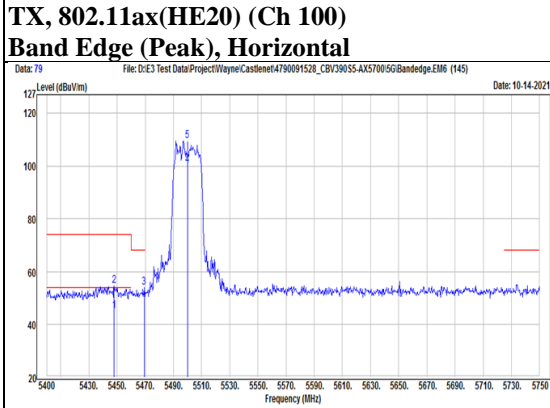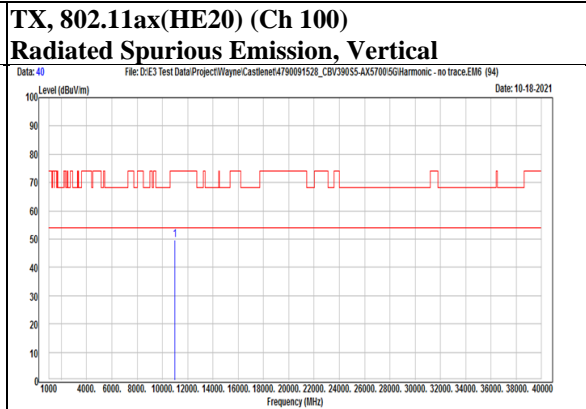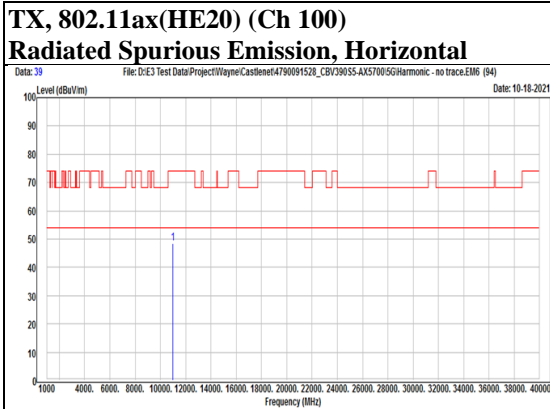

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000





Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ax(HE20)	Channel	116
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5443.05	40	13.64	53.64	74	-20.36	PK
		5443.05	29.7	13.64	43.34	54	-10.66	AVG
		5461.6	39.9	13.71	53.61	68.2	-14.59	PK
	@	5580	94.58	13.98	108.56	N/A	N/A	PK
	@	5580	85.68	13.98	99.66	N/A	N/A	AVG
	*	5743.7	40.54	14.27	54.81	68.2	-13.39	PK
Vertical		11160	30.41	18.32	48.73	74	-25.27	PK
		5431.15	40.24	13.57	53.81	74	-20.19	PK
		5431.15	28.95	13.57	42.52	54	-11.48	AVG
		5460.9	39.47	13.71	53.18	68.2	-15.02	PK
	@	5580	92.27	13.98	106.25	N/A	N/A	PK
	@	5580	83.31	13.98	97.29	N/A	N/A	AVG
	5742.3	39.67	14.27	53.94	68.2	-14.26	PK	
	* 11160	30.47	18.32	48.79	74	-25.21	PK	

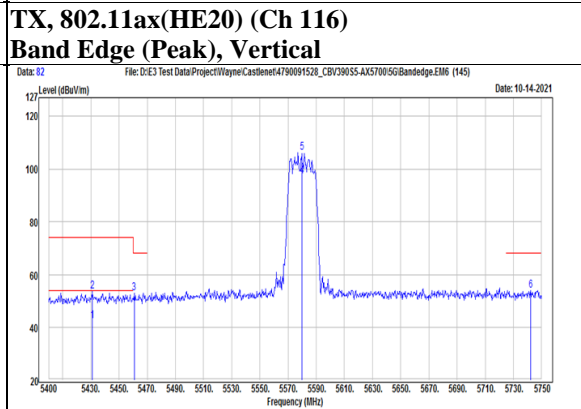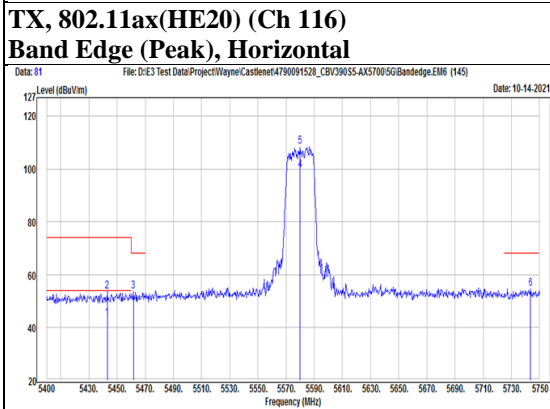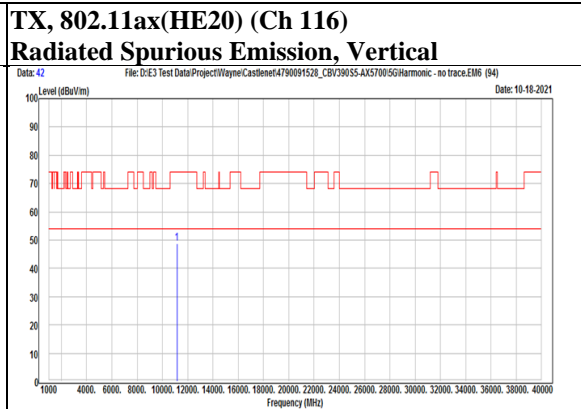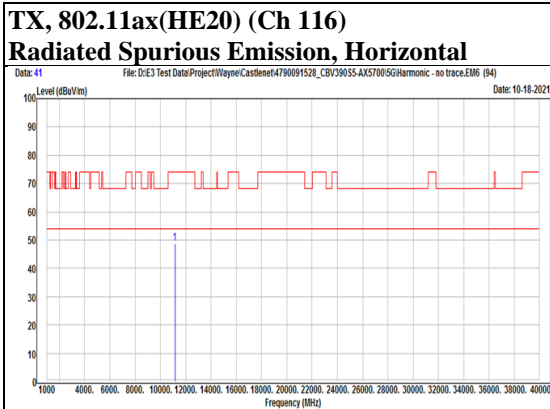

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000





Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ax(HE20)	Channel	140
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5700	96.27	14.05	110.32	N/A	N/A	PK
	@	5700	86.04	14.05	100.09	N/A	N/A	AVG
	*	5744.4	41.79	14.28	56.07	68.2	-12.13	PK
Vertical	*	11400	30.13	18.74	48.87	74	-25.13	PK
	@	5700	93.16	14.05	107.21	N/A	N/A	PK
	@	5700	83.99	14.05	98.04	N/A	N/A	AVG
	*	5744.4	40.64	14.28	54.92	68.2	-13.28	PK
	*	11400	30.46	18.74	49.2	74	-24.8	PK

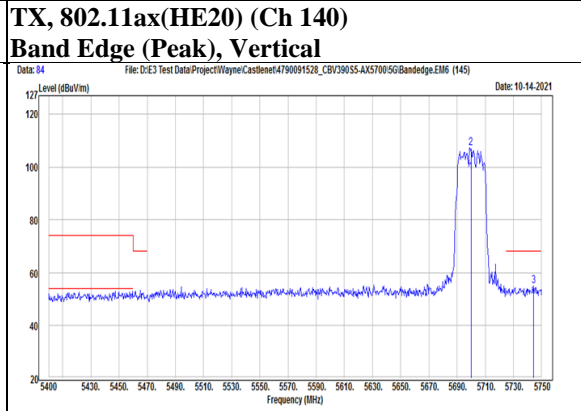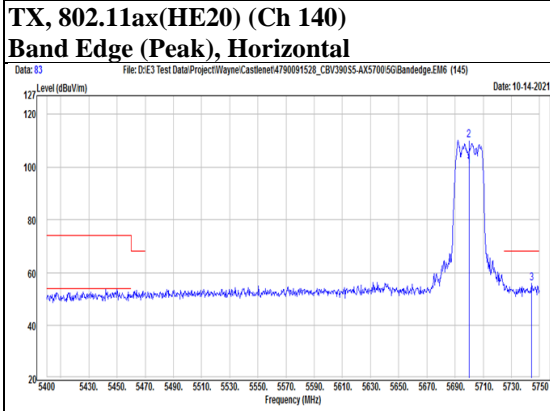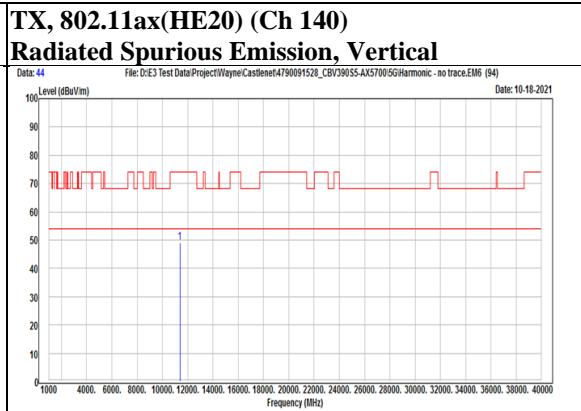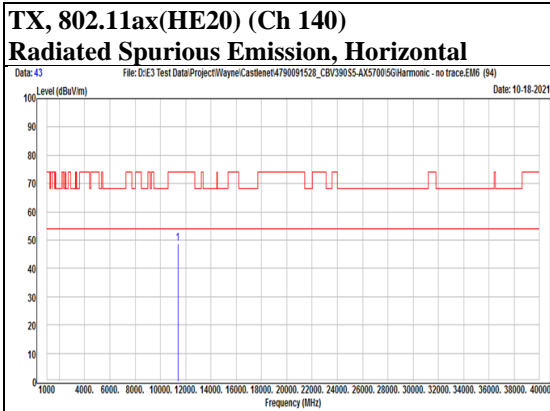

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0