




Mode	802.11ax(HE20)	Channel	144
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11440	29.47	18.86	48.33	74	-25.67	PK
Vertical	*	11440	29.93	18.86	48.79	74	-25.21	PK

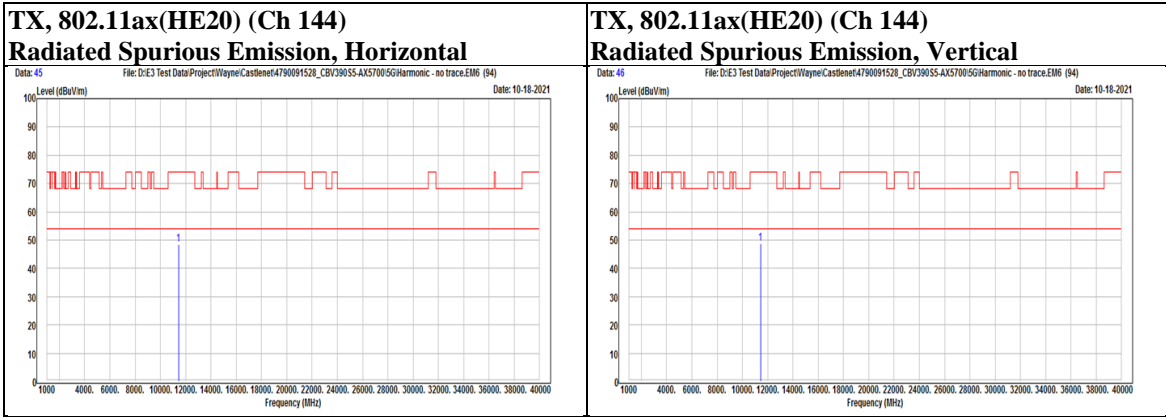

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan





Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Mode	802.11ax(HE20)	Channel	149
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5605	44.32	14.03	58.35	68.2	-9.85	PK
		5696	58.52	14.05	72.57	102.25	-29.68	PK
		5745	104.74	14.28	119.02	N/A	N/A	PK
		11490	48.61	19.02	67.63	74	-6.37	PK
		11490	34.14	19.02	53.16	54	-0.84	AVG
Vertical	@	5597.5	42.45	14.03	56.48	68.2	-11.72	PK
		5699.5	51.04	14.05	65.09	104.83	-39.74	PK
		5745	102.73	14.28	117.01	N/A	N/A	PK
		11490	43.2	19.02	62.22	74	-11.78	PK
		11490	29.14	19.02	48.16	54	-5.84	AVG

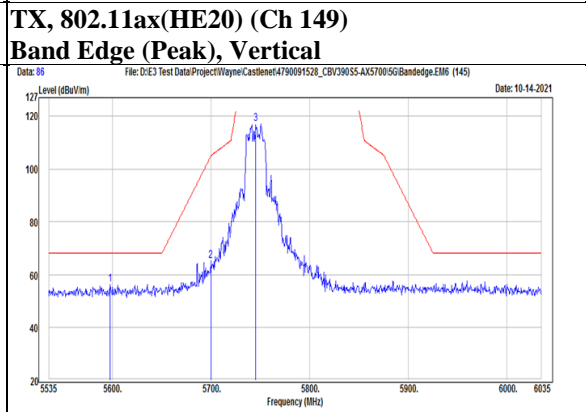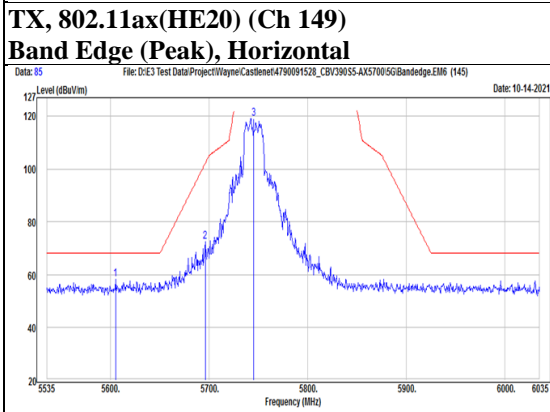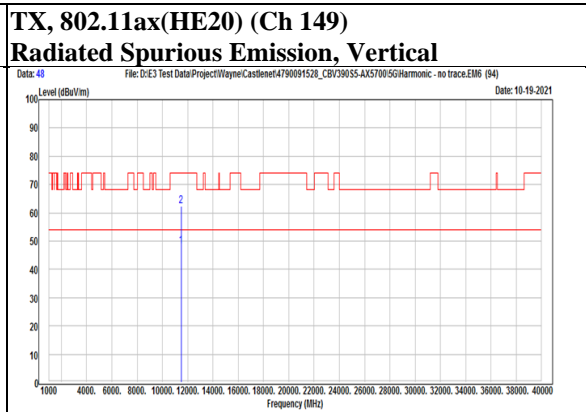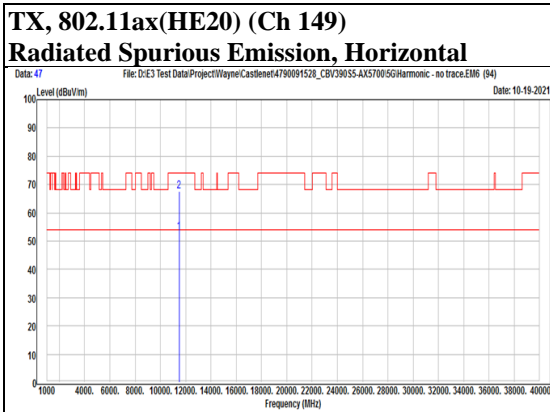

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000





Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ax(HE20)	Channel	157
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5538.5	44.02	13.87	57.89	68.2	-10.31	PK
		5691.5	43.84	14.04	57.88	98.93	-41.05	PK
	@	5785	104.1	14.48	118.58	N/A	N/A	PK
		5909.5	43.72	14.97	58.69	79.64	-20.95	PK
		5980	42.35	15.11	57.46	68.2	-10.74	PK
		11570	48.12	18.88	67	74	-7	PK
Vertical		11570	34.4	18.88	53.28	54	-0.72	AVG
		5611.5	42.26	14.03	56.29	68.2	-11.91	PK
		5684.5	41.65	14.04	55.69	93.76	-38.07	PK
	@	5785	101.84	14.48	116.32	N/A	N/A	PK
		5920	42.3	14.98	57.28	71.89	-14.61	PK
		5944.5	42.73	15.01	57.74	68.2	-10.46	PK
	11570	44.85	18.88	63.73	74	-10.27	PK	
	11570	30.62	18.88	49.5	54	-4.5	AVG	

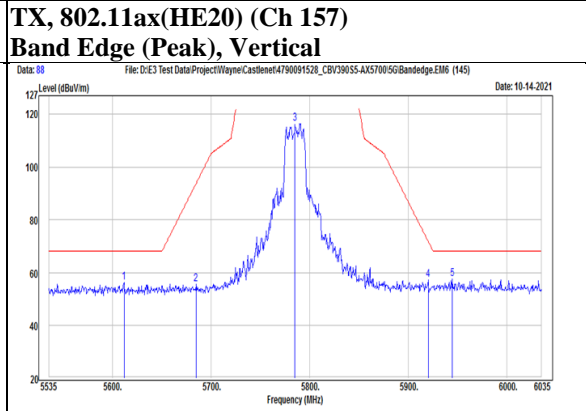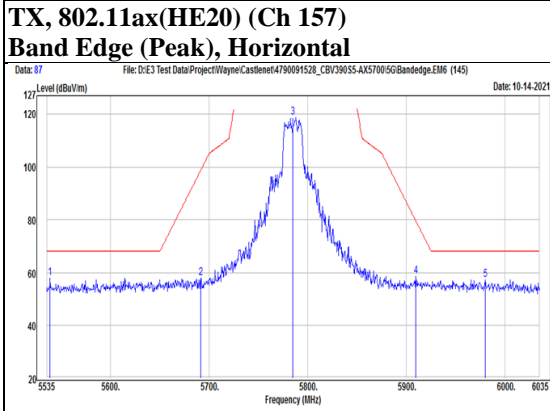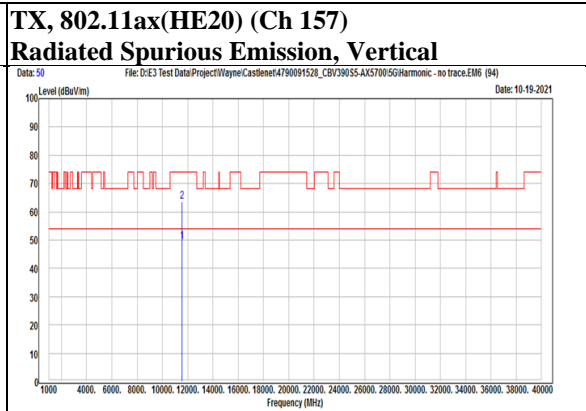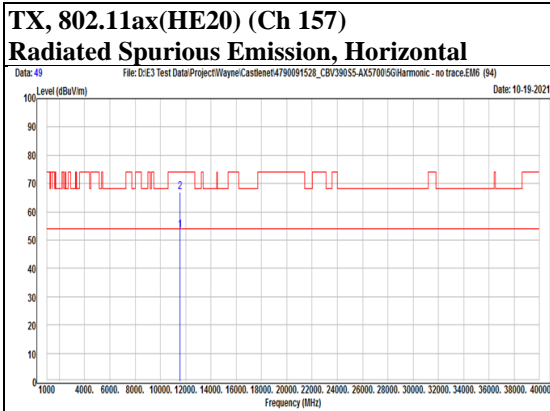

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan





Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ax(HE20)	Channel	165
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	103.45	14.69	118.14	N/A	N/A	PK
		5876	54.19	14.89	69.08	104.46	-35.38	PK
		5985	43.78	15.12	58.9	68.2	-9.3	PK
		11650	48.98	18.63	67.61	74	-6.39	PK
		11650	34.51	18.63	53.14	54	-0.86	AVG
Vertical	@	5825	101.95	14.69	116.64	N/A	N/A	PK
		5880	53.07	14.91	67.98	101.49	-33.51	PK
		5933.5	42.96	15	57.96	68.2	-10.24	PK
		11650	43.57	18.63	62.2	74	-11.8	PK
		11650	30.32	18.63	48.95	54	-5.05	AVG

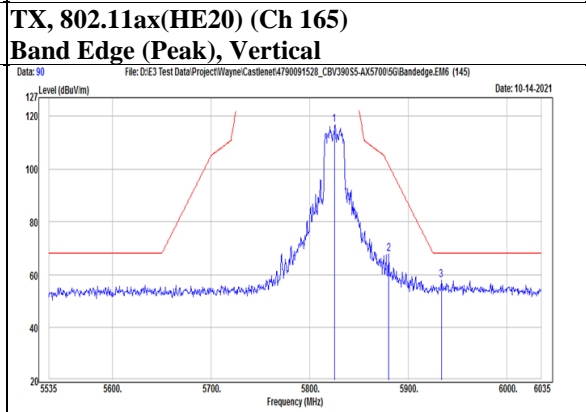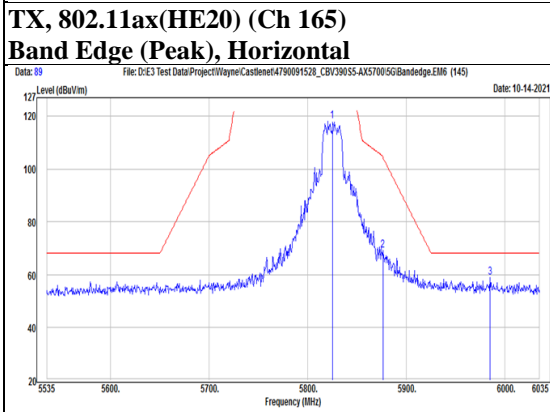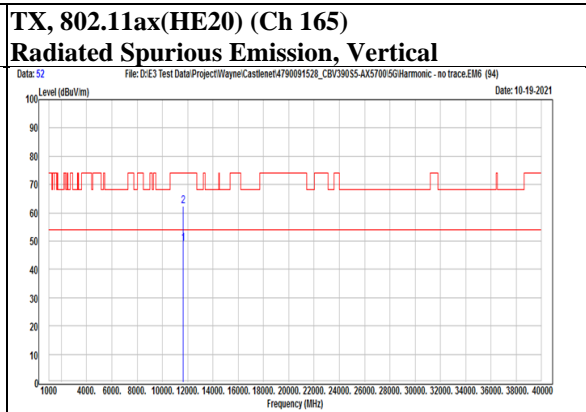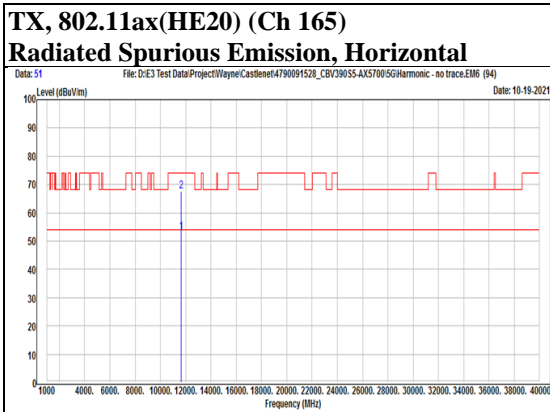

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ax(HE40)	Channel	38
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5141.4	50.6	13.43	64.03	74	-9.97	PK
		5149.1	40.17	13.43	53.6	54	-0.4	AVG
	@	5190	95.64	13.4	109.04	N/A	N/A	PK
	@	5190	85.97	13.4	99.37	N/A	N/A	AVG
	*	10380	31.03	17.49	48.52	68.2	-19.68	PK
Vertical		5075.6	42.67	13.38	56.05	74	-17.95	PK
		5149.45	32.04	13.43	45.47	54	-8.53	AVG
	@	5190	90.74	13.4	104.14	N/A	N/A	PK
	@	5190	80.97	13.4	94.37	N/A	N/A	AVG
	*	10380	31.52	17.49	49.01	68.2	-19.19	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

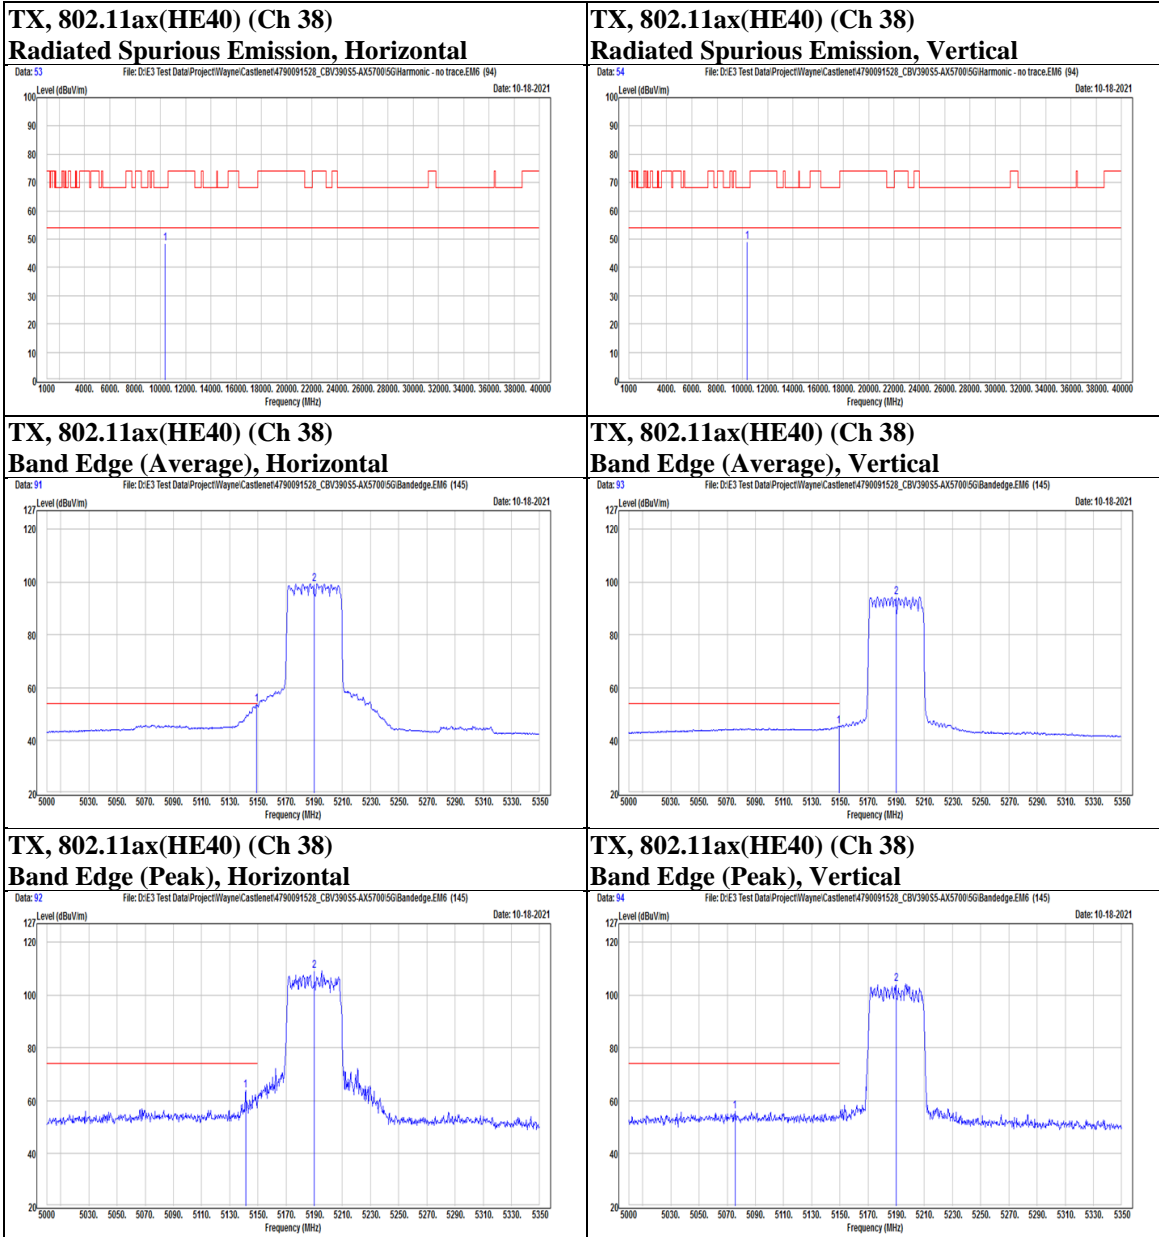



Mode	802.11ax(HE40)	Channel	46
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5145.95	51.14	13.43	64.57	74	-9.43	PK
		5149.45	39.57	13.43	53	54	-1	AVG
	@	5230	101.85	13.3	115.15	N/A	N/A	PK
	@	5230	92.61	13.3	105.91	N/A	N/A	AVG
	*	10460	32.18	17.66	49.84	68.2	-18.36	PK
Vertical		5139.3	44.8	13.43	58.23	74	-15.77	PK
		5139.3	33.94	13.43	47.37	54	-6.63	AVG
	@	5230	99.65	13.3	112.95	N/A	N/A	PK
	@	5230	89.8	13.3	103.1	N/A	N/A	AVG
	*	10460	32.92	17.66	50.58	68.2	-17.62	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

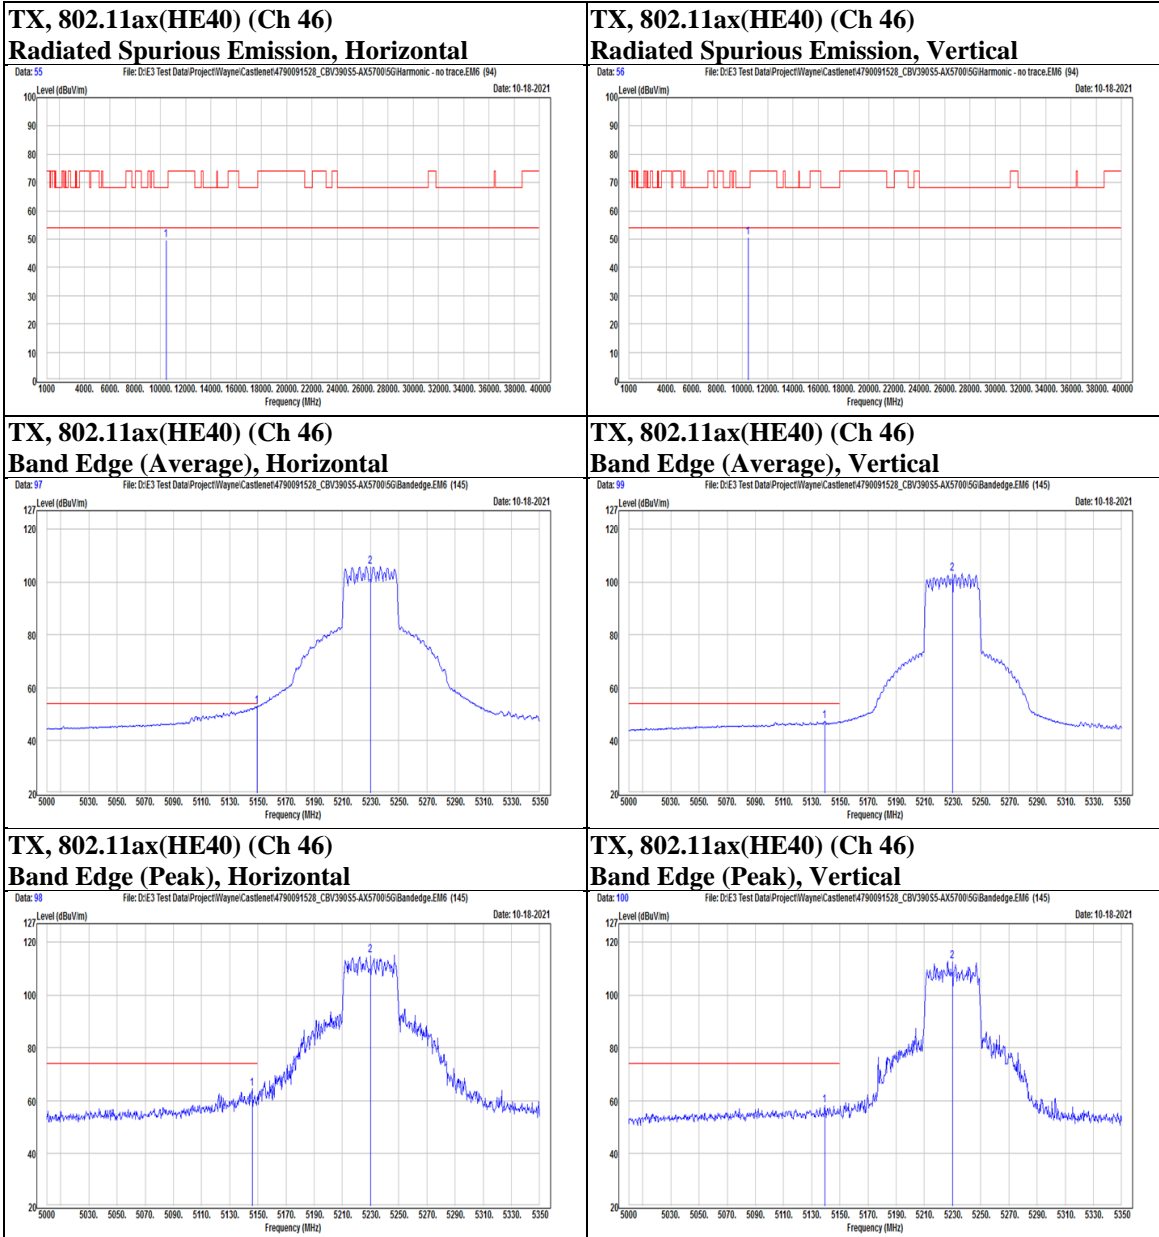



Test report No. : 4790091528-US-R1-V0
Page : 111 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11ax(HE40)	Channel	54
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	100.83	13.22	114.05	N/A	N/A	PK
	@	5270	88.83	13.22	102.05	N/A	N/A	AVG
		5374.5	33.45	13.34	46.79	54	-7.21	AVG
		5394.3	42.9	13.4	56.3	74	-17.7	PK
	*	10540	30.83	17.72	48.55	68.2	-19.65	PK
Vertical	@	5270	96.07	13.22	109.29	N/A	N/A	PK
	@	5270	86.53	13.22	99.75	N/A	N/A	AVG
		5362.2	30.65	13.3	43.95	54	-10.05	AVG
		5442.6	41.67	13.64	55.31	74	-18.69	PK
	*	10540	31.27	17.72	48.99	68.2	-19.21	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

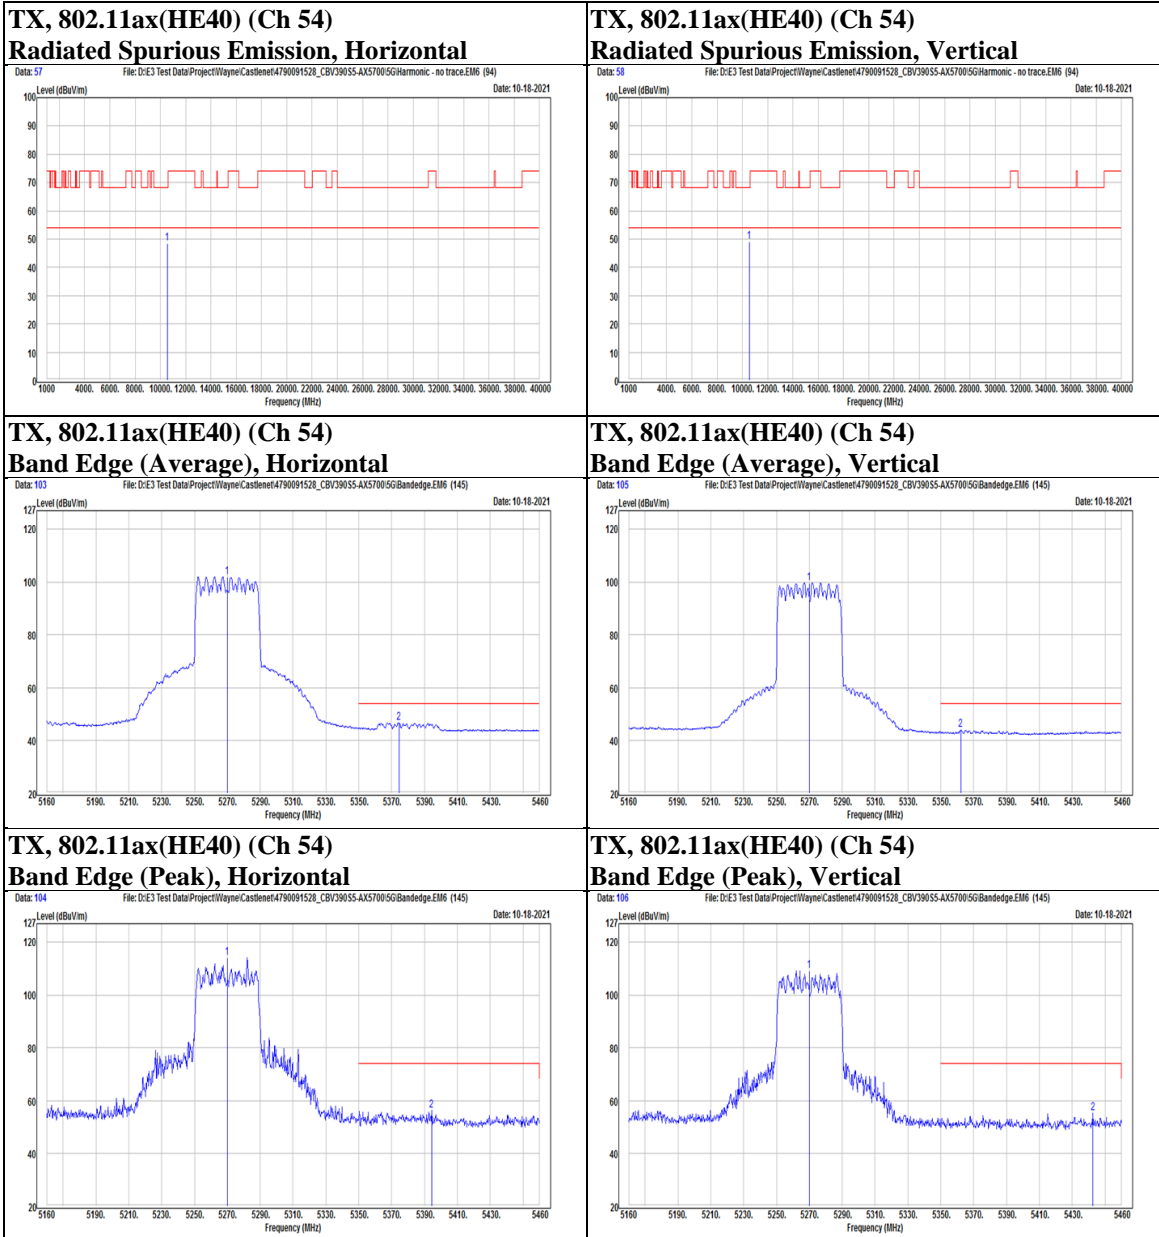



Test report No. : 4790091528-US-R1-V0
Page : 113 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11ax(HE40)	Channel	62
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5310	95.27	13.21	108.48	N/A	N/A	PK
	@	5310	86.01	13.21	99.22	N/A	N/A	AVG
		5350.2	39.4	13.26	52.66	54	-1.34	AVG
		5350.5	51.62	13.26	64.88	74	-9.12	PK
	*	10620	30.78	17.78	48.56	74	-25.44	PK
Vertical	@	5310	93.57	13.21	106.78	N/A	N/A	PK
	@	5310	84.33	13.21	97.54	N/A	N/A	AVG
		5351.4	34.34	13.26	47.6	54	-6.4	AVG
		5352.3	46.18	13.26	59.44	74	-14.56	PK
	*	10620	31.31	17.78	49.09	74	-24.91	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948





Doc No: 17-EM-F0878 / 6.0

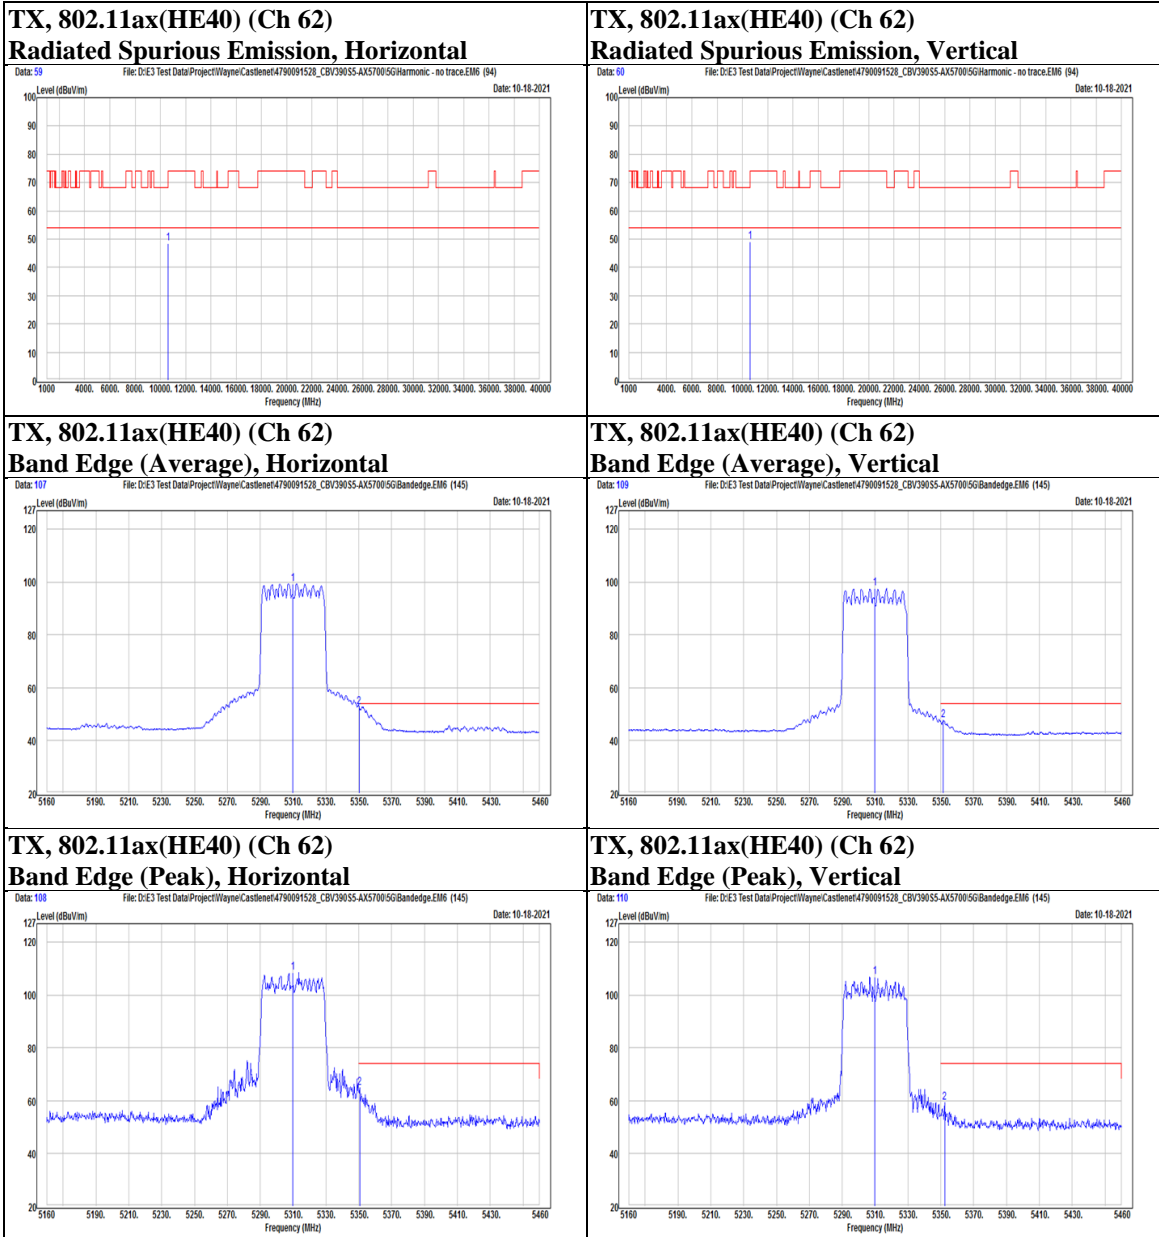



Mode	802.11ax(HE40)	Channel	102
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5457.75	48.86	13.7	62.56	74	-11.44	PK
		5457.75	37.45	13.7	51.15	54	-2.85	AVG
		5469.3	54.04	13.74	67.78	68.2	-0.42	PK
	@	5510	94.17	13.84	108.01	N/A	N/A	PK
	@	5510	86.28	13.84	100.12	N/A	N/A	AVG
Vertical	*	11020	30.04	18.32	48.36	74	-25.64	PK
		5459.85	41.11	13.7	54.81	74	-19.19	PK
		5459.85	32	13.7	45.7	54	-8.3	AVG
		5467.2	46.7	13.72	60.42	68.2	-7.78	PK
	@	5510	91.54	13.84	105.38	N/A	N/A	PK
	@	5510	84.64	13.84	98.48	N/A	N/A	AVG
	*	11020	30.64	18.32	48.96	74	-25.04	PK

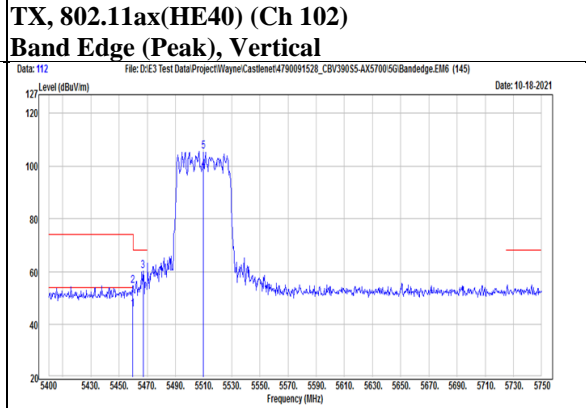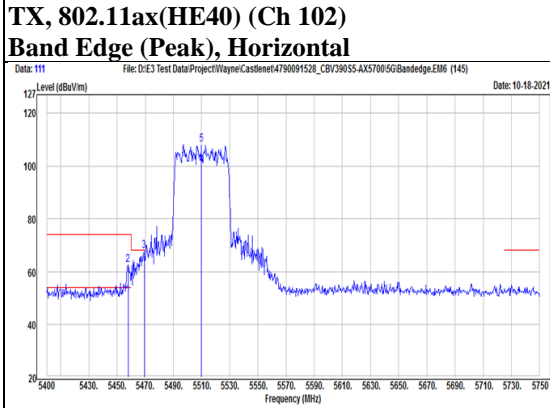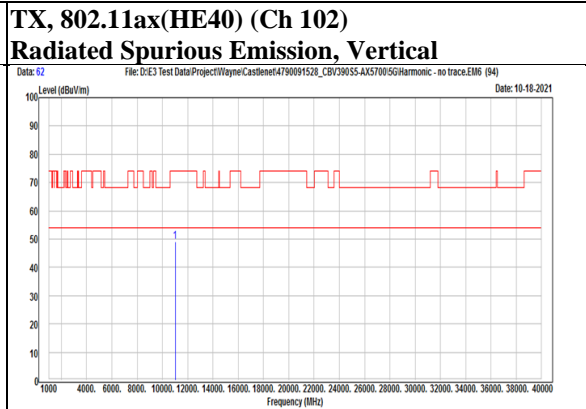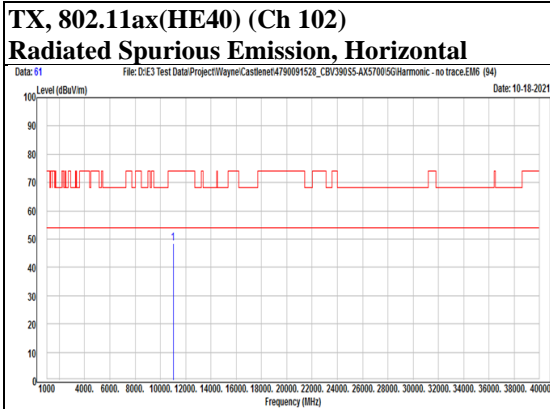

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000





Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ax(HE40)	Channel	110
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5418.55	43.31	13.51	56.82	74	-17.18	PK
		5418.55	33.03	13.51	46.54	54	-7.46	AVG
		5465.1	41.26	13.72	54.98	68.2	-13.22	PK
	@	5550	95.67	13.88	109.55	N/A	N/A	PK
	@	5550	87.22	13.88	101.1	N/A	N/A	AVG
	*	5738.1	41.28	14.24	55.52	68.2	-12.68	PK
Vertical		11100	30.27	18.49	48.76	74	-25.24	PK
		5444.8	41.7	13.65	55.35	74	-18.65	PK
		5444.8	31.06	13.65	44.71	54	-9.29	AVG
		5464.75	41.03	13.72	54.75	68.2	-13.45	PK
	@	5550	92.98	13.88	106.86	N/A	N/A	PK
	@	5550	85.56	13.88	99.44	N/A	N/A	AVG
	5745.45	40.76	14.28	55.04	68.2	-13.16	PK	
	* 11100	30.73	18.49	49.22	74	-24.78	PK	

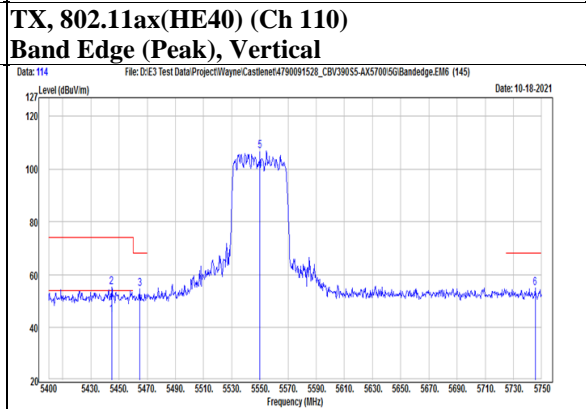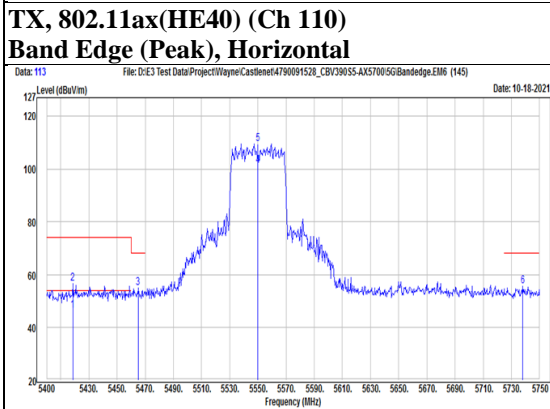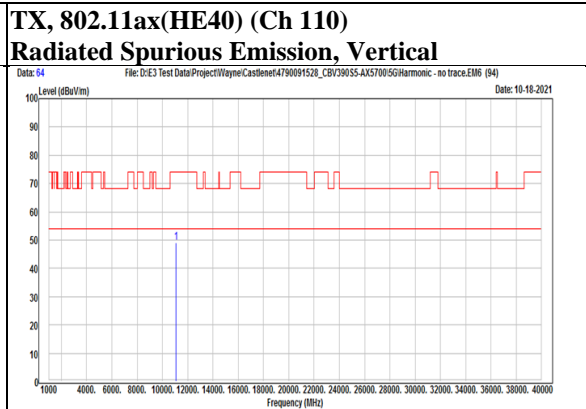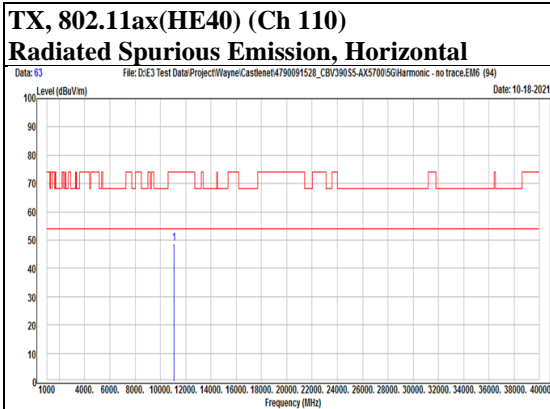

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000





Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ax(HE40)	Channel	134
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5670	96.18	14.02	110.2	N/A	N/A	PK
	@	5670	87.58	14.02	101.6	N/A	N/A	AVG
	*	5729.35	45.11	14.2	59.31	68.2	-8.89	PK
Vertical	*	11340	30.02	18.55	48.57	74	-25.43	PK
	@	5670	94.77	14.02	108.79	N/A	N/A	PK
	@	5670	86.5	14.02	100.52	N/A	N/A	AVG
	*	5749.65	41.98	14.31	56.29	68.2	-11.91	PK
	*	11340	30.94	18.55	49.49	74	-24.51	PK

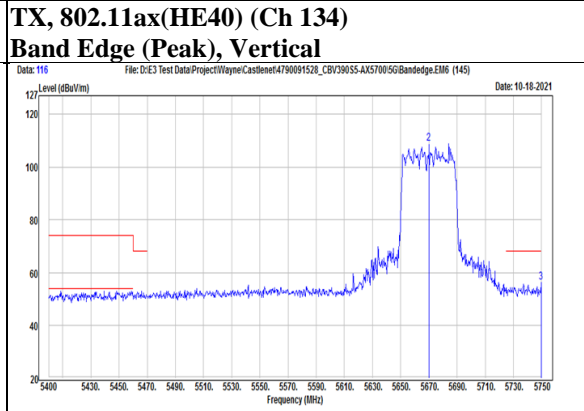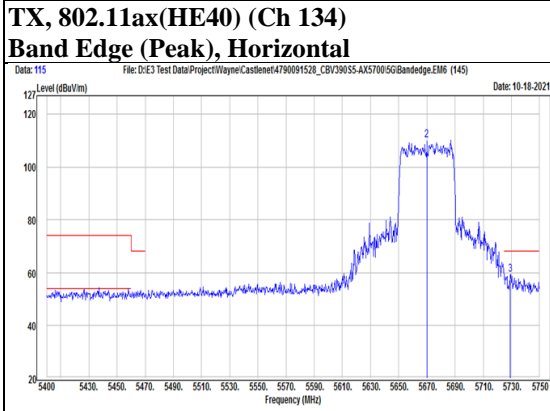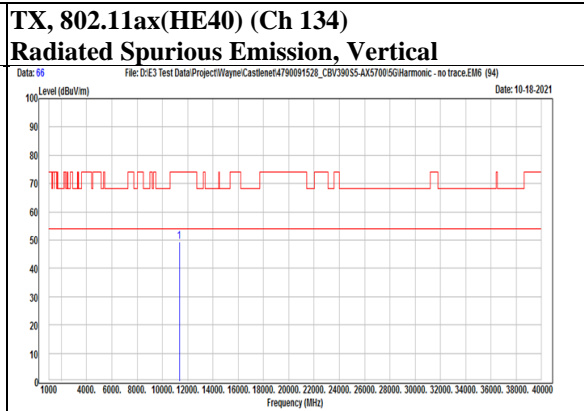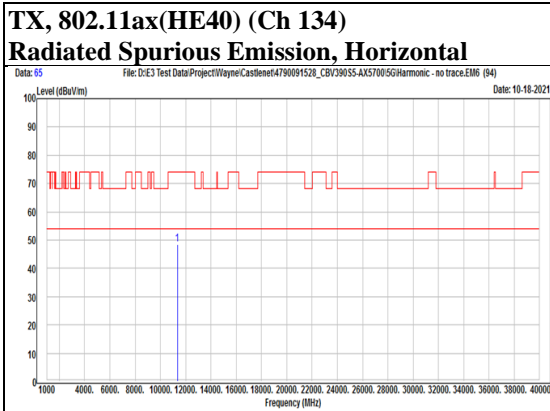

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ax(HE40)	Channel	142
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11420	29.83	18.8	48.63	74	-25.37	PK
Vertical	*	11420	30.22	18.8	49.02	74	-24.98	PK

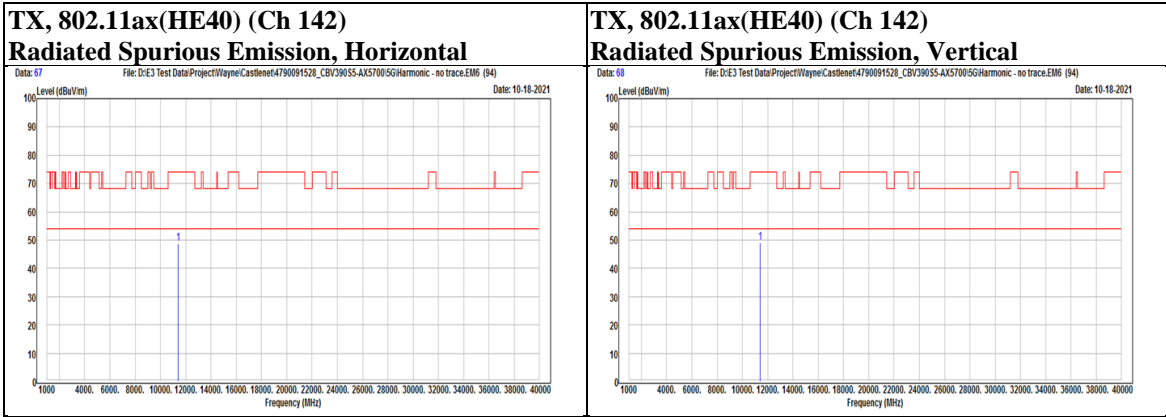

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan





Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Mode	802.11ax(HE40)	Channel	151
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5649	51.62	14	65.62	68.2	-2.58	PK
		5699	68.4	14.05	82.45	104.46	-22.01	PK
		5755	102.12	14.33	116.45	N/A	N/A	PK
		11510	47.25	19.03	66.28	74	-7.72	PK
		11510	33.08	19.03	52.11	54	-1.89	AVG
Vertical	@	5647	45.44	14.01	59.45	68.2	-8.75	PK
		5700	58.75	14.05	72.8	105.2	-32.4	PK
		5755	100.56	14.33	114.89	N/A	N/A	PK
		11510	41.73	19.03	60.76	74	-13.24	PK
		11510	30.84	19.03	49.87	54	-4.13	AVG

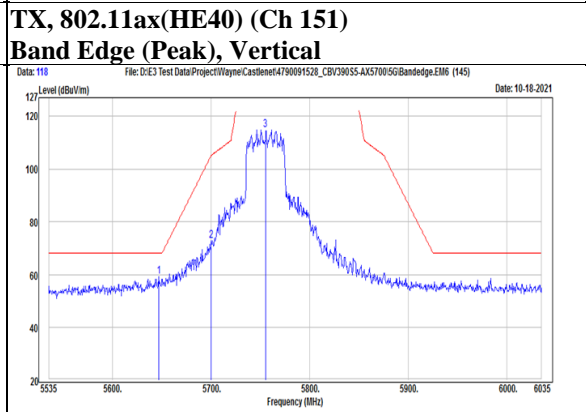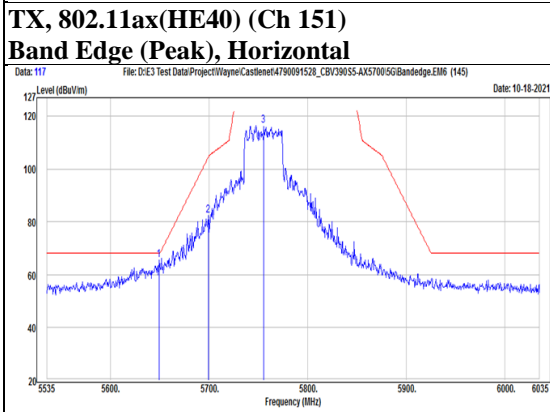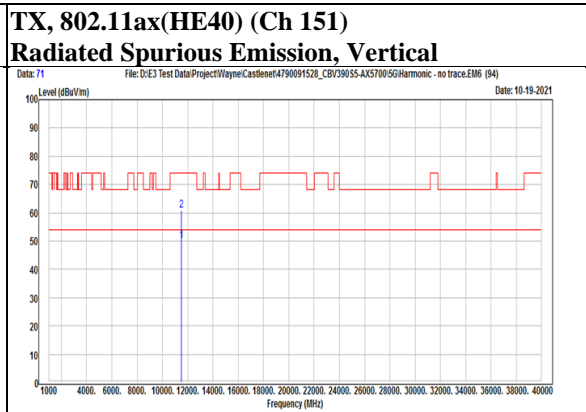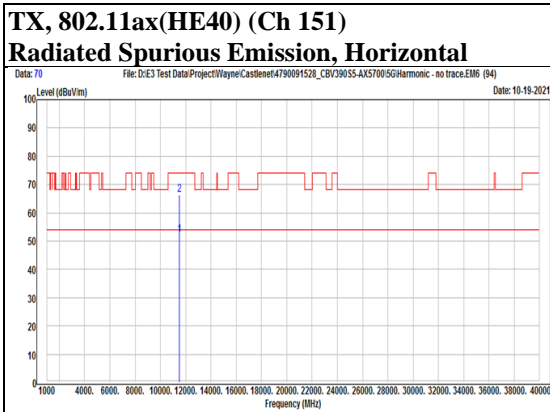

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan





Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ax(HE40)	Channel	159
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5795	102.45	14.53	116.98	N/A	N/A	PK
		5875	56.43	14.89	71.32	105.2	-33.88	PK
		5936	46.93	15	61.93	68.2	-6.27	PK
		11590	47.61	18.84	66.45	74	-7.55	PK
		11590	34.29	18.84	53.13	54	-0.87	AVG
Vertical	@	5795	101.43	14.53	115.96	N/A	N/A	PK
		5879	53.27	14.9	68.17	102.23	-34.06	PK
		5948.5	43.59	15.02	58.61	68.2	-9.59	PK
		11590	40.76	18.84	59.6	74	-14.4	PK
		11590	29.45	18.84	48.29	54	-5.71	AVG

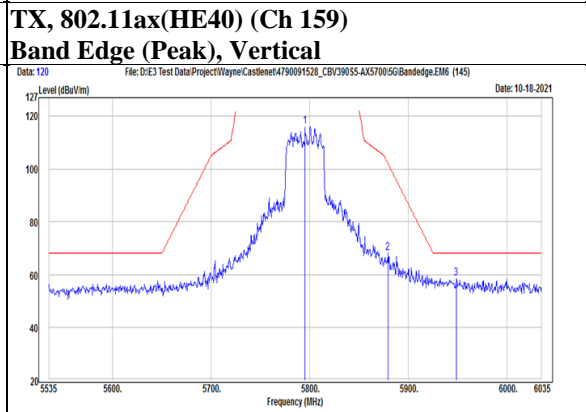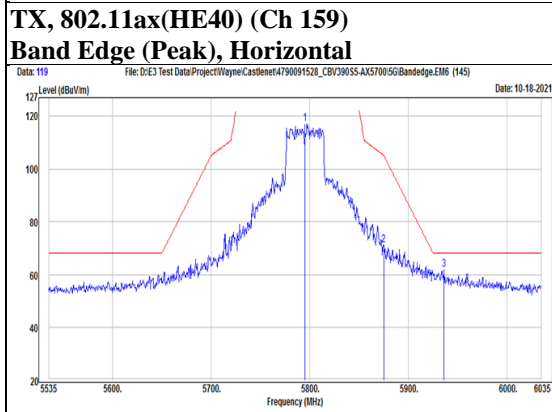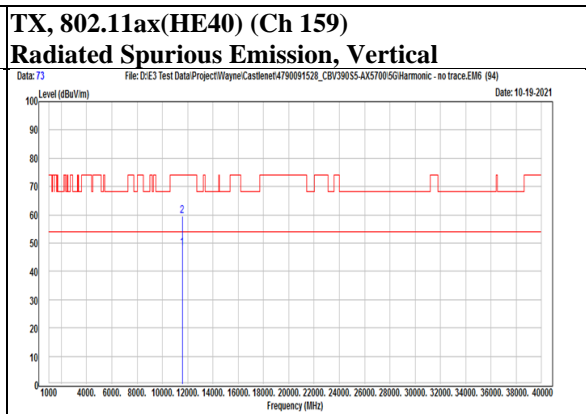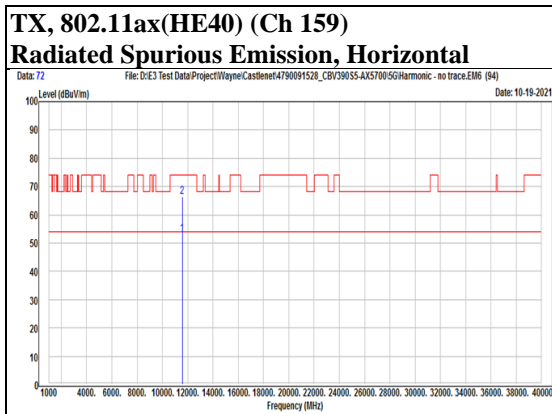

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790091528-US-R1-V0
Page : 121 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11ax(HE80)	Channel	42
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5117.25	48.89	13.46	62.35	74	-11.65	PK
		5147	39.57	13.43	53	54	-1	AVG
	@	5210	91.51	13.36	104.87	N/A	N/A	PK
	@	5210	83.29	13.36	96.65	N/A	N/A	AVG
	*	10420	30.61	17.6	48.21	68.2	-19.99	PK
Vertical		5036.4	43.02	13.15	56.17	74	-17.83	PK
		5148.75	32.32	13.42	45.74	54	-8.26	AVG
	@	5210	89.01	13.36	102.37	N/A	N/A	PK
	@	5210	78.61	13.36	91.97	N/A	N/A	AVG
	*	10420	31.29	17.6	48.89	68.2	-19.31	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

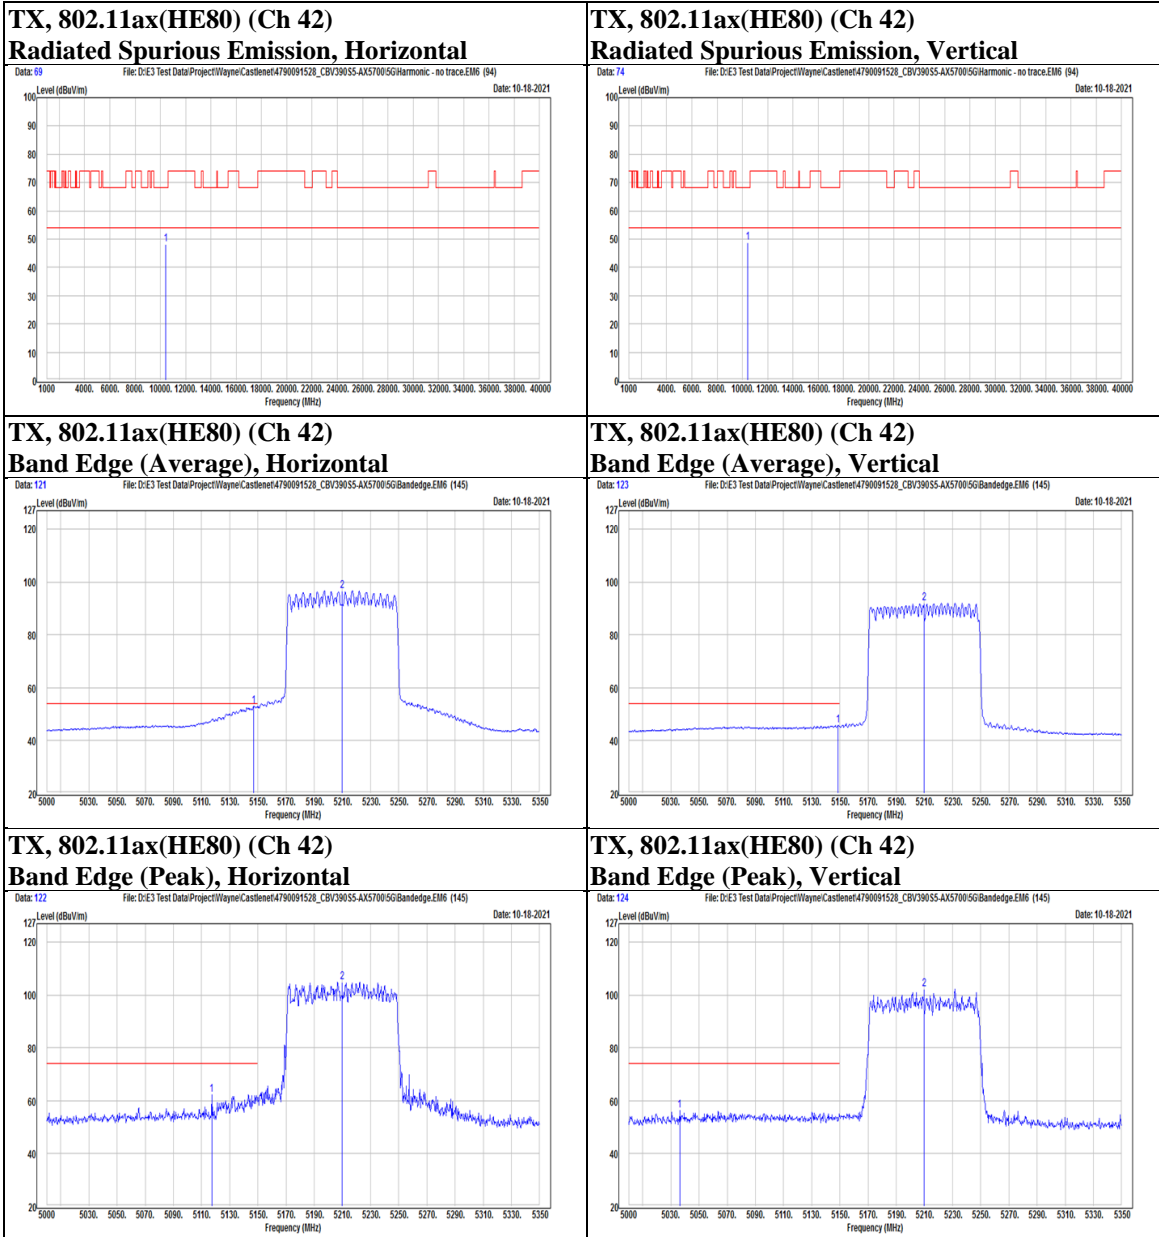



Test report No. : 4790091528-US-R1-V0
Page : 123 of 141
Issued date : 2022/3/22
FCC ID : RK9-CBV390S5

Mode	802.11ax(HE80)	Channel	58
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5290	94.2	13.21	107.41	N/A	N/A	PK
	@	5290	83.48	13.21	96.69	N/A	N/A	AVG
		5352.3	40.51	13.26	53.77	54	-0.23	AVG
		5369.7	48.76	13.33	62.09	74	-11.91	PK
	*	10580	30.12	17.73	47.85	68.2	-20.35	PK
Vertical	@	5290	89.65	13.21	102.86	N/A	N/A	PK
	@	5290	81.36	13.21	94.57	N/A	N/A	AVG
		5352	33.98	13.26	47.24	54	-6.76	AVG
		5365.5	44.45	13.31	57.76	74	-16.24	PK
	*	10580	31.56	17.73	49.29	68.2	-18.91	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948





Doc No: 17-EM-F0878 / 6.0

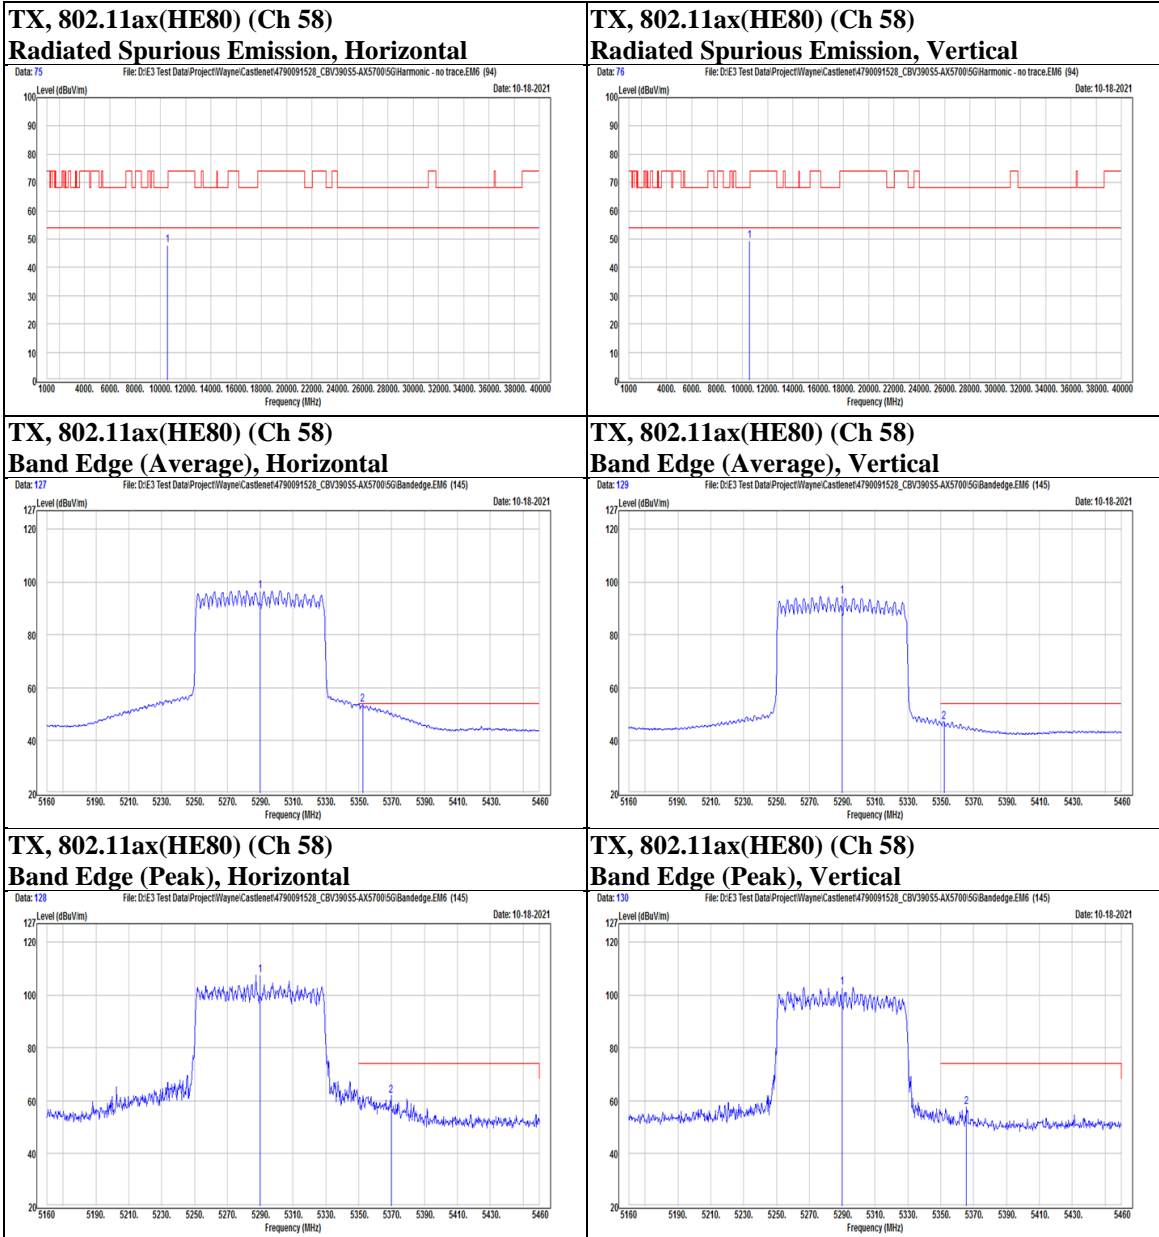



Mode	802.11ax(HE80)	Channel	106
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5457.75	48.8	13.7	62.5	74	-11.5	PK
		5457.75	39.16	13.7	52.86	54	-1.14	AVG
		5465.45	51.24	13.72	64.96	68.2	-3.24	PK
	@	5530	90.48	13.87	104.35	N/A	N/A	PK
	@	5530	82.11	13.87	95.98	N/A	N/A	AVG
Vertical	*	11060	29.98	18.41	48.39	74	-25.61	PK
		5459.5	41.52	13.7	55.22	74	-18.78	PK
		5459.5	33.98	13.7	47.68	54	-6.32	AVG
		5466.5	44.43	13.72	58.15	68.2	-10.05	PK
	@	5530	87.7	13.87	101.57	N/A	N/A	PK
	@	5530	80.73	13.87	94.6	N/A	N/A	AVG
	*	11060	30.66	18.41	49.07	74	-24.93	PK

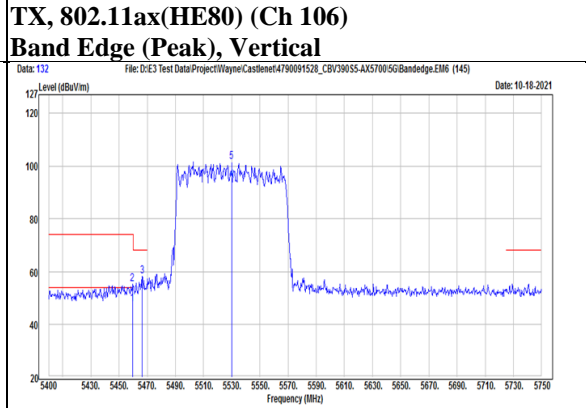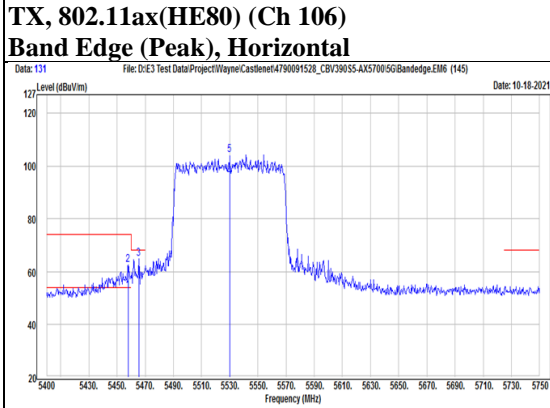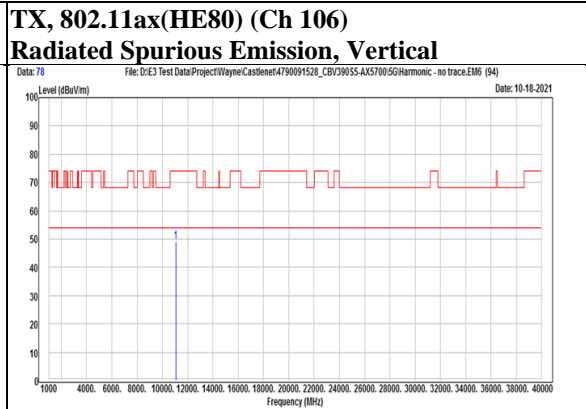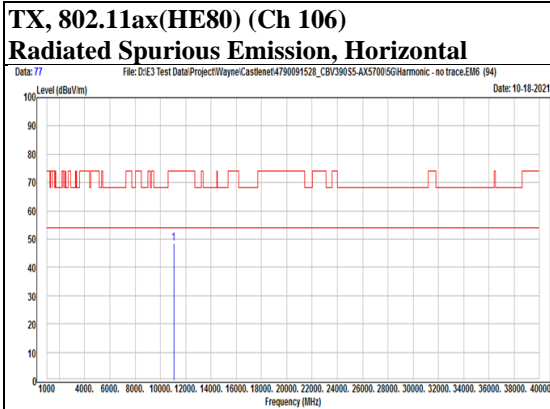

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ax(HE80)	Channel	122
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5445.5	44.51	13.65	58.16	74	-15.84	PK
		5445.5	37	13.65	50.65	54	-3.35	AVG
		5462.3	48.67	13.71	62.38	68.2	-5.82	PK
	@	5610	94.83	14.03	108.86	N/A	N/A	PK
	@	5610	87.35	14.03	101.38	N/A	N/A	AVG
		5726.55	51.43	14.19	65.62	68.2	-2.58	PK
Vertical	*	11220	29.88	18.25	48.13	74	-25.87	PK
		5447.6	43.66	13.66	57.32	74	-16.68	PK
		5447.6	37.05	13.66	50.71	54	-3.29	AVG
		5466.85	42.04	13.72	55.76	68.2	-12.44	PK
	@	5610	92.62	14.03	106.65	N/A	N/A	PK
	@	5610	85.68	14.03	99.71	N/A	N/A	AVG
	5726.2	43.12	14.18	57.3	68.2	-10.9	PK	
	*	11220	30.4	18.25	48.65	74	-25.35	PK

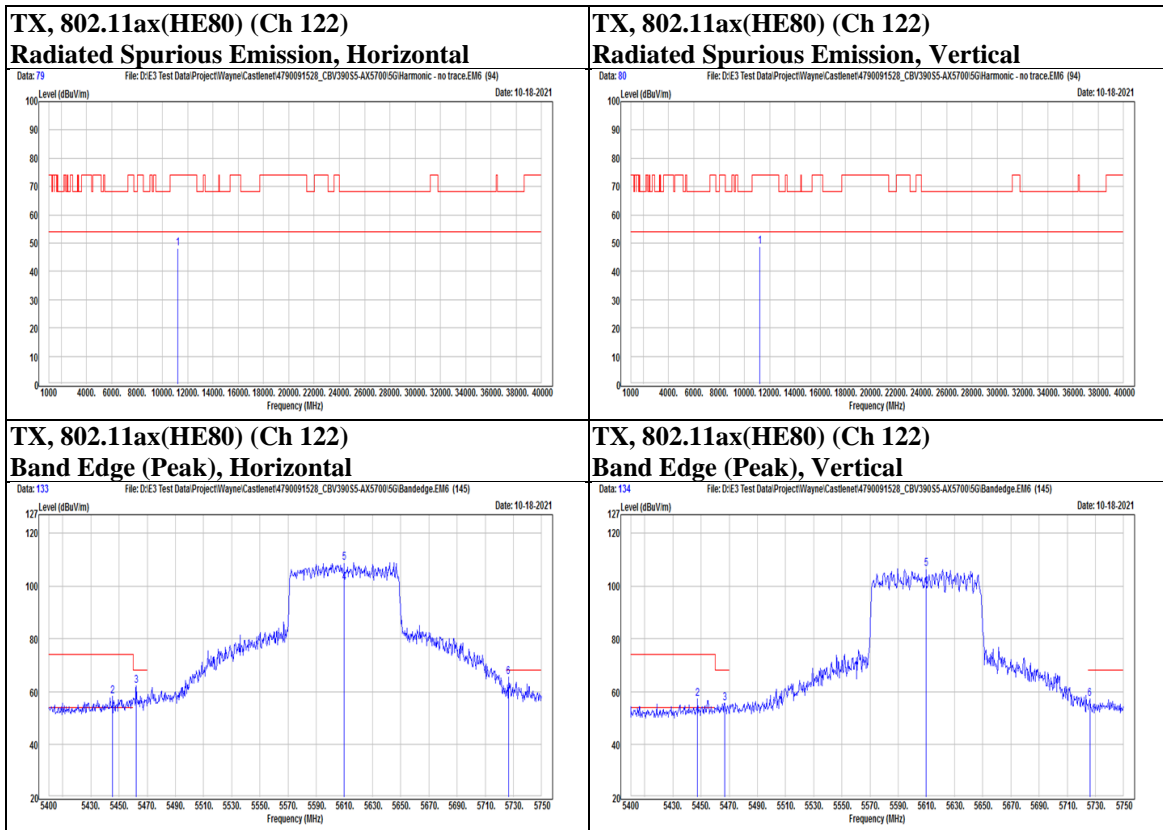

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ax(HE80)	Channel	138
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11380	30	18.67	48.67	74	-25.33	PK
Vertical	*	11380	30.25	18.67	48.92	74	-25.08	PK

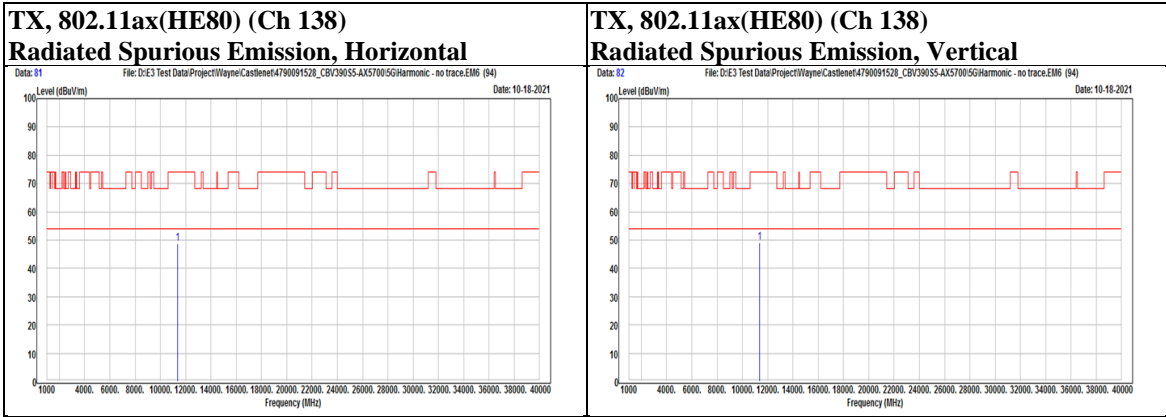

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan





Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Mode	802.11ax(HE80)	Channel	155
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5647.5	53.28	14.01	67.29	68.2	-0.91	PK
		5699	69.92	14.05	83.97	104.46	-20.49	PK
	@	5775	97.62	14.44	112.06	N/A	N/A	PK
		5876.5	62.36	14.89	77.25	104.09	-26.84	PK
		5928.5	50.97	14.99	65.96	68.2	-2.24	PK
		11550	42.88	18.93	61.81	74	-12.19	PK
		11550	30.15	18.93	49.08	54	-4.92	AVG
Vertical		5648.5	45.91	14	59.91	68.2	-8.29	PK
		5698	62.59	14.05	76.64	103.73	-27.09	PK
	@	5775	96.63	14.44	111.07	N/A	N/A	PK
		5880	53.12	14.91	68.03	101.49	-33.46	PK
		5925	48.33	14.99	63.32	68.2	-4.88	PK
		11550	37.81	18.93	56.74	74	-17.26	PK
		11550	26.24	18.93	45.17	54	-8.83	AVG

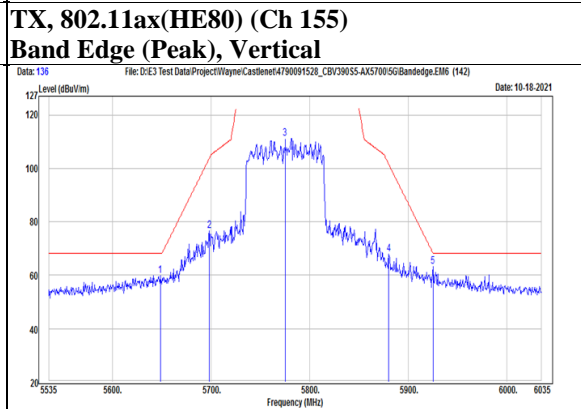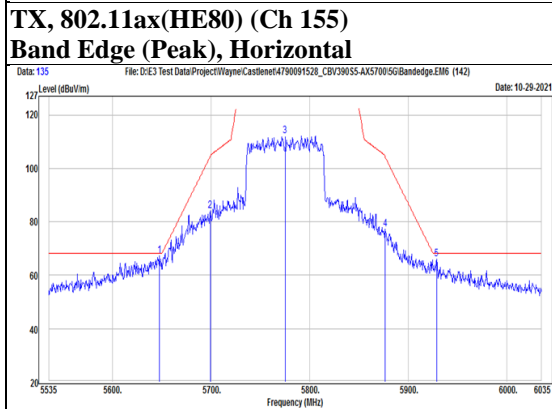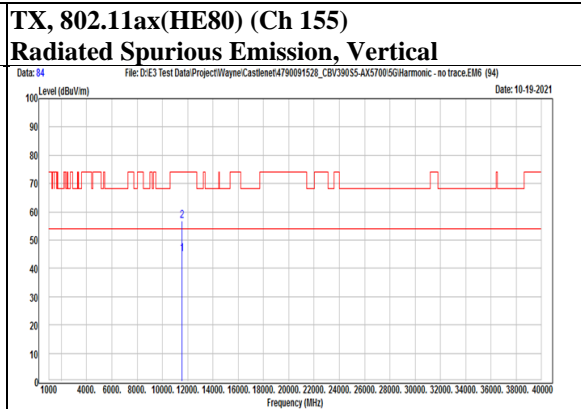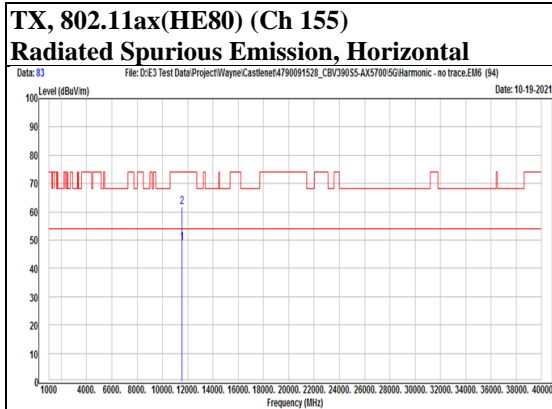

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ax(HE160)	Channel	50
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5127.88	53.36	13.43	66.79	74	-7.21	PK
		5147.2	39.44	13.43	52.87	54	-1.13	AVG
	@	5250	89.56	13.24	102.8	N/A	N/A	PK
	@	5250	80.78	13.24	94.02	N/A	N/A	AVG
		5350	39.59	13.26	52.85	54	-1.15	AVG
		5394.68	49.81	13.4	63.21	74	-10.79	PK
Vertical	*	10500	30.95	17.72	48.67	68.2	-19.53	PK
		5138.92	43.46	13.43	56.89	74	-17.11	PK
		5144.44	32.71	13.43	46.14	54	-7.86	AVG
	@	5250	86.64	13.24	99.88	N/A	N/A	PK
	@	5250	77.81	13.24	91.05	N/A	N/A	AVG
		5351.9	31.91	13.26	45.17	54	-8.83	AVG
	5372.6	42.95	13.34	56.29	74	-17.71	PK	
	*	10500	31.24	17.72	48.96	68.2	-19.24	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0