

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 263 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	229
------	---------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	7095	109.27	-11.74	97.53	N/A	N/A	PK
	@	7095	101.42	-11.74	89.68	N/A	N/A	AVG
		7125	62.35	-11.74	50.61	88.2	-37.59	PK
		7218	51.63	-11.74	39.89	68.2	-28.31	AVG
		14190	58.28	-11.74	46.54	88.2	-41.66	PK
		14190	52.56	-11.74	40.82	68.2	-27.38	AVG
Chain 1	@	7095	108.46	-11.74	96.72	N/A	N/A	PK
	@	7095	99.73	-11.74	87.99	N/A	N/A	AVG
		7211	51.6	-11.74	39.86	68.2	-28.34	AVG
		7216.6	64.15	-11.74	52.41	88.2	-35.79	PK
		14190	59.24	-11.74	47.5	88.2	-40.7	PK
		14190	52.01	-11.74	40.27	68.2	-27.93	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

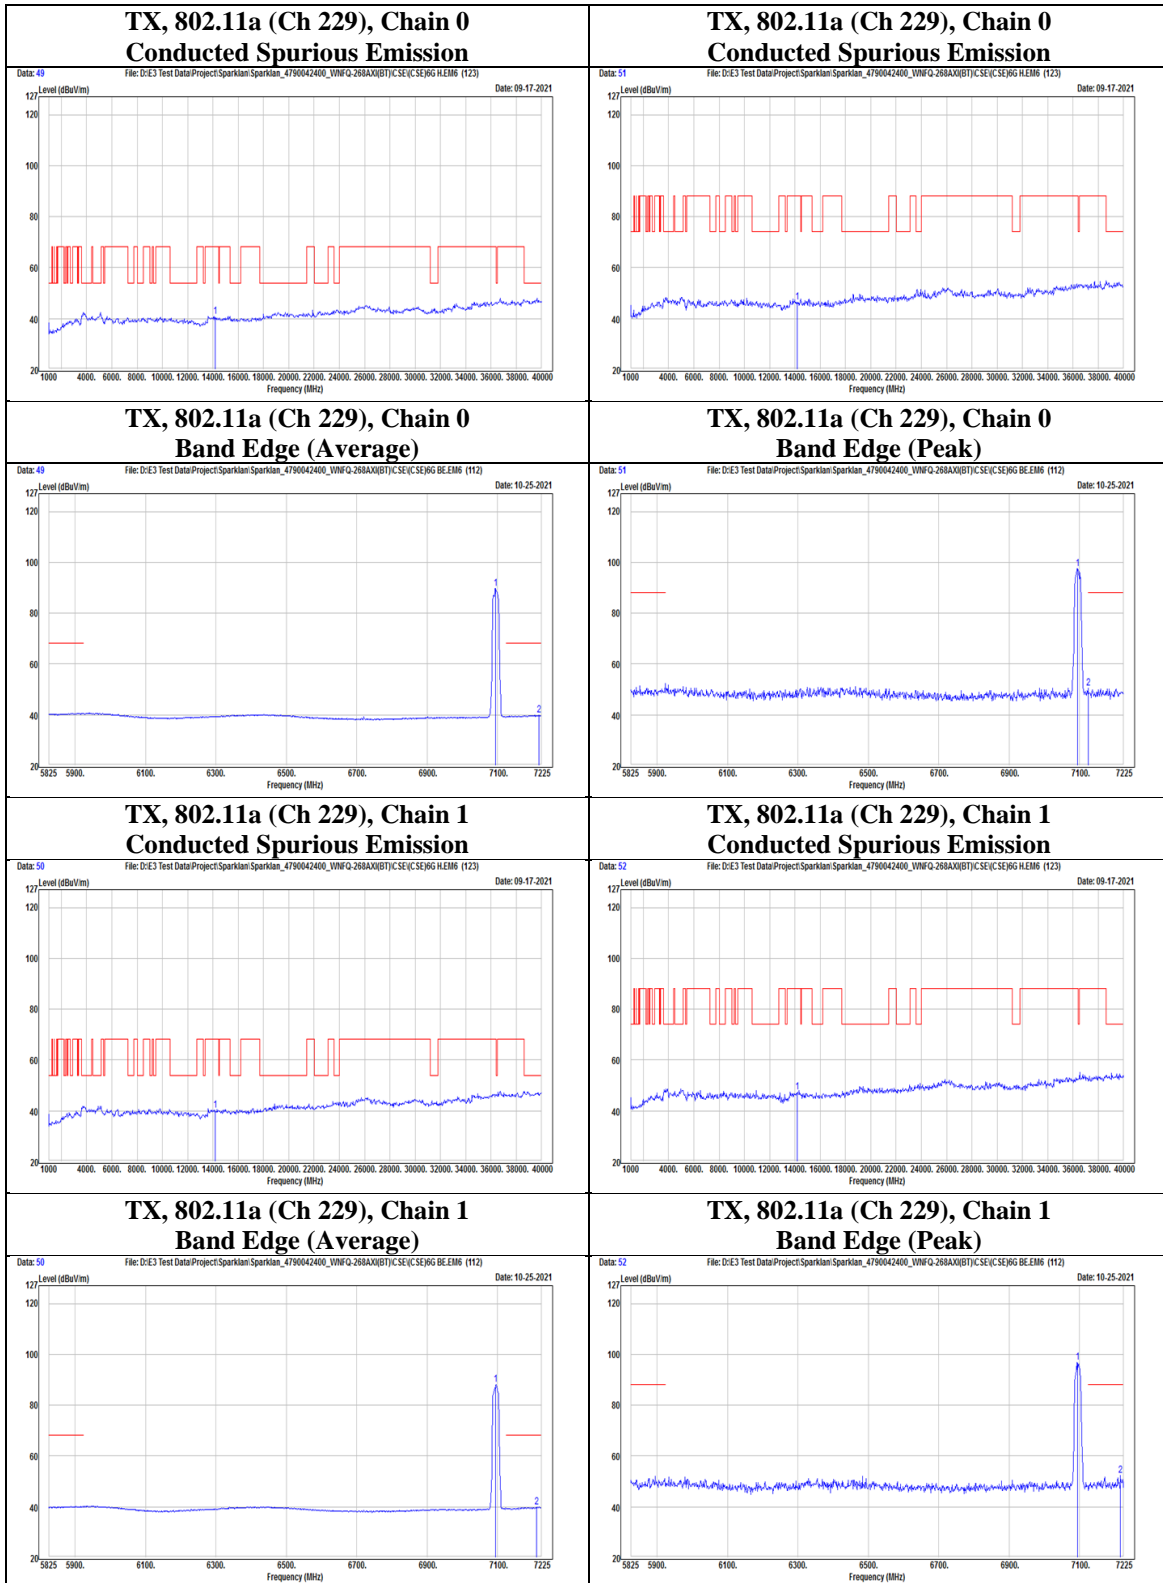

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 265 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11a	Channel	233
------	---------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	7115	111.12	-11.74	99.38	N/A	N/A	PK
	@	7115	101.83	-11.74	90.09	N/A	N/A	AVG
		7125	84.72	-11.74	72.98	88.2	-15.22	PK
		7125.6	71.77	-11.74	60.03	68.2	-8.17	AVG
		14230	58.75	-11.74	47.01	88.2	-41.19	PK
		14230	52.47	-11.74	40.73	68.2	-27.47	AVG
Chain 1	@	7115	108.7	-11.74	96.96	N/A	N/A	PK
	@	7115	100.18	-11.74	88.44	N/A	N/A	AVG
		7125	86.25	-11.74	74.51	88.2	-13.69	PK
		7125	66.68	-11.74	54.94	68.2	-13.26	AVG
		14230	57.93	-11.74	46.19	88.2	-42.01	PK
		14230	52.27	-11.74	40.53	68.2	-27.67	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

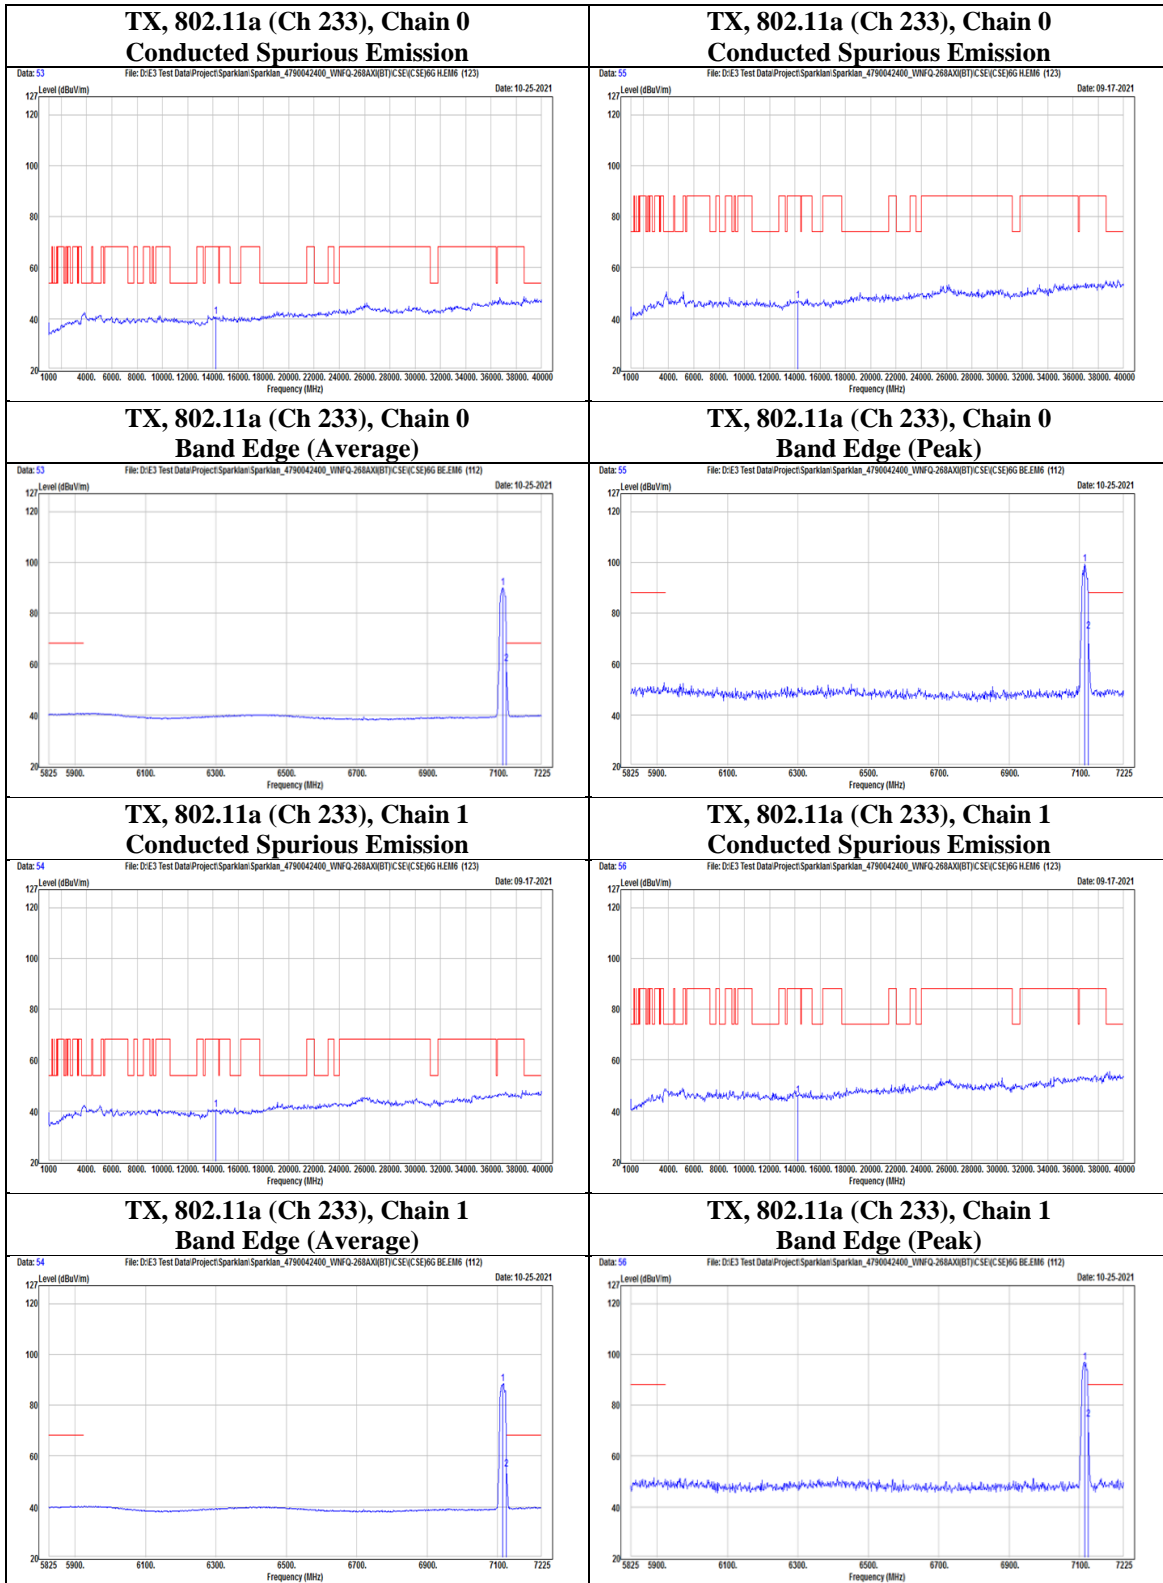

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 267 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE20)	Channel	2
------	----------------	---------	---

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5924.4	86.23	-11.74	74.49	88.2	-13.71	PK
		5924.4	71.85	-11.74	60.11	68.2	-8.09	AVG
	@	5935	111.57	-11.74	99.83	N/A	N/A	PK
	@	5935	102.25	-11.74	90.51	N/A	N/A	AVG
		11870	58.28	-11.74	46.54	74	-27.46	PK
		11870	50.68	-11.74	38.94	54	-15.06	AVG
Chain 1		5924.4	82.13	-11.74	70.39	88.2	-17.81	PK
		5924.4	70.18	-11.74	58.44	68.2	-9.76	AVG
	@	5935	110.03	-11.74	98.29	N/A	N/A	PK
	@	5935	99.26	-11.74	87.52	N/A	N/A	AVG
		11870	58.42	-11.74	46.68	74	-27.32	PK
		11870	51.59	-11.74	39.85	54	-14.15	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

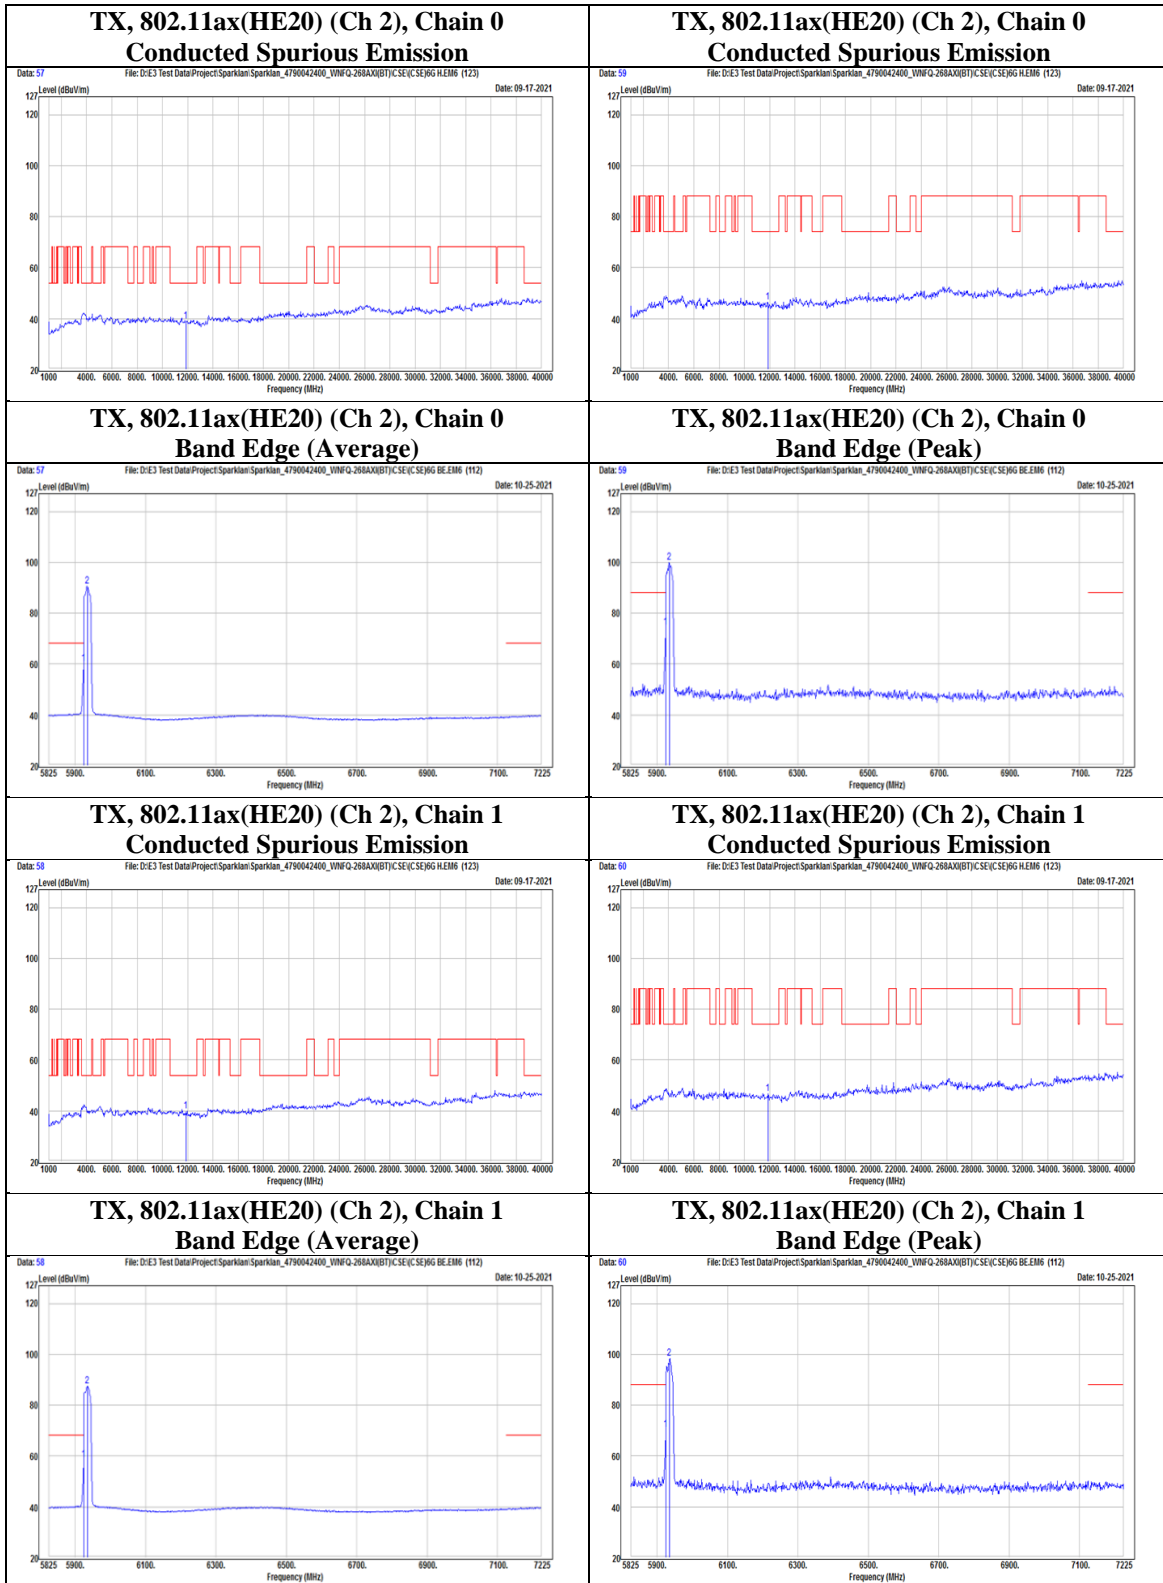

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 269 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE20)	Channel	1
------	----------------	---------	---

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5917.4	62.65	-11.74	50.91	88.2	-37.29	PK
		5924.4	52.05	-11.74	40.31	68.2	-27.89	AVG
	@	5955	109.63	-11.74	97.89	N/A	N/A	PK
	@	5955	101.67	-11.74	89.93	N/A	N/A	AVG
		11910	57.1	-11.74	45.36	74	-28.64	PK
		11910	50.91	-11.74	39.17	54	-14.83	AVG
Chain 1		5892.2	63.96	-11.74	52.22	88.2	-35.98	PK
		5909	52.09	-11.74	40.35	68.2	-27.85	AVG
	@	5955	108.66	-11.74	96.92	N/A	N/A	PK
	@	5955	100.59	-11.74	88.85	N/A	N/A	AVG
		11910	57.73	-11.74	45.99	74	-28.01	PK
		11910	50.5	-11.74	38.76	54	-15.24	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

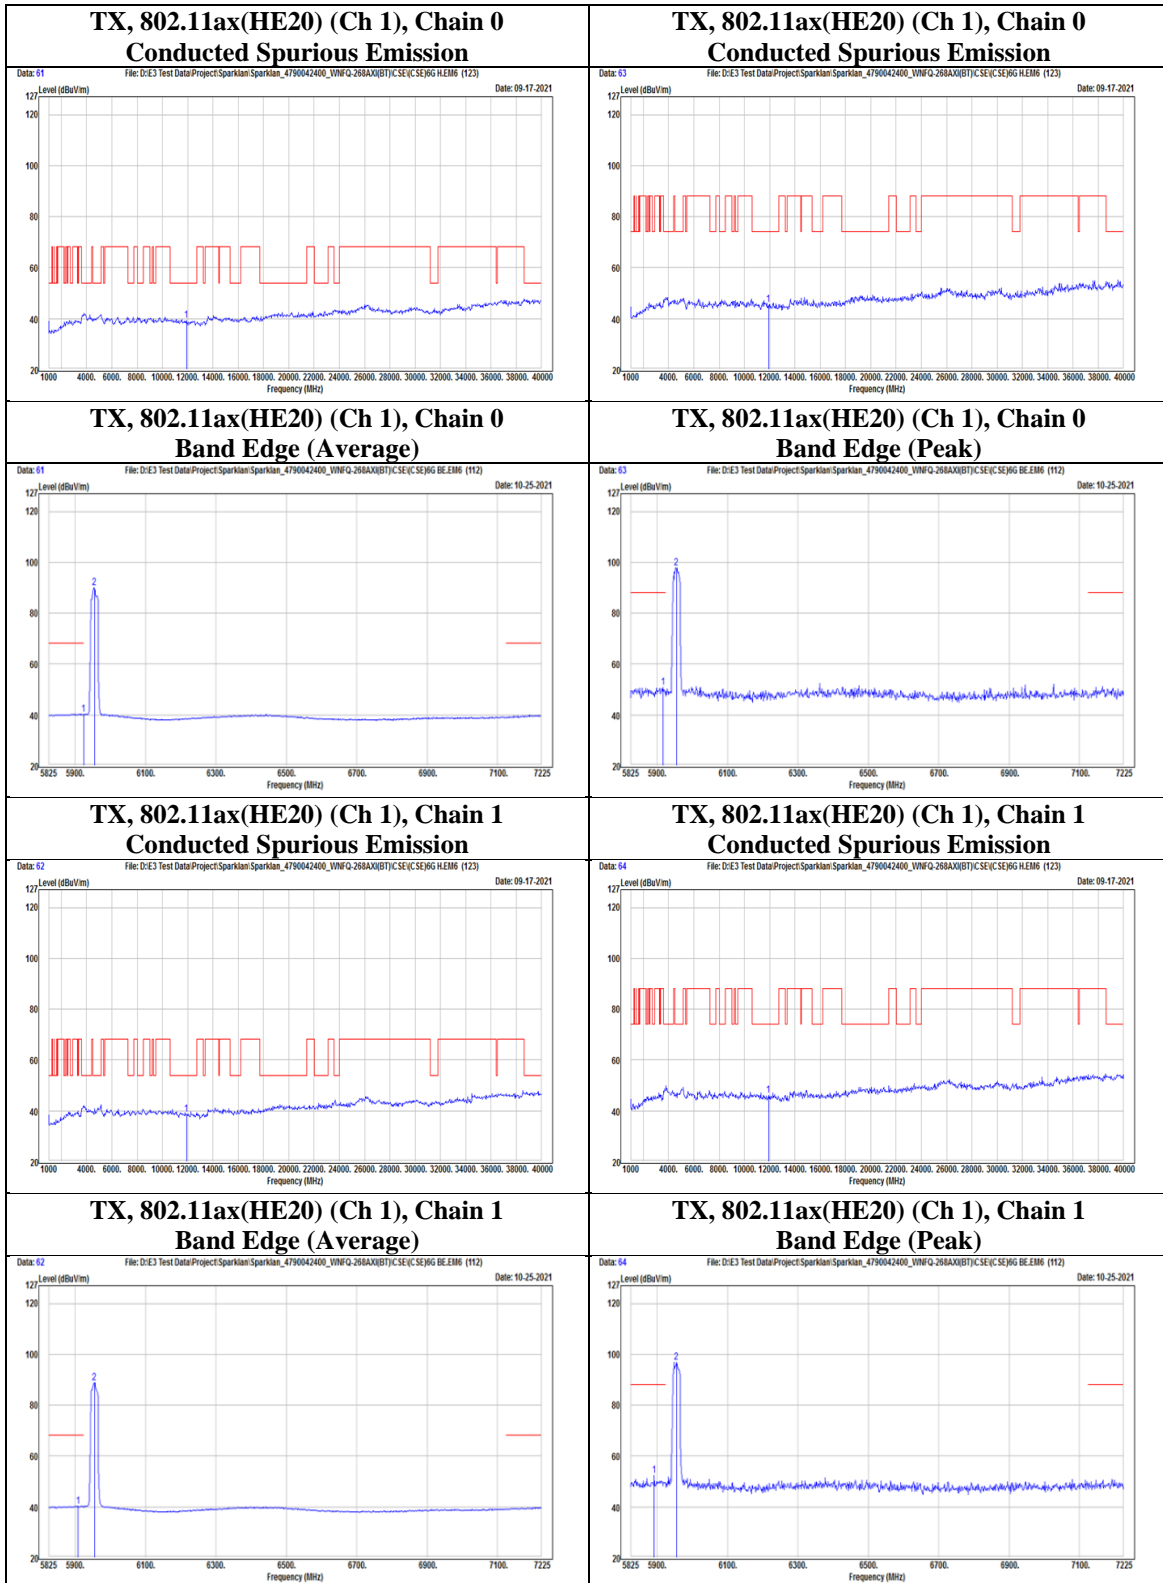



Test report No. : 4790042400-US-R2-V0
Page : 271 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE20)	Channel	45
------	----------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5899.2	52.13	-11.74	40.39	68.2	-27.81	AVG
		5917.4	63.12	-11.74	51.38	88.2	-36.82	PK
	@	6175	114.82	-11.74	103.08	N/A	N/A	PK
	@	6175	103.72	-11.74	91.98	N/A	N/A	AVG
		12350	57.96	-11.74	46.22	74	-27.78	PK
		12350	51.34	-11.74	39.6	54	-14.4	AVG
Chain 1		5855.8	64.35	-11.74	52.61	88.2	-35.59	PK
		5911.8	51.95	-11.74	40.21	68.2	-27.99	AVG
	@	6175	111.86	-11.74	100.12	N/A	N/A	PK
	@	6175	101.44	-11.74	89.7	N/A	N/A	AVG
		12350	57.54	-11.74	45.8	74	-28.2	PK
		12350	51.16	-11.74	39.42	54	-14.58	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

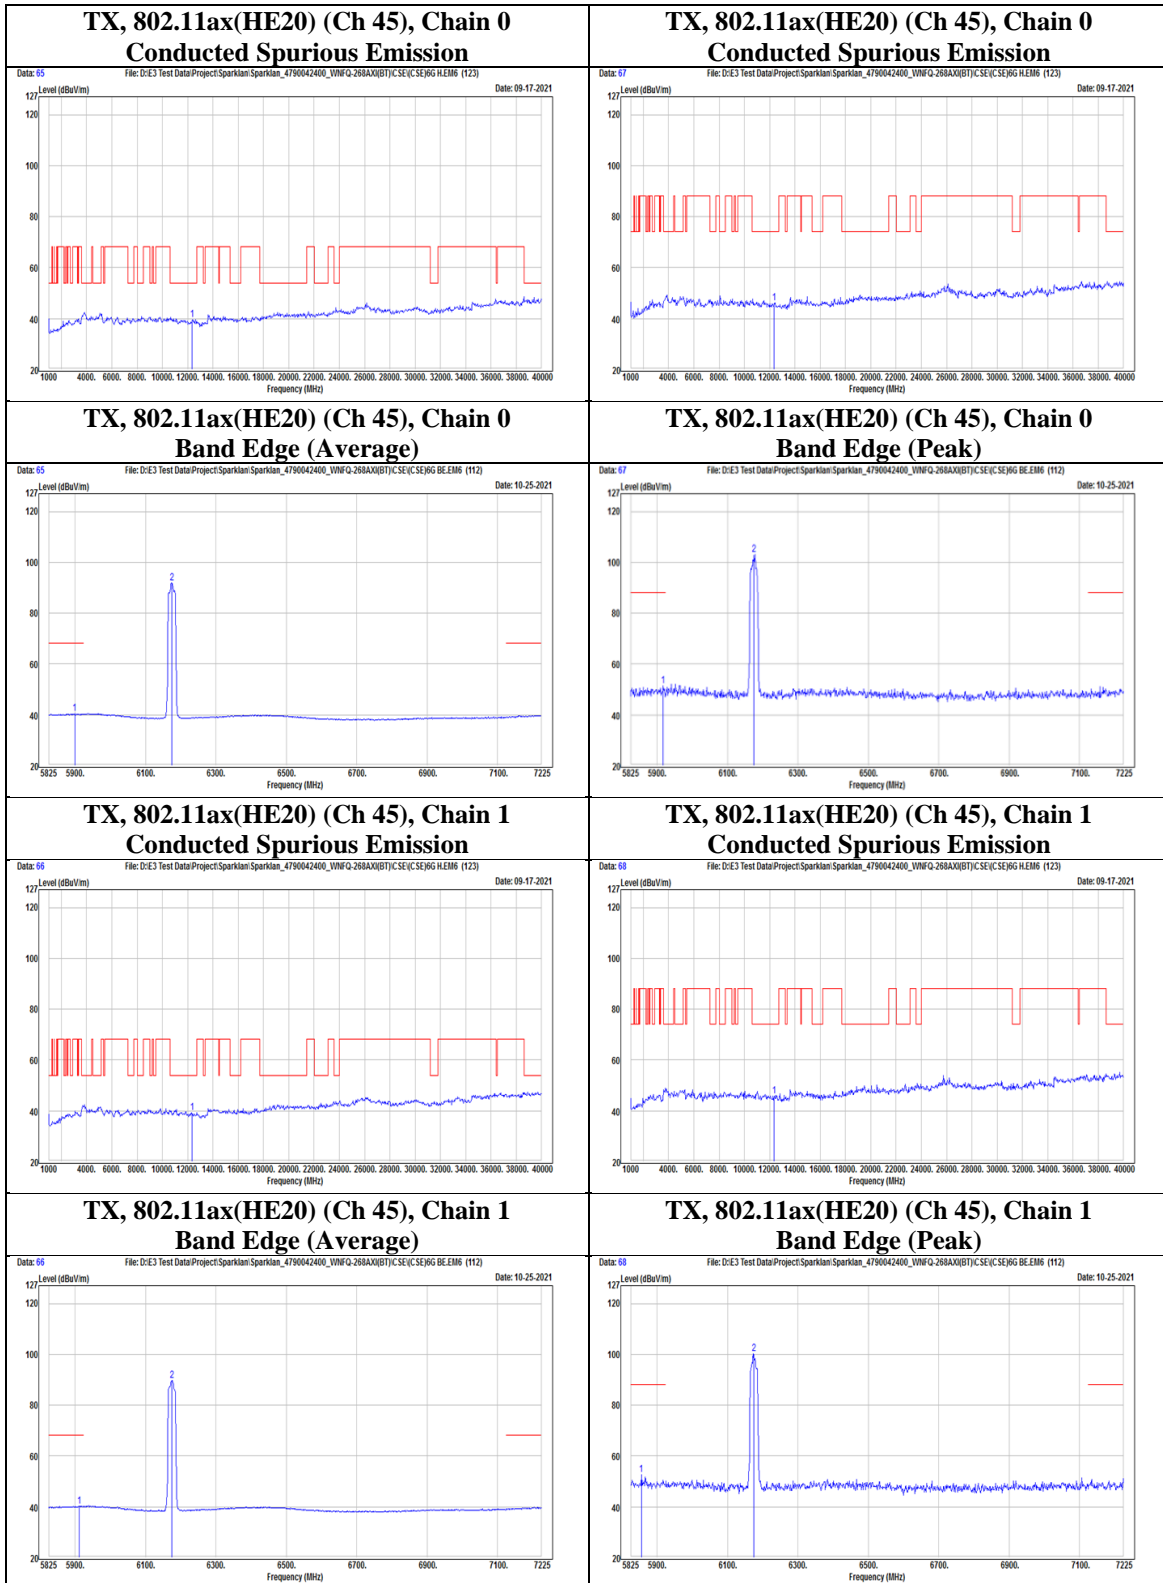



Mode	802.11ax(HE20)	Channel	93
------	----------------	---------	----


TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5878.2	63.45	-11.74	51.71	88.2	-36.49	PK
		5921.6	52.26	-11.74	40.52	68.2	-27.68	AVG
	@	6415	114.34	-11.74	102.6	N/A	N/A	PK
	@	6415	105.64	-11.74	93.9	N/A	N/A	AVG
		7159.2	62.38	-11.74	50.64	88.2	-37.56	PK
		7219.4	51.55	-11.74	39.81	68.2	-28.39	AVG
		12830	57.49	-11.74	45.75	88.2	-42.45	PK
		12830	50.37	-11.74	38.63	68.2	-29.57	AVG
Chain 1		5899.2	62.54	-11.74	50.8	88.2	-37.4	PK
		5920.2	51.97	-11.74	40.23	68.2	-27.97	AVG
	@	6415	110.53	-11.74	98.79	N/A	N/A	PK
	@	6415	100.98	-11.74	89.24	N/A	N/A	AVG
		7135.4	63.85	-11.74	52.11	88.2	-36.09	PK
		7209.6	51.46	-11.74	39.72	68.2	-28.48	AVG
		12830	57.84	-11.74	46.1	88.2	-42.1	PK
		12830	50.32	-11.74	38.58	68.2	-29.62	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

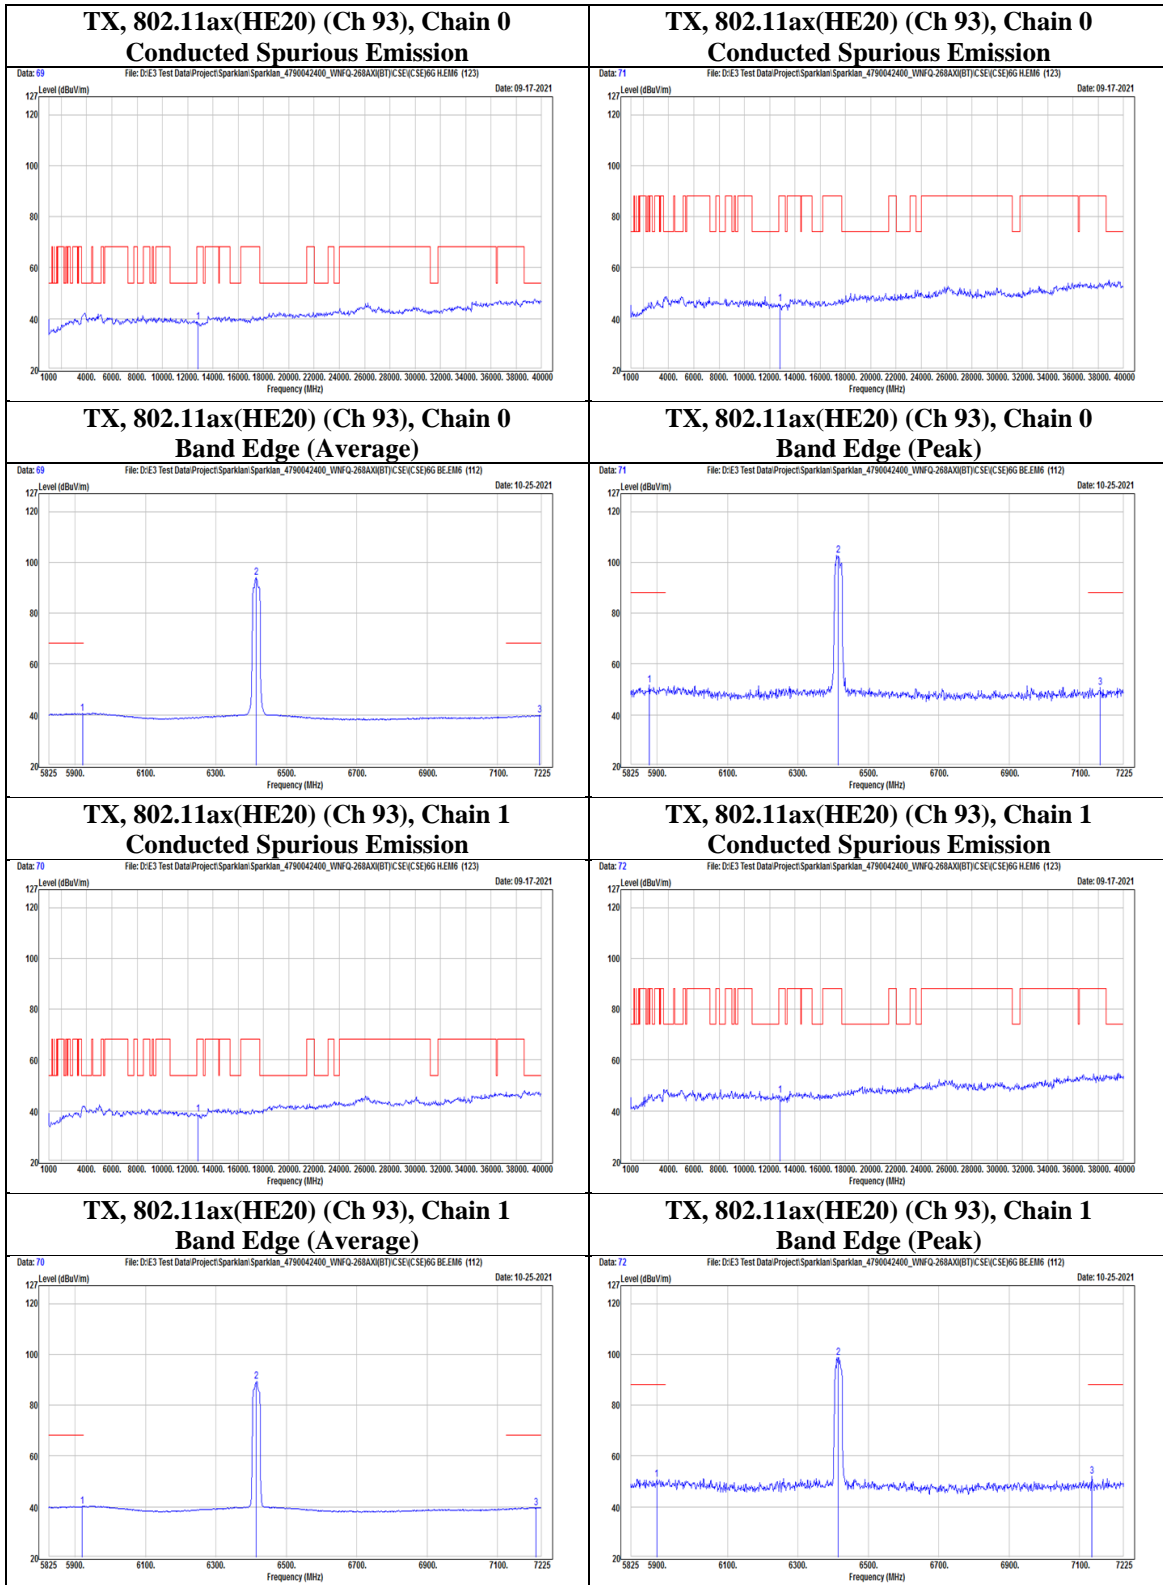

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ax(HE20)	Channel	97
------	----------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5871.2	64.83	-11.74	53.09	88.2	-35.11	PK
		5918.8	52.42	-11.74	40.68	68.2	-27.52	AVG
	@	6435	114.54	-11.74	102.8	N/A	N/A	PK
	@	6435	104.92	-11.74	93.18	N/A	N/A	AVG
		7187.2	62.72	-11.74	50.98	88.2	-37.22	PK
		7223.6	51.71	-11.74	39.97	68.2	-28.23	AVG
		12870	57.15	-11.74	45.41	88.2	-42.79	PK
		12870	50.99	-11.74	39.25	68.2	-28.95	AVG
Chain 1		5864.2	63.45	-11.74	51.71	88.2	-36.49	PK
		5923	52.01	-11.74	40.27	68.2	-27.93	AVG
	@	6435	112.99	-11.74	101.25	N/A	N/A	PK
	@	6435	101.91	-11.74	90.17	N/A	N/A	AVG
		7194.2	62.73	-11.74	50.99	88.2	-37.21	PK
		7212.4	51.55	-11.74	39.81	68.2	-28.39	AVG
		12870	57.14	-11.74	45.4	88.2	-42.8	PK
		12870	50.55	-11.74	38.81	68.2	-29.39	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

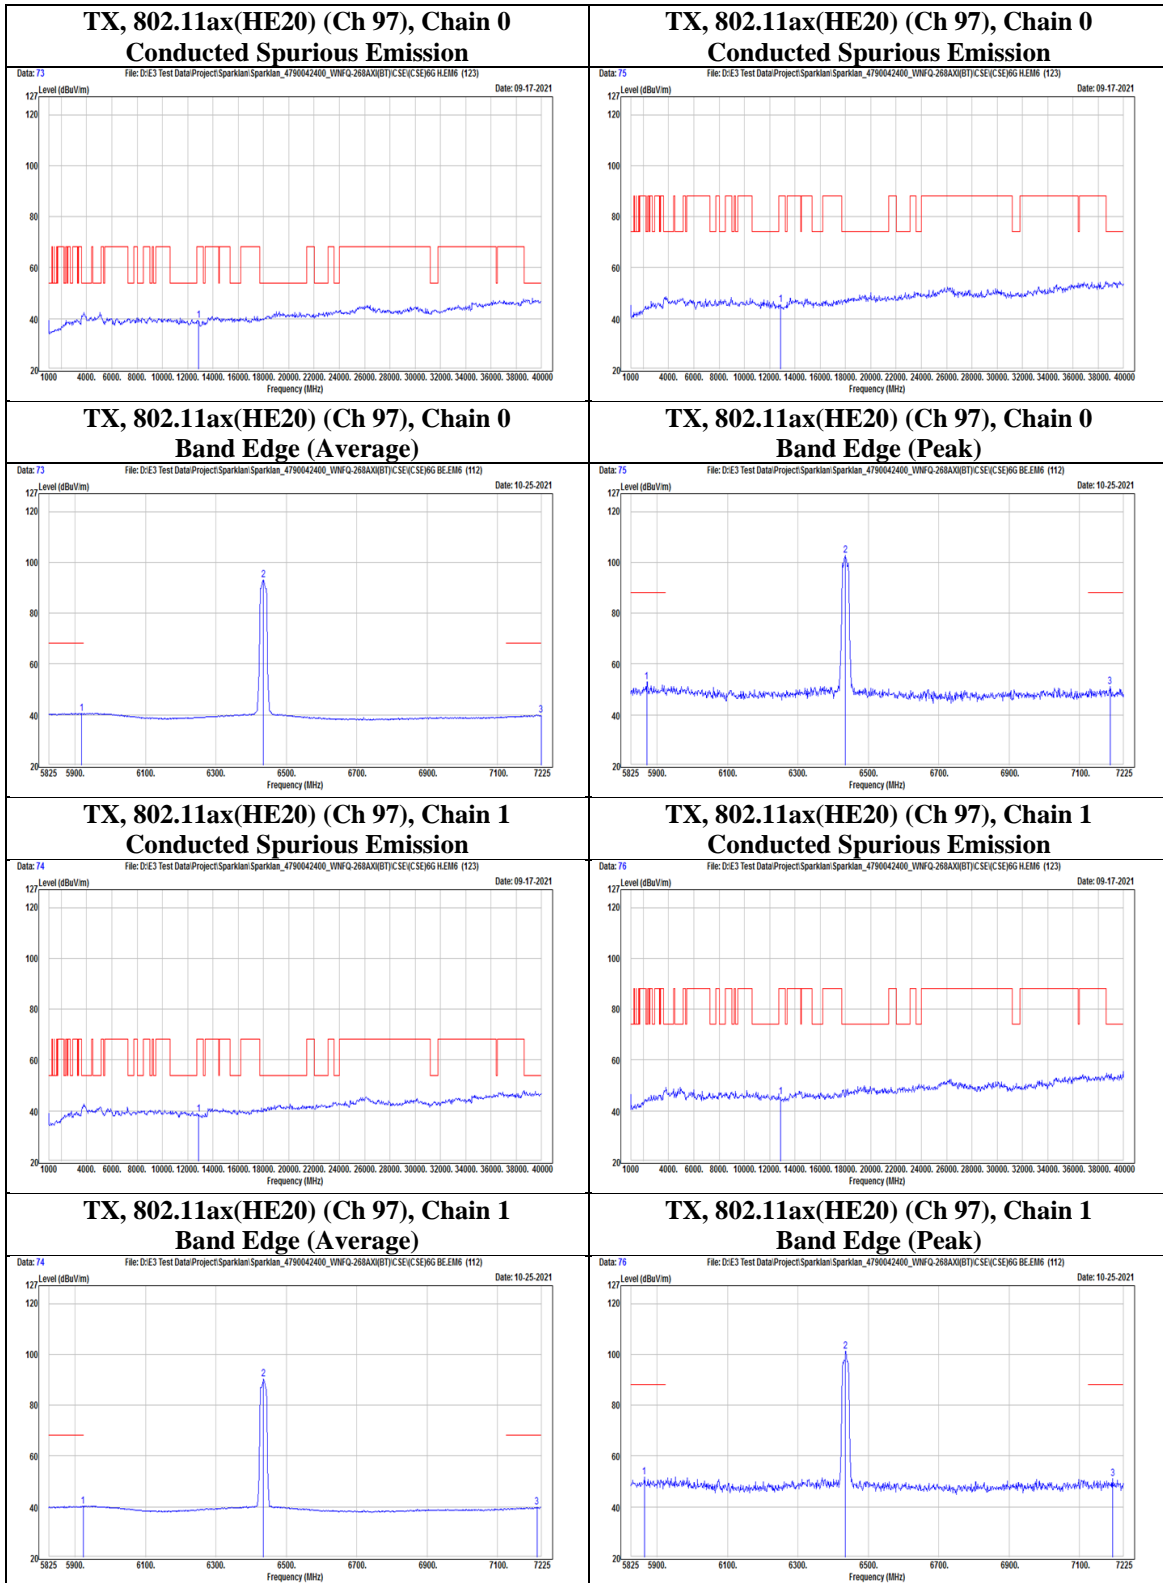

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 277 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE20)	Channel	105
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5910.4	63.55	-11.74	51.81	88.2	-36.39	PK
		5910.4	52.27	-11.74	40.53	68.2	-27.67	AVG
	@	6475	113.9	-11.74	102.16	N/A	N/A	PK
	@	6475	105.28	-11.74	93.54	N/A	N/A	AVG
		7199.8	51.51	-11.74	39.77	68.2	-28.43	AVG
		7209.6	62.19	-11.74	50.45	88.2	-37.75	PK
		12950	57.1	-11.74	45.36	88.2	-42.84	PK
		12950	50.39	-11.74	38.65	68.2	-29.55	AVG
Chain 1		5872.6	62.88	-11.74	51.14	88.2	-37.06	PK
		5924.4	52.04	-11.74	40.3	68.2	-27.9	AVG
	@	6475	112.13	-11.74	100.39	N/A	N/A	PK
	@	6475	102.54	-11.74	90.8	N/A	N/A	AVG
		7177.4	63.21	-11.74	51.47	88.2	-36.73	PK
		7184.4	51.51	-11.74	39.77	68.2	-28.43	AVG
		12950	56.87	-11.74	45.13	88.2	-43.07	PK
		12950	51.28	-11.74	39.54	68.2	-28.66	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

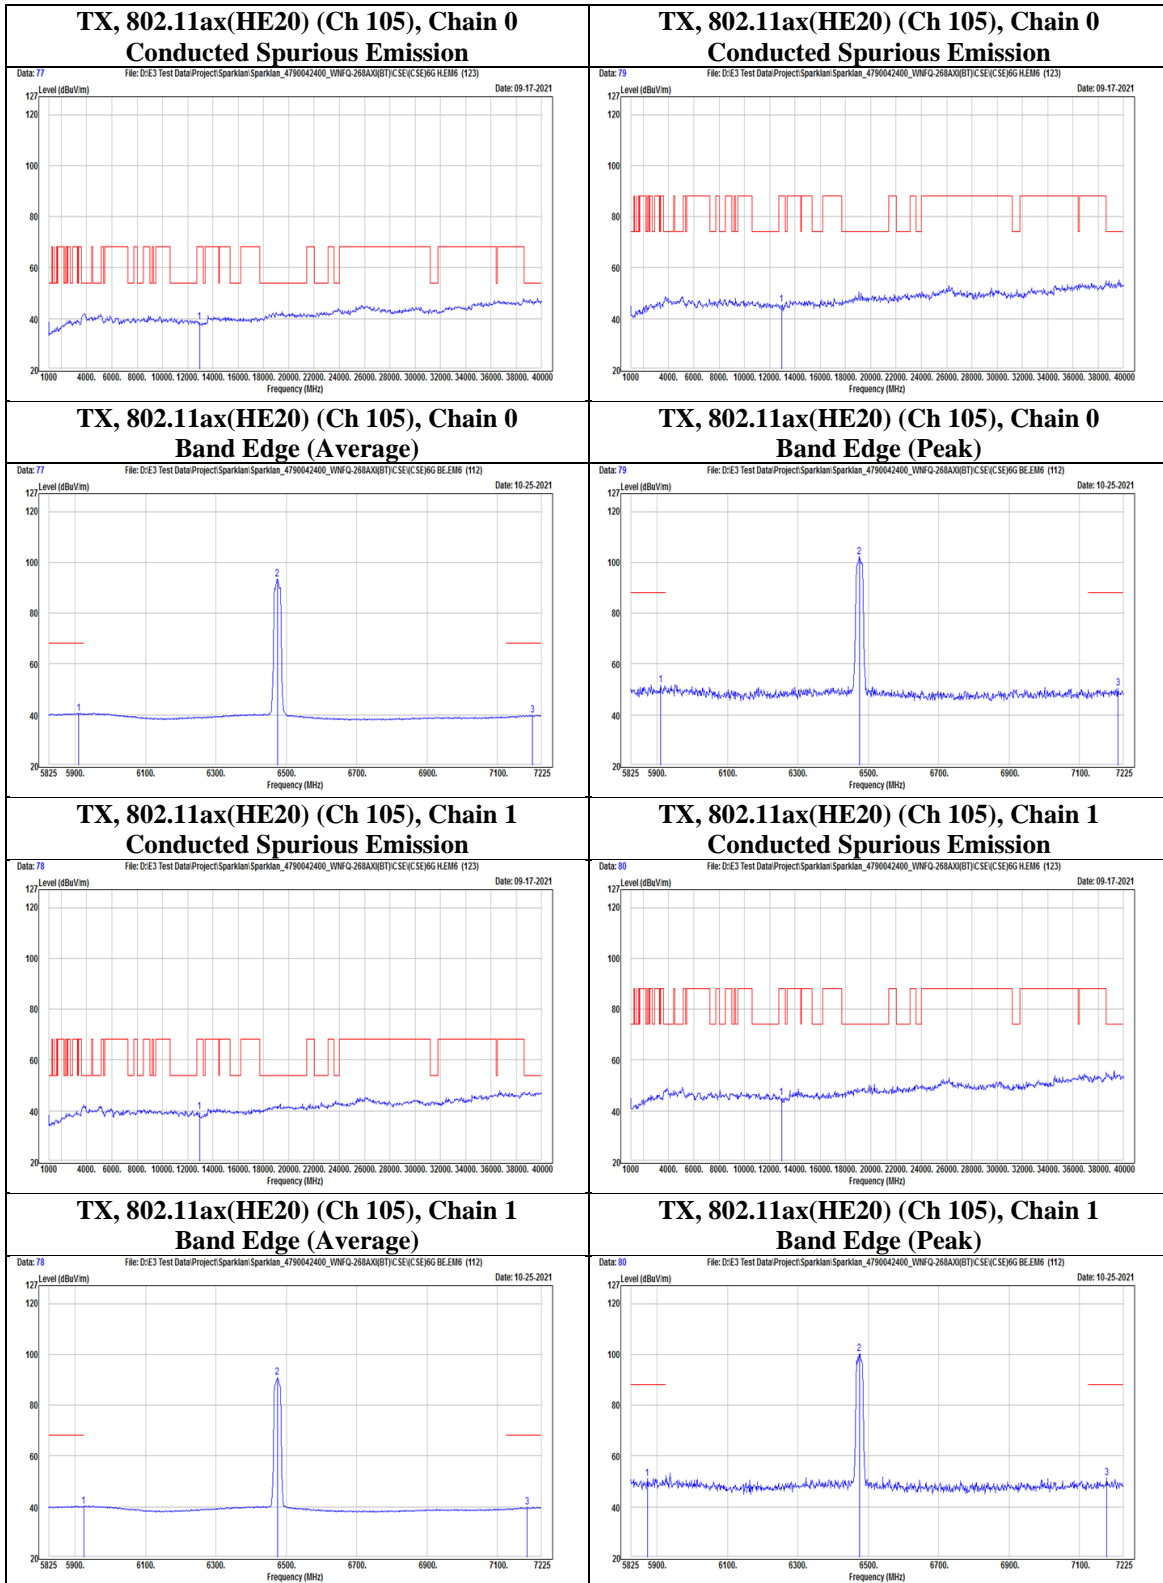

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ax(HE20)	Channel	113
------	----------------	---------	-----


TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5834.8	63.65	-11.74	51.91	88.2	-36.29	PK
		5921.6	52.23	-11.74	40.49	68.2	-27.71	AVG
	@	6515	114.37	-11.74	102.63	N/A	N/A	PK
	@	6515	104.94	-11.74	93.2	N/A	N/A	AVG
		7153.6	62.62	-11.74	50.88	88.2	-37.32	PK
		7220.8	51.51	-11.74	39.77	68.2	-28.43	AVG
		13030	57.27	-11.74	45.53	88.2	-42.67	PK
		13030	49.71	-11.74	37.97	68.2	-30.23	AVG
Chain 1		5882.4	63.8	-11.74	52.06	88.2	-36.14	PK
		5914.6	52.01	-11.74	40.27	68.2	-27.93	AVG
	@	6515	112.39	-11.74	100.65	N/A	N/A	PK
	@	6515	103.24	-11.74	91.5	N/A	N/A	AVG
		7211	51.61	-11.74	39.87	68.2	-28.33	AVG
		7222.2	62.43	-11.74	50.69	88.2	-37.51	PK
		13030	57.65	-11.74	45.91	88.2	-42.29	PK
		13030	49.87	-11.74	38.13	68.2	-30.07	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

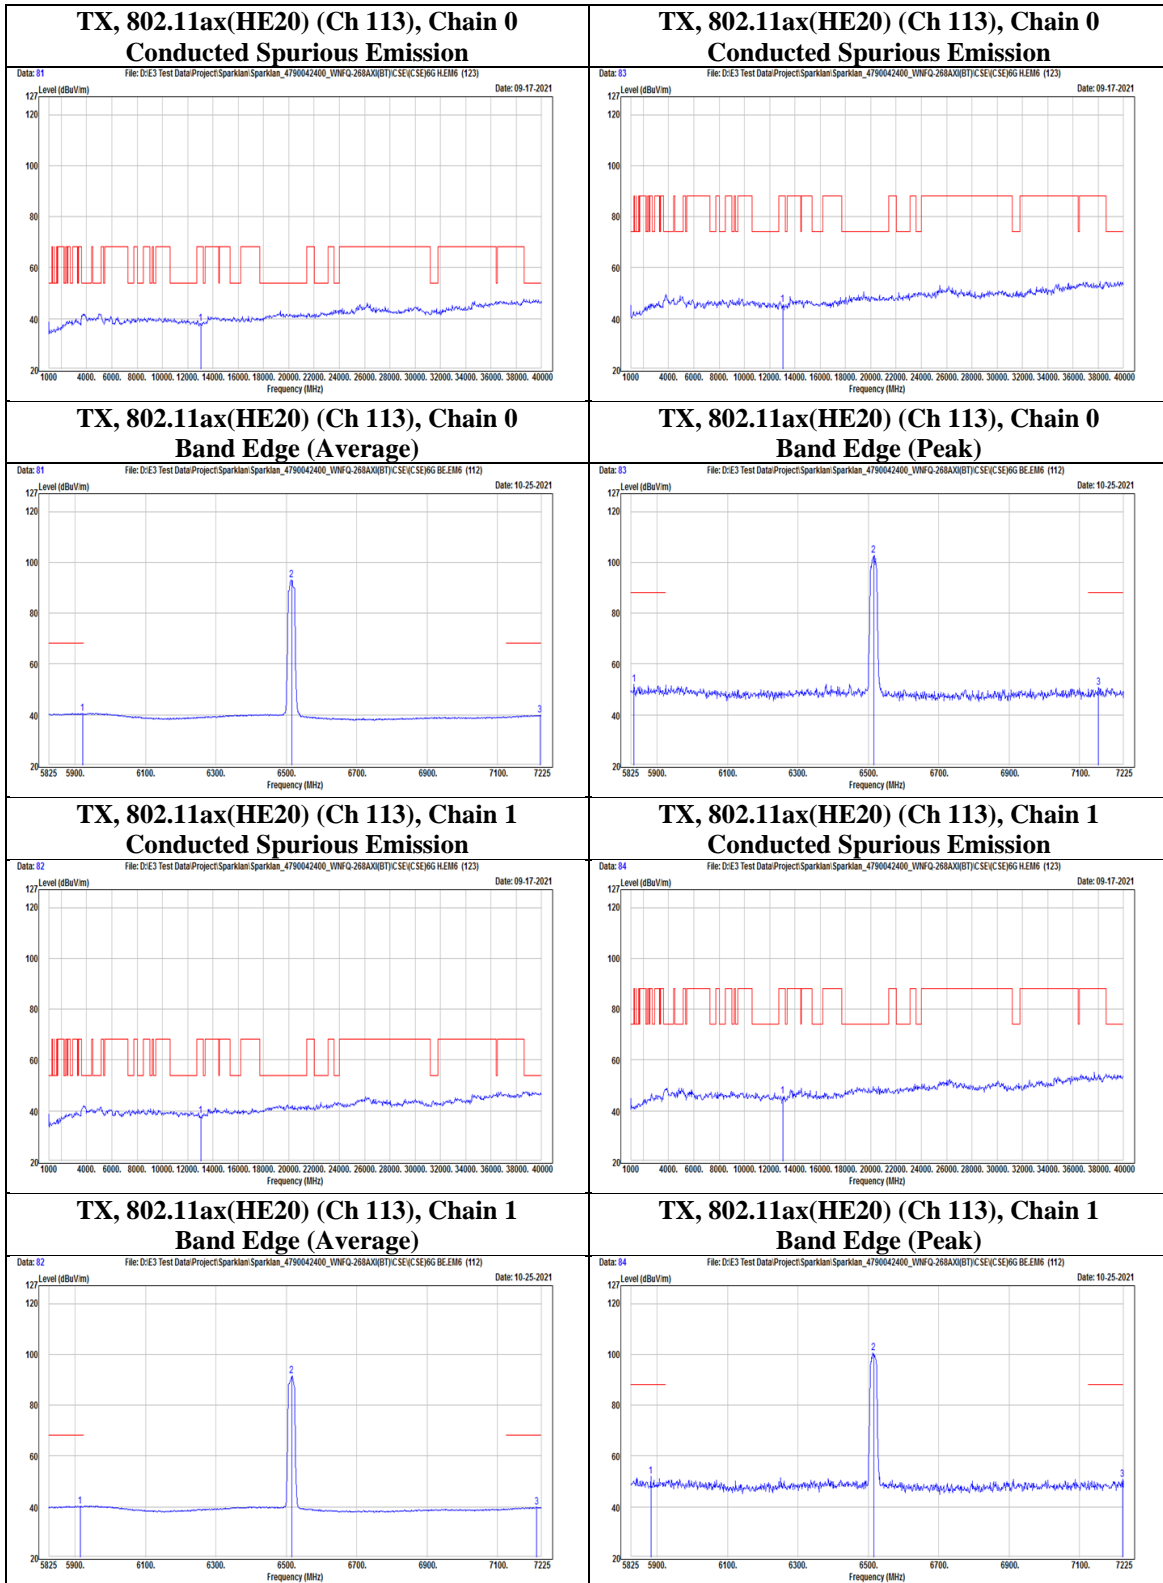



Test report No. : 4790042400-US-R2-V0
Page : 281 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE20)	Channel	117
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5874	62.77	-11.74	51.03	88.2	-37.17	PK
		5920.2	52.32	-11.74	40.58	68.2	-27.62	AVG
	@	6535	116.5	-11.74	104.76	N/A	N/A	PK
	@	6535	104.45	-11.74	92.71	N/A	N/A	AVG
		7177.4	64.15	-11.74	52.41	88.2	-35.79	PK
		7223.6	51.47	-11.74	39.73	68.2	-28.47	AVG
		13070	56.74	-11.74	45	88.2	-43.2	PK
		13070	50.25	-11.74	38.51	68.2	-29.69	AVG
Chain 1		5836.2	63.33	-11.74	51.59	88.2	-36.61	PK
		5899.2	51.97	-11.74	40.23	68.2	-27.97	AVG
	@	6535	110.19	-11.74	98.45	N/A	N/A	PK
	@	6535	101.21	-11.74	89.47	N/A	N/A	AVG
		7211	63.16	-11.74	51.42	88.2	-36.78	PK
		7218	51.62	-11.74	39.88	68.2	-28.32	AVG
		13070	56.9	-11.74	45.16	88.2	-43.04	PK
		13070	49.9	-11.74	38.16	68.2	-30.04	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

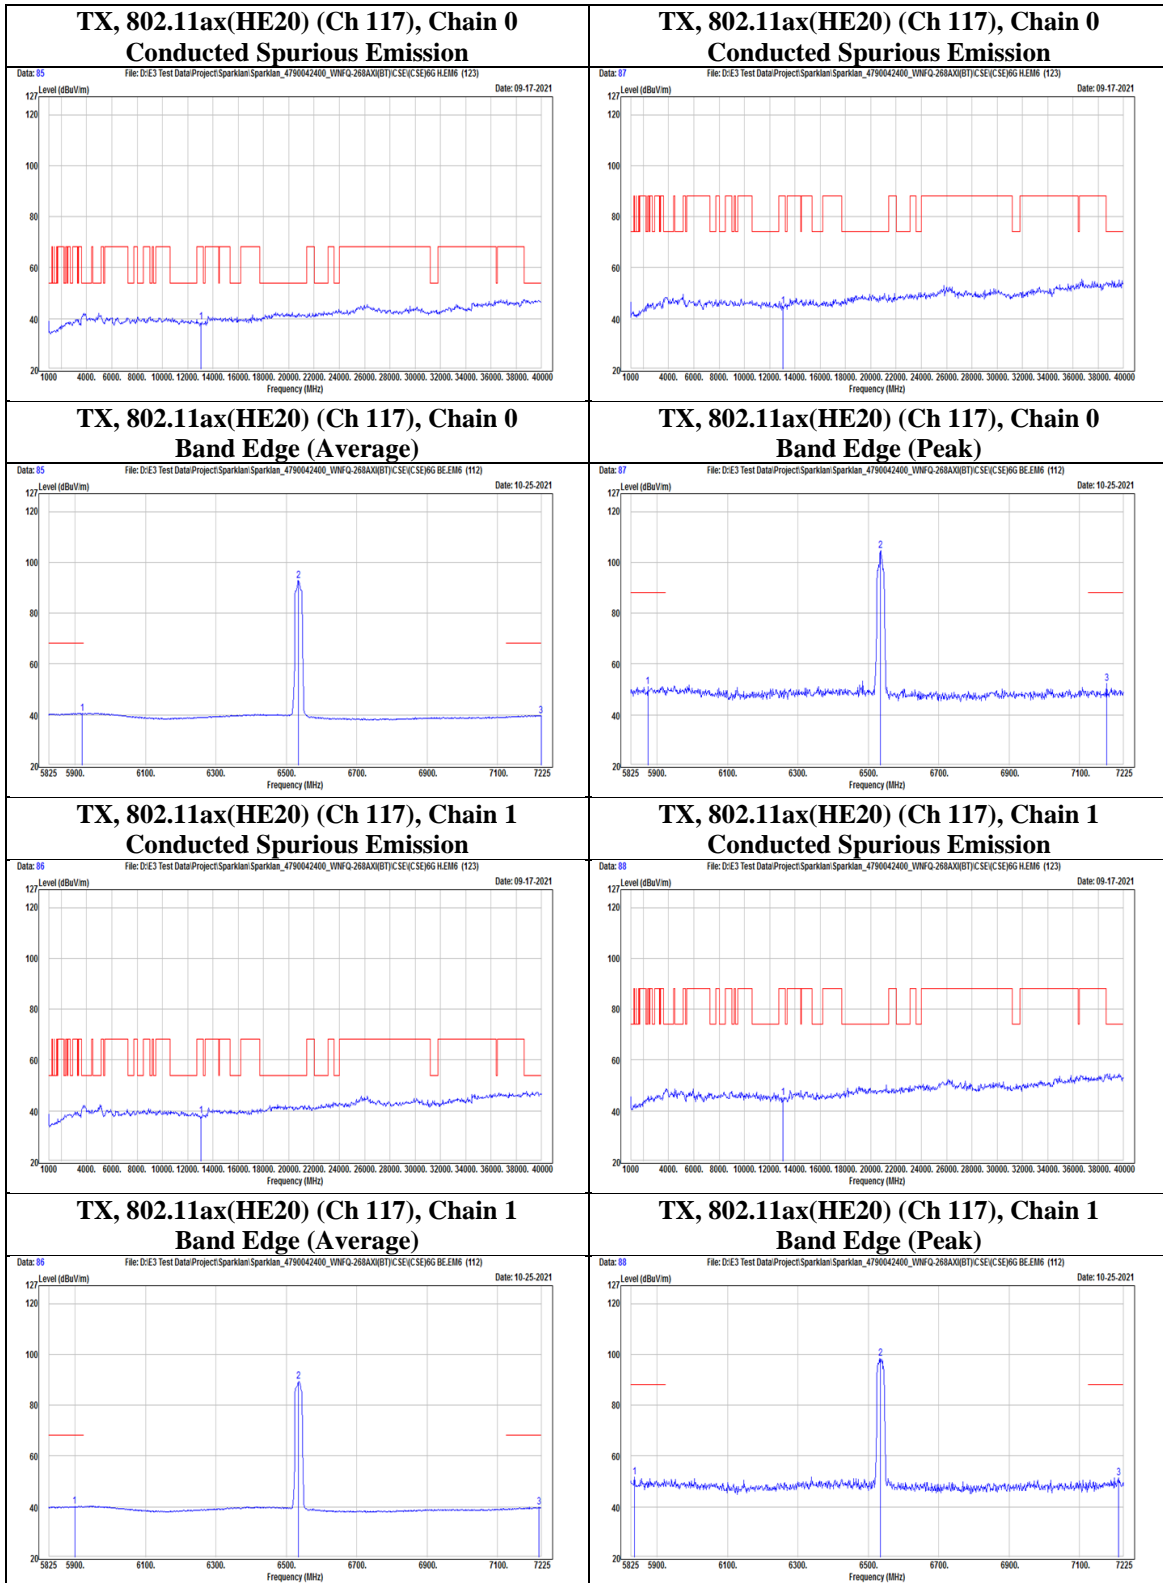



Mode	802.11ax(HE20)	Channel	149
------	----------------	---------	-----


TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5861.4	63.71	-11.74	51.97	88.2	-36.23	PK
		5913.2	52.05	-11.74	40.31	68.2	-27.89	AVG
	@	6695	112.08	-11.74	100.34	N/A	N/A	PK
	@	6695	102.83	-11.74	91.09	N/A	N/A	AVG
		7150.8	63.05	-11.74	51.31	88.2	-36.89	PK
		7218	51.54	-11.74	39.8	68.2	-28.4	AVG
		13390	57.03	-11.74	45.29	74	-28.71	PK
		13390	49.8	-11.74	38.06	54	-15.94	AVG
Chain 1		5896.4	51.89	-11.74	40.15	68.2	-28.05	AVG
		5903.4	62.99	-11.74	51.25	88.2	-36.95	PK
	@	6695	109.02	-11.74	97.28	N/A	N/A	PK
	@	6695	99.63	-11.74	87.89	N/A	N/A	AVG
		7141	61.86	-11.74	50.12	88.2	-38.08	PK
		7222.2	51.46	-11.74	39.72	68.2	-28.48	AVG
		13390	57.7	-11.74	45.96	74	-28.04	PK
		13390	50.1	-11.74	38.36	54	-15.64	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

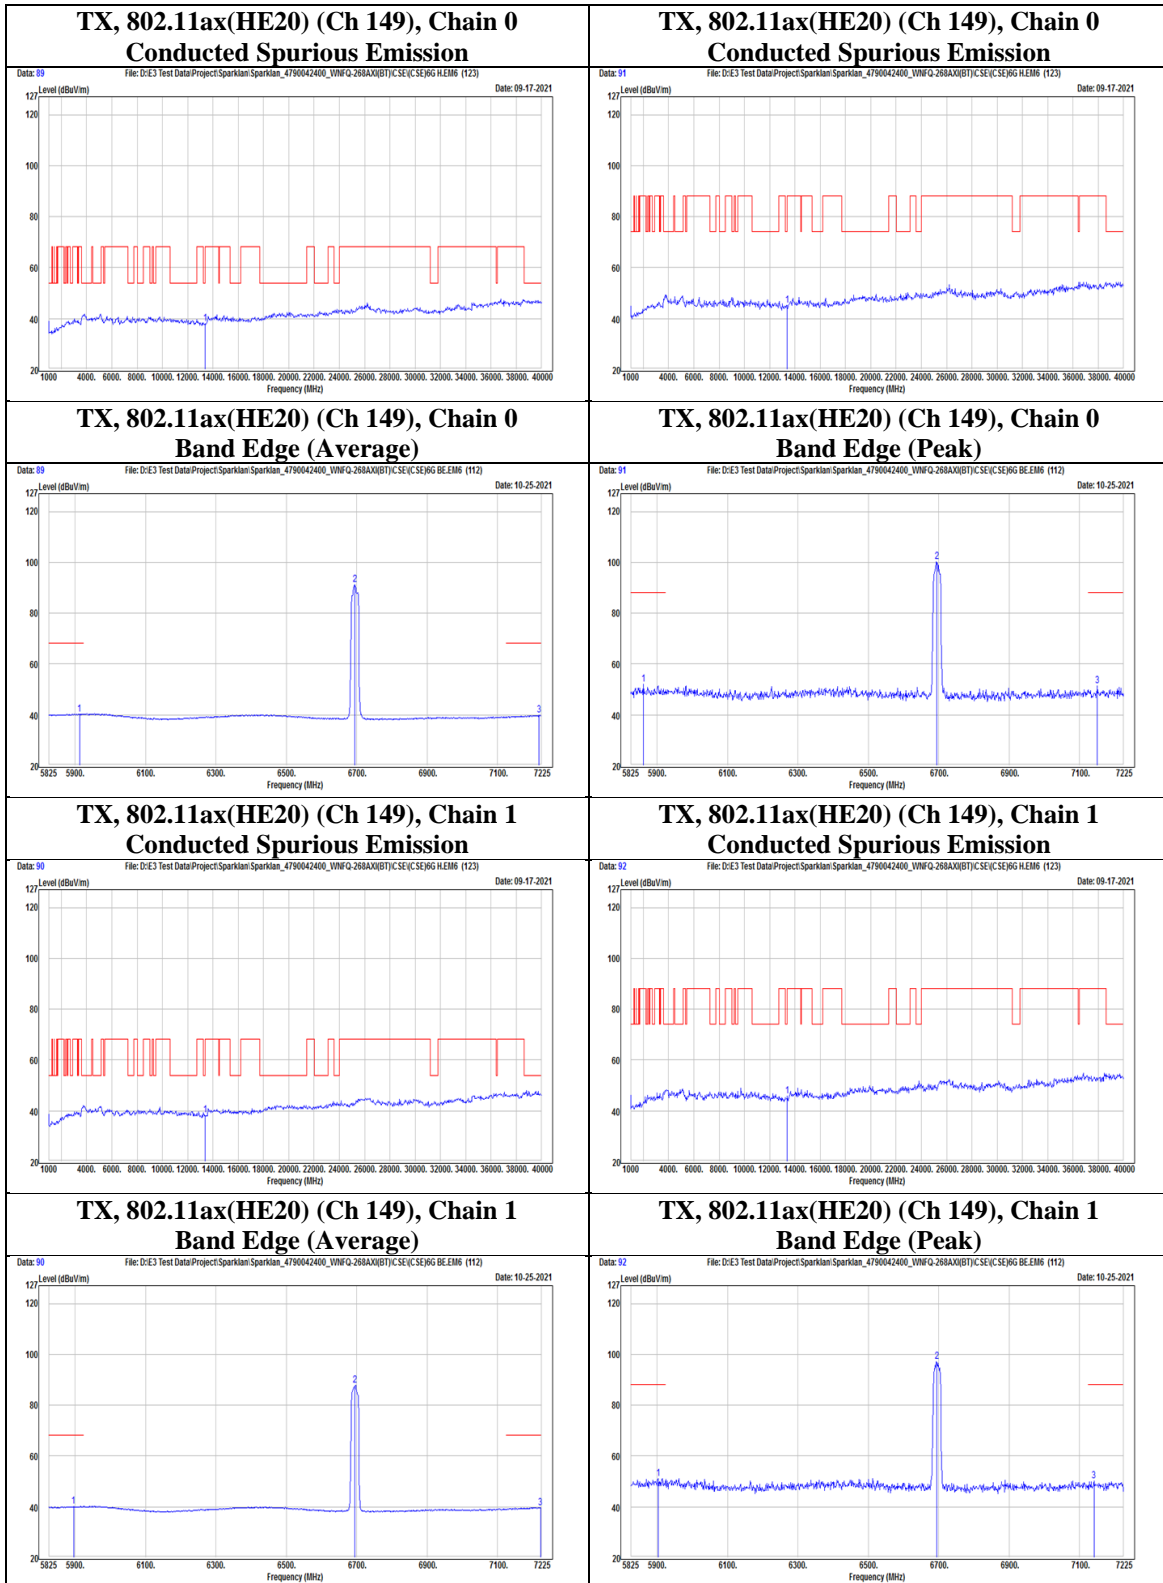



Mode	802.11ax(HE20)	Channel	181
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5878.2	64.78	-11.74	53.04	88.2	-35.16	PK
		5914.6	52.34	-11.74	40.6	68.2	-27.6	AVG
	@	6855	112.48	-11.74	100.74	N/A	N/A	PK
	@	6855	102.8	-11.74	91.06	N/A	N/A	AVG
		7139.6	61.99	-11.74	50.25	88.2	-37.95	PK
		7219.4	51.62	-11.74	39.88	68.2	-28.32	AVG
		13710	59.12	-11.74	47.38	88.2	-40.82	PK
		13710	51.9	-11.74	40.16	68.2	-28.04	AVG
Chain 1		5872.6	62.91	-11.74	51.17	88.2	-37.03	PK
		5885.2	52.03	-11.74	40.29	68.2	-27.91	AVG
	@	6855	109.79	-11.74	98.05	N/A	N/A	PK
	@	6855	100.51	-11.74	88.77	N/A	N/A	AVG
		7125.6	63.29	-11.74	51.55	88.2	-36.65	PK
		7209.6	51.7	-11.74	39.96	68.2	-28.24	AVG
		13710	59.39	-11.74	47.65	88.2	-40.55	PK
		13710	52.78	-11.74	41.04	68.2	-27.16	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0