

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ax(HE40)	Channel	179
------	----------------	---------	-----


TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5900.6	52.67	-11.74	40.93	68.2	-27.27	AVG
		5918.8	63.73	-11.74	51.99	88.2	-36.21	PK
	@	6845	112.12	-11.74	100.38	N/A	N/A	PK
	@	6845	103.22	-11.74	91.48	N/A	N/A	AVG
		7215.2	63.51	-11.74	51.77	88.2	-36.43	PK
		7223.6	51.61	-11.74	39.87	68.2	-28.33	AVG
		13690	59.18	-11.74	47.44	88.2	-40.76	PK
		13690	52.5	-11.74	40.76	68.2	-27.44	AVG
Chain 1		5879.6	63.08	-11.74	51.34	88.2	-36.86	PK
		5917.4	51.95	-11.74	40.21	68.2	-27.99	AVG
	@	6845	110.39	-11.74	98.65	N/A	N/A	PK
	@	6845	100.02	-11.74	88.28	N/A	N/A	AVG
		7202.6	63.25	-11.74	51.51	88.2	-36.69	PK
		7218	51.6	-11.74	39.86	68.2	-28.34	AVG
		13690	59.72	-11.74	47.98	88.2	-40.22	PK
		13690	51.77	-11.74	40.03	68.2	-28.17	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

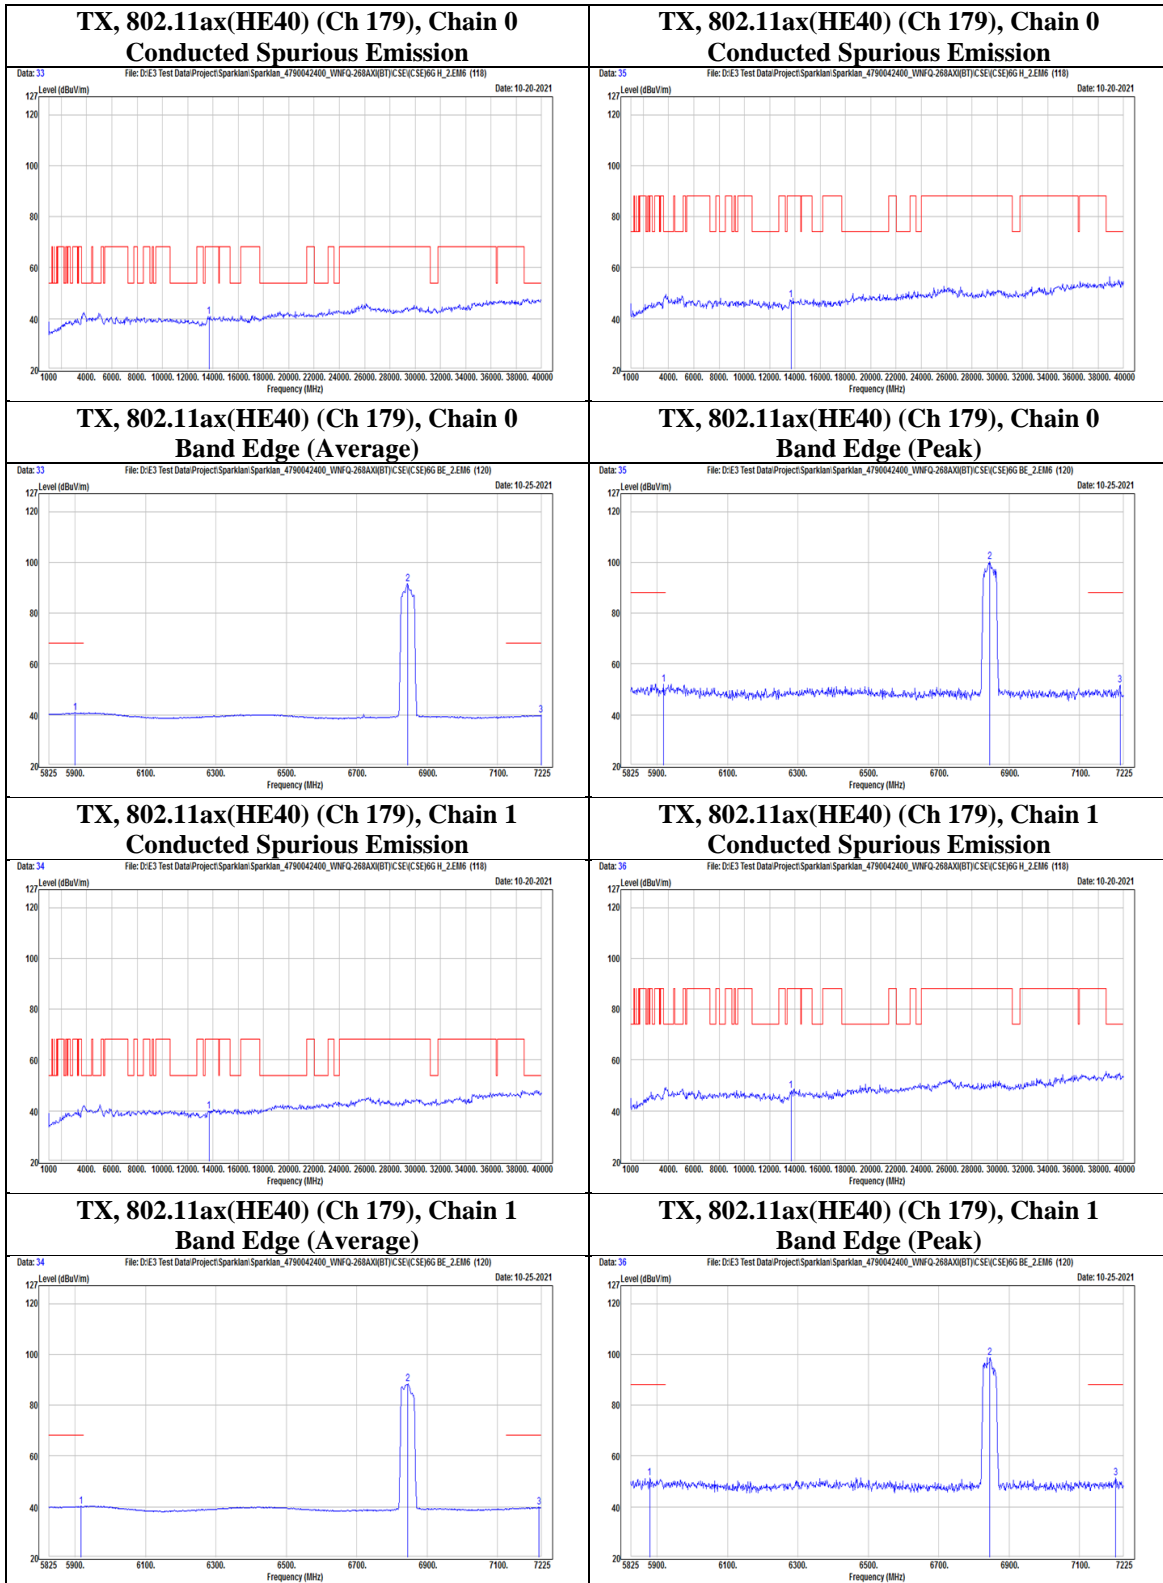



Mode	802.11ax(HE40)	Channel	187
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5892.2	63.17	-11.74	51.43	88.2	-36.77	PK
		5909	52.62	-11.74	40.88	68.2	-27.32	AVG
	@	6885	112.38	-11.74	100.64	N/A	N/A	PK
	@	6885	103.22	-11.74	91.48	N/A	N/A	AVG
		7149.4	62.89	-11.74	51.15	88.2	-37.05	PK
		7218	51.57	-11.74	39.83	68.2	-28.37	AVG
		13770	59.74	-11.74	48	88.2	-40.2	PK
		13770	52.64	-11.74	40.9	68.2	-27.3	AVG
Chain 1		5881	63.66	-11.74	51.92	88.2	-36.28	PK
		5924.4	51.98	-11.74	40.24	68.2	-27.96	AVG
	@	6885	110.61	-11.74	98.87	N/A	N/A	PK
	@	6885	101.54	-11.74	89.8	N/A	N/A	AVG
		7191.4	51.57	-11.74	39.83	68.2	-28.37	AVG
		7222.2	62.7	-11.74	50.96	88.2	-37.24	PK
		13770	59.16	-11.74	47.42	88.2	-40.78	PK
		13770	52.24	-11.74	40.5	68.2	-27.7	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

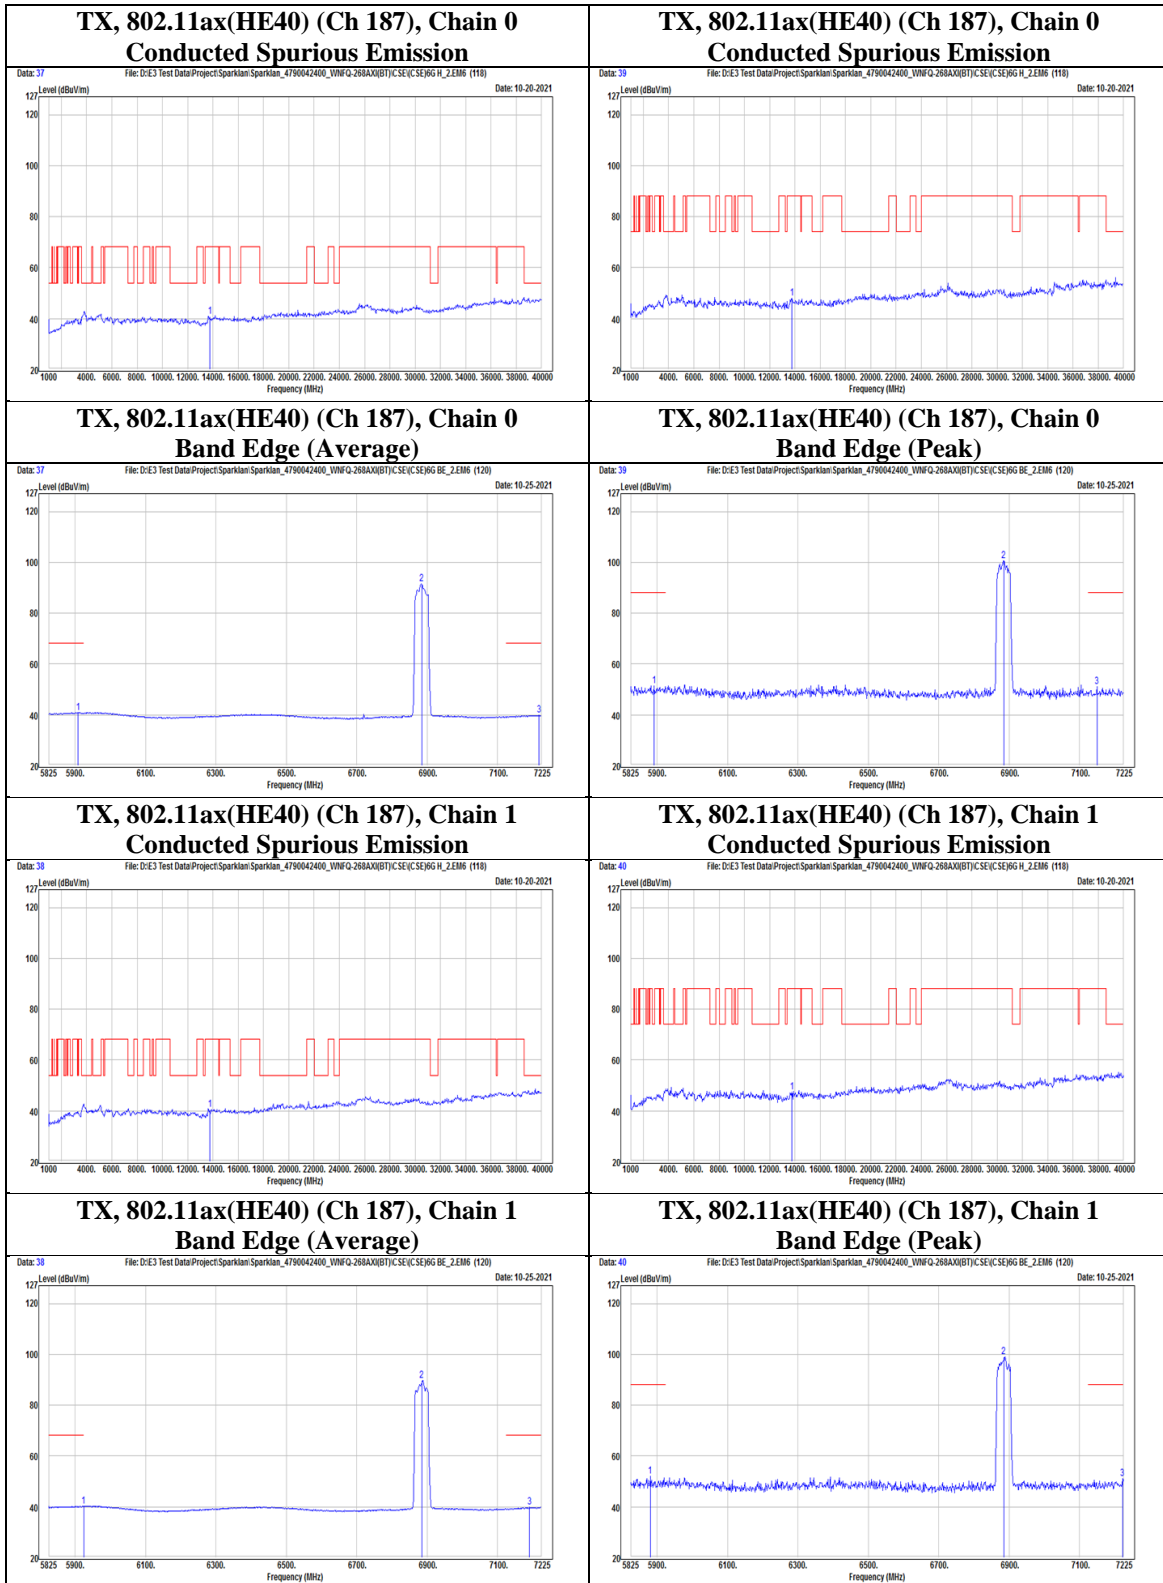



Test report No. : 4790042400-US-R2-V0
Page : 315 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE40)	Channel	211
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	7005	111.97	-11.74	100.23	N/A	N/A	PK
	@	7005	103.11	-11.74	91.37	N/A	N/A	AVG
		7150.8	62.19	-11.74	50.45	88.2	-37.75	PK
		7204	51.64	-11.74	39.9	68.2	-28.3	AVG
		14010	58.73	-11.74	46.99	88.2	-41.21	PK
		14010	52.24	-11.74	40.5	68.2	-27.7	AVG
Chain 1	@	7005	108.69	-11.74	96.95	N/A	N/A	PK
	@	7005	100.81	-11.74	89.07	N/A	N/A	AVG
		7167.6	63.12	-11.74	51.38	88.2	-36.82	PK
		7191.4	51.55	-11.74	39.81	68.2	-28.39	AVG
		14010	59.16	-11.74	47.42	88.2	-40.78	PK
		14010	51.88	-11.74	40.14	68.2	-28.06	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

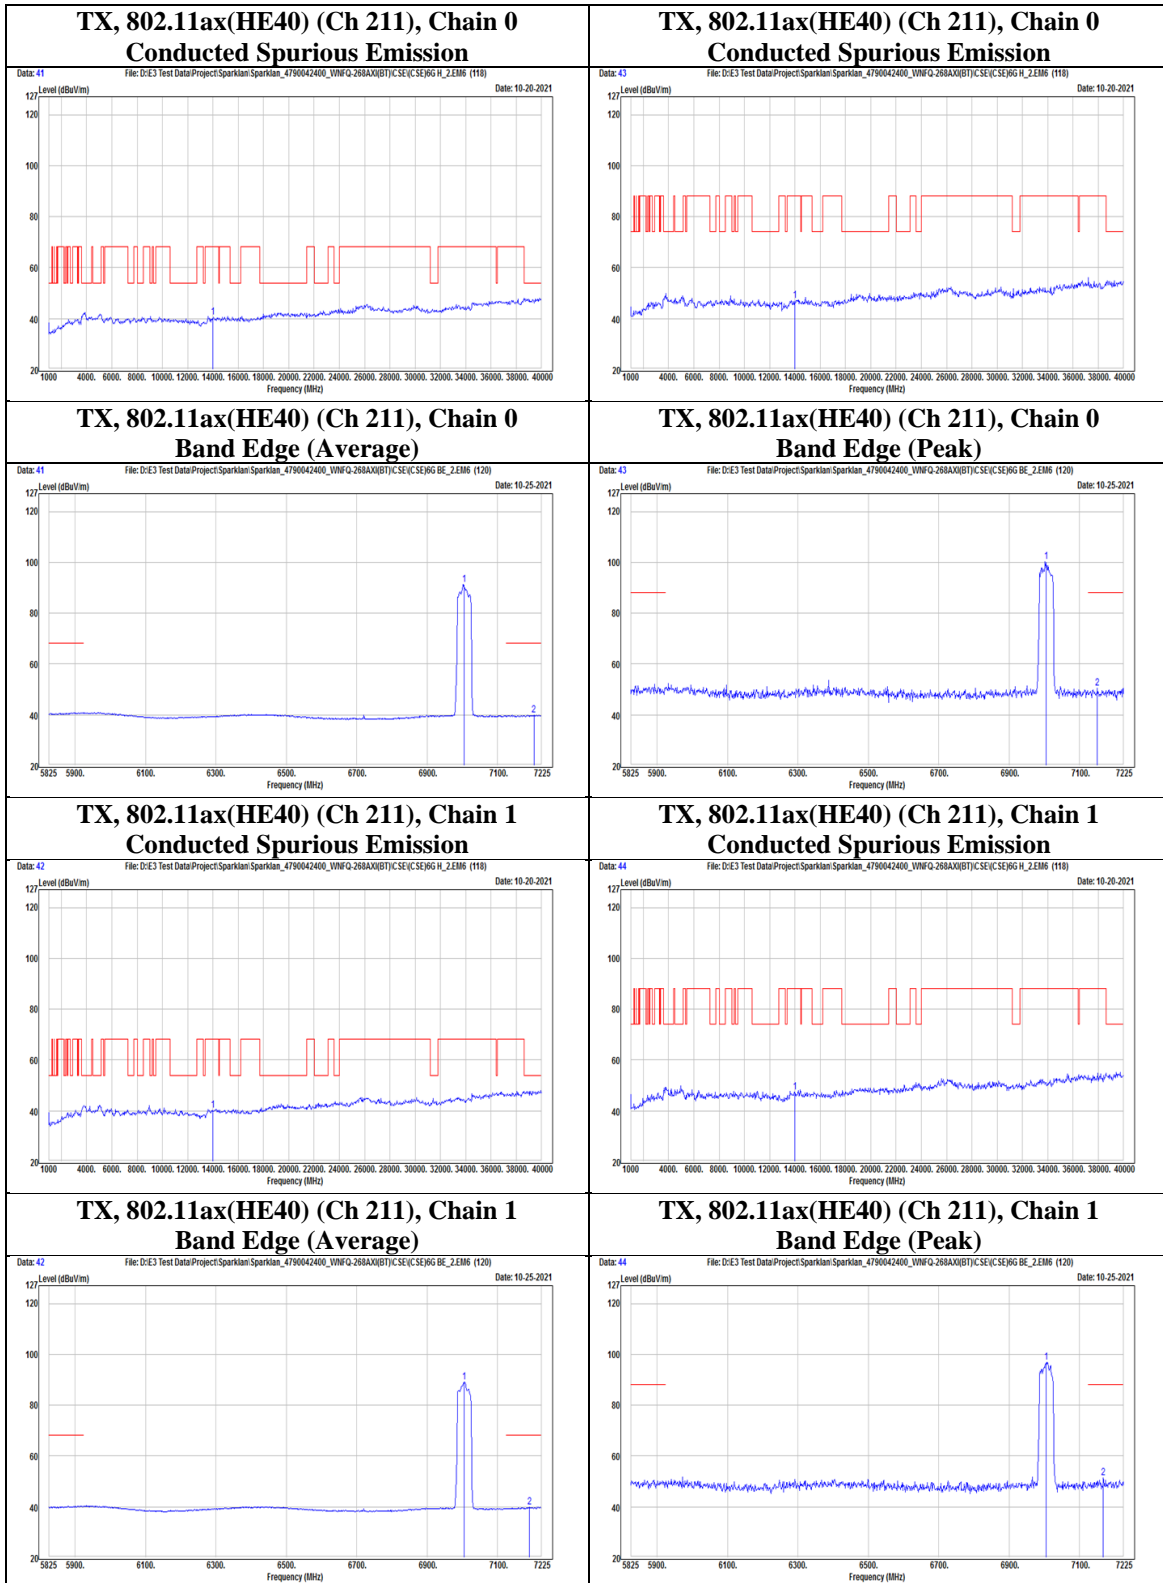

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 317 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE40)	Channel	227
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0	@	7085	110.63	-11.74	98.89	N/A	N/A	PK
	@	7085	102.45	-11.74	90.71	N/A	N/A	AVG
		7198.4	51.81	-11.74	40.07	68.2	-28.13	AVG
		7208.2	63.43	-11.74	51.69	88.2	-36.51	PK
		14170	59.73	-11.74	47.99	88.2	-40.21	PK
		14170	52.62	-11.74	40.88	68.2	-27.32	AVG
Chain 1	@	7085	109.07	-11.74	97.33	N/A	N/A	PK
	@	7085	100.67	-11.74	88.93	N/A	N/A	AVG
		7183	63.45	-11.74	51.71	88.2	-36.49	PK
		7204	51.82	-11.74	40.08	68.2	-28.12	AVG
		14170	58.51	-11.74	46.77	88.2	-41.43	PK
		14170	52.02	-11.74	40.28	68.2	-27.92	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

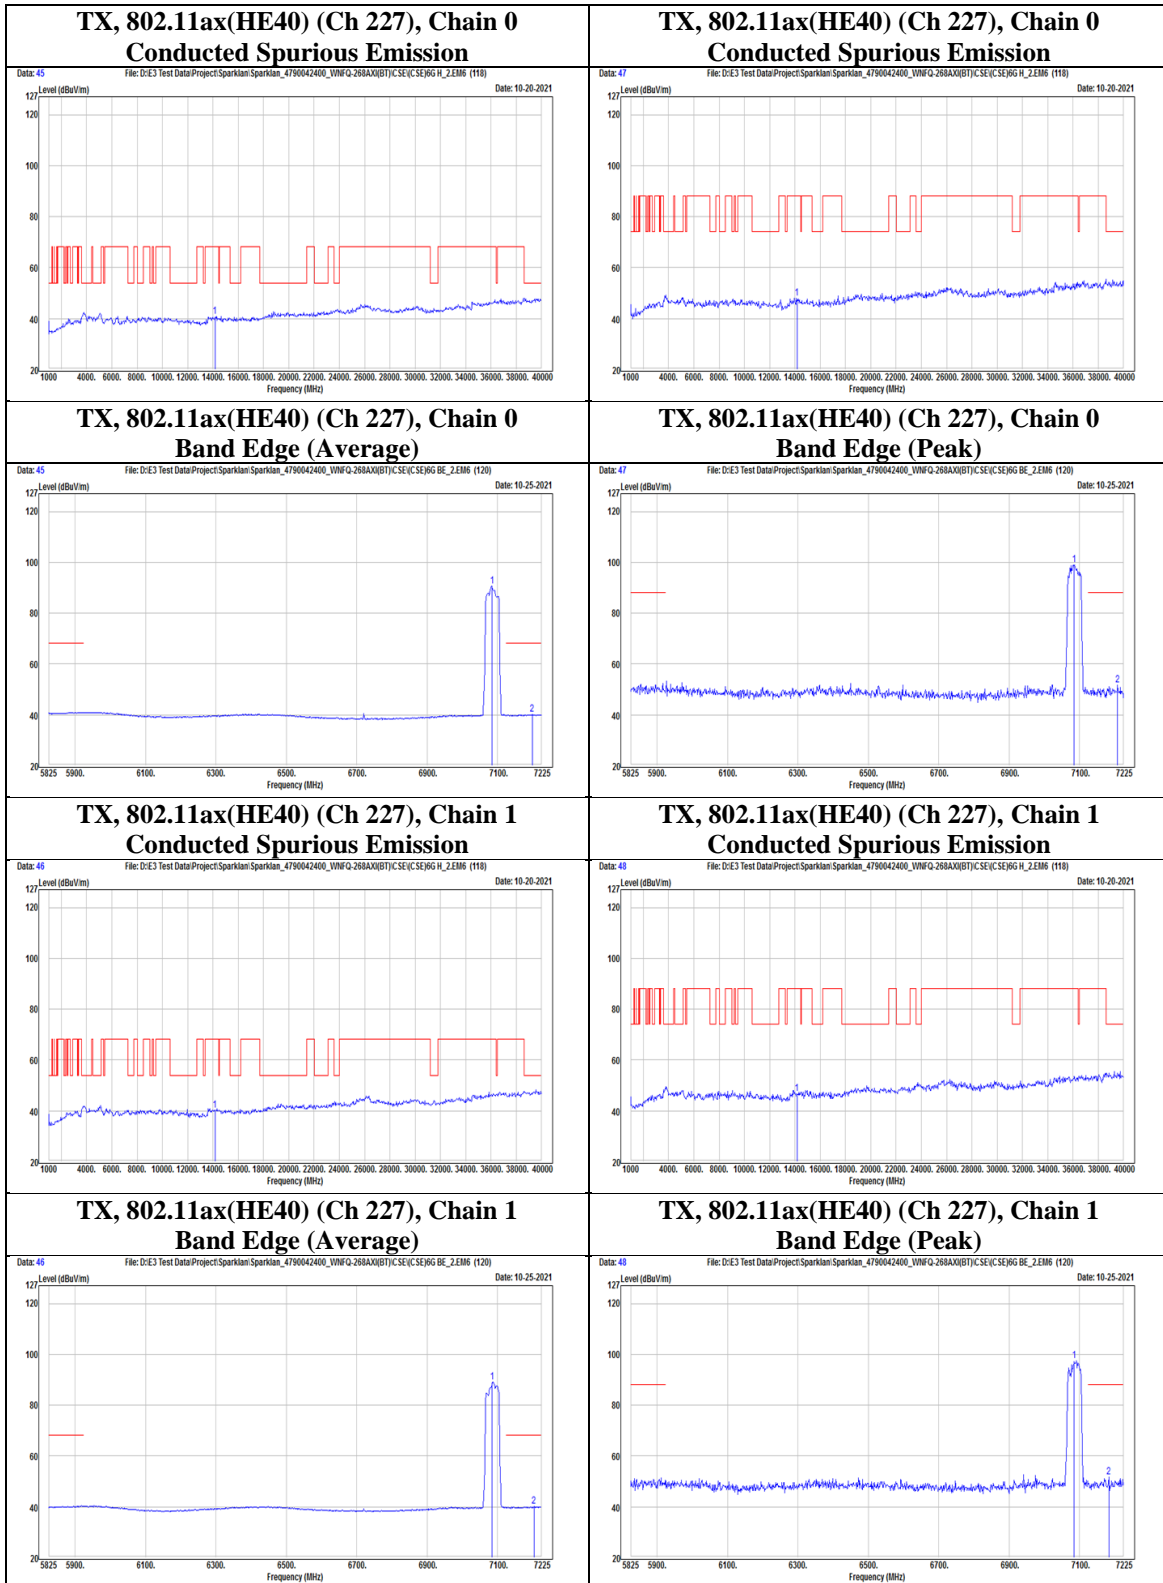



Test report No. : 4790042400-US-R2-V0
Page : 319 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE80)	Channel	7
------	----------------	---------	---

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5907.6	55.54	-11.74	43.8	68.2	-24.4	AVG
		5920.2	66.14	-11.74	54.4	88.2	-33.8	PK
	@	5985	113.43	-11.74	101.69	N/A	N/A	PK
	@	5985	104.13	-11.74	92.39	N/A	N/A	AVG
		11970	58.01	-11.74	46.27	74	-27.73	PK
		11970	50.7	-11.74	38.96	54	-15.04	AVG
Chain 1		5899.2	64.27	-11.74	52.53	88.2	-35.67	PK
		5924.4	53.68	-11.74	41.94	68.2	-26.26	AVG
	@	5985	111.63	-11.74	99.89	N/A	N/A	PK
	@	5985	102.03	-11.74	90.29	N/A	N/A	AVG
		11970	57.47	-11.74	45.73	74	-28.27	PK
		11970	51.17	-11.74	39.43	54	-14.57	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

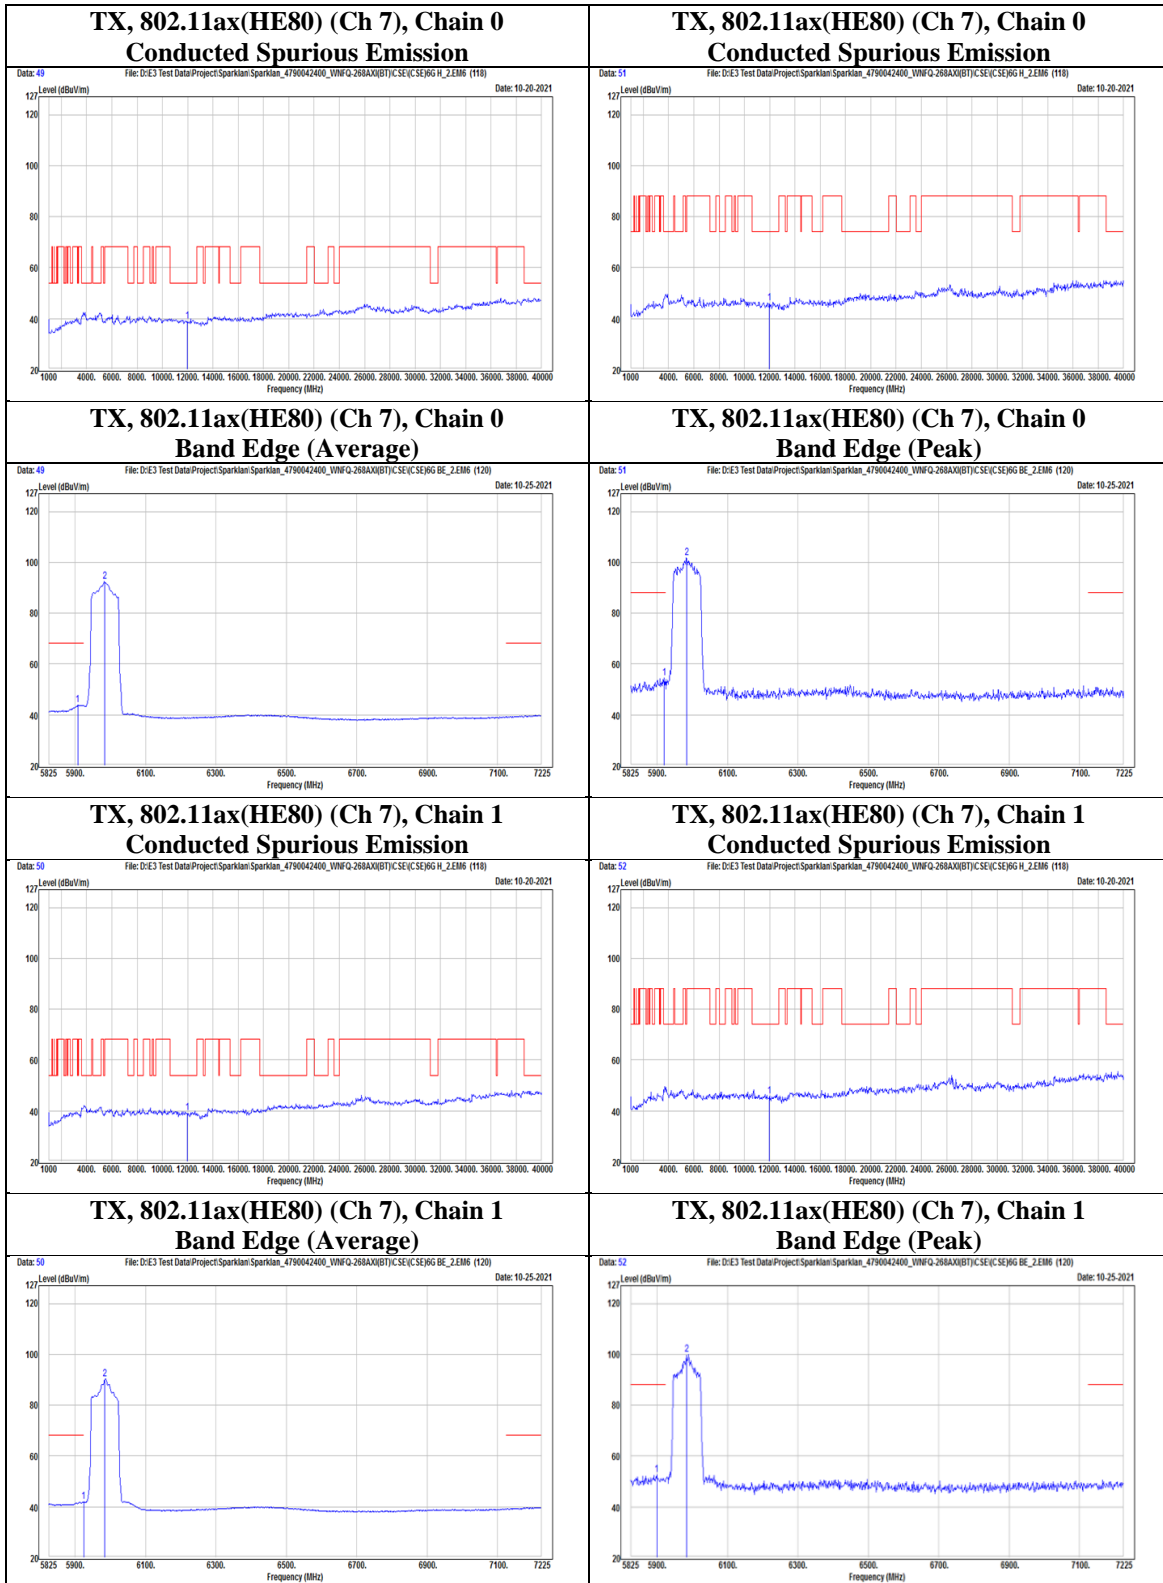

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790042400-US-R2-V0
Page : 321 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE80)	Channel	39
------	----------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5903.4	53.21	-11.74	41.47	68.2	-26.73	AVG
		5923	63.68	-11.74	51.94	88.2	-36.26	PK
	@	6145	111.75	-11.74	100.01	N/A	N/A	PK
	@	6145	102.66	-11.74	90.92	N/A	N/A	AVG
		12290	57.5	-11.74	45.76	74	-28.24	PK
		12290	51.17	-11.74	39.43	54	-14.57	AVG
Chain 1		5869.8	62.77	-11.74	51.03	88.2	-37.17	PK
		5896.4	52.29	-11.74	40.55	68.2	-27.65	AVG
	@	6145	109.42	-11.74	97.68	N/A	N/A	PK
	@	6145	99.96	-11.74	88.22	N/A	N/A	AVG
		12290	57.67	-11.74	45.93	74	-28.07	PK
		12290	51.07	-11.74	39.33	54	-14.67	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

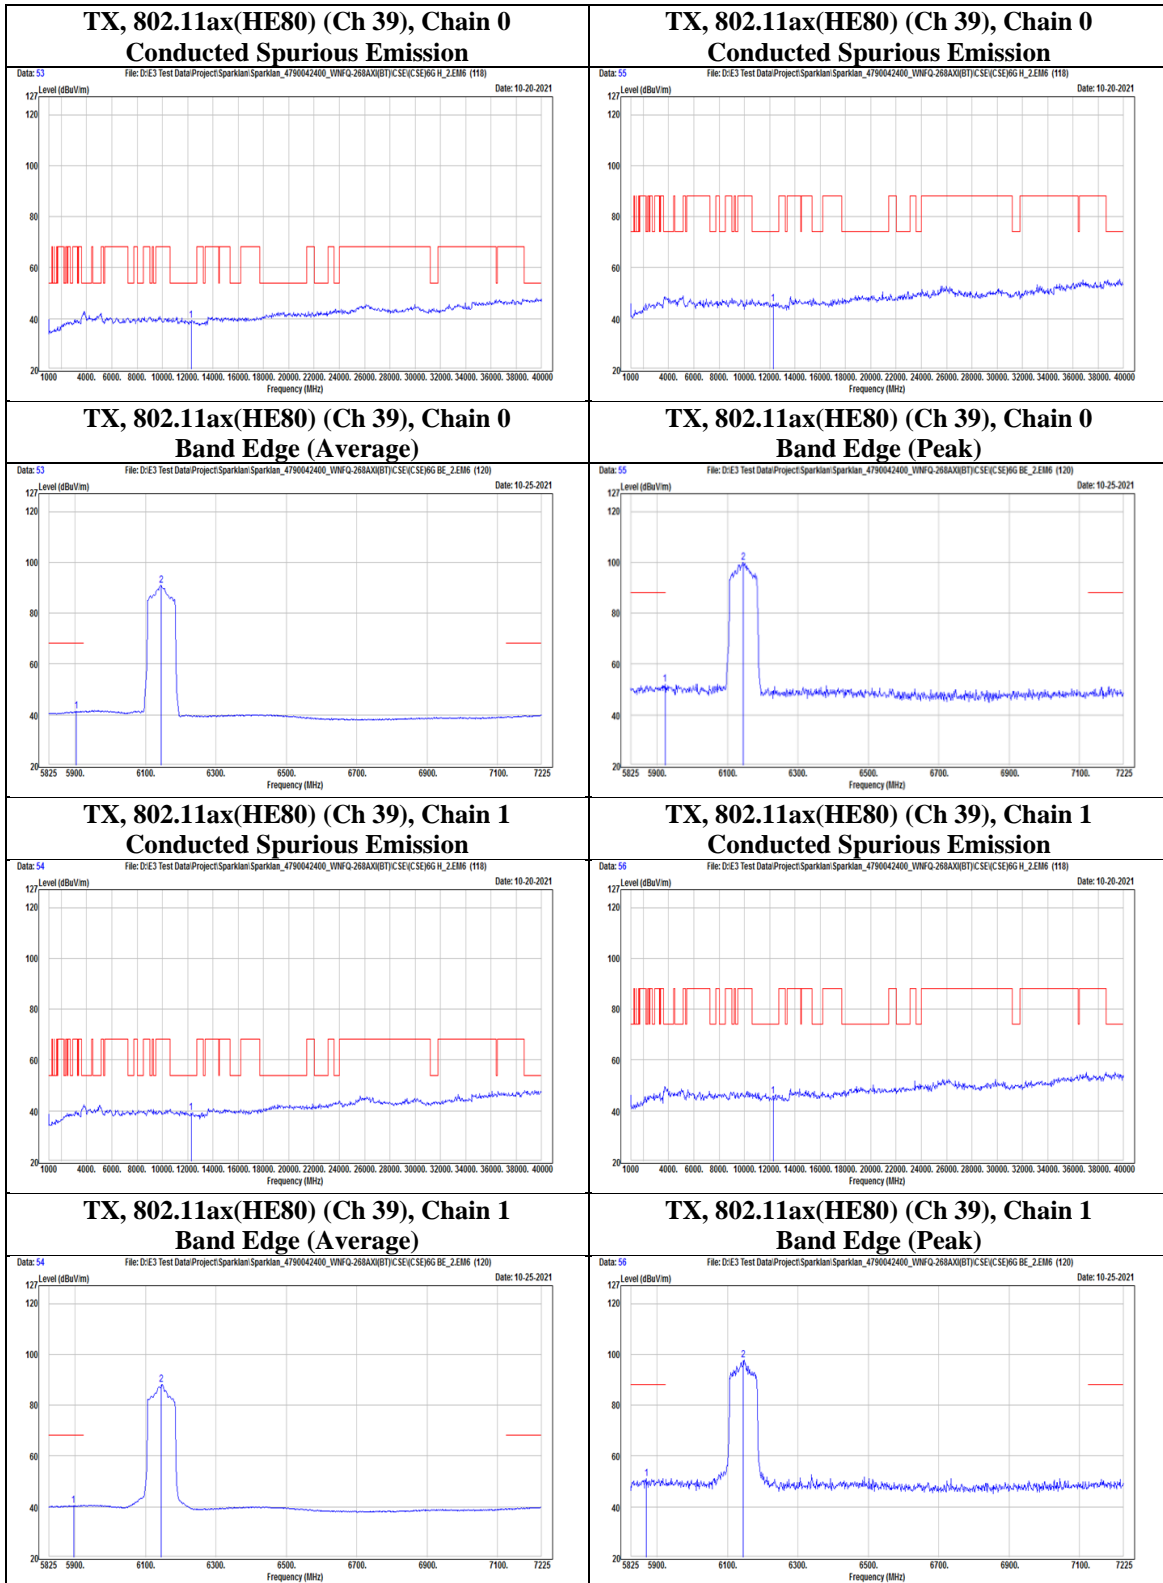



Mode	802.11ax(HE80)	Channel	87
------	----------------	---------	----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5871.2	63.6	-11.74	51.86	88.2	-36.34	PK
		5924.4	52.75	-11.74	41.01	68.2	-27.19	AVG
	@	6385	113.89	-11.74	102.15	N/A	N/A	PK
	@	6385	103.5	-11.74	91.76	N/A	N/A	AVG
		7169	62.12	-11.74	50.38	88.2	-37.82	PK
		7208.2	51.52	-11.74	39.78	68.2	-28.42	AVG
		12770	58.14	-11.74	46.4	88.2	-41.8	PK
		12770	50.67	-11.74	38.93	68.2	-29.27	AVG
Chain 1		5853	63.4	-11.74	51.66	88.2	-36.54	PK
		5913.2	52.11	-11.74	40.37	68.2	-27.83	AVG
	@	6385	109.71	-11.74	97.97	N/A	N/A	PK
	@	6385	99.39	-11.74	87.65	N/A	N/A	AVG
		7181.6	62.61	-11.74	50.87	88.2	-37.33	PK
		7216.6	51.52	-11.74	39.78	68.2	-28.42	AVG
		12770	57.83	-11.74	46.09	88.2	-42.11	PK
		12770	50.92	-11.74	39.18	68.2	-29.02	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

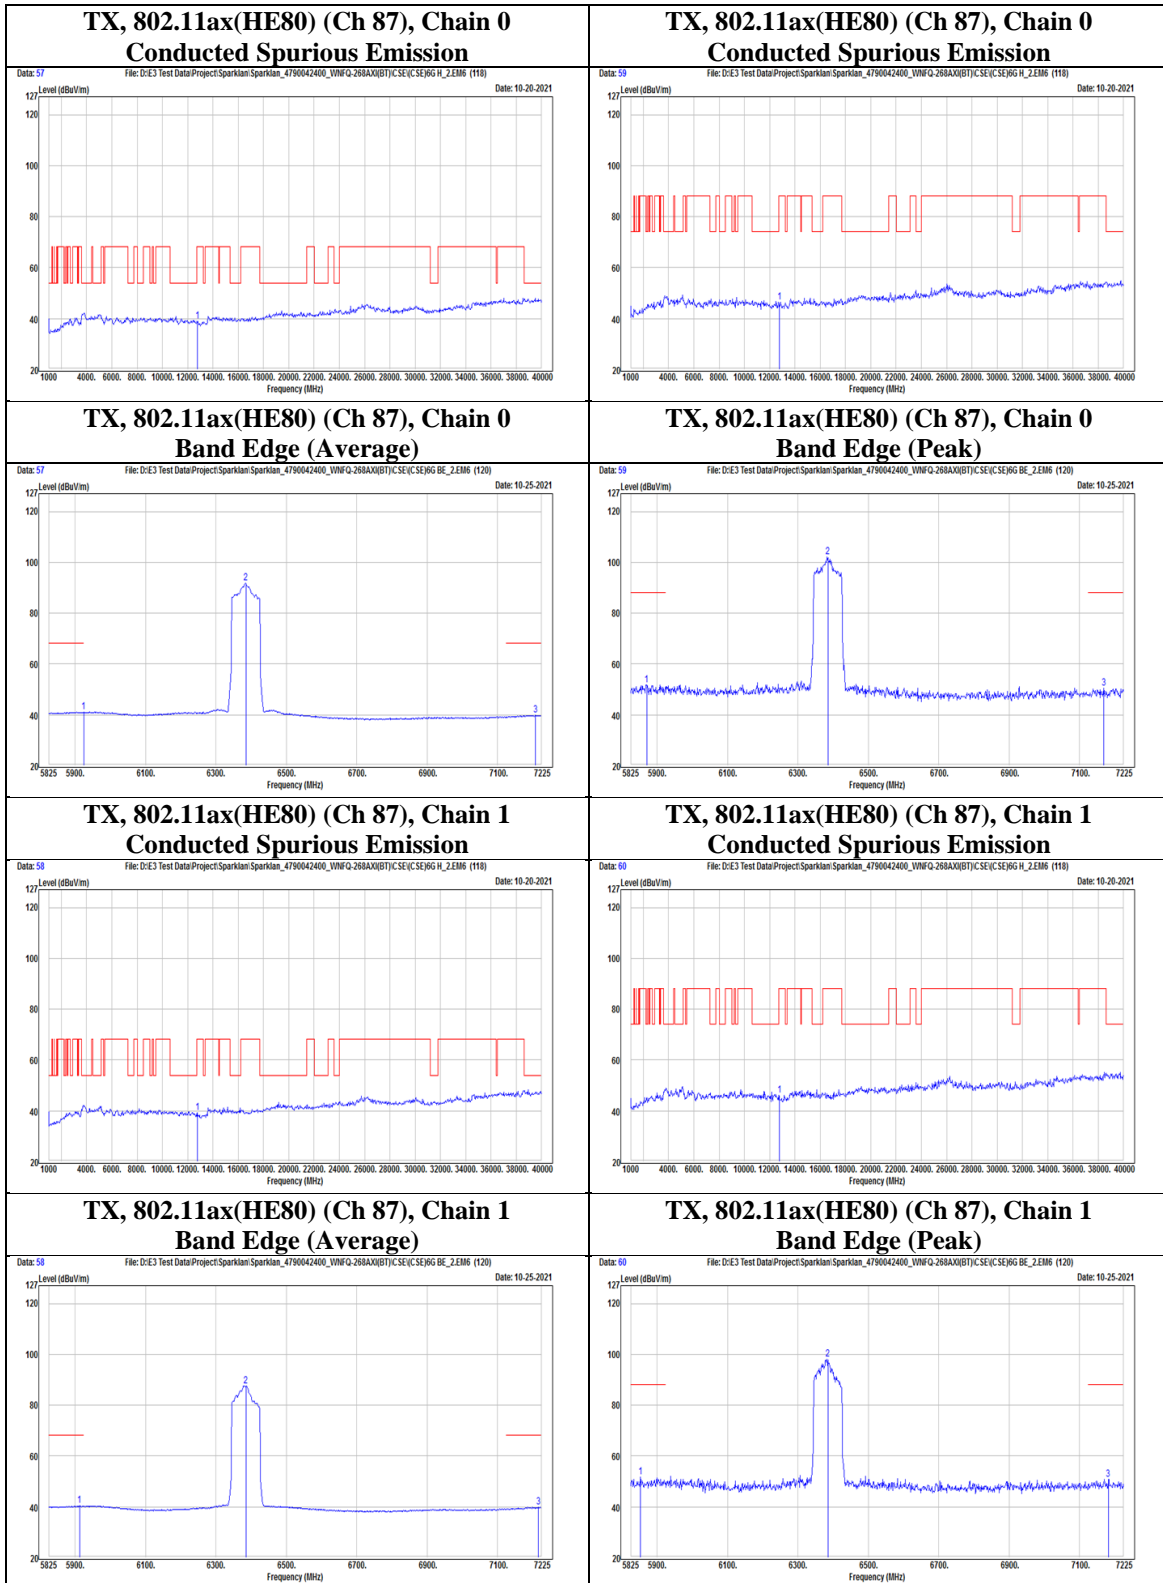



Mode	802.11ax(HE80)	Channel	103
------	----------------	---------	-----


TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5902	52.7	-11.74	40.96	68.2	-27.24	AVG
		5913.2	63.72	-11.74	51.98	88.2	-36.22	PK
	@	6465	114.91	-11.74	103.17	N/A	N/A	PK
	@	6465	104.54	-11.74	92.8	N/A	N/A	AVG
		7205.4	62.86	-11.74	51.12	88.2	-37.08	PK
		7212.4	51.5	-11.74	39.76	68.2	-28.44	AVG
		12930	56.94	-11.74	45.2	88.2	-43	PK
		12930	50.01	-11.74	38.27	68.2	-29.93	AVG
Chain 1		5853	62.88	-11.74	51.14	88.2	-37.06	PK
		5906.2	52.01	-11.74	40.27	68.2	-27.93	AVG
	@	6465	111.98	-11.74	100.24	N/A	N/A	PK
	@	6465	101.23	-11.74	89.49	N/A	N/A	AVG
		7220.8	61.94	-11.74	50.2	88.2	-38	PK
		7222.2	51.73	-11.74	39.99	68.2	-28.21	AVG
		12930	57.03	-11.74	45.29	88.2	-42.91	PK
		12930	50.05	-11.74	38.31	68.2	-29.89	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

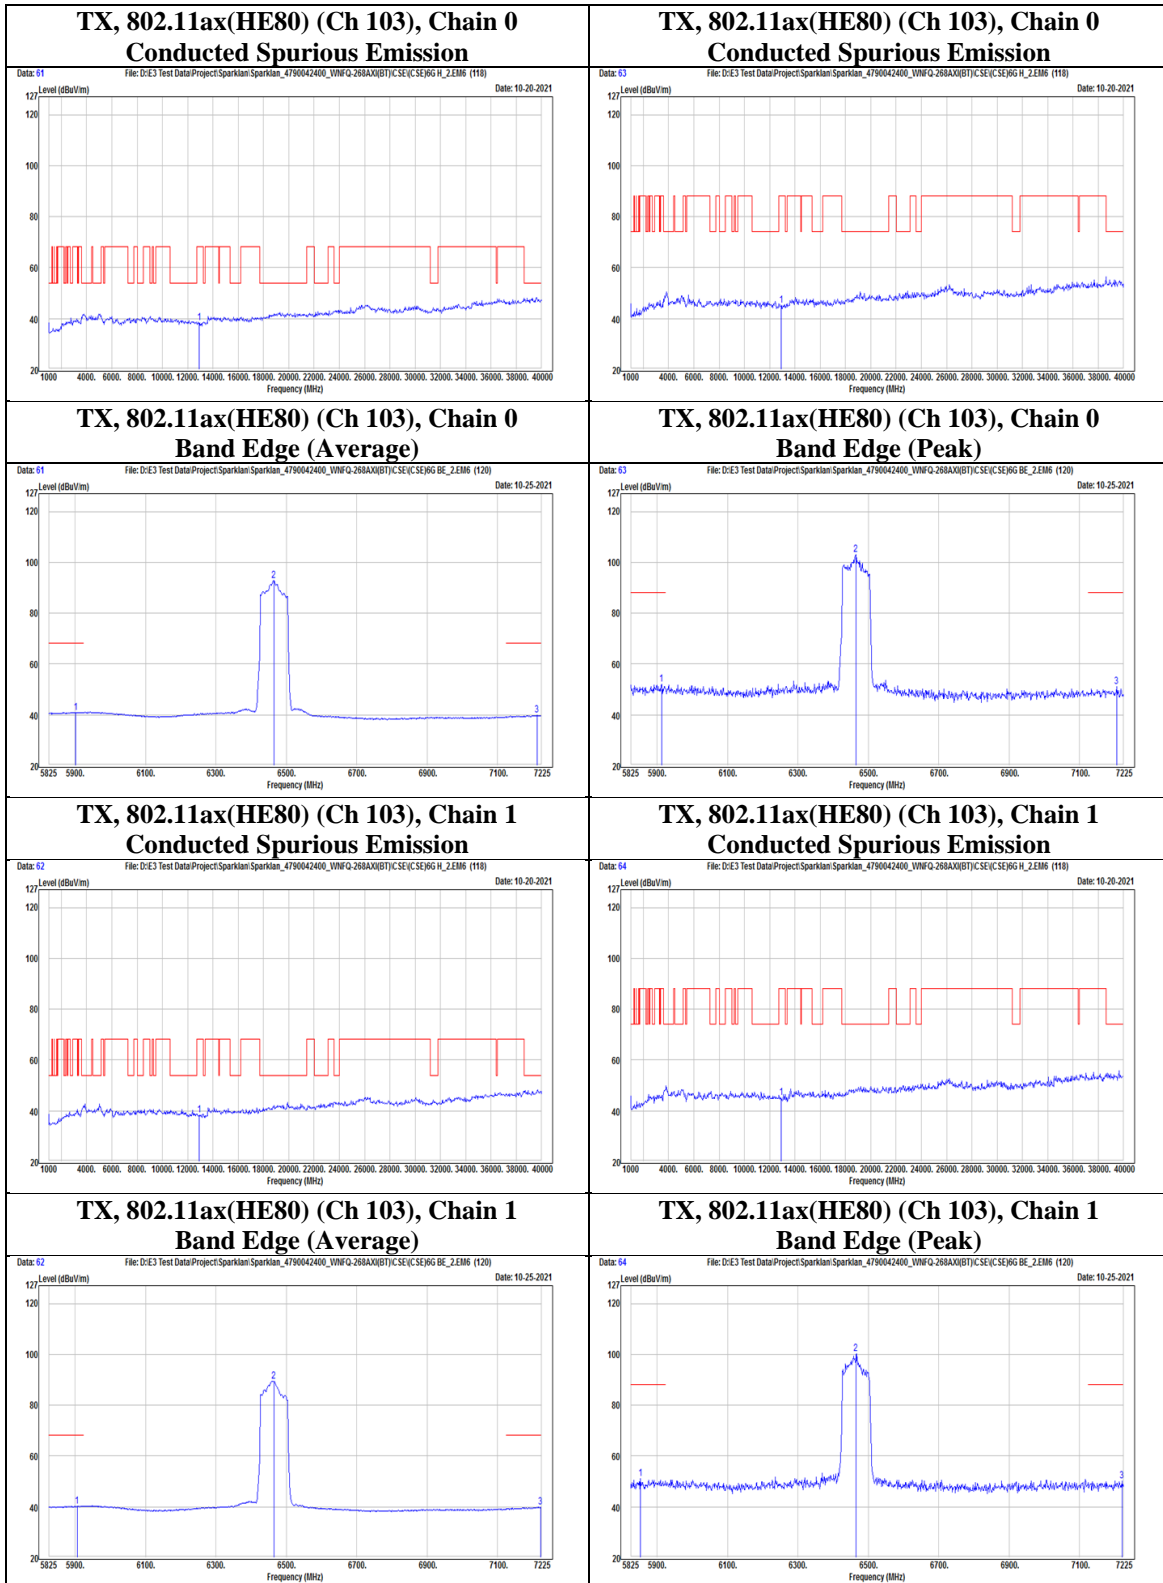



Test report No. : 4790042400-US-R2-V0
Page : 327 of 395
Issued date : 2022/1/28
FCC ID : RYK-WNFQ268AXB

Mode	802.11ax(HE80)	Channel	119
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5874	63.21	-11.74	51.47	88.2	-36.73	PK
		5892.2	52.87	-11.74	41.13	68.2	-27.07	AVG
	@	6545	113.28	-11.74	101.54	N/A	N/A	PK
	@	6545	103.96	-11.74	92.22	N/A	N/A	AVG
		7190	62.74	-11.74	51	88.2	-37.2	PK
		7216.6	51.66	-11.74	39.92	68.2	-28.28	AVG
		13090	57.08	-11.74	45.34	88.2	-42.86	PK
		13090	50.63	-11.74	38.89	68.2	-29.31	AVG
Chain 1		5843.2	64.19	-11.74	52.45	88.2	-35.75	PK
		5907.6	52.04	-11.74	40.3	68.2	-27.9	AVG
	@	6545	110.62	-11.74	98.88	N/A	N/A	PK
	@	6545	100.26	-11.74	88.52	N/A	N/A	AVG
		7198.4	51.5	-11.74	39.76	68.2	-28.44	AVG
		7219.4	62.88	-11.74	51.14	88.2	-37.06	PK
		13090	57.65	-11.74	45.91	88.2	-42.29	PK
		13090	50.4	-11.74	38.66	68.2	-29.54	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

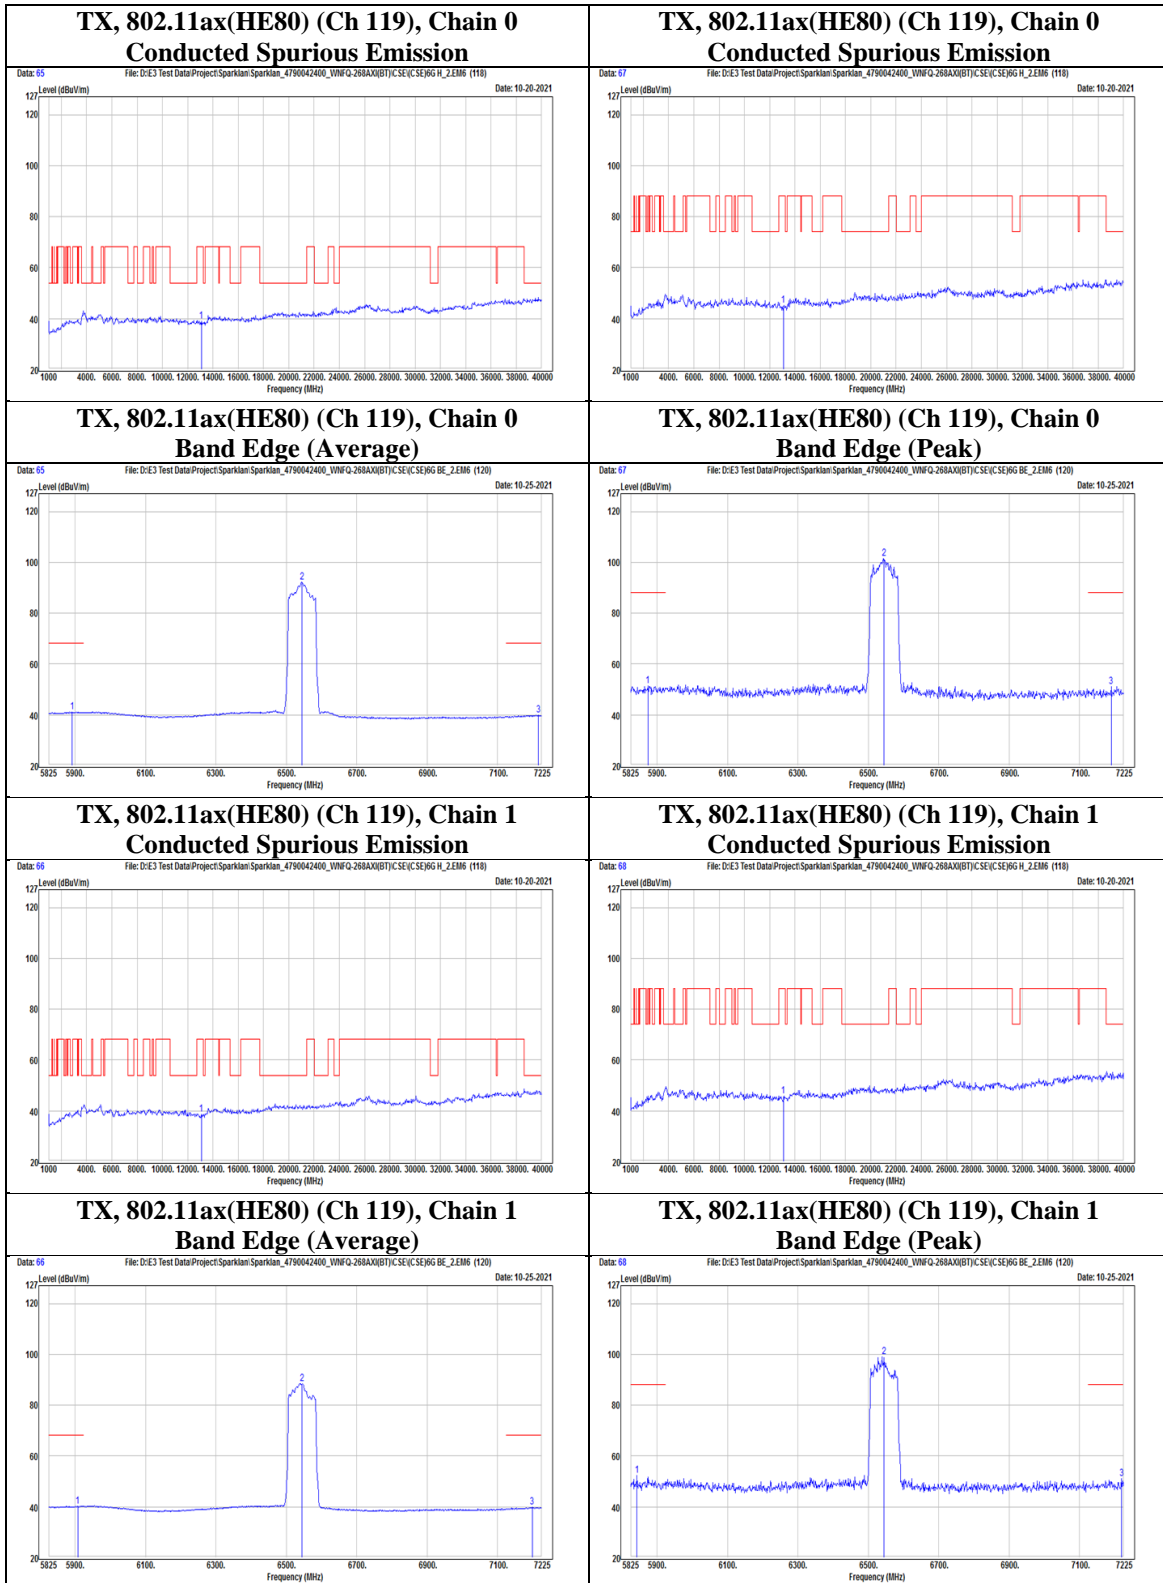



Mode	802.11ax(HE80)	Channel	135
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5903.4	64.2	-11.74	52.46	88.2	-35.74	PK
		5914.6	52.83	-11.74	41.09	68.2	-27.11	AVG
	@	6625	115.94	-11.74	104.2	N/A	N/A	PK
	@	6625	103.5	-11.74	91.76	N/A	N/A	AVG
		7220.8	51.57	-11.74	39.83	68.2	-28.37	AVG
		7223.6	62.56	-11.74	50.82	88.2	-37.38	PK
		13250	57.97	-11.74	46.23	74	-27.77	PK
		13250	50.19	-11.74	38.45	54	-15.55	AVG
Chain 1		5855.8	63.81	-11.74	52.07	88.2	-36.13	PK
		5921.6	52.03	-11.74	40.29	68.2	-27.91	AVG
	@	6625	109.33	-11.74	97.59	N/A	N/A	PK
	@	6625	99.49	-11.74	87.75	N/A	N/A	AVG
		7141	63.24	-11.74	51.5	88.2	-36.7	PK
		7198.4	51.7	-11.74	39.96	68.2	-28.24	AVG
		13250	56.89	-11.74	45.15	74	-28.85	PK
		13250	51.88	-11.74	40.14	54	-13.86	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

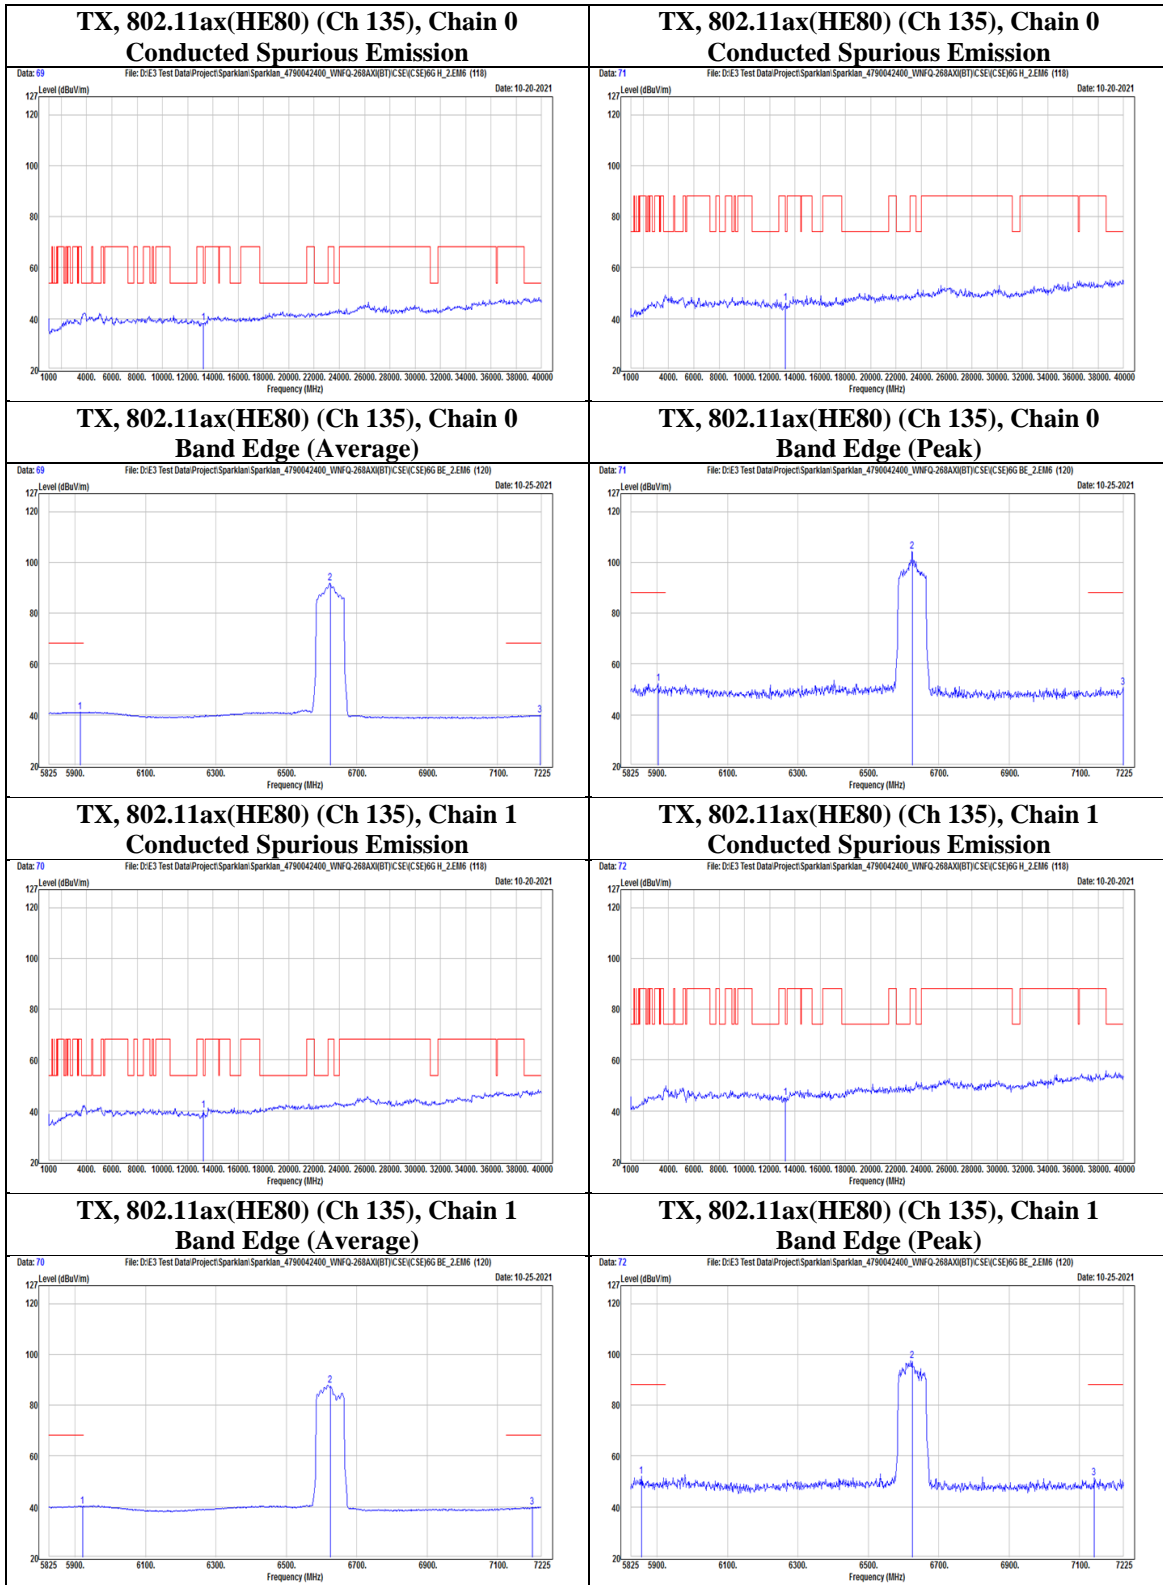



Mode	802.11ax(HE80)	Channel	151
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5896.4	52.6	-11.74	40.86	68.2	-27.34	AVG
		5914.6	63.64	-11.74	51.9	88.2	-36.3	PK
	@	6705	113.21	-11.74	101.47	N/A	N/A	PK
	@	6705	103.62	-11.74	91.88	N/A	N/A	AVG
		7187.2	62.06	-11.74	50.32	88.2	-37.88	PK
		7190	51.59	-11.74	39.85	68.2	-28.35	AVG
		13410	57.28	-11.74	45.54	88.2	-42.66	PK
		13410	50.28	-11.74	38.54	68.2	-29.66	AVG
Chain 1		5895	63.55	-11.74	51.81	88.2	-36.39	PK
		5916	51.97	-11.74	40.23	68.2	-27.97	AVG
	@	6705	109.44	-11.74	97.7	N/A	N/A	PK
	@	6705	98.74	-11.74	87	N/A	N/A	AVG
		7160.6	62.02	-11.74	50.28	88.2	-37.92	PK
		7206.8	51.49	-11.74	39.75	68.2	-28.45	AVG
		13410	57.45	-11.74	45.71	88.2	-42.49	PK
		13410	50.77	-11.74	39.03	68.2	-29.17	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

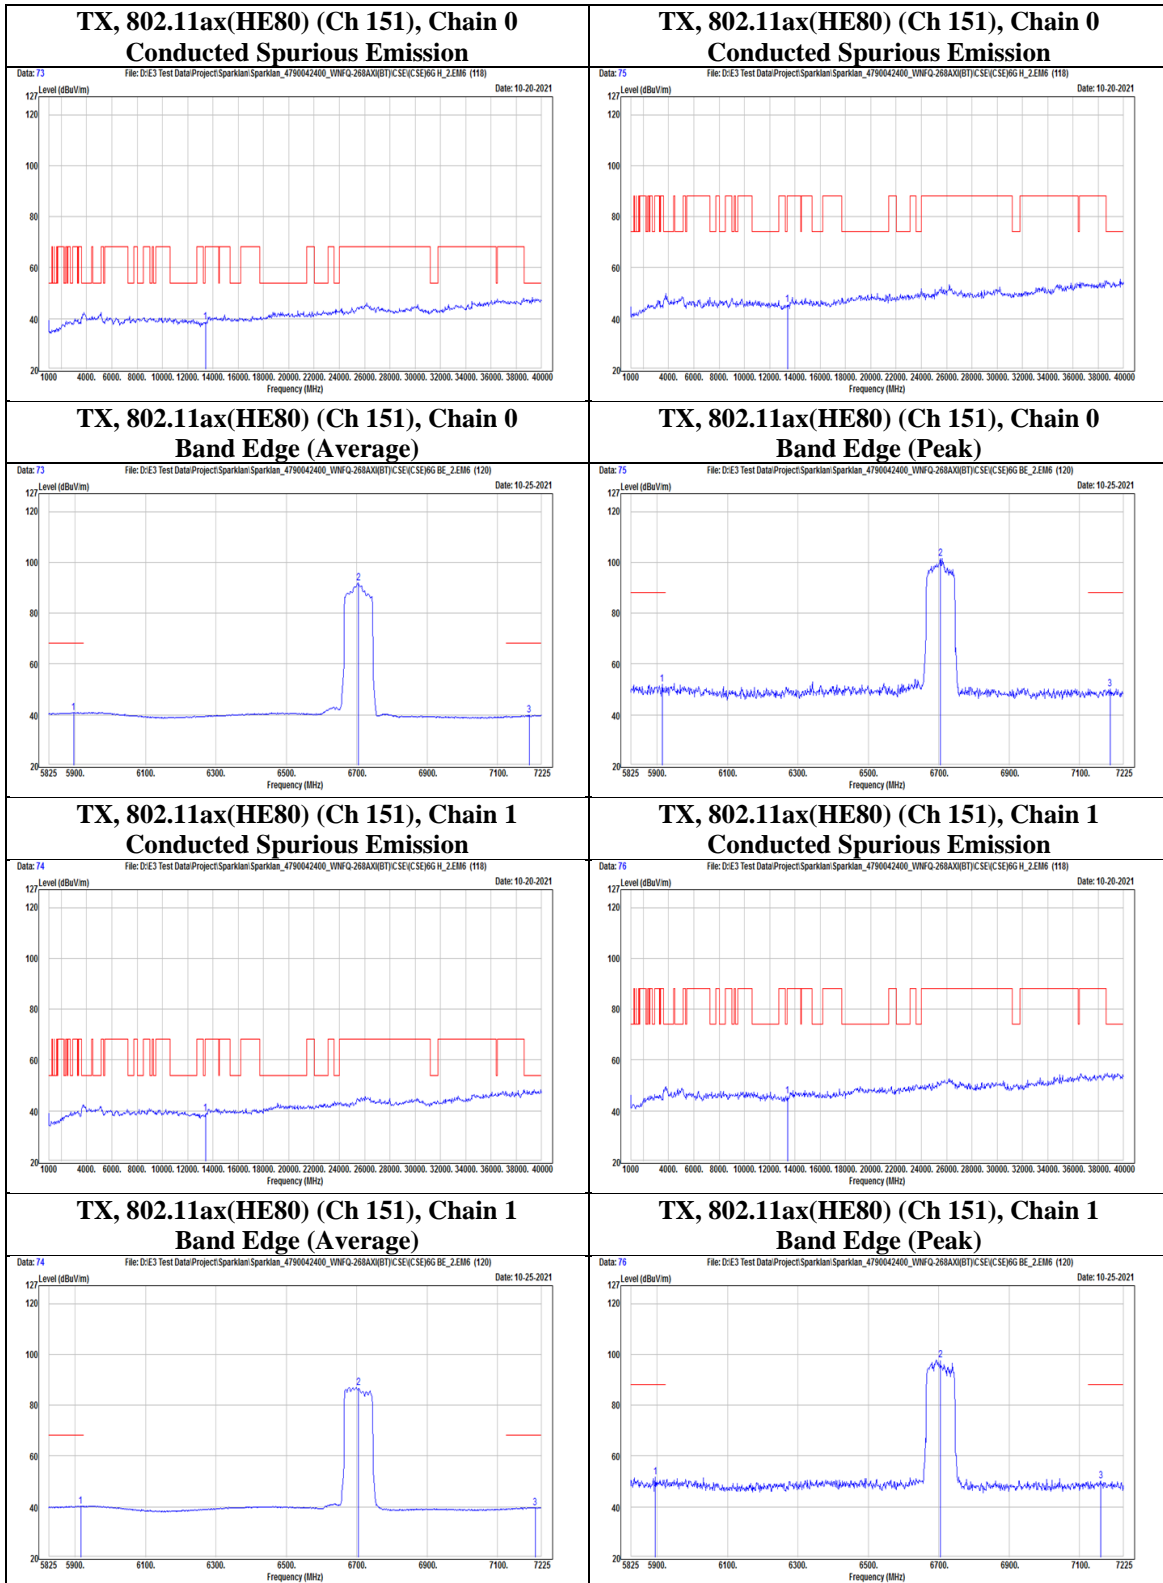



Mode	802.11ax(HE80)	Channel	167
------	----------------	---------	-----

TX Chain	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Chain 0		5850.2	63.96	-11.74	52.22	88.2	-35.98	PK
		5918.8	52.63	-11.74	40.89	68.2	-27.31	AVG
	@	6785	112.55	-11.74	100.81	N/A	N/A	PK
	@	6785	104.2	-11.74	92.46	N/A	N/A	AVG
		7190	62.9	-11.74	51.16	88.2	-37.04	PK
		7201.2	51.55	-11.74	39.81	68.2	-28.39	AVG
		13570	58.53	-11.74	46.79	88.2	-41.41	PK
		13570	52.67	-11.74	40.93	68.2	-27.27	AVG
Chain 1		5900.6	64.21	-11.74	52.47	88.2	-35.73	PK
		5918.8	52.09	-11.74	40.35	68.2	-27.85	AVG
	@	6785	108.59	-11.74	96.85	N/A	N/A	PK
	@	6785	101.11	-11.74	89.37	N/A	N/A	AVG
		7163.4	62.91	-11.74	51.17	88.2	-37.03	PK
		7190	51.6	-11.74	39.86	68.2	-28.34	AVG
		13570	58.68	-11.74	46.94	88.2	-41.26	PK
		13570	52.5	-11.74	40.76	68.2	-27.44	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948