



Mode	802.11a	Channel	117
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5902	41.59	14.98	56.57	88.2	-31.63	PK
		5909	30.68	14.97	45.65	68.2	-22.55	AVG
	@	6535	63.85	17.33	81.18	N/A	N/A	PK
	@	6535	59.3	17.33	76.63	N/A	N/A	AVG
		7178.8	39.96	20.01	59.97	88.2	-28.23	PK
		7220.8	30.24	20.23	50.47	68.2	-17.73	AVG
	*	13070	27.45	21.01	48.46	88.2	-39.74	PK
Vertical		5848.8	40.94	14.61	55.55	88.2	-32.65	PK
		5916	30.59	14.97	45.56	68.2	-22.64	AVG
	@	6535	80.25	17.33	97.58	N/A	N/A	PK
	@	6535	72.14	17.33	89.47	N/A	N/A	AVG
		7208.2	39.87	20.17	60.04	88.2	-28.16	PK
		7209.6	29.98	20.18	50.16	68.2	-18.04	AVG
	*	13070	27.66	21.01	48.67	88.2	-39.53	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

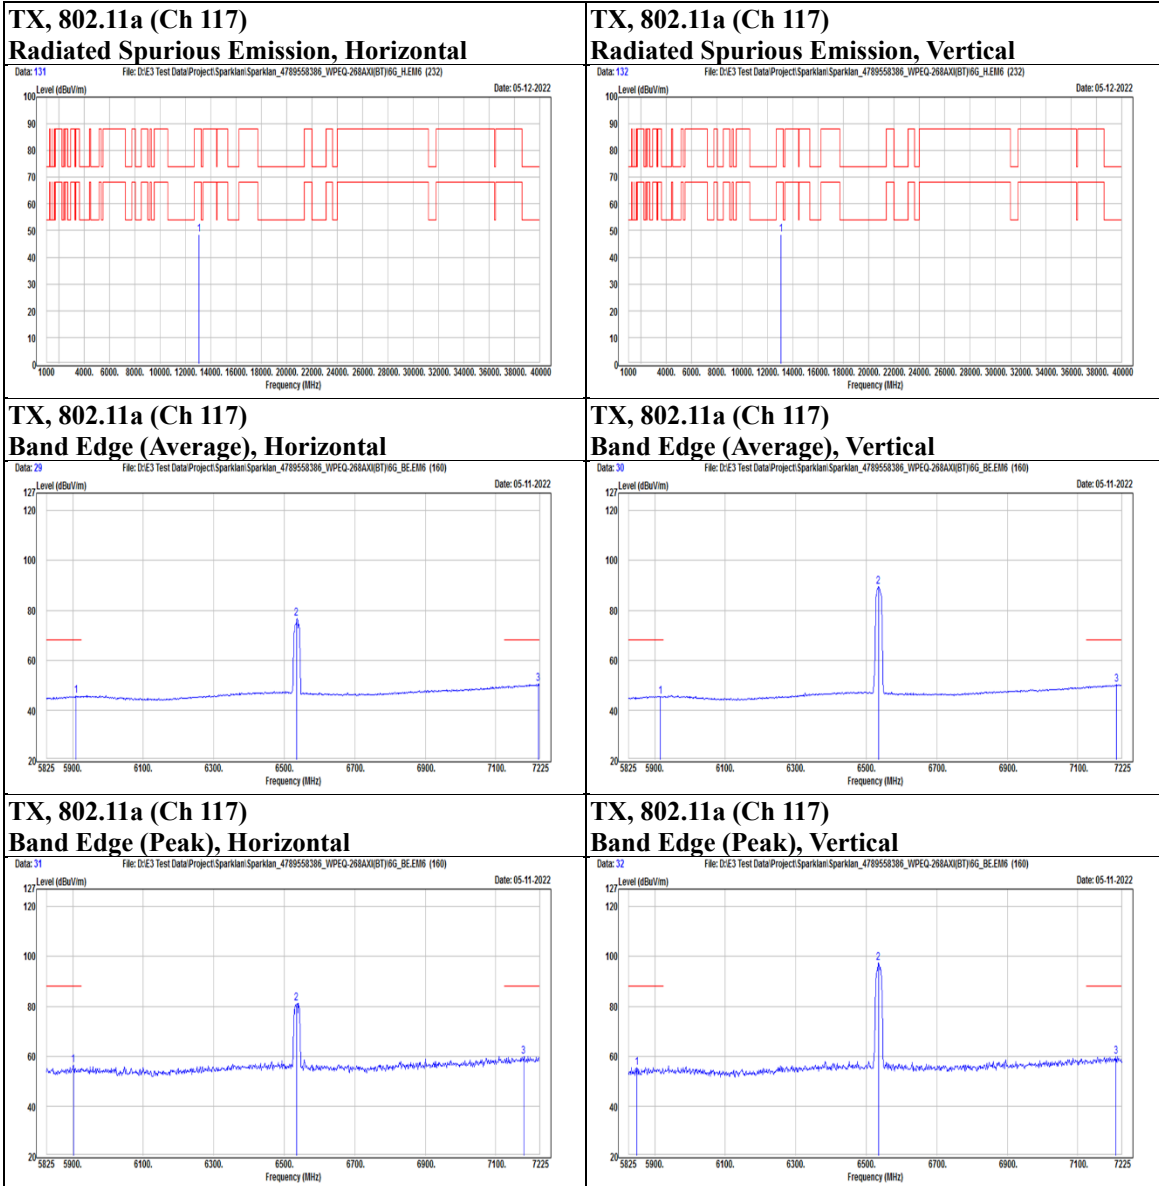



Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5882.4	41.59	14.85	56.44	88.2	-31.76	PK
		5917.4	30.76	14.97	45.73	68.2	-22.47	AVG
	@	6695	67.42	17.5	84.92	N/A	N/A	PK
	@	6695	61.78	17.5	79.28	N/A	N/A	AVG
		7206.8	40.09	20.16	60.25	88.2	-27.95	PK
		7223.6	29.96	20.25	50.21	68.2	-17.99	AVG
	*	13390	27.88	22.07	49.95	74	-24.05	PK
Vertical		5892.2	40.75	14.92	55.67	88.2	-32.53	PK
		5920.2	30.66	14.96	45.62	68.2	-22.58	AVG
	@	6695	80.81	17.5	98.31	N/A	N/A	PK
	@	6695	72.6	17.5	90.1	N/A	N/A	AVG
		7211	40.87	20.18	61.05	88.2	-27.15	PK
		7225	29.97	20.26	50.23	68.2	-17.97	AVG
	*	13390	27.73	22.07	49.8	74	-24.2	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

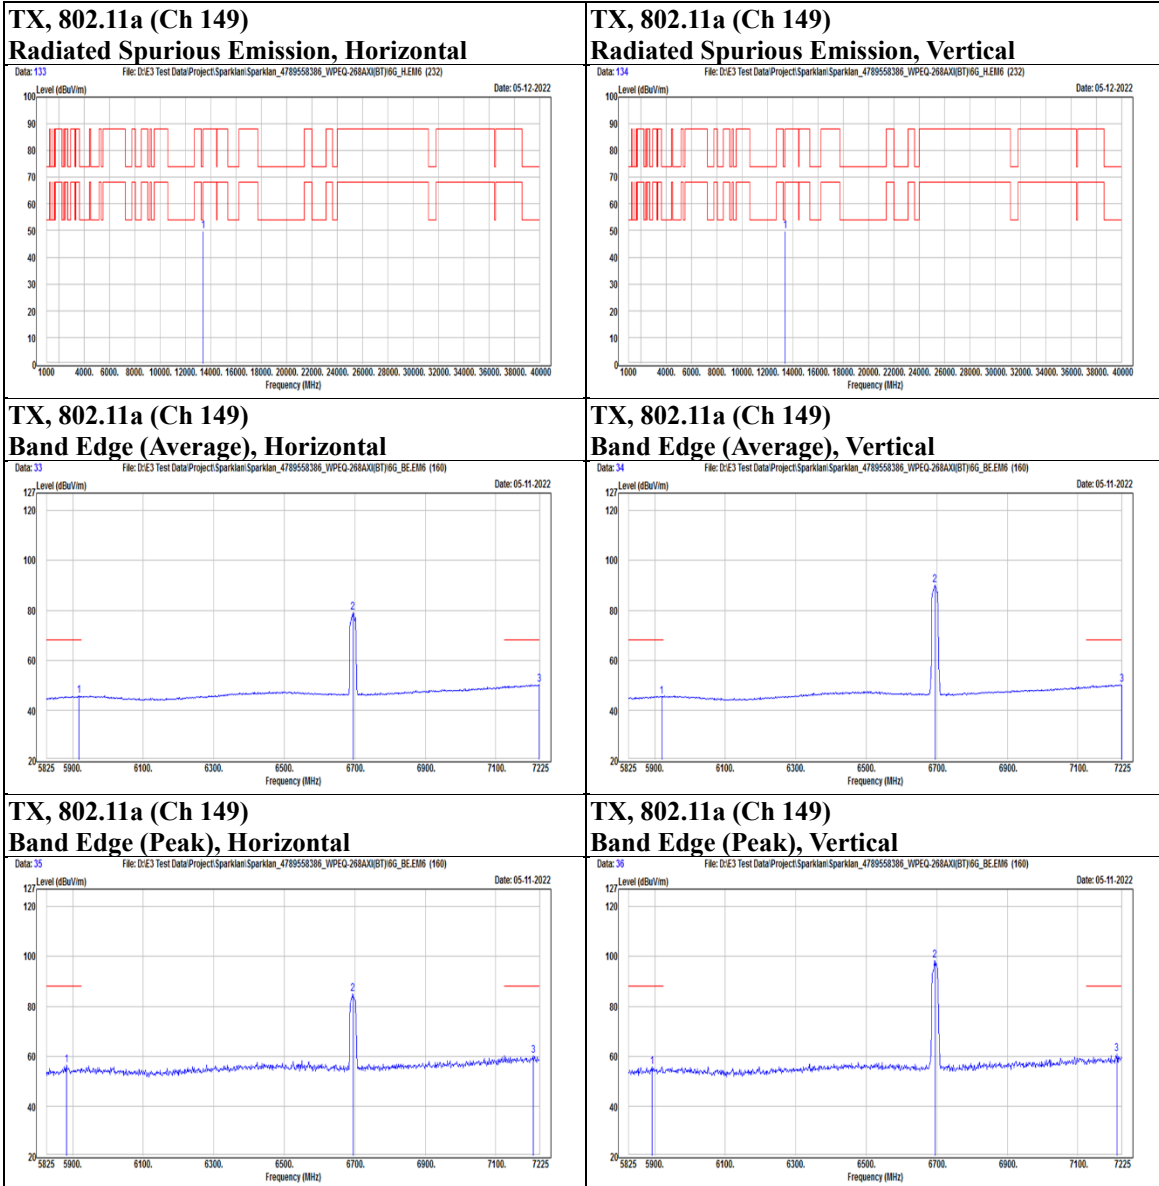



Mode	802.11a	Channel	181
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5861.4	40.62	14.7	55.32	88.2	-32.88	PK
		5909	30.78	14.97	45.75	68.2	-22.45	AVG
	@	6855	67.28	18.28	85.56	N/A	N/A	PK
	@	6855	60	18.28	78.28	N/A	N/A	AVG
		7219.4	39.98	20.23	60.21	88.2	-27.99	PK
		7222.2	30.37	20.25	50.62	68.2	-17.58	AVG
	*	13710	28.2	22.78	50.98	88.2	-37.22	PK
Vertical		5867	31.12	14.74	45.86	68.2	-22.34	AVG
		5911.8	40.33	14.97	55.3	88.2	-32.9	PK
	@	6855	77.76	18.28	96.04	N/A	N/A	PK
	@	6855	72.15	18.28	90.43	N/A	N/A	AVG
		7209.6	39.71	20.18	59.89	88.2	-28.31	PK
		7218	29.98	20.22	50.2	68.2	-18	AVG
	*	13710	28.43	22.78	51.21	88.2	-36.99	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

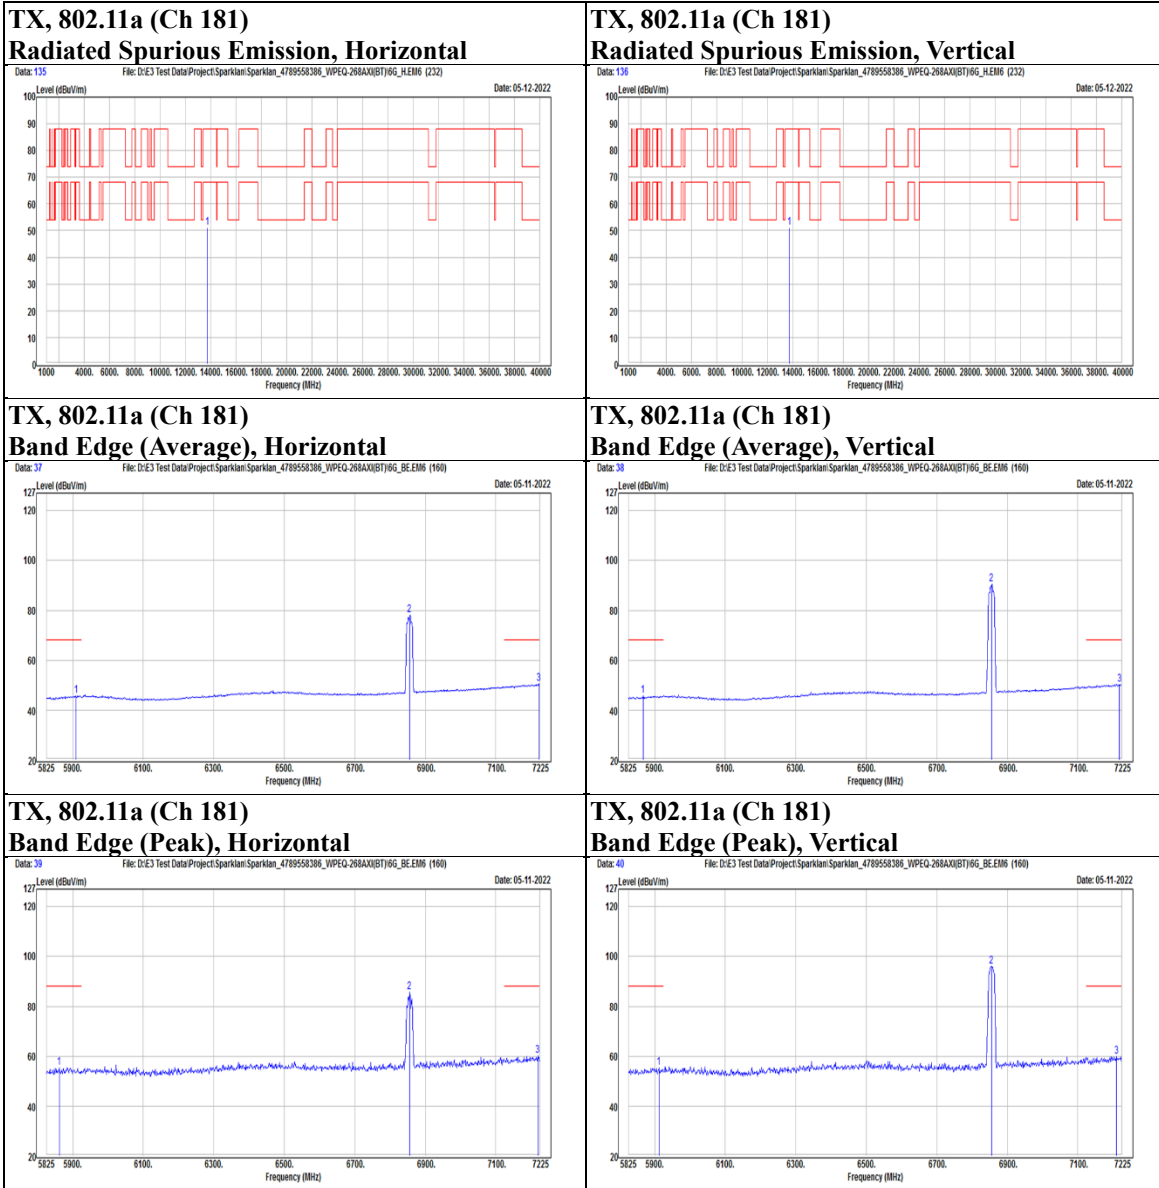



Mode	802.11a	Channel	185
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5889.4	31.03	14.91	45.94	68.2	-22.26	AVG
		5913.2	41.49	14.96	56.45	88.2	-31.75	PK
	@	6875	66.04	18.3	84.34	N/A	N/A	PK
	@	6875	60.04	18.3	78.34	N/A	N/A	AVG
		7198.4	40.36	20.11	60.47	88.2	-27.73	PK
		7211	30.26	20.18	50.44	68.2	-17.76	AVG
	*	13750	28.3	22.94	51.24	88.2	-36.96	PK
Vertical		5865.6	31.04	14.73	45.77	68.2	-22.43	AVG
		5892.2	40.39	14.92	55.31	88.2	-32.89	PK
	@	6875	79.24	18.3	97.54	N/A	N/A	PK
	@	6875	71.99	18.3	90.29	N/A	N/A	AVG
		7156.4	41.07	19.89	60.96	88.2	-27.24	PK
		7215.2	29.91	20.21	50.12	68.2	-18.08	AVG
	*	13750	30.04	22.94	52.98	88.2	-35.22	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

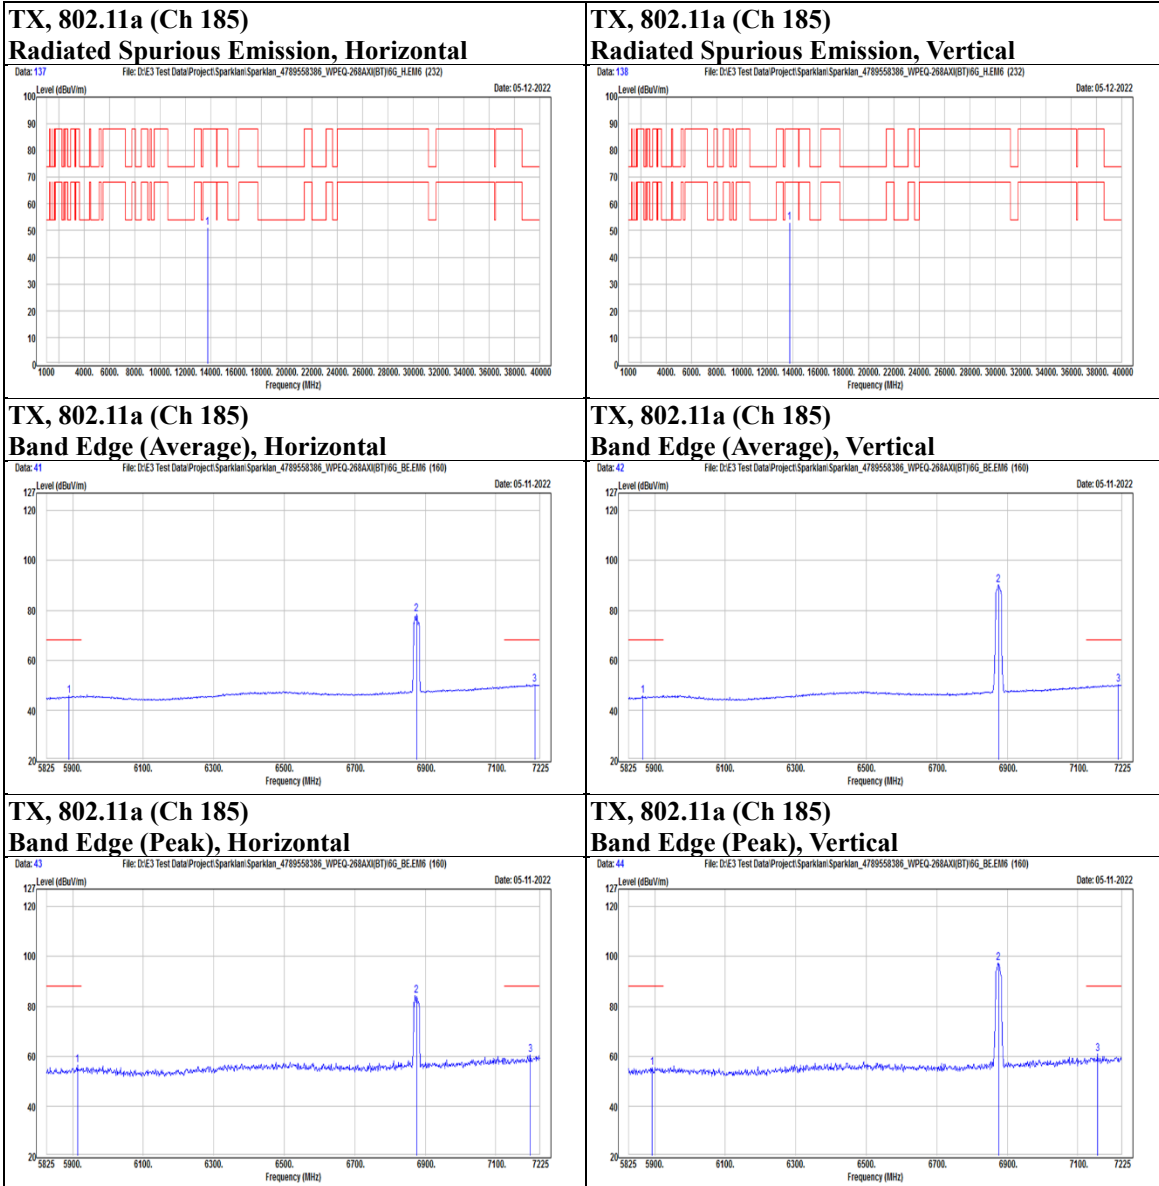



Mode	802.11a	Channel	209
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	6995	63.95	18.71	82.66	N/A	N/A	PK
	@	6995	60.41	18.71	79.12	N/A	N/A	AVG
		7212.4	41.73	20.19	61.92	88.2	-26.28	PK
		7216.6	30.09	20.22	50.31	68.2	-17.89	AVG
	*	13990	28.74	23.87	52.61	88.2	-35.59	PK
Vertical	@	6995	77.03	18.71	95.74	N/A	N/A	PK
	@	6995	71.08	18.71	89.79	N/A	N/A	AVG
		7205.4	30.02	20.15	50.17	68.2	-18.03	AVG
		7223.6	40.17	20.25	60.42	88.2	-27.78	PK
	*	13990	28.69	23.87	52.56	88.2	-35.64	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

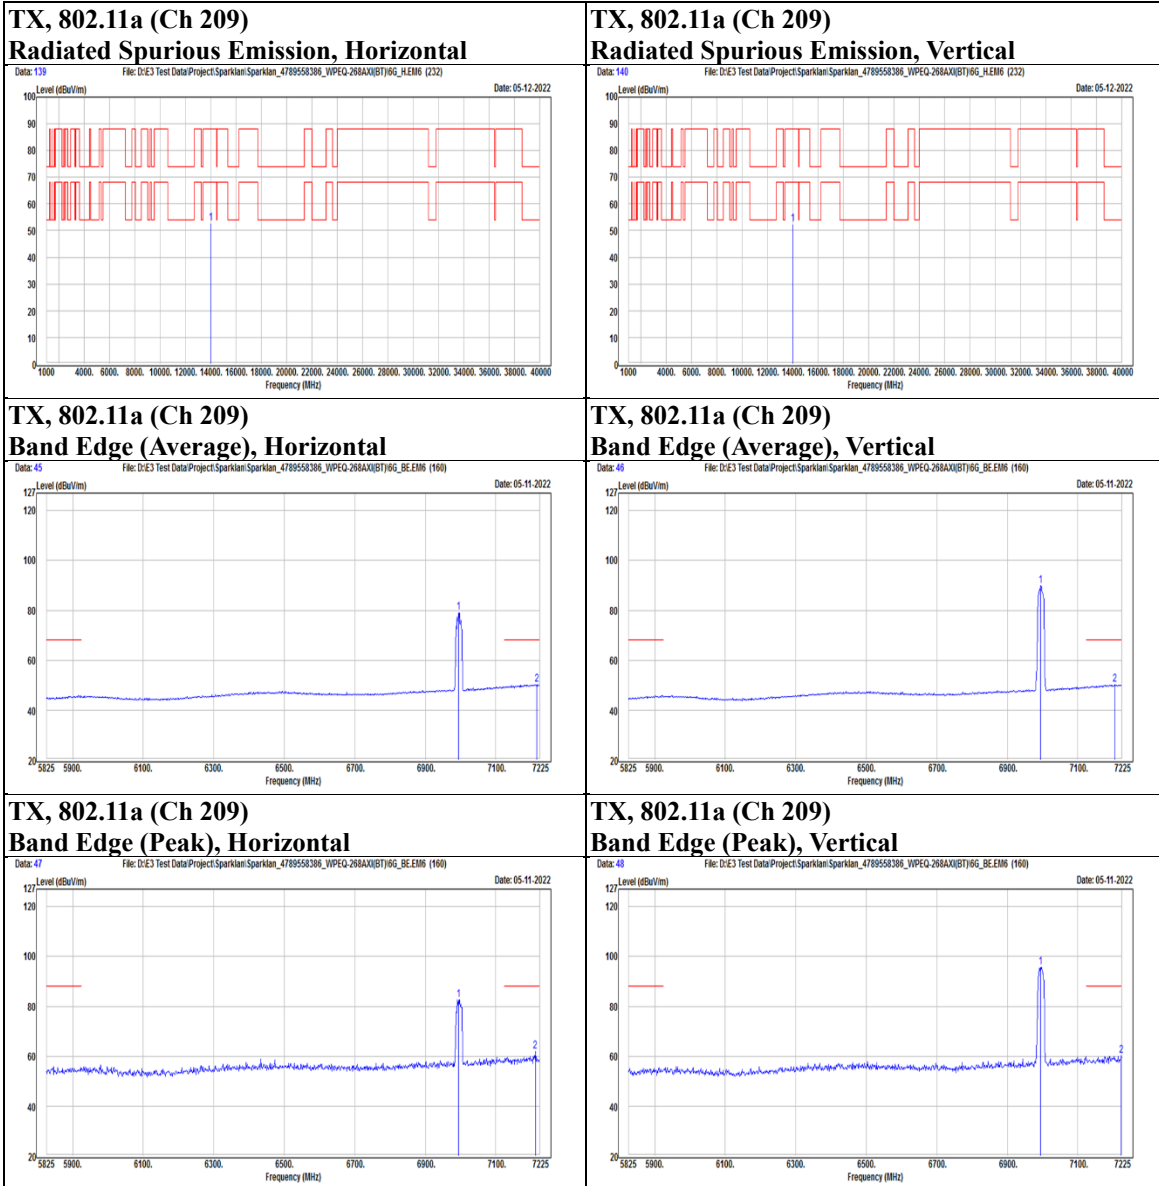



Mode	802.11a	Channel	229
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7095	60.64	19.54	80.18	N/A	N/A	PK
	@	7095	55.84	19.54	75.38	N/A	N/A	AVG
		7218	39.78	20.22	60	88.2	-28.2	PK
		7222.2	30.08	20.25	50.33	68.2	-17.87	AVG
	*	14190	28.62	24.68	53.3	88.2	-34.9	PK
Vertical	@	7095	75.71	19.54	95.25	N/A	N/A	PK
	@	7095	69.39	19.54	88.93	N/A	N/A	AVG
		7213.8	39.65	20.2	59.85	88.2	-28.35	PK
		7219.4	30.01	20.23	50.24	68.2	-17.96	AVG
	*	14190	28.23	24.68	52.91	88.2	-35.29	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

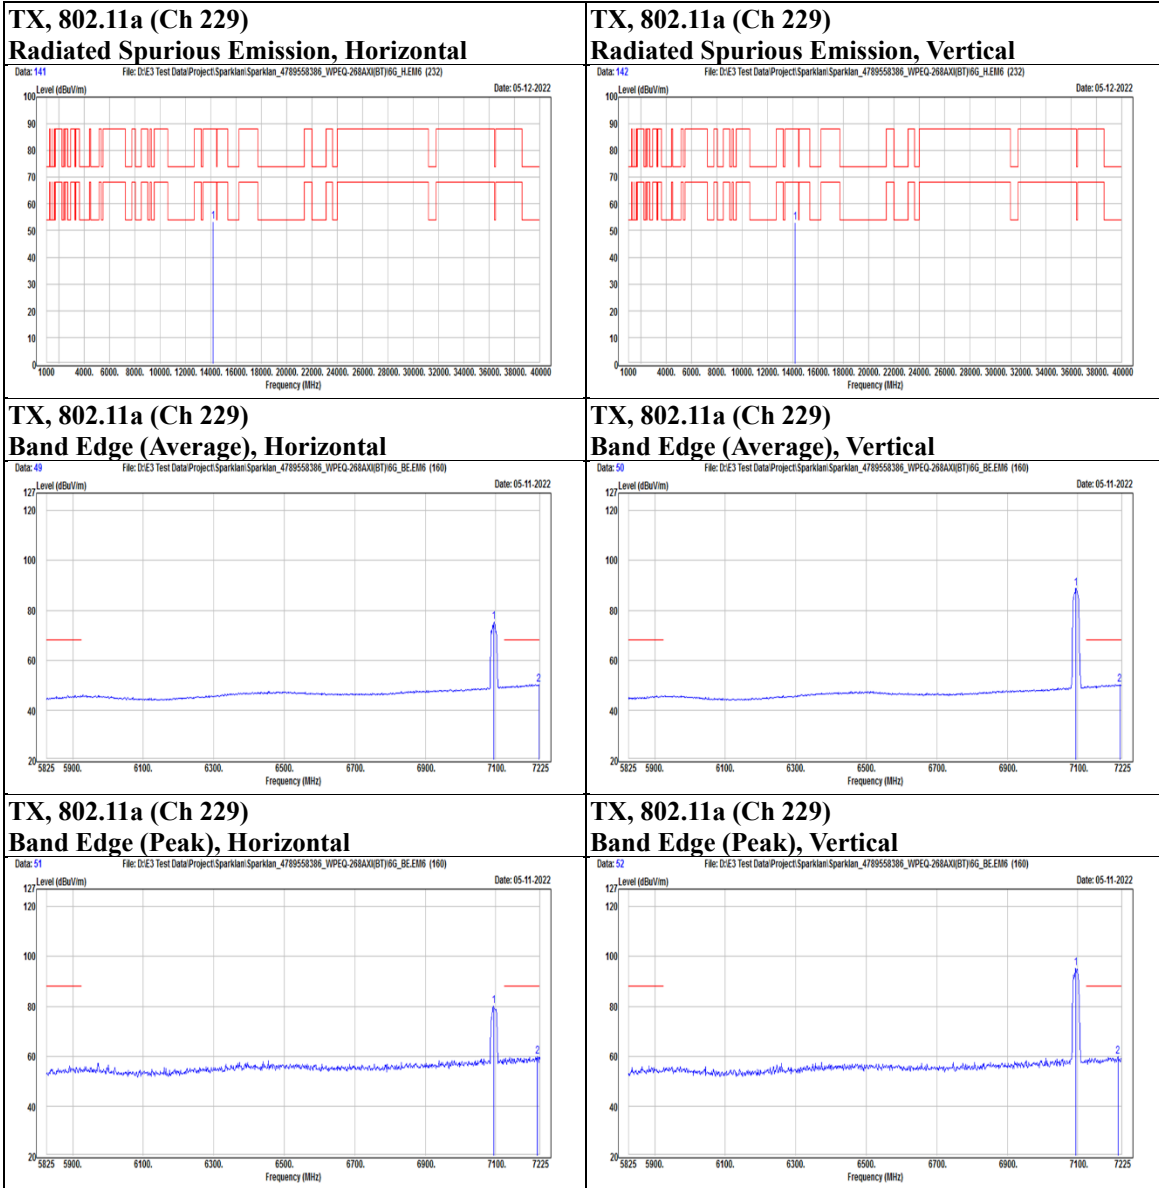



Mode	802.11a	Channel	233
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7115	61.83	19.66	81.49	N/A	N/A	PK
	@	7115	55.03	19.66	74.69	N/A	N/A	AVG
		7125	50.78	19.71	70.49	88.2	-17.71	PK
		7125	38.6	19.71	58.31	68.2	-9.89	AVG
	*	14230	29.1	24.79	53.89	88.2	-34.31	PK
Vertical	@	7115	75.33	19.66	94.99	N/A	N/A	PK
	@	7115	69.28	19.66	88.94	N/A	N/A	AVG
		7125	65.6	19.71	85.31	88.2	-2.89	PK
		7125.6	38.57	19.72	58.29	68.2	-9.91	AVG
	*	14230	28.76	24.79	53.55	88.2	-34.65	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

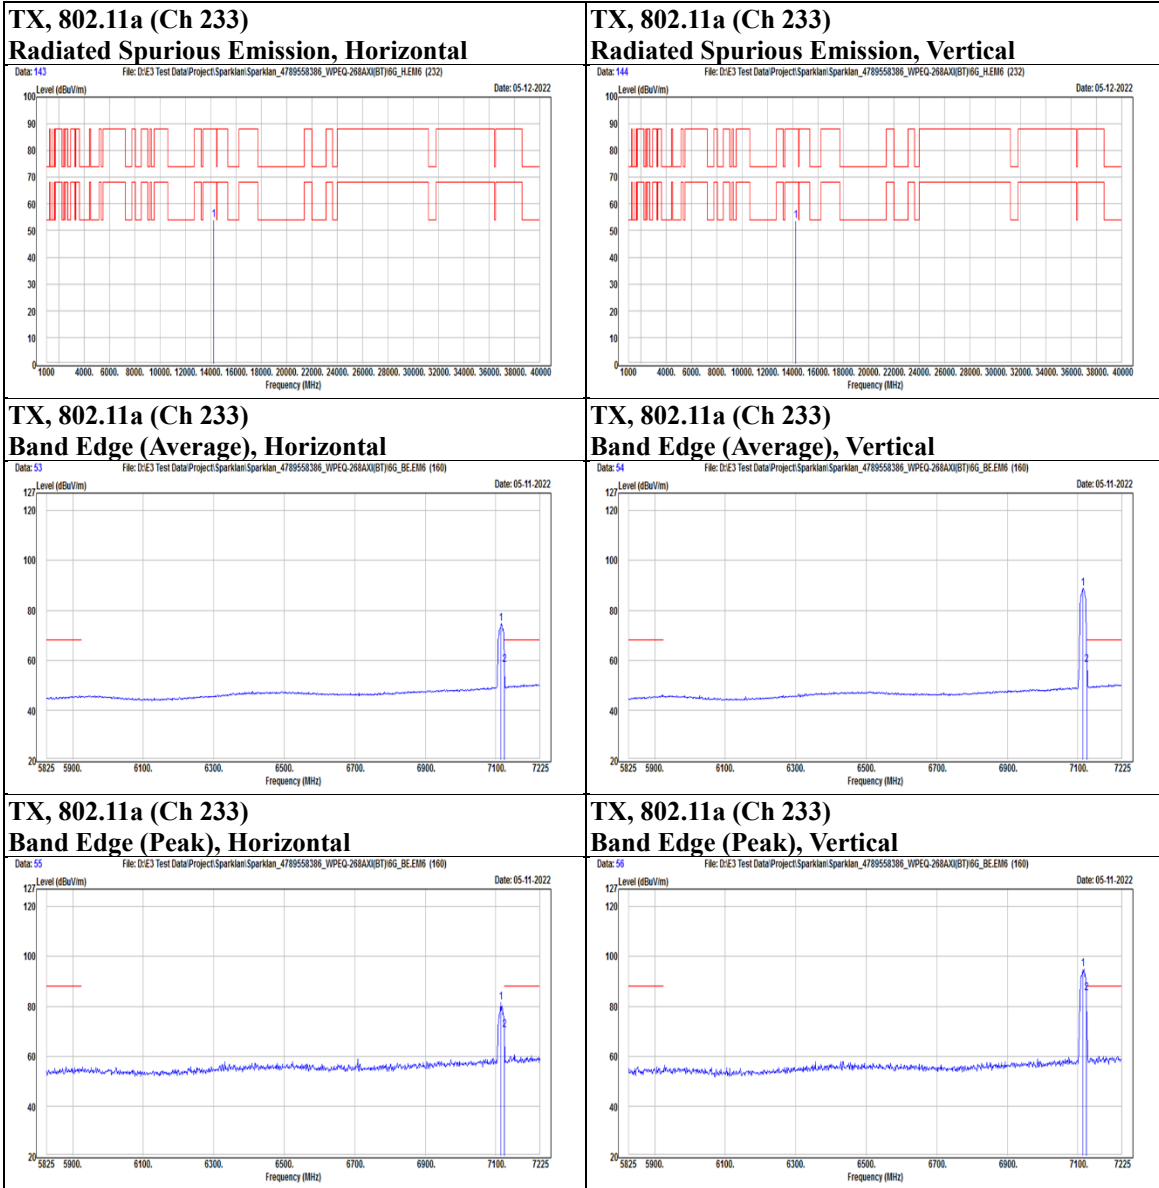



Mode	802.11ax(HE20)	Channel	2
------	----------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5924.4	55.73	14.96	70.69	88.2	-17.51	PK
		5924.4	44.26	14.96	59.22	68.2	-8.98	AVG
	@	5935	74.01	14.95	88.96	N/A	N/A	PK
	@	5935	66.26	14.95	81.21	N/A	N/A	AVG
	*	11870	28.51	18.7	47.21	74	-26.79	PK
Vertical		5924.4	64.73	14.96	79.69	88.2	-8.51	PK
		5924.4	50.53	14.96	65.49	68.2	-2.71	AVG
	@	5935	84.07	14.95	99.02	N/A	N/A	PK
	@	5935	74.59	14.95	89.54	N/A	N/A	AVG
	*	11870	28.64	18.7	47.34	74	-26.66	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

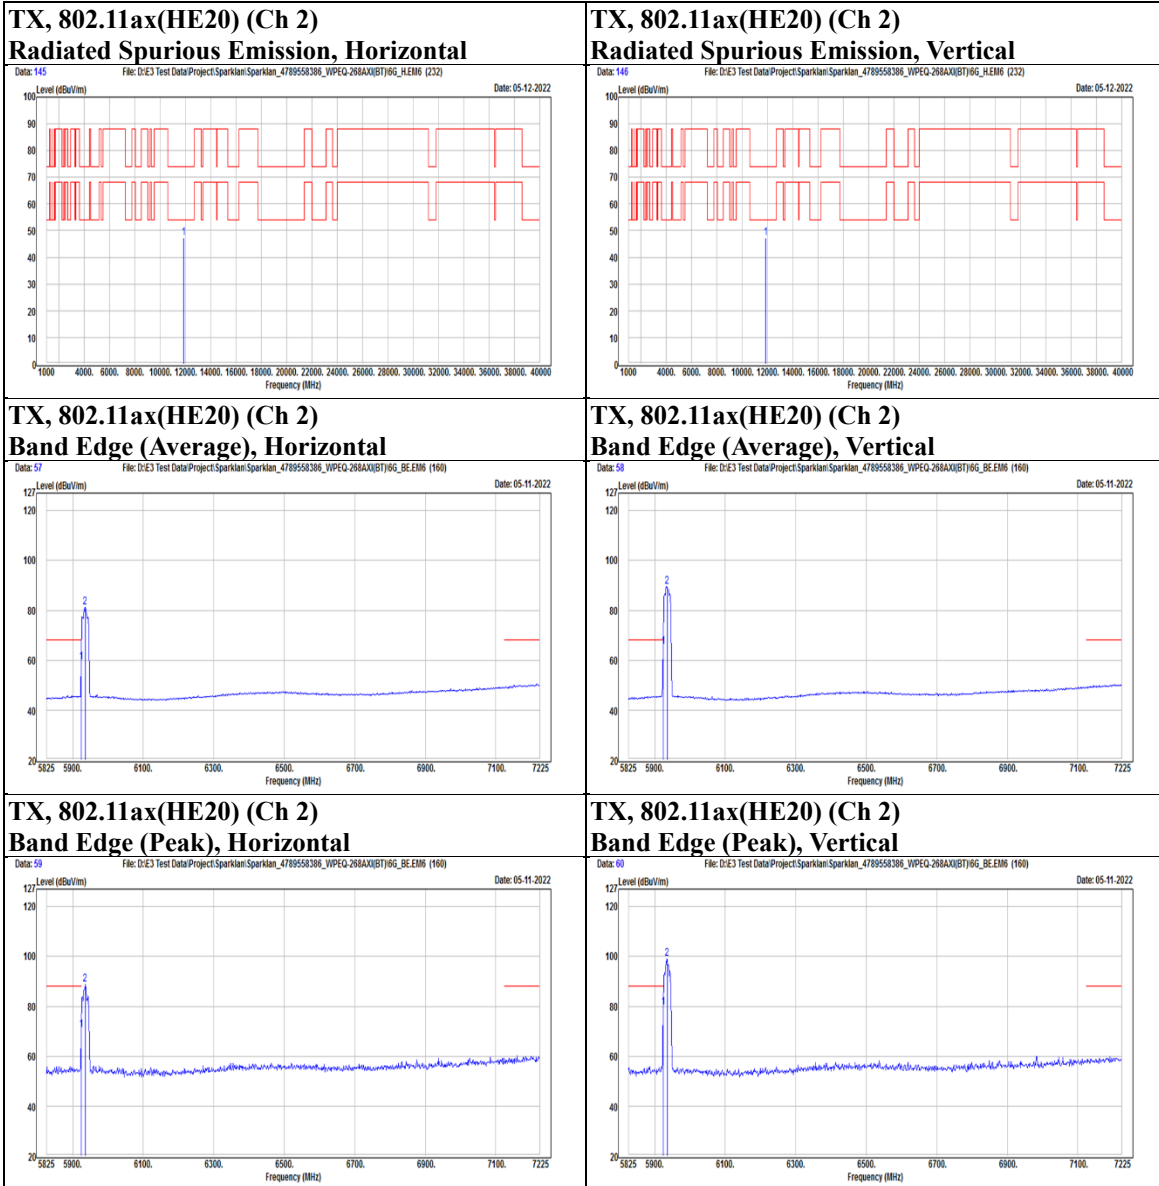



Mode	802.11ax(HE20)	Channel	1
------	----------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5907.6	30.77	14.97	45.74	68.2	-22.46	AVG
		5910.4	41.5	14.97	56.47	88.2	-31.73	PK
	@	5955	72.14	14.95	87.09	N/A	N/A	PK
	@	5955	66.11	14.95	81.06	N/A	N/A	AVG
	*	11910	28.81	18.84	47.65	74	-26.35	PK
Vertical		5892.2	41.12	14.92	56.04	88.2	-32.16	PK
		5895	31.3	14.94	46.24	68.2	-21.96	AVG
	@	5955	83.28	14.95	98.23	N/A	N/A	PK
	@	5955	74.58	14.95	89.53	N/A	N/A	AVG
	*	11910	27.78	18.84	46.62	74	-27.38	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

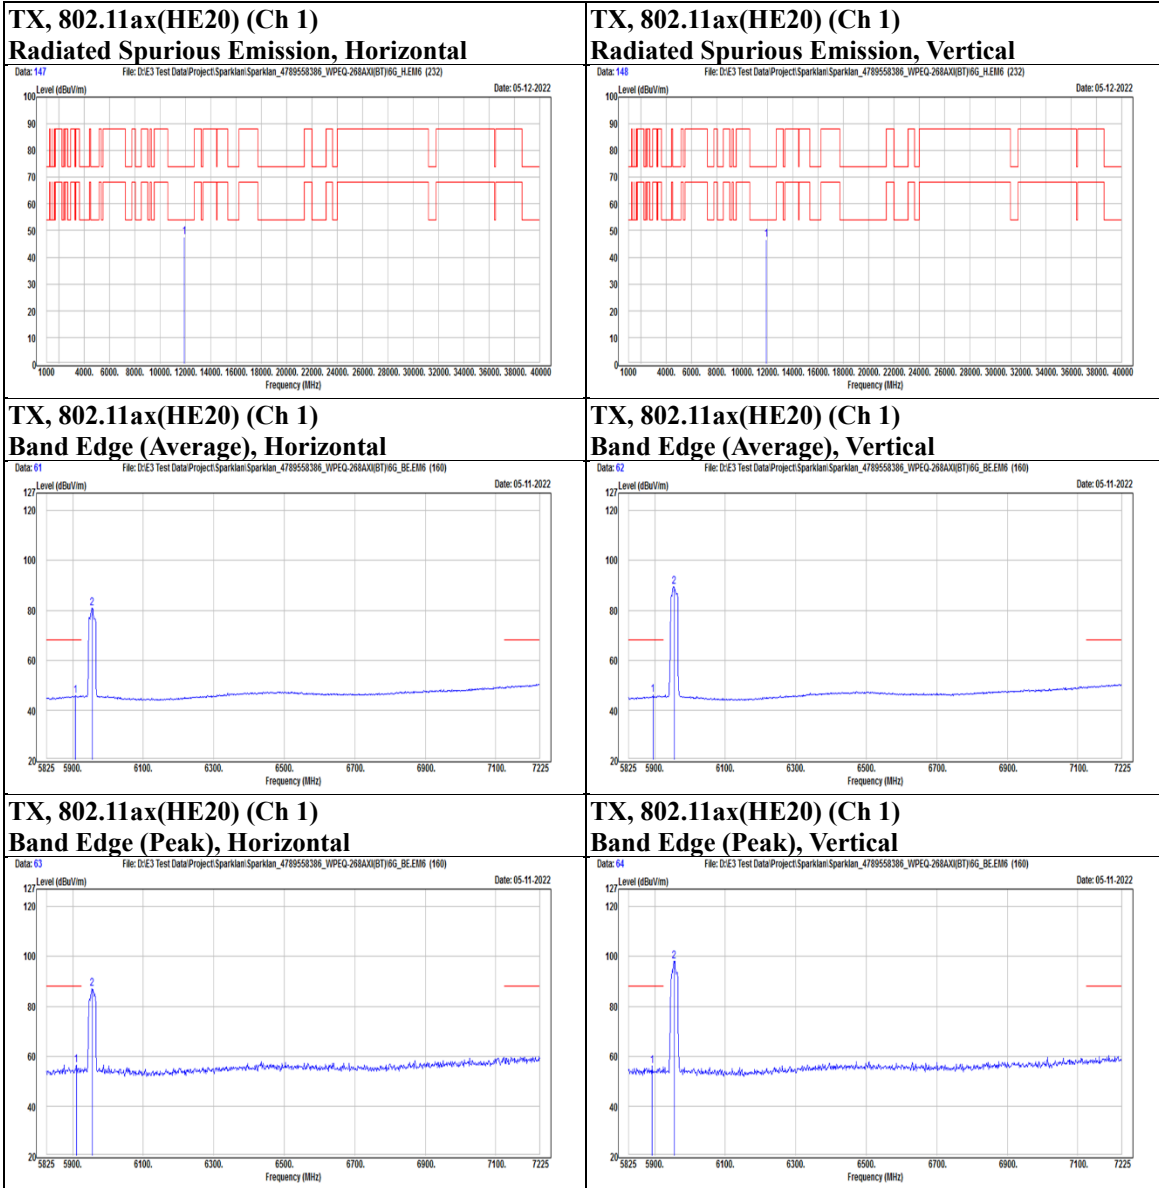



Mode	802.11ax(HE20)	Channel	45
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5869.8	41.28	14.76	56.04	88.2	-32.16	PK
		5900.6	30.78	14.98	45.76	68.2	-22.44	AVG
	@	6175	64.44	15.52	79.96	N/A	N/A	PK
	@	6175	57.74	15.52	73.26	N/A	N/A	AVG
	*	12350	28.45	19.25	47.7	74	-26.3	PK
Vertical		5910.4	41.1	14.97	56.07	88.2	-32.13	PK
		5914.6	30.67	14.96	45.63	68.2	-22.57	AVG
	@	6175	82.65	15.52	98.17	N/A	N/A	PK
	@	6175	73.95	15.52	89.47	N/A	N/A	AVG
	*	12350	28.06	19.25	47.31	74	-26.69	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

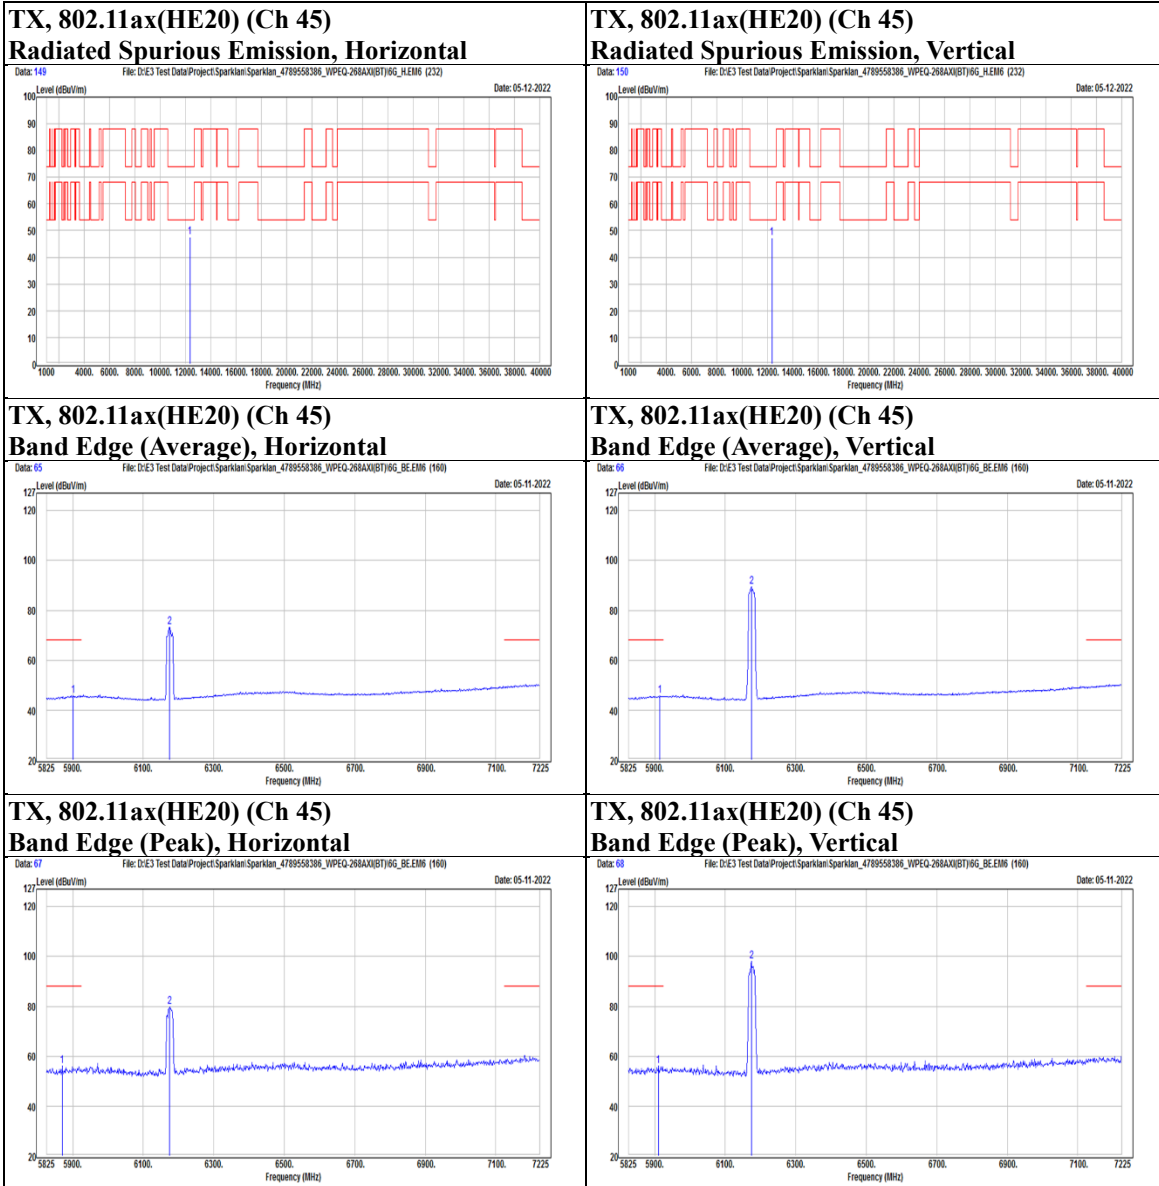



Mode	802.11ax(HE20)	Channel	93
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5869.8	30.91	14.76	45.67	68.2	-22.53	AVG
		5911.8	41.45	14.97	56.42	88.2	-31.78	PK
	@	6415	67.06	16.72	83.78	N/A	N/A	PK
	@	6415	59.88	16.72	76.6	N/A	N/A	AVG
		7166.2	40.04	19.93	59.97	88.2	-28.23	PK
		7225	29.95	20.26	50.21	68.2	-17.99	AVG
	*	12830	28.29	20.62	48.91	88.2	-39.29	PK
Vertical		5840.4	41.03	14.6	55.63	88.2	-32.57	PK
		5923	31.09	14.96	46.05	68.2	-22.15	AVG
	@	6415	80.67	16.72	97.39	N/A	N/A	PK
	@	6415	72.63	16.72	89.35	N/A	N/A	AVG
		7138.2	41.17	19.78	60.95	88.2	-27.25	PK
		7222.2	30.24	20.25	50.49	68.2	-17.71	AVG
	*	12830	28.31	20.62	48.93	88.2	-39.27	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

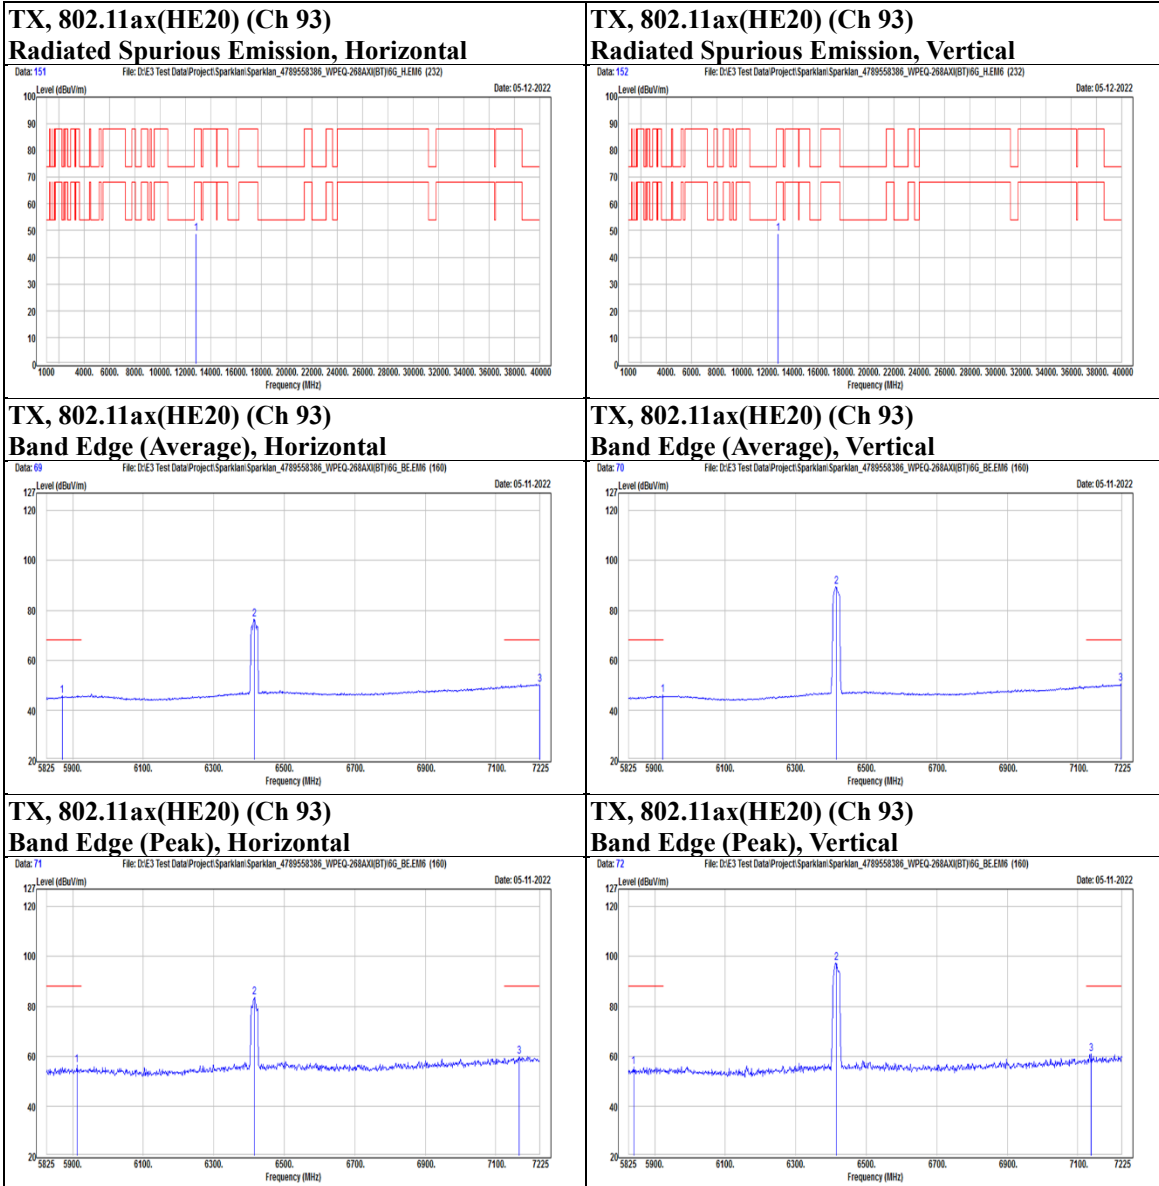



Mode	802.11ax(HE20)	Channel	97
------	----------------	---------	----


Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5834.8	41.07	14.6	55.67	88.2	-32.53	PK
		5916	30.9	14.97	45.87	68.2	-22.33	AVG
	@	6435	67.19	16.78	83.97	N/A	N/A	PK
	@	6435	60.46	16.78	77.24	N/A	N/A	AVG
		7218	30.12	20.22	50.34	68.2	-17.86	AVG
		7223.6	39.87	20.25	60.12	88.2	-28.08	PK
	*	12870	27.5	20.73	48.23	88.2	-39.97	PK
Vertical		5888	30.81	14.9	45.71	68.2	-22.49	AVG
		5906.2	40.87	14.97	55.84	88.2	-32.36	PK
	@	6435	83.68	16.78	100.46	N/A	N/A	PK
	@	6435	73.27	16.78	90.05	N/A	N/A	AVG
		7180.2	41	20.02	61.02	88.2	-27.18	PK
		7223.6	30.2	20.25	50.45	68.2	-17.75	AVG
	*	12870	27.23	20.73	47.96	88.2	-40.24	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

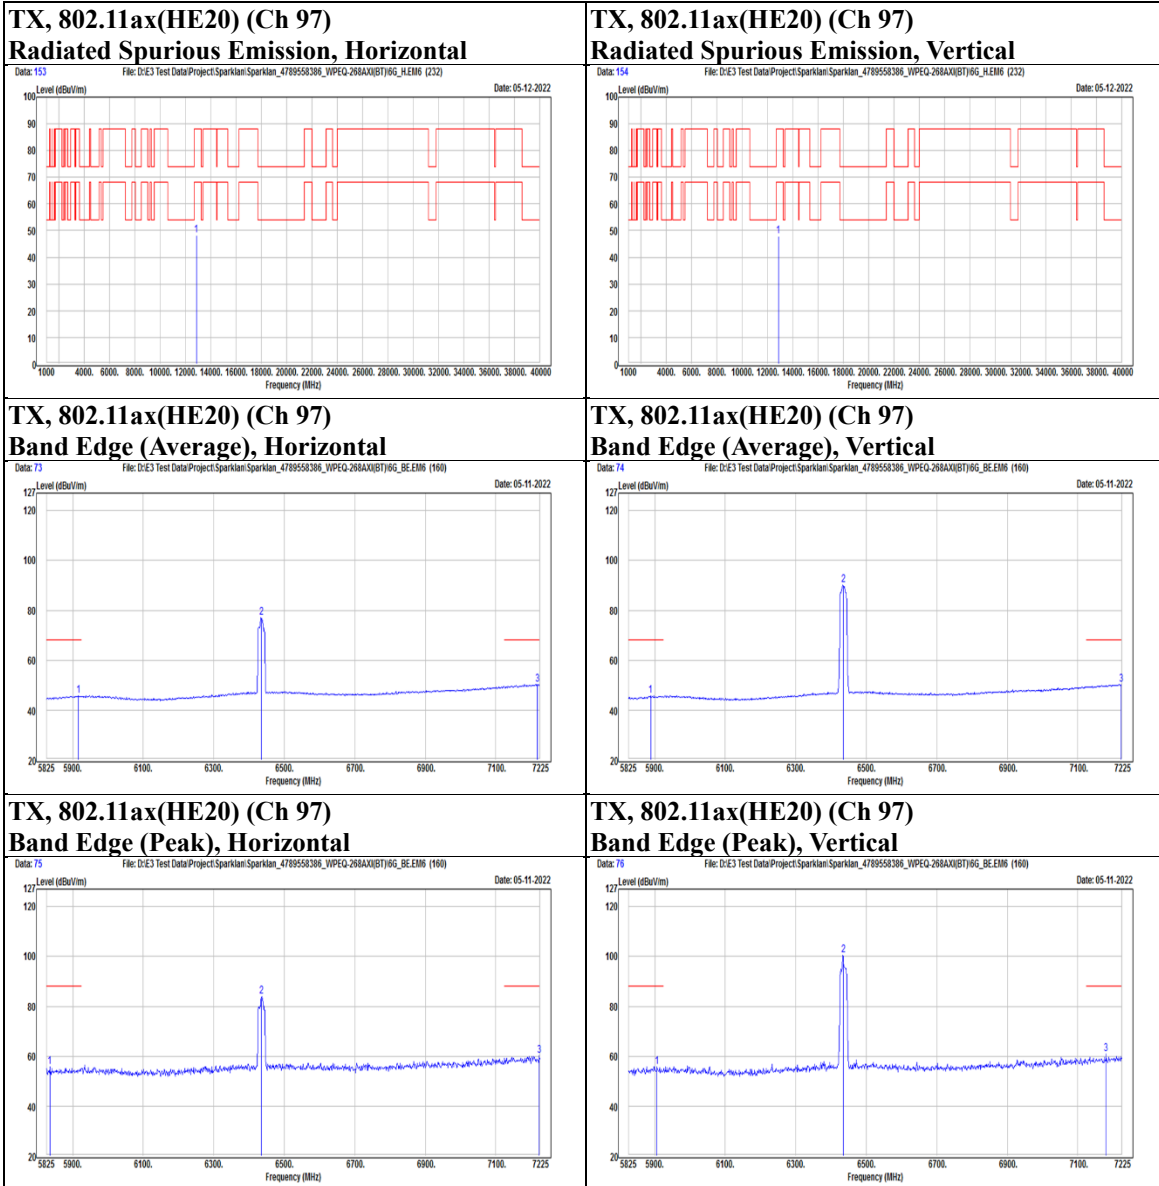



Mode	802.11ax(HE20)	Channel	105
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5904.8	30.94	14.97	45.91	68.2	-22.29	AVG
		5923	40.88	14.96	55.84	88.2	-32.36	PK
	@	6475	64.08	17.06	81.14	N/A	N/A	PK
	@	6475	58.3	17.06	75.36	N/A	N/A	AVG
		7223.6	29.87	20.25	50.12	68.2	-18.08	AVG
		7225	40.01	20.26	60.27	88.2	-27.93	PK
	*	12950	27.18	20.86	48.04	88.2	-40.16	PK
Vertical		5916	40.72	14.97	55.69	88.2	-32.51	PK
		5924.4	30.82	14.96	45.78	68.2	-22.42	AVG
	@	6475	79.55	17.06	96.61	N/A	N/A	PK
	@	6475	72.34	17.06	89.4	N/A	N/A	AVG
		7218	40.28	20.22	60.5	88.2	-27.7	PK
		7220.8	30.05	20.23	50.28	68.2	-17.92	AVG
	*	12950	27.53	20.86	48.39	88.2	-39.81	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

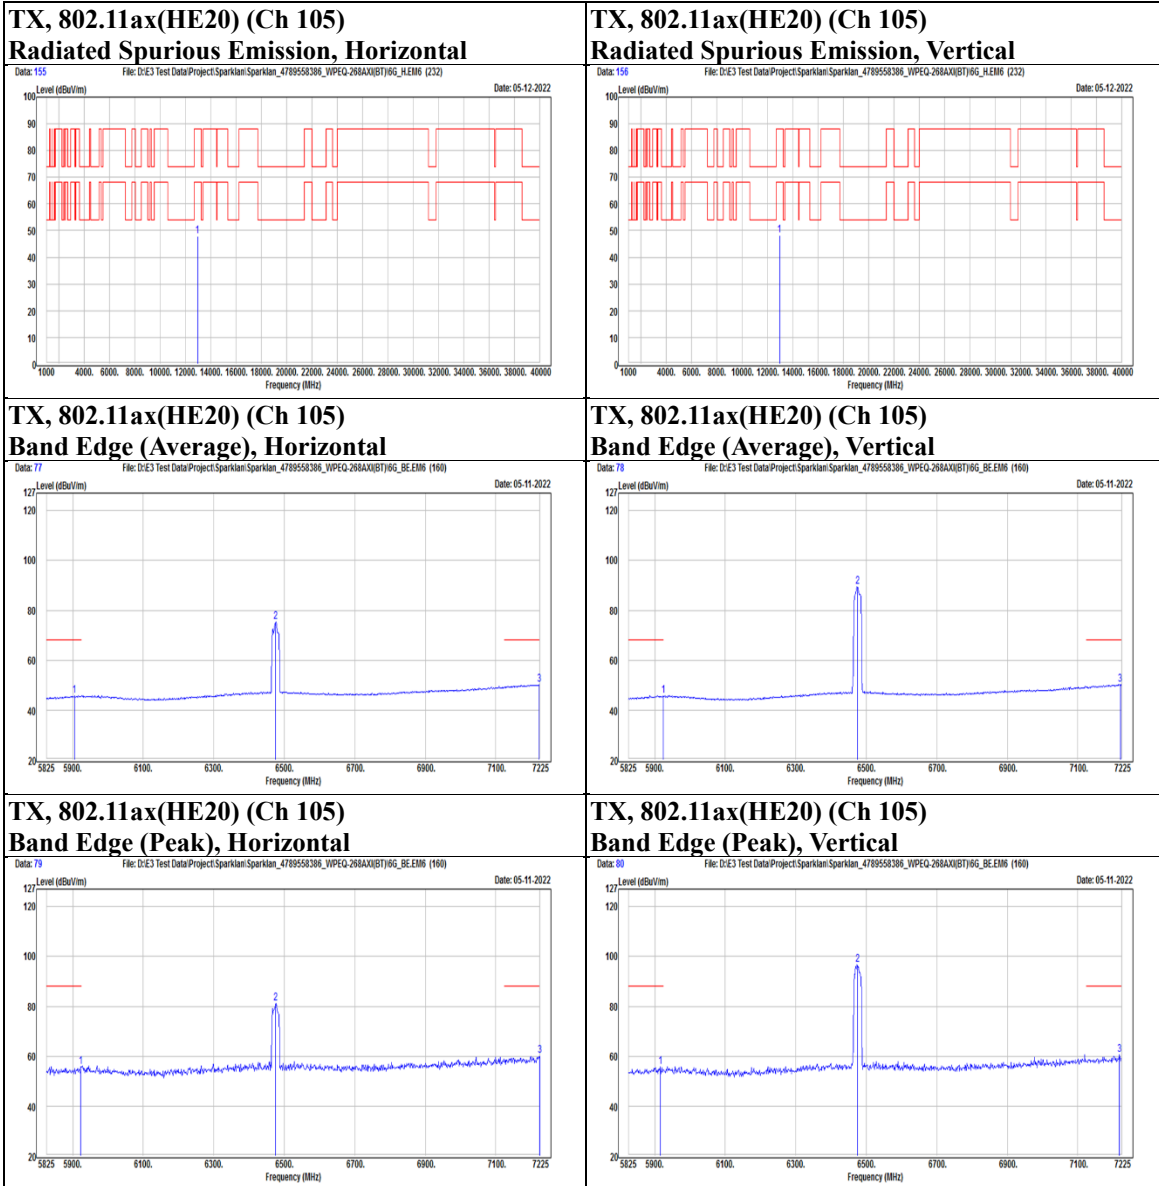



Mode	802.11ax(HE20)	Channel	113
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5888	40.51	14.9	55.41	88.2	-32.79	PK
		5924.4	30.81	14.96	45.77	68.2	-22.43	AVG
	@	6515	66.1	17.31	83.41	N/A	N/A	PK
	@	6515	59.1	17.31	76.41	N/A	N/A	AVG
		7148	40.43	19.84	60.27	88.2	-27.93	PK
		7209.6	30.18	20.18	50.36	68.2	-17.84	AVG
	*	13030	28.24	20.95	49.19	88.2	-39.01	PK
Vertical		5910.4	40.69	14.97	55.66	88.2	-32.54	PK
		5921.6	30.7	14.96	45.66	68.2	-22.54	AVG
	@	6515	80.1	17.31	97.41	N/A	N/A	PK
	@	6515	72.12	17.31	89.43	N/A	N/A	AVG
		7199.8	39.35	20.12	59.47	88.2	-28.73	PK
		7209.6	30.31	20.18	50.49	68.2	-17.71	AVG
	*	13030	27.45	20.95	48.4	88.2	-39.8	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

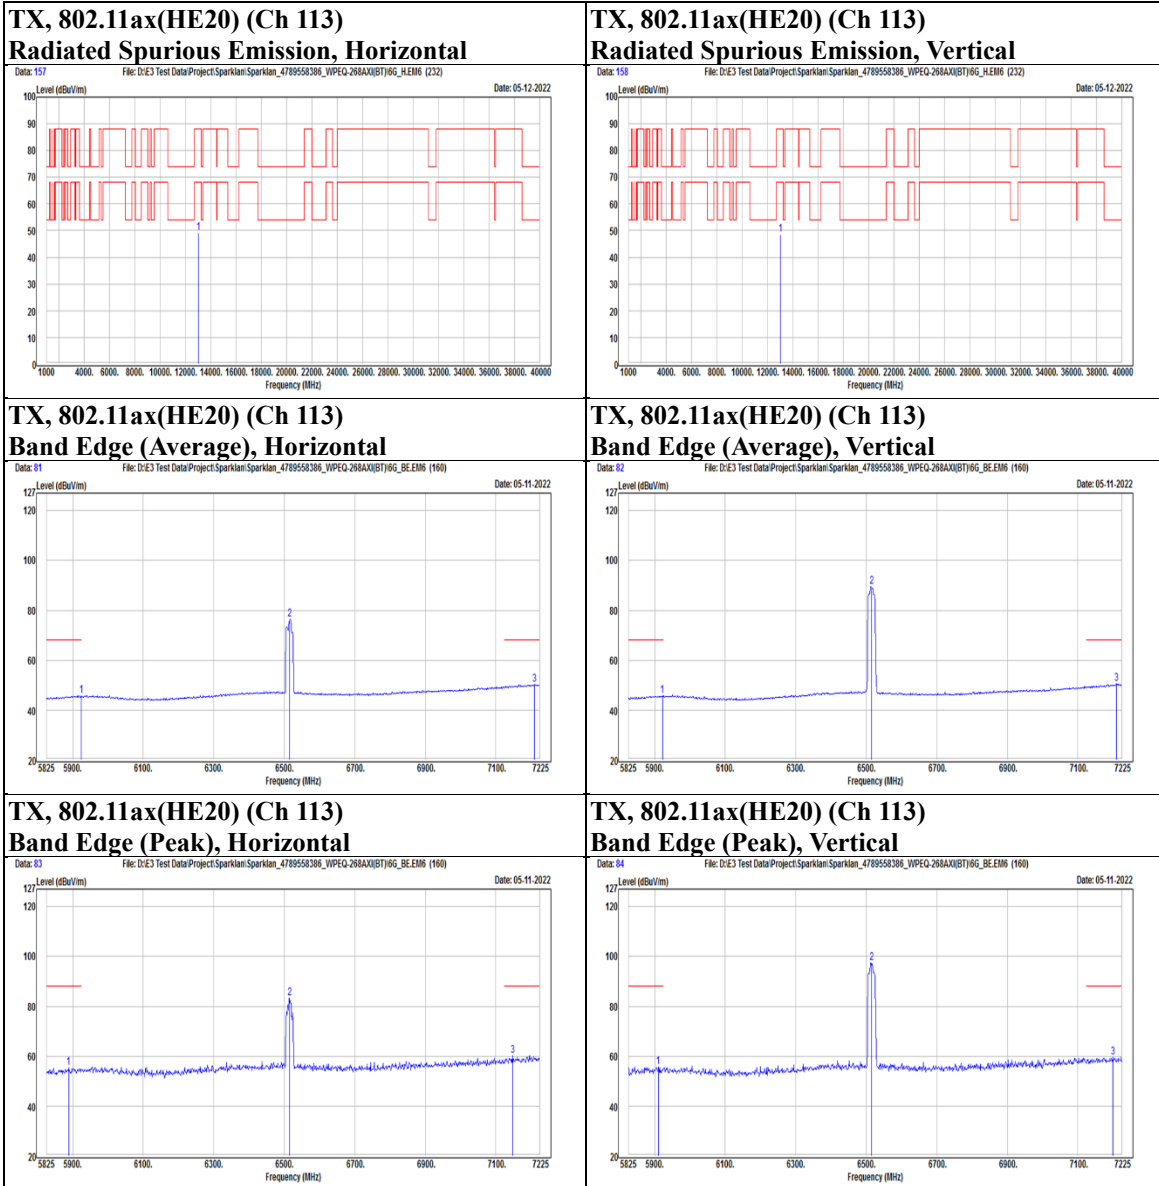



Mode	802.11ax(HE20)	Channel	117
------	----------------	---------	-----


Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5843.2	40.97	14.61	55.58	88.2	-32.62	PK
		5911.8	30.81	14.97	45.78	68.2	-22.42	AVG
	@	6535	65.71	17.33	83.04	N/A	N/A	PK
	@	6535	58.74	17.33	76.07	N/A	N/A	AVG
		7180.2	40.83	20.02	60.85	88.2	-27.35	PK
		7198.4	30.32	20.11	50.43	68.2	-17.77	AVG
	*	13070	27.72	21.01	48.73	88.2	-39.47	PK
Vertical		5871.2	41.53	14.78	56.31	88.2	-31.89	PK
		5917.4	30.62	14.97	45.59	68.2	-22.61	AVG
	@	6535	80.17	17.33	97.5	N/A	N/A	PK
	@	6535	72.14	17.33	89.47	N/A	N/A	AVG
		7212.4	39.79	20.19	59.98	88.2	-28.22	PK
		7216.6	30.39	20.22	50.61	68.2	-17.59	AVG
	*	13070	26.84	21.01	47.85	88.2	-40.35	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

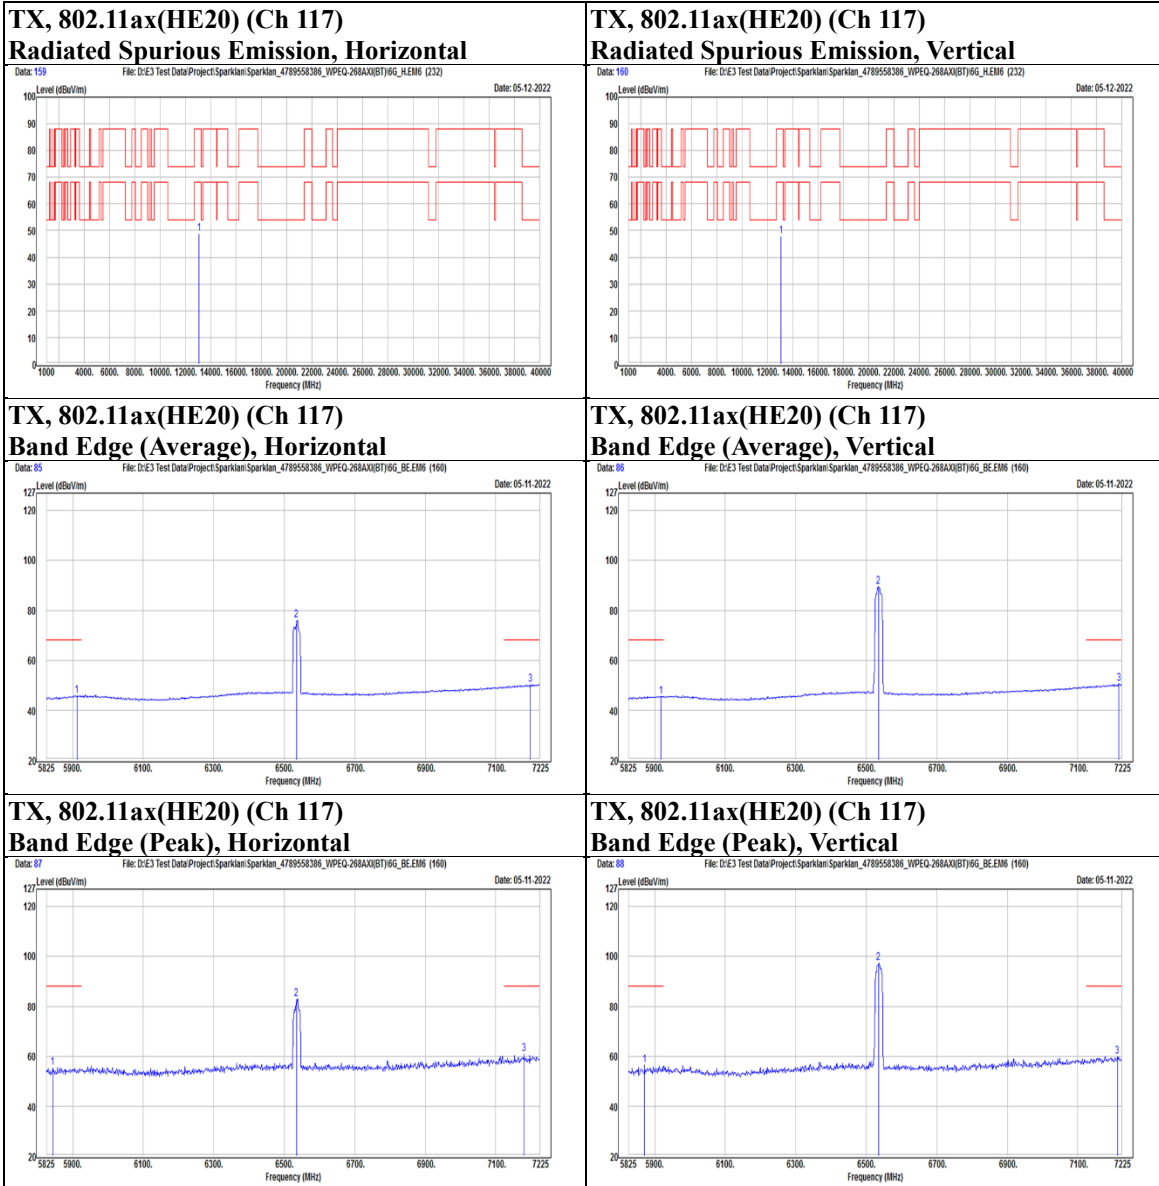



Mode	802.11ax(HE20)	Channel	149
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5913.2	30.85	14.96	45.81	68.2	-22.39	AVG
		5917.4	40.97	14.97	55.94	88.2	-32.26	PK
	@	6695	69.94	17.5	87.44	N/A	N/A	PK
	@	6695	60.64	17.5	78.14	N/A	N/A	AVG
		7212.4	40.2	20.19	60.39	88.2	-27.81	PK
		7223.6	30.03	20.25	50.28	68.2	-17.92	AVG
	*	13390	27.47	22.07	49.54	74	-24.46	PK
Vertical		5900.6	41	14.98	55.98	88.2	-32.22	PK
		5917.4	30.97	14.97	45.94	68.2	-22.26	AVG
	@	6695	80.06	17.5	97.56	N/A	N/A	PK
	@	6695	72.25	17.5	89.75	N/A	N/A	AVG
		7150.8	40.79	19.85	60.64	88.2	-27.56	PK
		7201.2	30.1	20.13	50.23	68.2	-17.97	AVG
	*	13390	27.5	22.07	49.57	74	-24.43	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

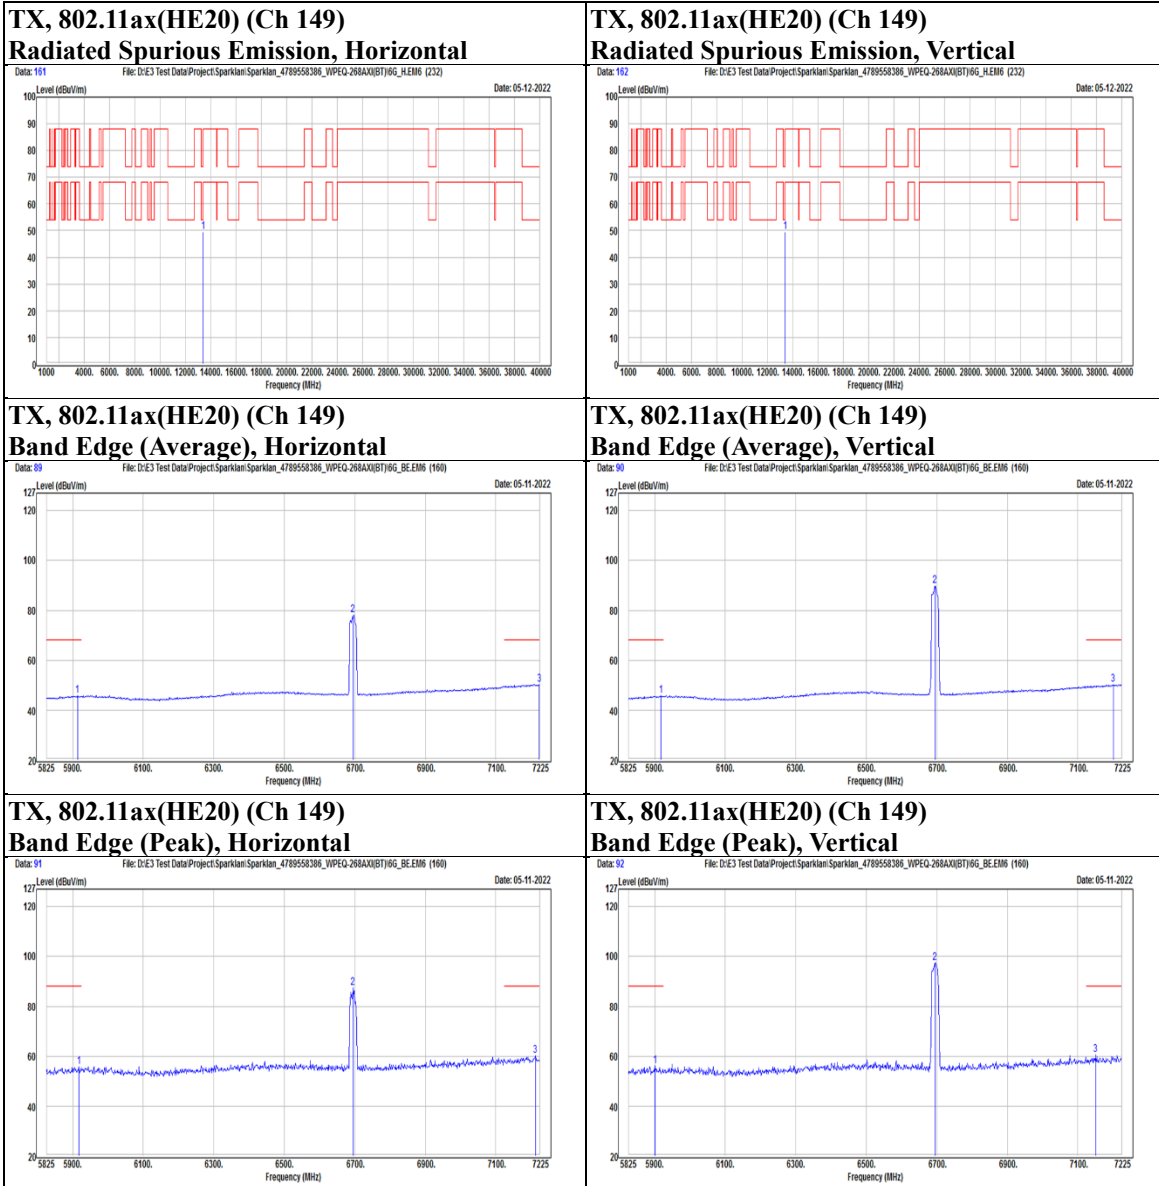



Mode	802.11ax(HE20)	Channel	181
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5917.4	40.72	14.97	55.69	88.2	-32.51	PK
		5924.4	30.81	14.96	45.77	68.2	-22.43	AVG
	@	6855	67.71	18.28	85.99	N/A	N/A	PK
	@	6855	59.27	18.28	77.55	N/A	N/A	AVG
		7162	41.36	19.92	61.28	88.2	-26.92	PK
		7222.2	30.2	20.25	50.45	68.2	-17.75	AVG
	*	13710	27.92	22.78	50.7	88.2	-37.5	PK
Vertical		5918.8	40.74	14.96	55.7	88.2	-32.5	PK
		5918.8	31.2	14.96	46.16	68.2	-22.04	AVG
	@	6855	79	18.28	97.28	N/A	N/A	PK
	@	6855	71.32	18.28	89.6	N/A	N/A	AVG
		7176	39.63	19.99	59.62	88.2	-28.58	PK
		7204	30.41	20.15	50.56	68.2	-17.64	AVG
	*	13710	28.57	22.78	51.35	88.2	-36.85	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0