



Mode	802.11ax(HE20)	Channel	44
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5103.25	30.31	13.44	43.75	54	-10.25	AVG
		5105	42.21	13.44	55.65	74	-18.35	PK
	@	5220	89.3	13.12	102.42	N/A	N/A	PK
	@	5220	81.81	13.12	94.93	N/A	N/A	AVG
	*	10440	32.51	17.81	50.32	68.2	-17.88	PK
Vertical		5134.75	43.17	13.41	56.58	74	-17.42	PK
		5149.45	32.94	13.4	46.34	54	-7.66	AVG
	@	5220	101.53	13.12	114.65	N/A	N/A	PK
	@	5220	94.47	13.12	107.59	N/A	N/A	AVG
	*	10440	32.41	17.81	50.22	68.2	-17.98	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

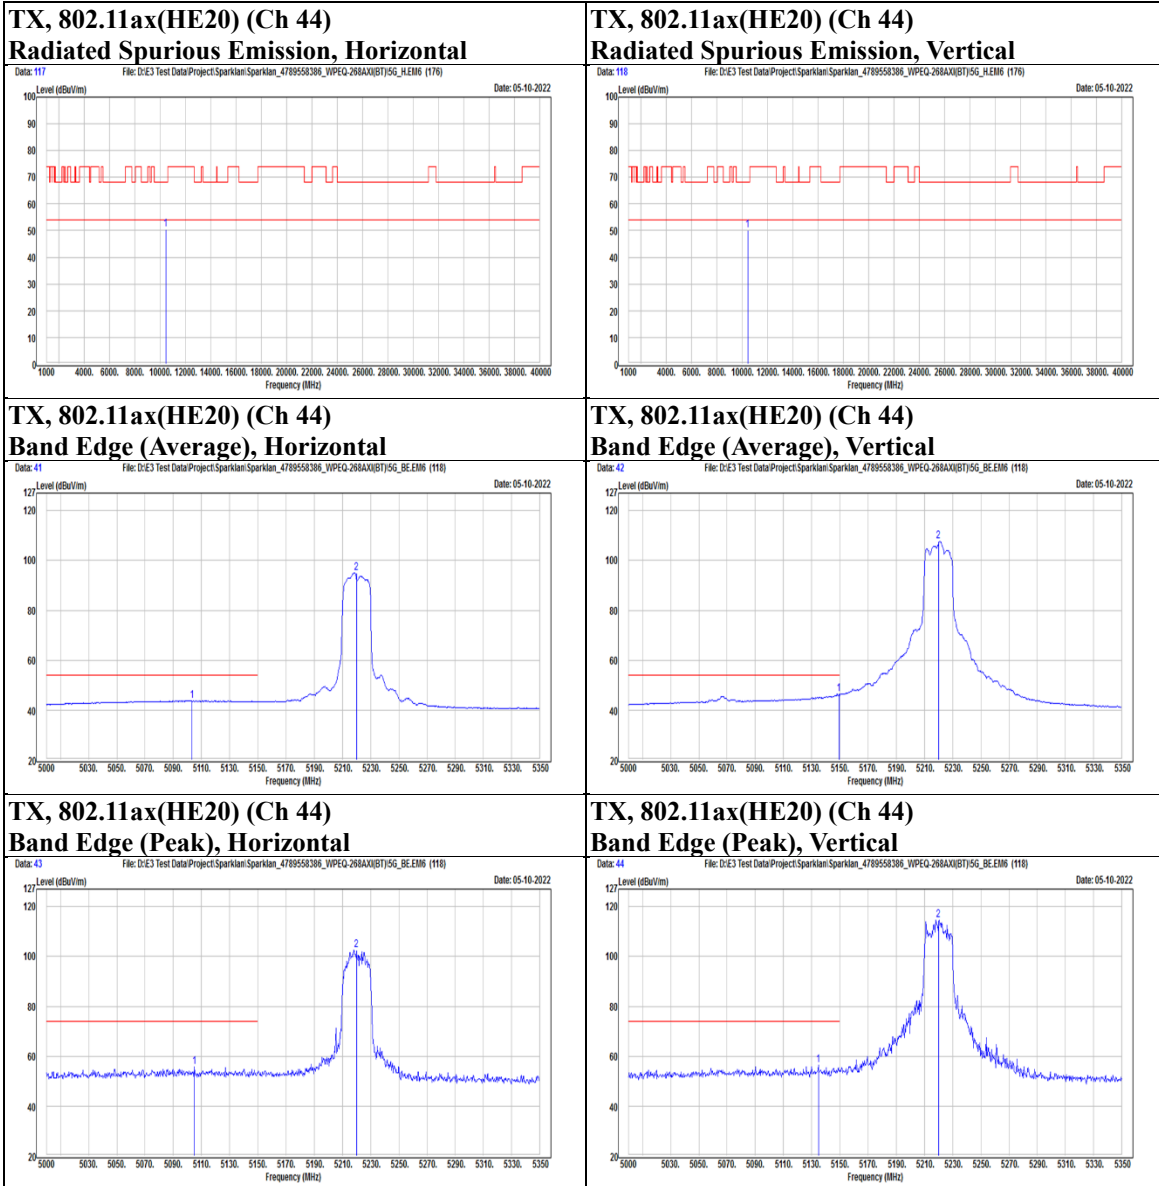



Mode	802.11ax(HE20)	Channel	48
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5112.35	30.36	13.44	43.8	54	-10.2	AVG
		5138.6	42.11	13.41	55.52	74	-18.48	PK
	@	5240	90.57	12.97	103.54	N/A	N/A	PK
	@	5240	81.22	12.97	94.19	N/A	N/A	AVG
	*	10480	30.4	17.92	48.32	68.2	-19.88	PK
Vertical		5086.45	32.25	13.35	45.6	54	-8.4	AVG
		5146.65	43.73	13.41	57.14	74	-16.86	PK
	@	5240	101.99	12.97	114.96	N/A	N/A	PK
	@	5240	94.14	12.97	107.11	N/A	N/A	AVG
	*	10480	33	17.92	50.92	68.2	-17.28	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

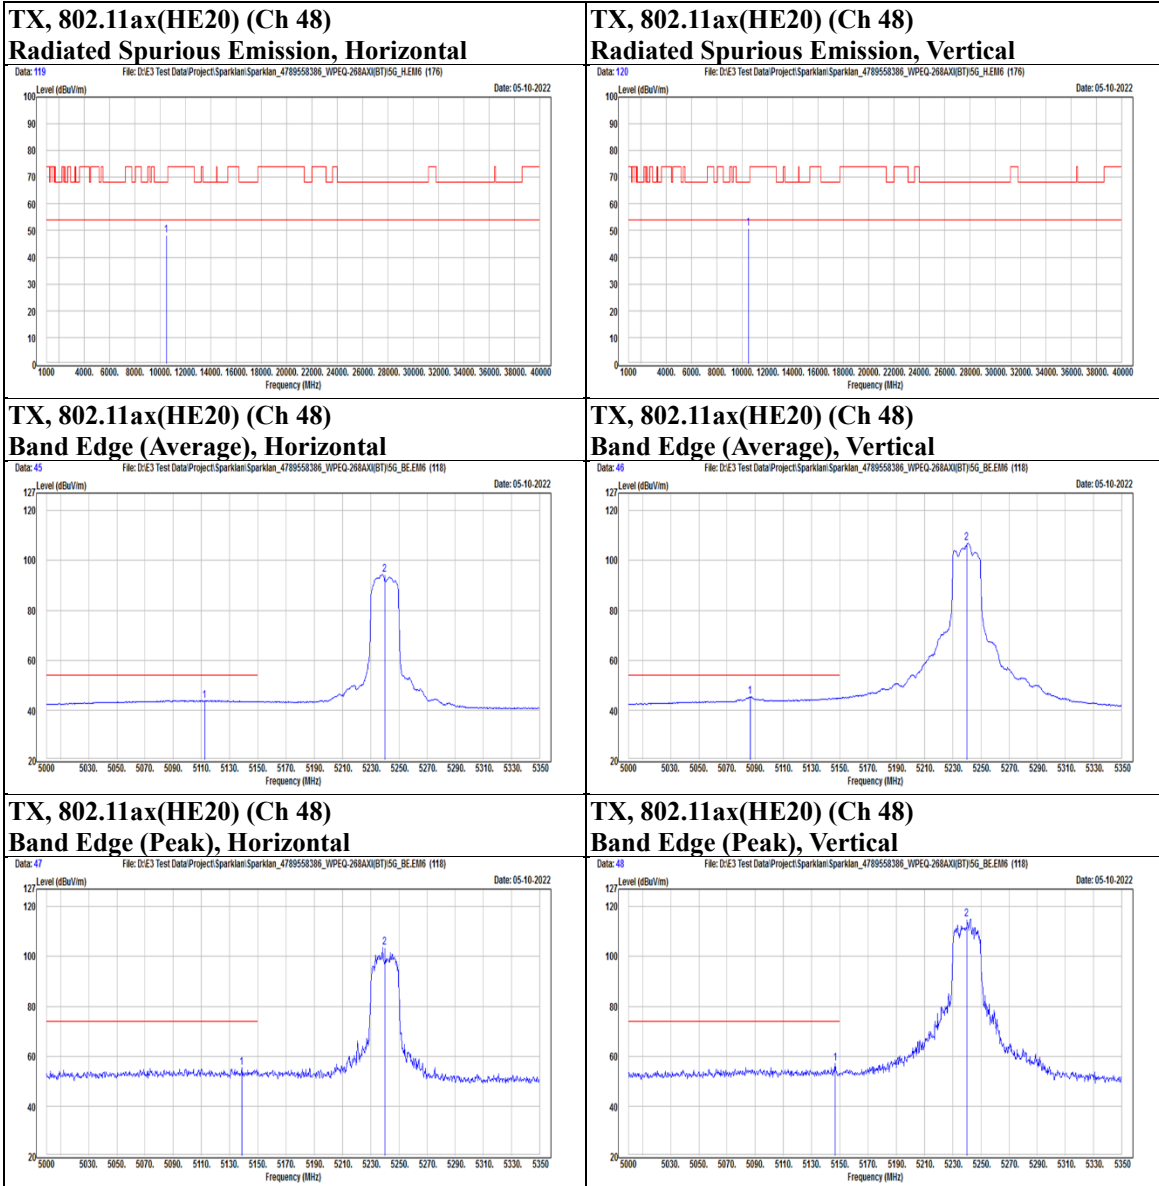



Test report No. : 4790371368-US-R1-V0
Page : 146 of 206
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	52
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	89.87	12.88	102.75	N/A	N/A	PK
	@	5260	81.36	12.88	94.24	N/A	N/A	AVG
		5458.2	39.72	13.56	53.28	74	-20.72	PK
		5459.7	28.26	13.57	41.83	54	-12.17	AVG
	*	10520	31.24	17.99	49.23	68.2	-18.97	PK
Vertical	@	5260	101.93	12.88	114.81	N/A	N/A	PK
	@	5260	93.75	12.88	106.63	N/A	N/A	AVG
		5350.8	29.52	13.01	42.53	54	-11.47	AVG
		5441.7	41.15	13.48	54.63	74	-19.37	PK
	*	10520	33.6	17.99	51.59	68.2	-16.61	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

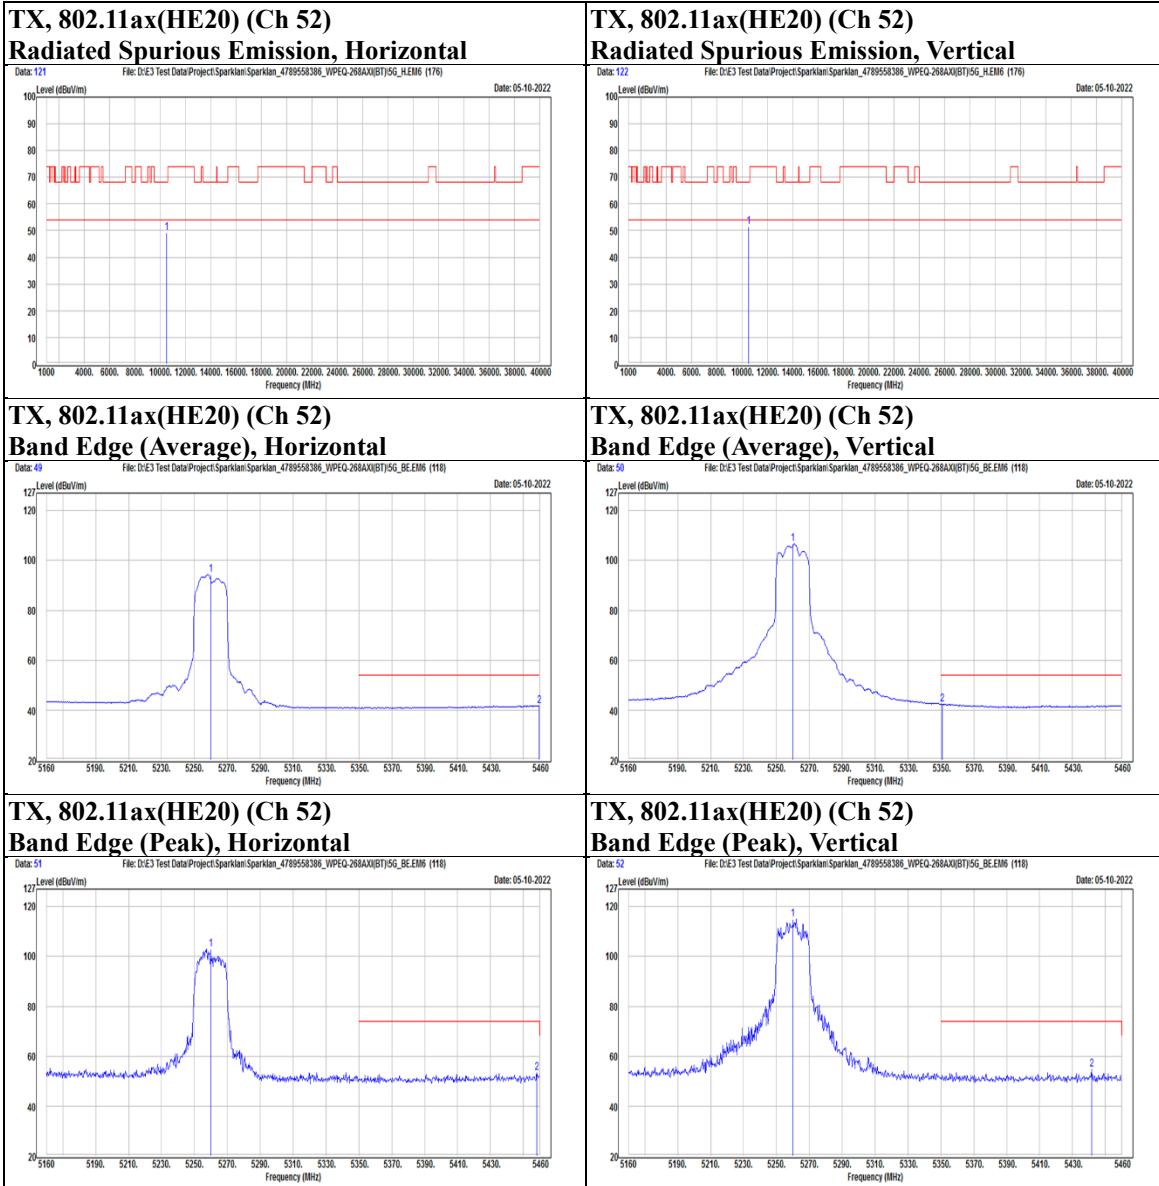



Mode	802.11ax(HE20)	Channel	60
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	87.73	12.77	100.5	N/A	N/A	PK
	@	5300	79.71	12.77	92.48	N/A	N/A	AVG
		5454.3	28.25	13.54	41.79	54	-12.21	AVG
		5454.6	39.73	13.54	53.27	74	-20.73	PK
	*	10600	32.03	18.04	50.07	68.2	-18.13	PK
Vertical	@	5300	100.74	12.77	113.51	N/A	N/A	PK
	@	5300	93.63	12.77	106.4	N/A	N/A	AVG
		5350.5	34.55	13.01	47.56	54	-6.44	AVG
		5352.3	46.64	13.03	59.67	74	-14.33	PK
	*	10600	32.68	18.04	50.72	68.2	-17.48	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

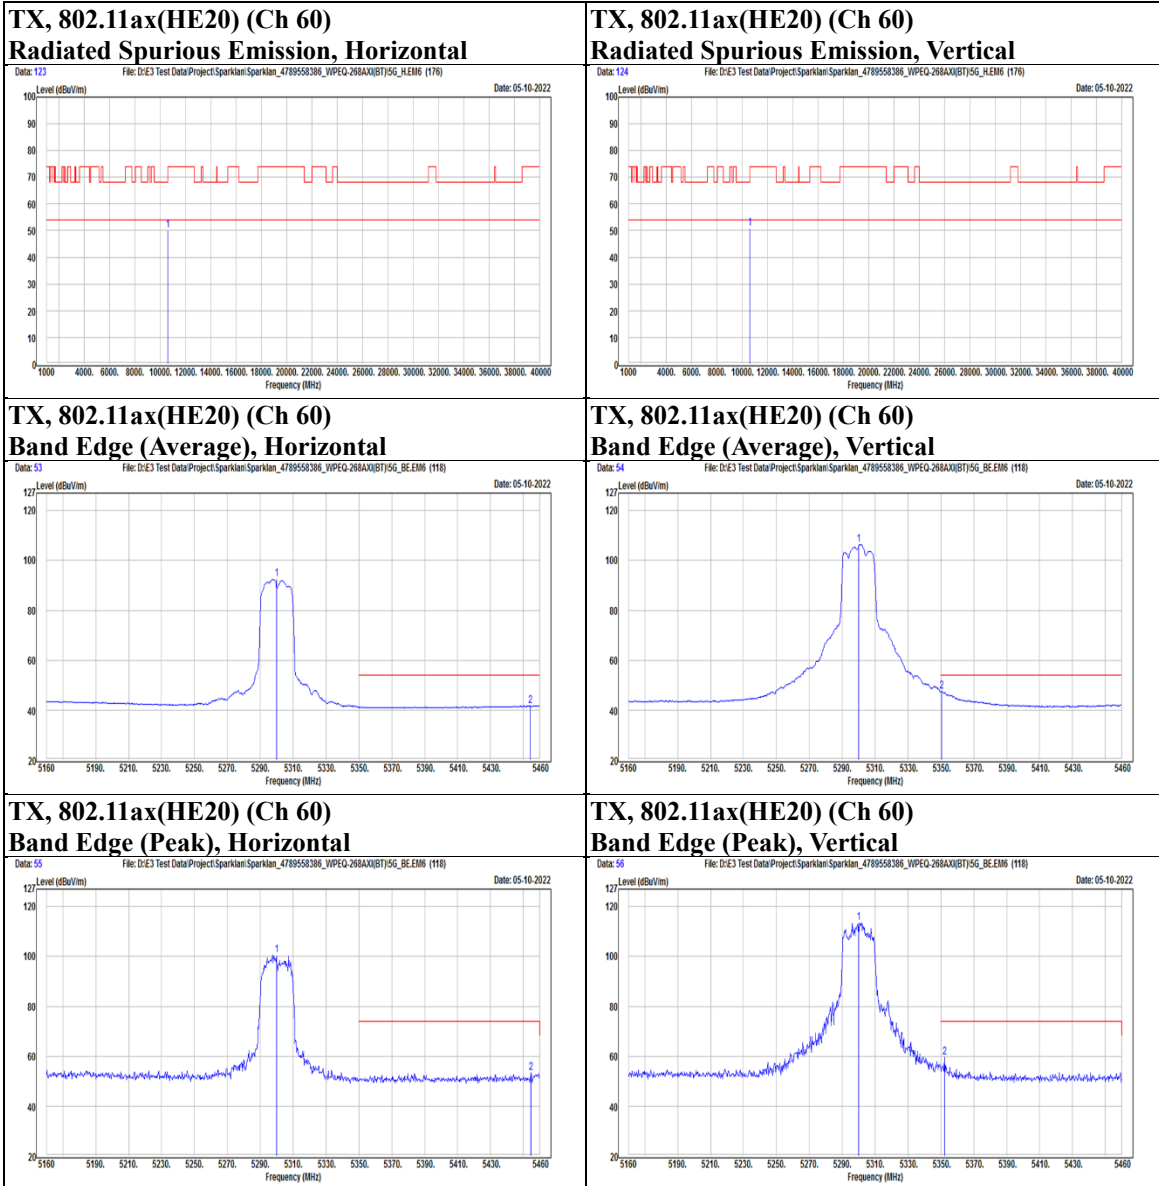



Mode	802.11ax(HE20)	Channel	64
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	85.72	12.86	98.58	N/A	N/A	PK
	@	5320	78.33	12.86	91.19	N/A	N/A	AVG
		5418.3	39.89	13.35	53.24	74	-20.76	PK
		5459.1	28.16	13.57	41.73	54	-12.27	AVG
	*	10640	30.52	18.03	48.55	74	-25.45	PK
Vertical	@	5320	99.16	12.86	112.02	N/A	N/A	PK
	@	5320	91.8	12.86	104.66	N/A	N/A	AVG
		5350.2	33.56	13.01	46.57	54	-7.43	AVG
		5351.1	41.87	13.01	54.88	74	-19.12	PK
	*	10640	30.98	18.03	49.01	74	-24.99	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

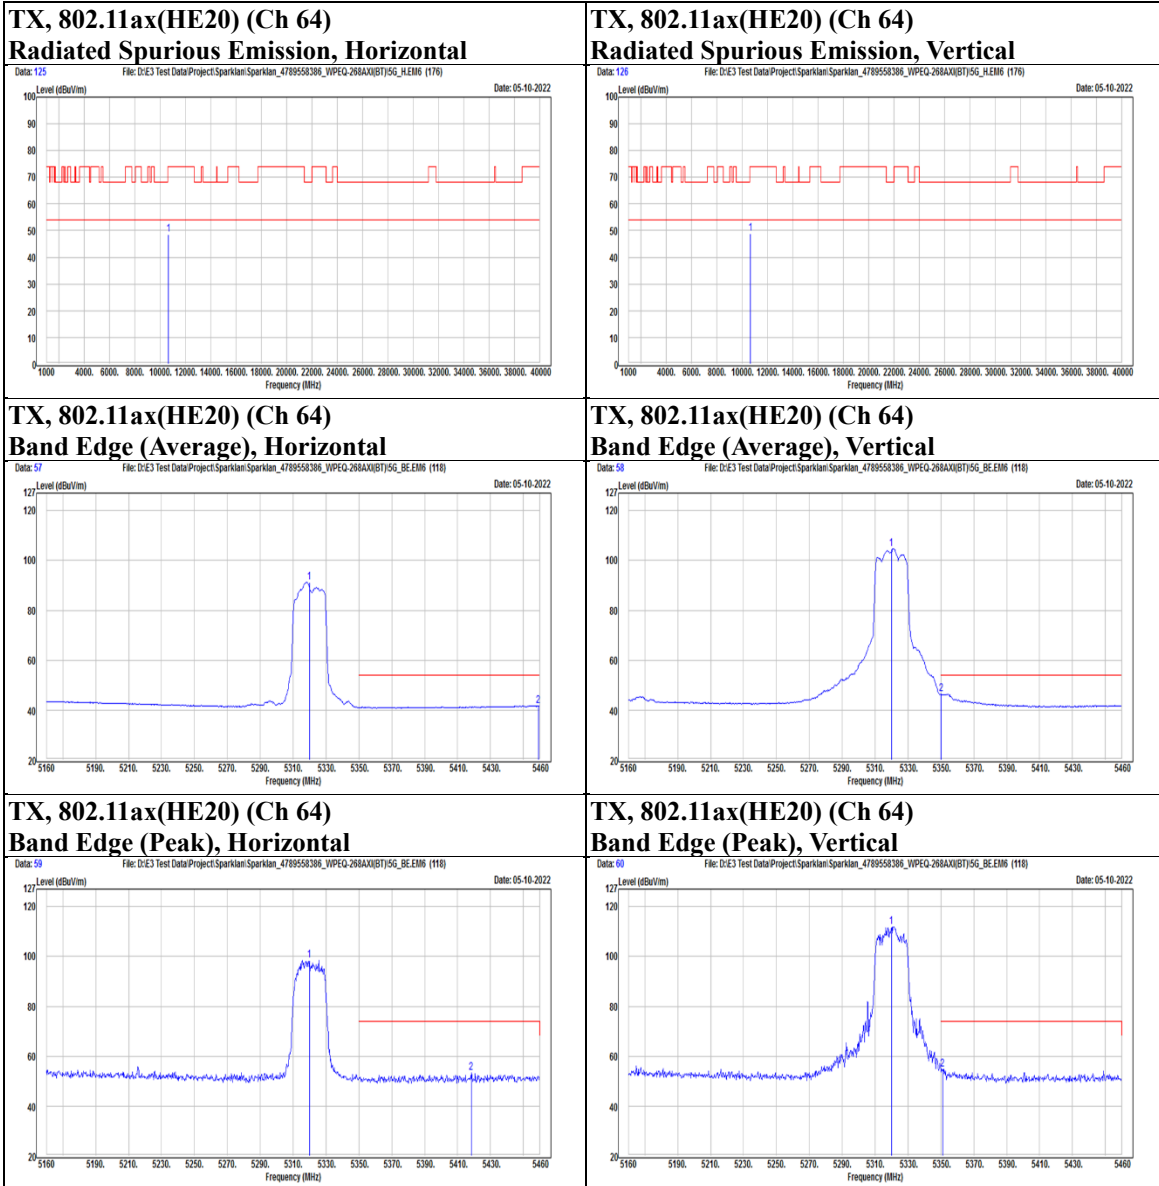



Mode	802.11ax(HE20)	Channel	100
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5415.75	39.88	13.34	53.22	74	-20.78	PK
		5415.75	29.21	13.34	42.55	54	-11.45	AVG
		5463.7	39.46	13.58	53.04	68.2	-15.16	PK
	@	5500	86	13.77	99.77	N/A	N/A	PK
	@	5500	75.3	13.77	89.07	N/A	N/A	AVG
	*	11000	32.03	18.41	50.44	74	-23.56	PK
Vertical		5458.45	41.28	13.56	54.84	74	-19.16	PK
		5458.45	31.1	13.56	44.66	54	-9.34	AVG
		5469.65	47.24	13.62	60.86	68.2	-7.34	PK
	@	5500	98.34	13.77	112.11	N/A	N/A	PK
	@	5500	88.4	13.77	102.17	N/A	N/A	AVG
	*	11000	32.52	18.41	50.93	74	-23.07	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

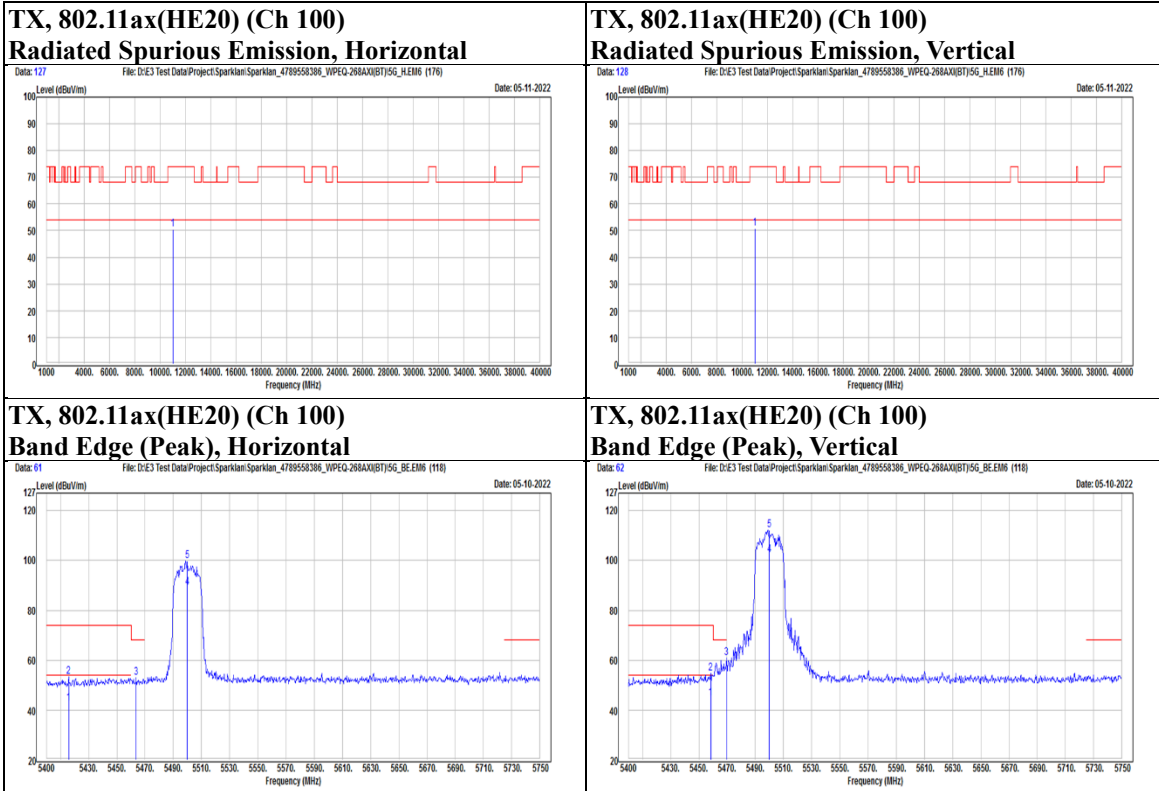



Mode	802.11ax(HE20)	Channel	116
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5459.5	40.25	13.57	53.82	74	-20.18	PK
		5459.5	29.9	13.57	43.47	54	-10.53	AVG
		5467.2	39.62	13.61	53.23	68.2	-14.97	PK
	@	5580	86.86	13.76	100.62	N/A	N/A	PK
	@	5580	76.19	13.76	89.95	N/A	N/A	AVG
		5729.35	41.6	14	55.6	68.2	-12.6	PK
	*	11160	31.52	18.47	49.99	74	-24.01	PK
Vertical		5417.5	40.54	13.35	53.89	74	-20.11	PK
		5417.5	30.31	13.35	43.66	54	-10.34	AVG
		5467.9	39.8	13.61	53.41	68.2	-14.79	PK
	@	5580	98.02	13.76	111.78	N/A	N/A	PK
	@	5580	88.19	13.76	101.95	N/A	N/A	AVG
		5726.9	40.71	13.99	54.7	68.2	-13.5	PK
	*	11160	34.39	18.47	52.86	74	-21.14	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

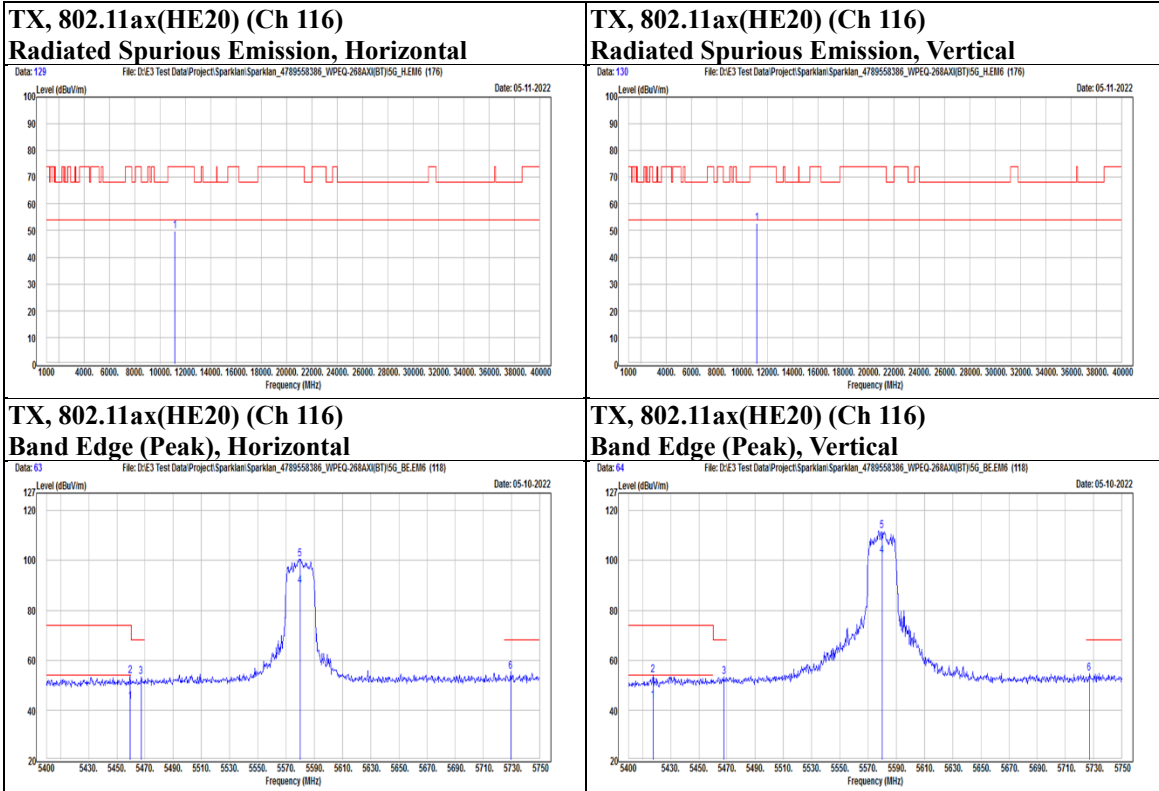



Test report No. : 4790371368-US-R1-V0
Page : 156 of 206
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	140
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5700	84.29	13.73	98.02	N/A	N/A	PK
	@	5700	74.3	13.73	88.03	N/A	N/A	AVG
		5734.95	39.98	14.06	54.04	68.2	-14.16	PK
	*	11400	30.82	18.85	49.67	74	-24.33	PK
Vertical	@	5700	99.57	13.73	113.3	N/A	N/A	PK
	@	5700	89.4	13.73	103.13	N/A	N/A	AVG
		5725.85	41.83	13.97	55.8	68.2	-12.4	PK
		11400	36.11	18.85	54.96	74	-19.04	PK
		11400	24.5	18.85	43.35	54	-10.65	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

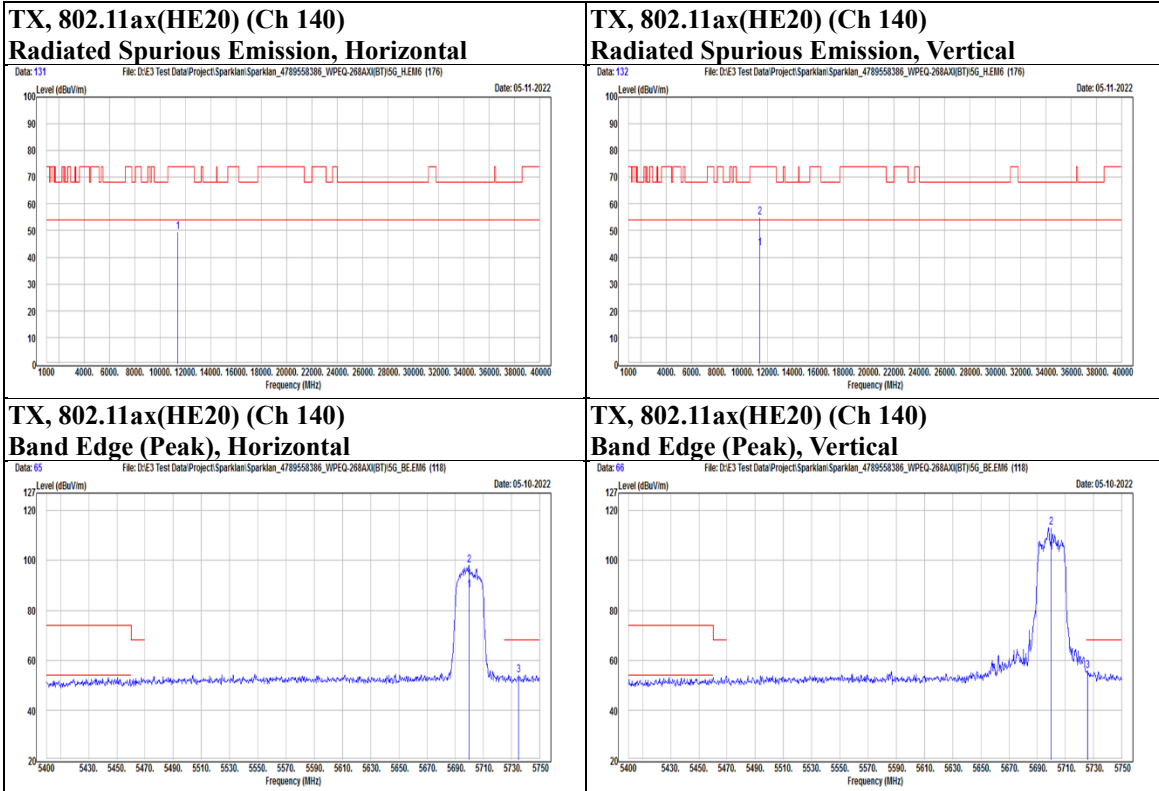



Test report No. : 4790371368-US-R1-V0
Page : 158 of 206
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE20)	Channel	144
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11440	31.33	19.06	50.39	74	-23.61	PK
Vertical	*	11440	34.01	19.06	53.07	74	-20.93	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

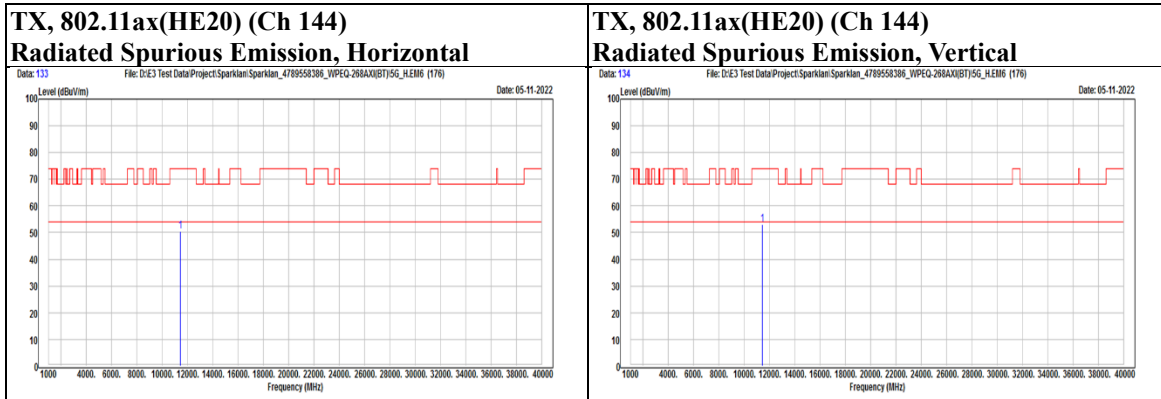

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11ax(HE20)	Channel	149
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5648.5	42.15	13.66	55.81	68.2	-12.39	PK
		5688.5	44.6	13.71	58.31	96.72	-38.41	PK
	@	5745	86.87	14.15	101.02	N/A	N/A	PK
	*	11490	31	19.33	50.33	74	-23.67	PK
Vertical		5641.5	43.21	13.67	56.88	68.2	-11.32	PK
		5699	53.77	13.73	67.5	104.46	-36.96	PK
	@	5745	99.9	14.15	114.05	N/A	N/A	PK
	*	11490	33.74	19.33	53.07	74	-20.93	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

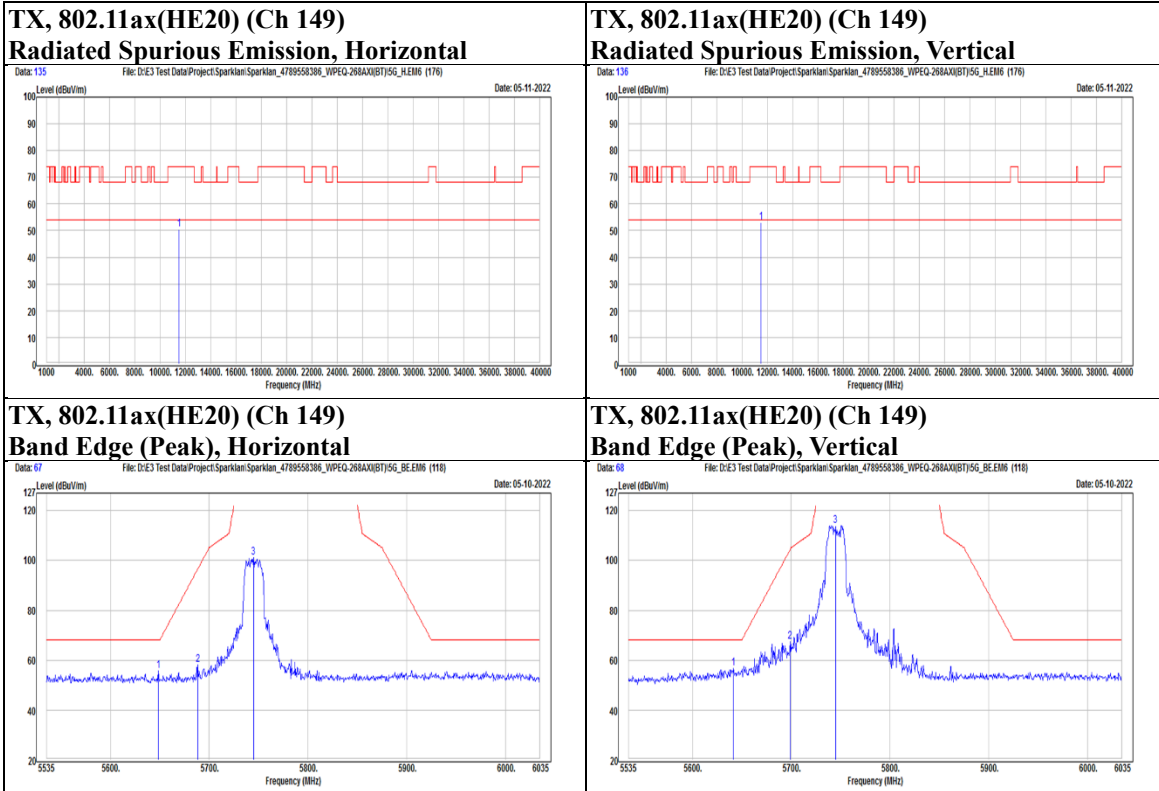



Mode	802.11ax(HE20)	Channel	157
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5610.5	41.1	13.69	54.79	68.2	-13.41	PK
		5671	40.46	13.7	54.16	83.78	-29.62	PK
	@	5785	89.11	14.45	103.56	N/A	N/A	PK
		5895.5	41.28	14.94	56.22	89.99	-33.77	PK
		5945.5	40.76	14.95	55.71	68.2	-12.49	PK
	*	11570	32.93	19.07	52	74	-22	PK
Vertical		5555	41.69	13.82	55.51	68.2	-12.69	PK
		5700	42.5	13.73	56.23	105.2	-48.97	PK
	@	5785	100.79	14.45	115.24	N/A	N/A	PK
		5899.5	41.51	14.97	56.48	87.03	-30.55	PK
		6020	40.21	14.98	55.19	68.2	-13.01	PK
	*	11570	33.96	19.07	53.03	74	-20.97	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

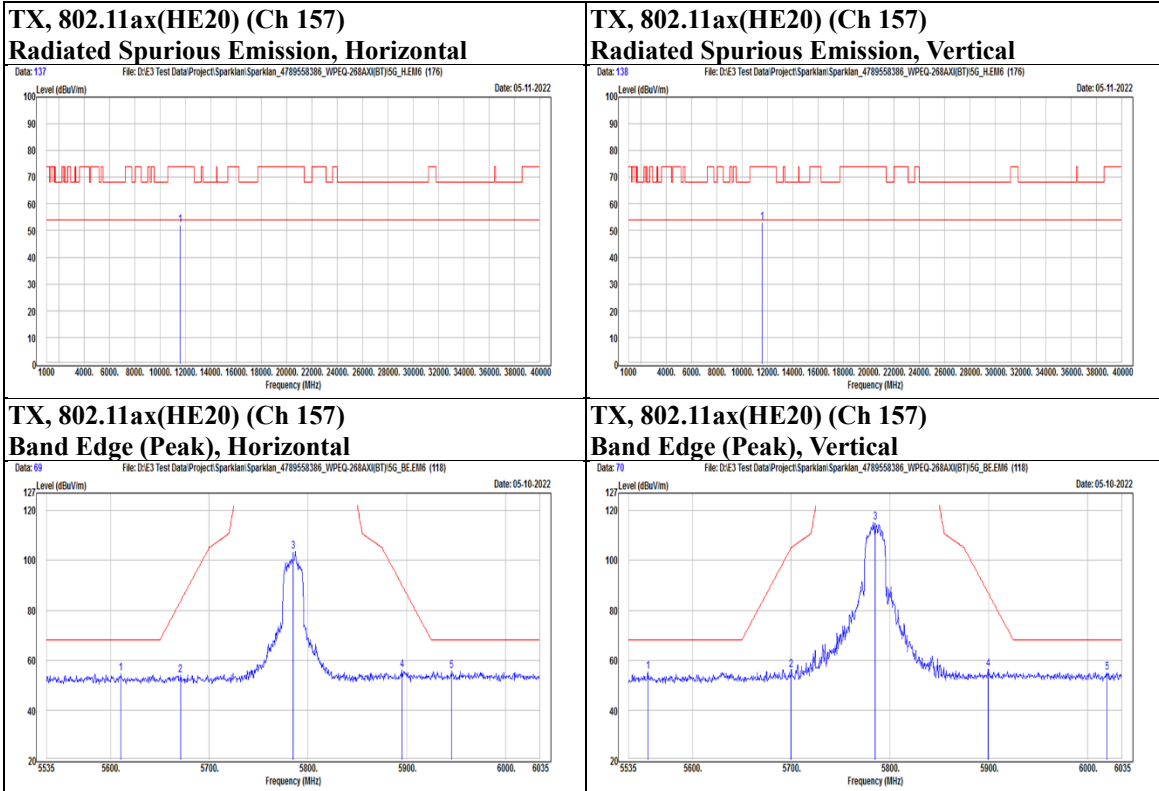



Mode	802.11ax(HE20)	Channel	165
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	88.45	14.58	103.03	N/A	N/A	PK
		5925	41.04	14.96	56	68.2	-12.2	PK
		5925.5	41.21	14.96	56.17	68.2	-12.03	PK
	*	11650	32.51	18.83	51.34	74	-22.66	PK
Vertical	@	5825	100.69	14.58	115.27	N/A	N/A	PK
		5882	42.19	14.85	57.04	100	-42.96	PK
		5940	41.05	14.95	56	68.2	-12.2	PK
		11650	36.55	18.83	55.38	74	-18.62	PK
		11650	24.1	18.83	42.93	54	-11.07	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

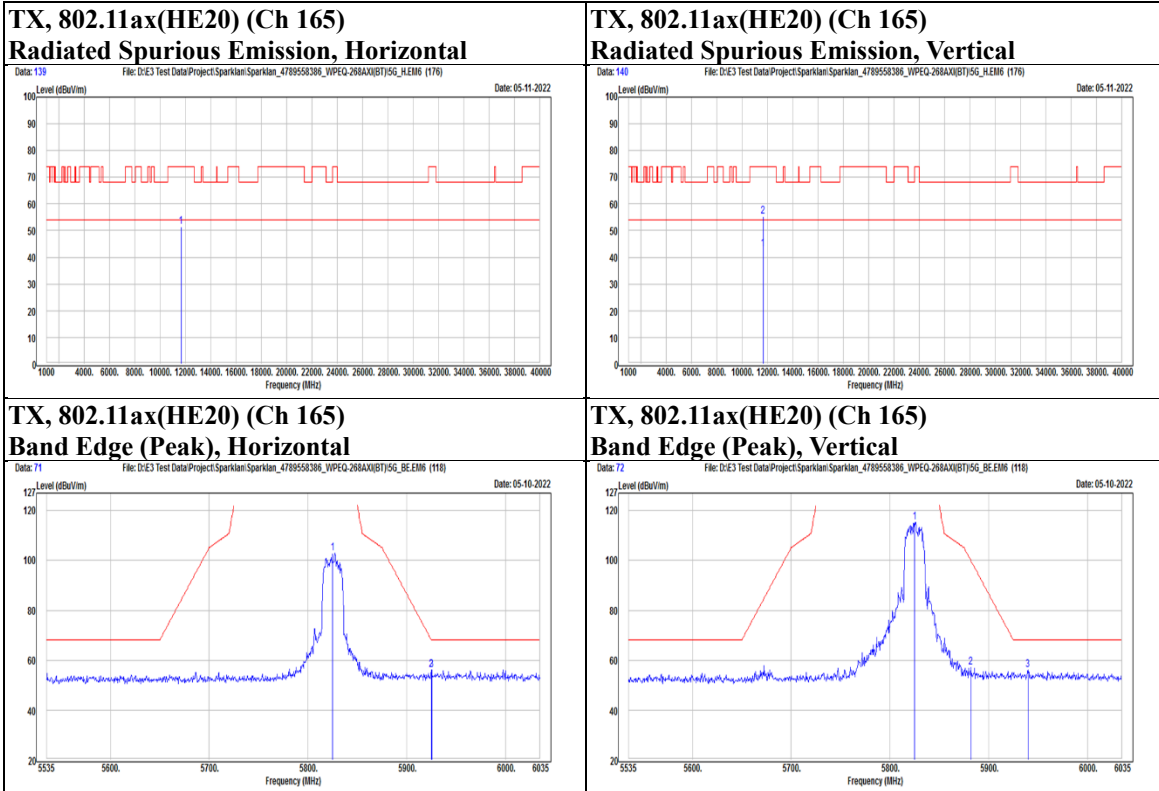



Mode	802.11ax(HE40)	Channel	38
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5102.9	30.61	13.44	44.05	54	-9.95	AVG
		5114.1	42.41	13.43	55.84	74	-18.16	PK
	@	5190	81.03	13.29	94.32	N/A	N/A	PK
	@	5190	72.37	13.29	85.66	N/A	N/A	AVG
	*	10380	30.08	17.61	47.69	68.2	-20.51	PK
Vertical		5147	44.76	13.41	58.17	74	-15.83	PK
		5149.8	35.18	13.4	48.58	54	-5.42	AVG
	@	5190	92.46	13.29	105.75	N/A	N/A	PK
	@	5190	86.23	13.29	99.52	N/A	N/A	AVG
	*	10380	30.86	17.61	48.47	68.2	-19.73	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

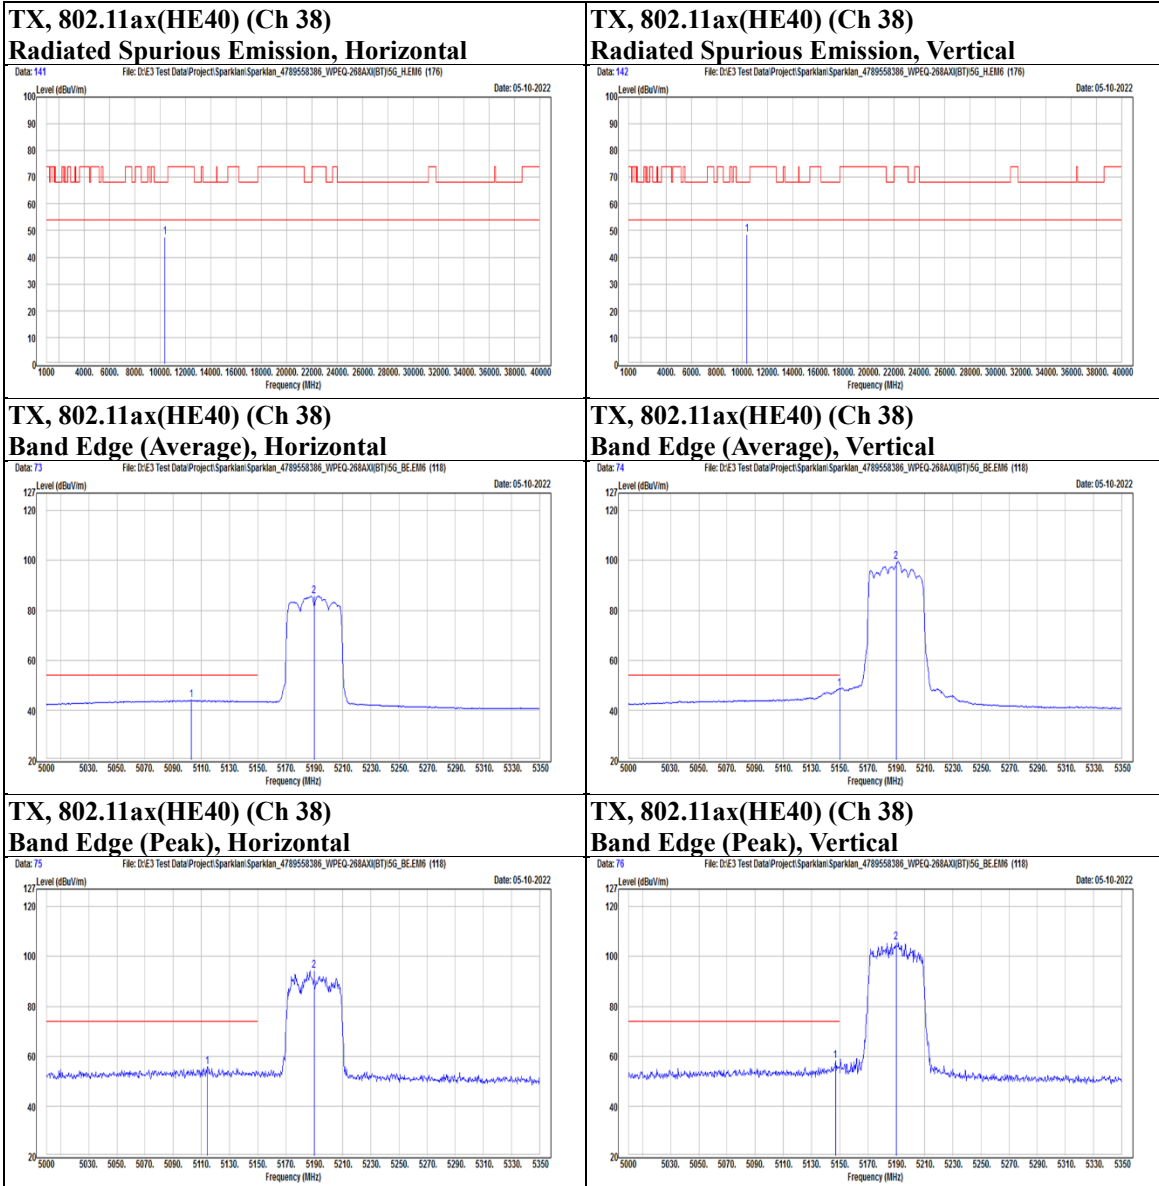



Mode	802.11ax(HE40)	Channel	46
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5100.8	41.77	13.44	55.21	74	-18.79	PK
		5115.85	30.38	13.43	43.81	54	-10.19	AVG
	@	5230	83.91	13.05	96.96	N/A	N/A	PK
	@	5230	76.31	13.05	89.36	N/A	N/A	AVG
	*	10460	29.78	17.87	47.65	68.2	-20.55	PK
Vertical		5077.7	42.51	13.29	55.8	74	-18.2	PK
		5149.8	32.91	13.4	46.31	54	-7.69	AVG
	@	5230	96.73	13.05	109.78	N/A	N/A	PK
	@	5230	89.23	13.05	102.28	N/A	N/A	AVG
	*	10460	30.88	17.87	48.75	68.2	-19.45	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

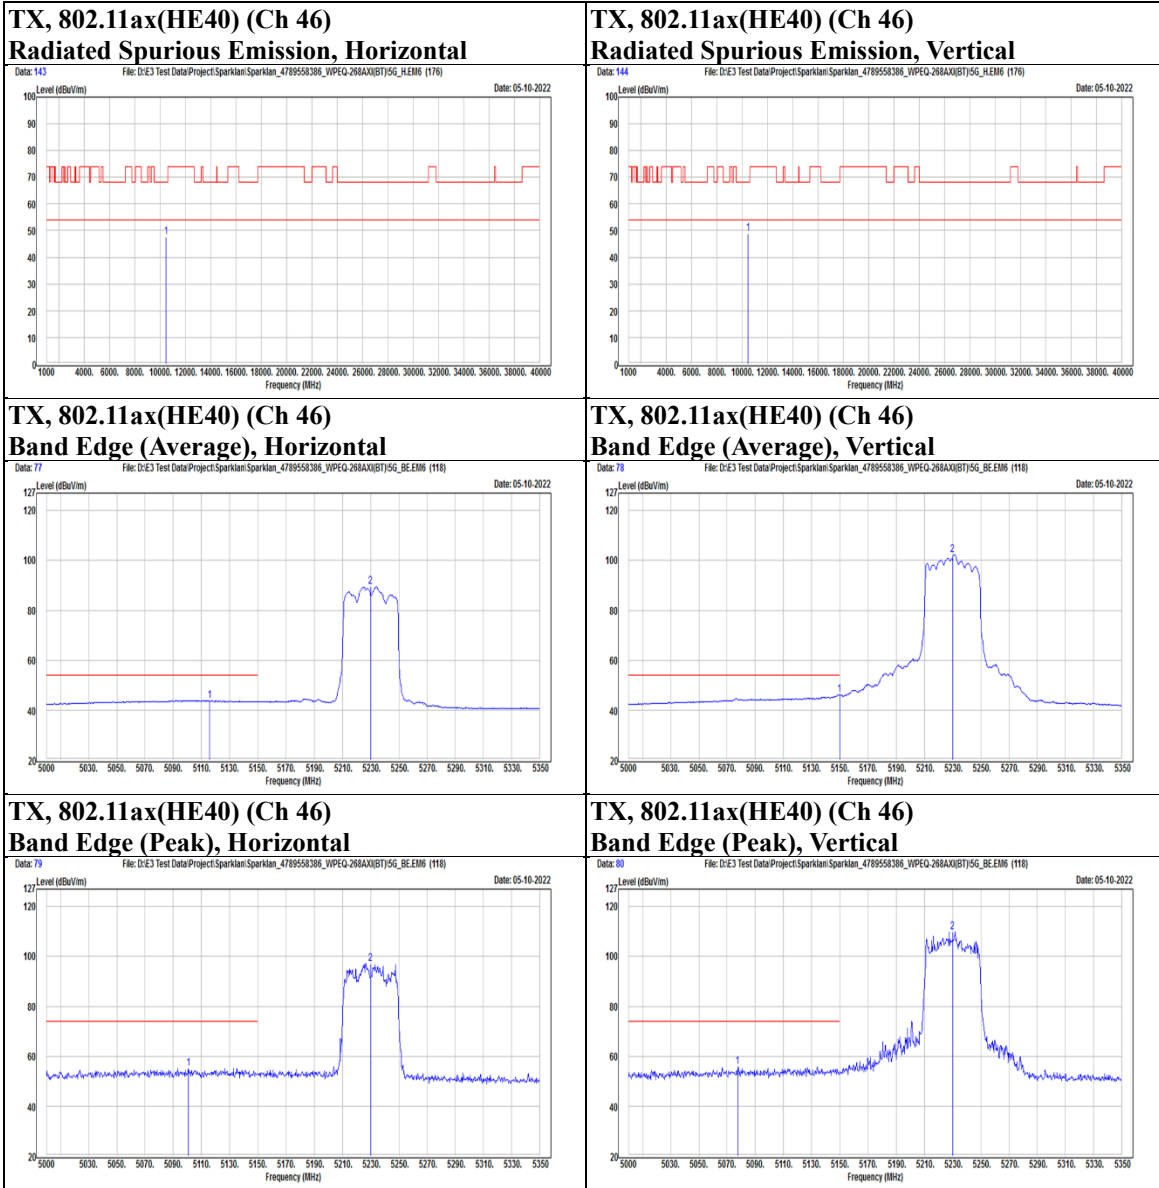



Test report No. : 4790371368-US-R1-V0
Page : 170 of 206
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	54
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	86.86	12.85	99.71	N/A	N/A	PK
	@	5270	75.87	12.85	88.72	N/A	N/A	AVG
		5432.4	39.58	13.43	53.01	74	-20.99	PK
		5455.8	28.18	13.54	41.72	54	-12.28	AVG
	*	10540	32.51	18.01	50.52	68.2	-17.68	PK
Vertical	@	5270	96.27	12.85	109.12	N/A	N/A	PK
	@	5270	88.47	12.85	101.32	N/A	N/A	AVG
		5356.2	30.78	13.04	43.82	54	-10.18	AVG
		5361	41.08	13.07	54.15	74	-19.85	PK
	*	10540	30.59	18.01	48.6	68.2	-19.6	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

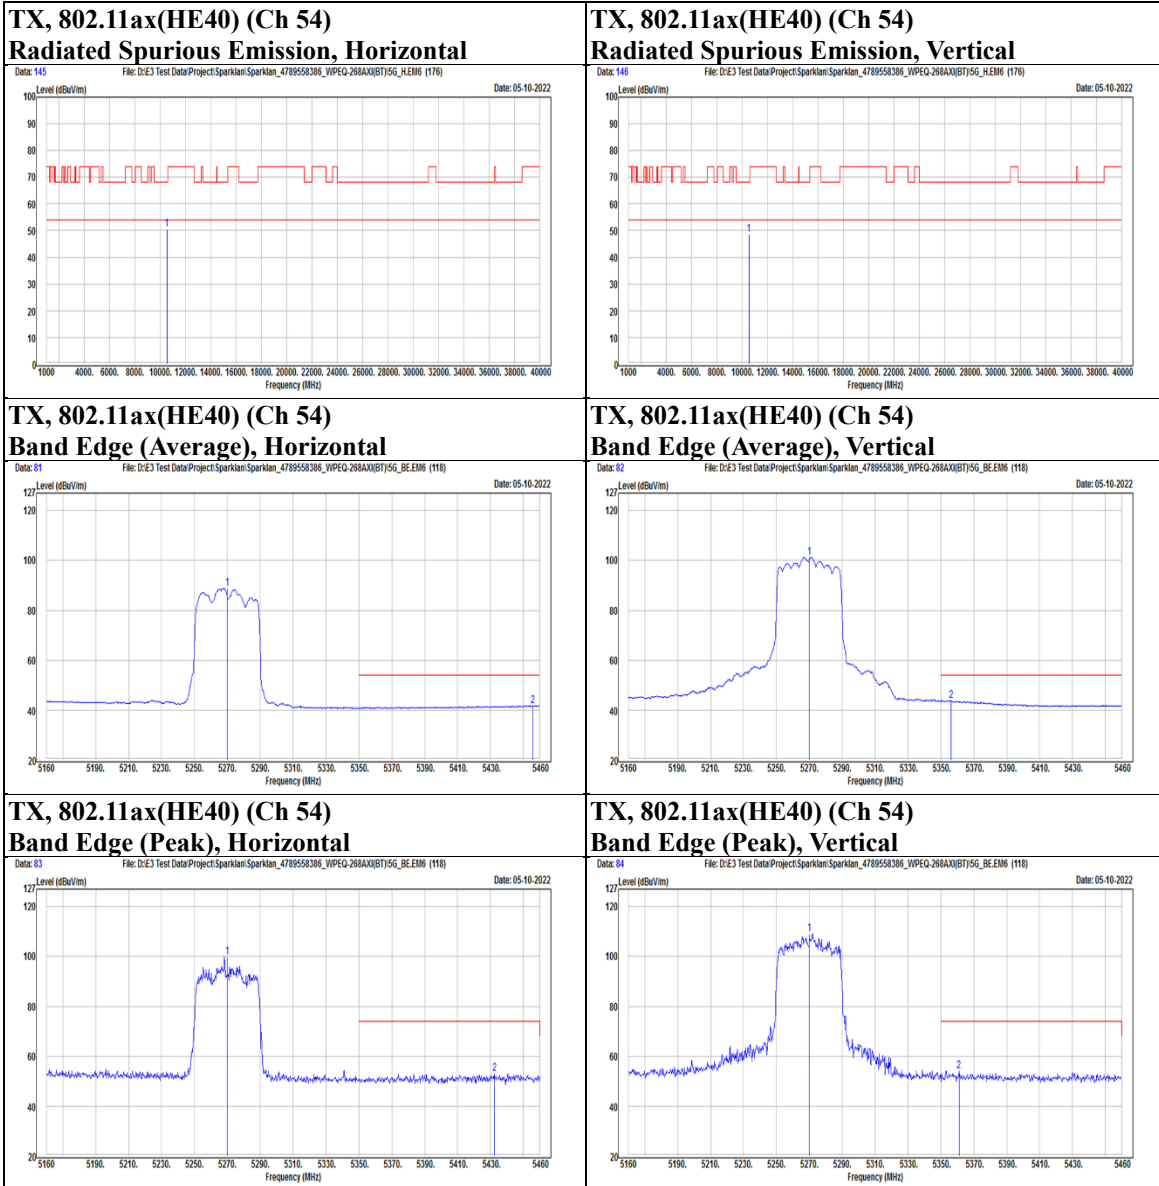



Mode	802.11ax(HE40)	Channel	62
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5310	83.31	12.81	96.12	N/A	N/A	PK
	@	5310	72.85	12.81	85.66	N/A	N/A	AVG
		5433.3	40.03	13.43	53.46	74	-20.54	PK
		5452.8	28.23	13.53	41.76	54	-12.24	AVG
	*	10620	30.75	18.04	48.79	74	-25.21	PK
Vertical	@	5310	96.04	12.81	108.85	N/A	N/A	PK
	@	5310	87.05	12.81	99.86	N/A	N/A	AVG
		5350.2	35.29	13.01	48.3	54	-5.7	AVG
		5352	44.24	13.03	57.27	74	-16.73	PK
	*	10620	32.36	18.04	50.4	74	-23.6	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

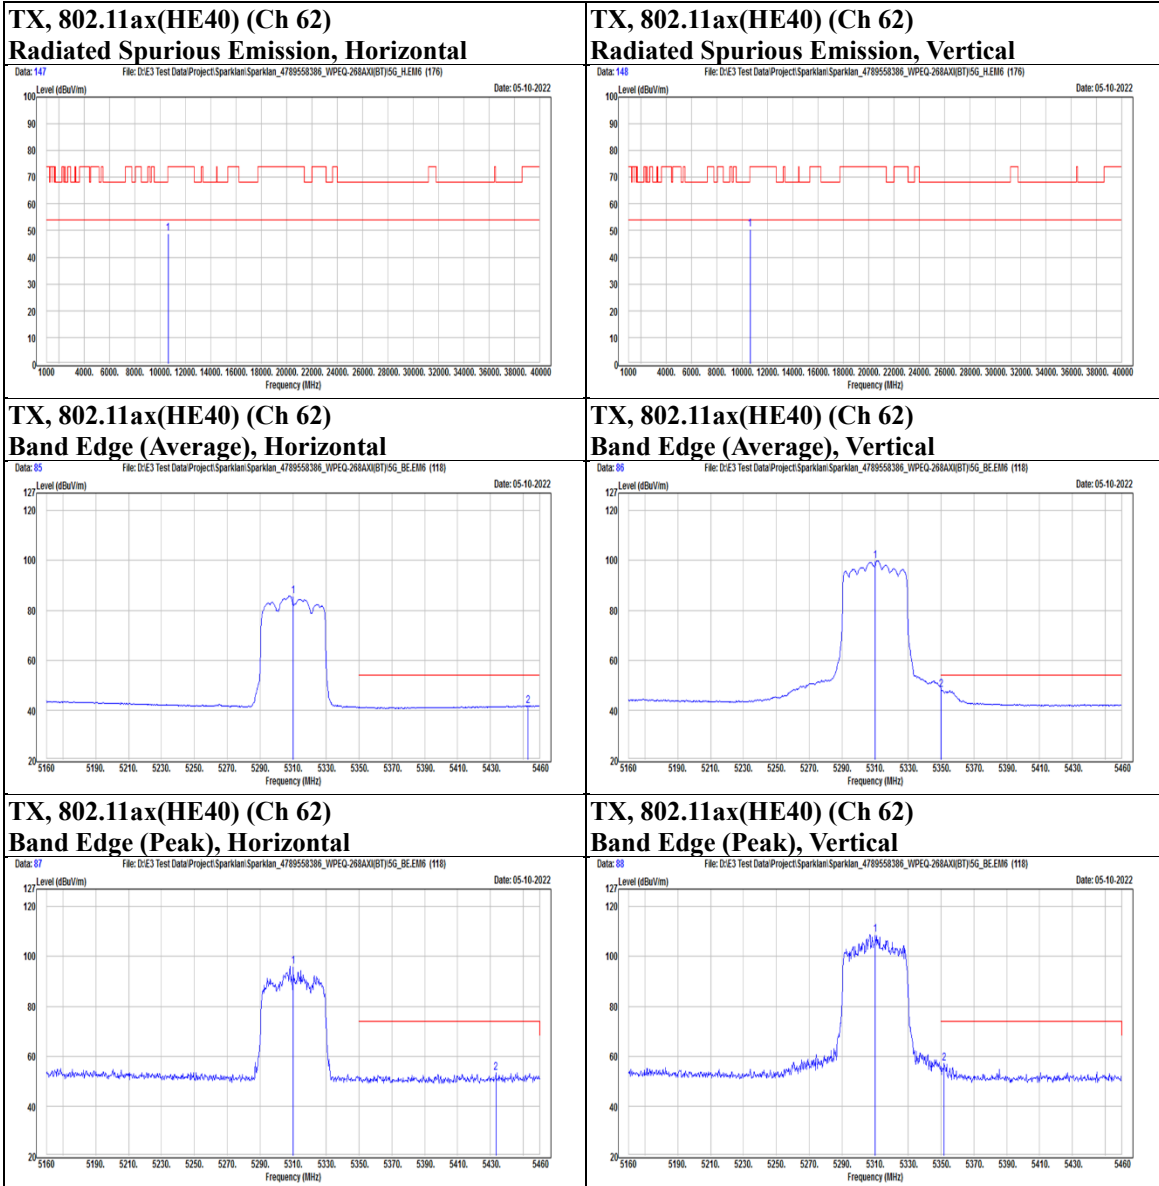



Mode	802.11ax(HE40)	Channel	102
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5453.2	39.82	13.53	53.35	74	-20.65	PK
		5453.2	29.9	13.53	43.43	54	-10.57	AVG
		5465.45	38.89	13.6	52.49	68.2	-15.71	PK
	@	5510	80.33	13.78	94.11	N/A	N/A	PK
	@	5510	70.2	13.78	83.98	N/A	N/A	AVG
	*	11020	31.23	18.42	49.65	74	-24.35	PK
Vertical		5459.15	45.6	13.57	59.17	74	-14.83	PK
		5459.15	34.29	13.57	47.86	54	-6.14	AVG
		5466.15	45.8	13.6	59.4	68.2	-8.8	PK
	@	5510	93.72	13.78	107.5	N/A	N/A	PK
	@	5510	83.1	13.78	96.88	N/A	N/A	AVG
	*	11020	31.3	18.42	49.72	74	-24.28	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

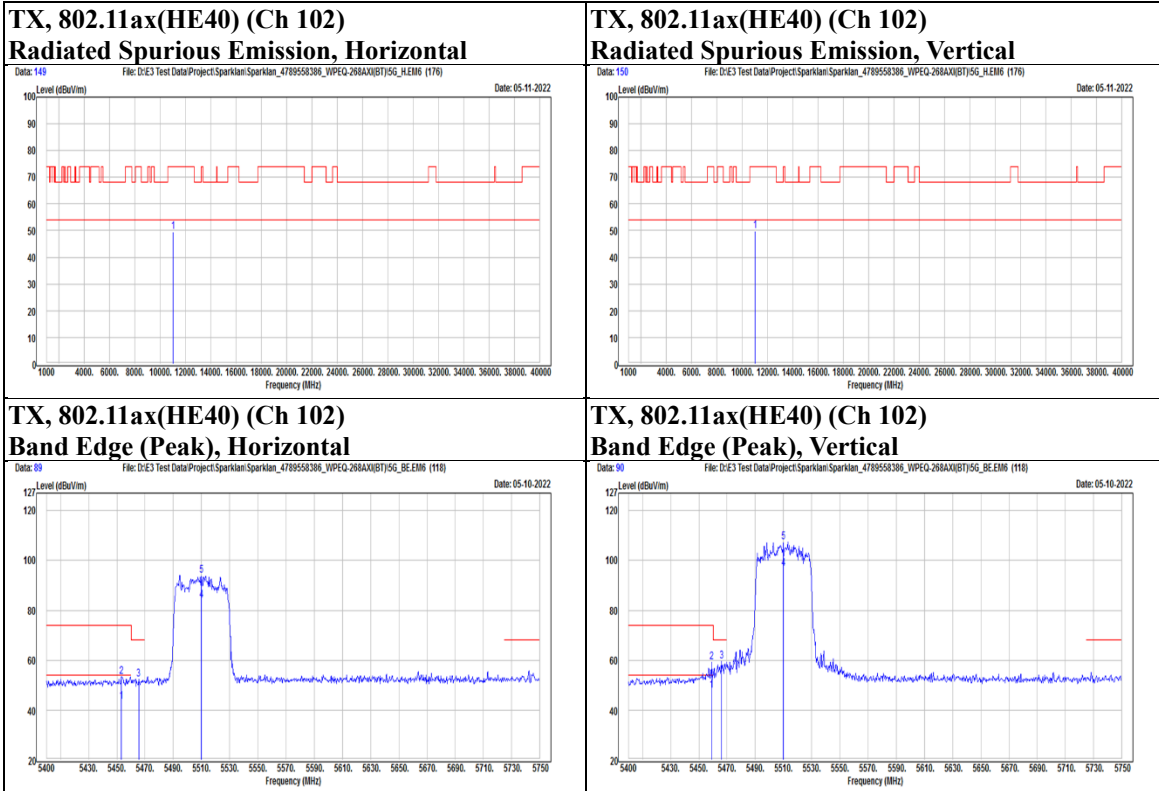



Mode	802.11ax(HE40)	Channel	110
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5450.05	39.4	13.51	52.91	74	-21.09	PK
		5450.05	29.41	13.51	42.92	54	-11.08	AVG
		5460.55	39.11	13.57	52.68	68.2	-15.52	PK
	@	5550	82.59	13.83	96.42	N/A	N/A	PK
	@	5550	72.11	13.83	85.94	N/A	N/A	AVG
		5726.55	41.09	13.97	55.06	68.2	-13.14	PK
	*	11100	31.47	18.45	49.92	74	-24.08	PK
Vertical		5446.9	40.8	13.5	54.3	74	-19.7	PK
		5446.9	30.5	13.5	44	54	-10	AVG
		5468.6	41.97	13.61	55.58	68.2	-12.62	PK
	@	5550	94.79	13.83	108.62	N/A	N/A	PK
	@	5550	84.51	13.83	98.34	N/A	N/A	AVG
		5739.15	41.7	14.09	55.79	68.2	-12.41	PK
	*	11100	31.36	18.45	49.81	74	-24.19	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

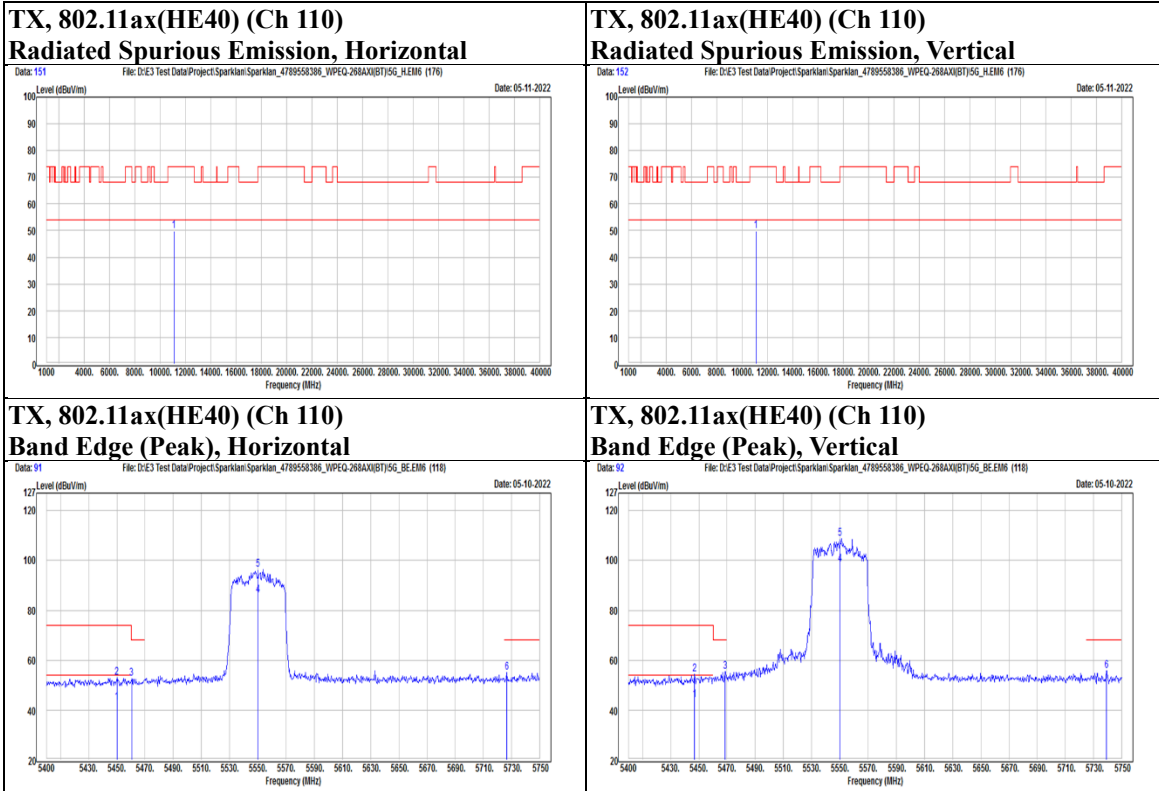



Test report No. : 4790371368-US-R1-V0
Page : 178 of 206
Issued date : 2022/11/9
FCC ID : RYK-WPEQ268AXB

Mode	802.11ax(HE40)	Channel	134
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5670	83.84	13.69	97.53	N/A	N/A	PK
	@	5670	73.8	13.69	87.49	N/A	N/A	AVG
		5728.3	41.08	14	55.08	68.2	-13.12	PK
	*	11340	31.11	18.58	49.69	74	-24.31	PK
Vertical	@	5670	98.7	13.69	112.39	N/A	N/A	PK
	@	5670	88.3	13.69	101.99	N/A	N/A	AVG
		5725.85	45.73	13.97	59.7	68.2	-8.5	PK
	*	11340	33.59	18.58	52.17	74	-21.83	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0