

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 141 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE40)	Channel	99
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5890.8	41.25	14.91	56.16	88.2	-32.04	PK
		5911.8	30.65	14.97	45.62	68.2	-22.58	AVG
	@	6445	70.65	16.82	87.47	N/A	N/A	PK
	@	6445	59.64	16.82	76.46	N/A	N/A	AVG
		7166.2	30.06	19.93	49.99	68.2	-18.21	AVG
		7223.6	40.73	20.25	60.98	88.2	-27.22	PK
	*	12890	29.17	20.79	49.96	88.2	-38.24	PK
Vertical		5879.6	41.28	14.84	56.12	88.2	-32.08	PK
		5907.6	30.68	14.97	45.65	68.2	-22.55	AVG
	@	6445	81.52	16.82	98.34	N/A	N/A	PK
	@	6445	71.25	16.82	88.07	N/A	N/A	AVG
		7190	40.13	20.07	60.2	88.2	-28	PK
		7206.8	29.77	20.16	49.93	68.2	-18.27	AVG
	*	12890	29.04	20.79	49.83	88.2	-38.37	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

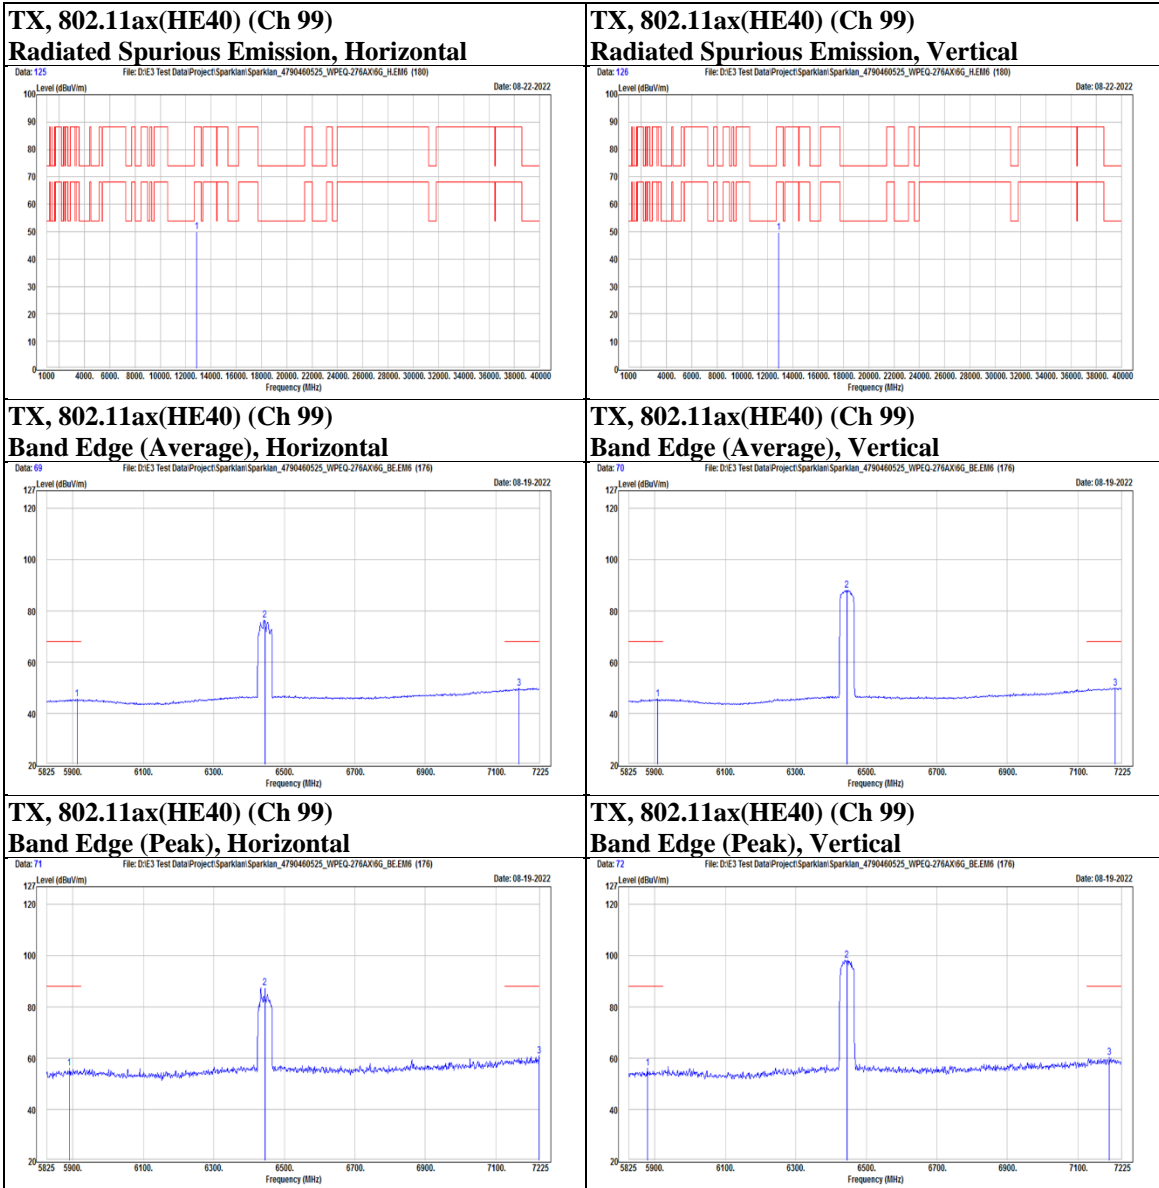

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 143 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE40)	Channel	107
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5917.4	30.56	14.97	45.53	68.2	-22.67	AVG
		5924.4	40.97	14.96	55.93	88.2	-32.27	PK
	@	6485	68.38	17.15	85.53	N/A	N/A	PK
	@	6485	58.84	17.15	75.99	N/A	N/A	AVG
		7170.4	30.16	19.96	50.12	68.2	-18.08	AVG
		7205.4	40.03	20.15	60.18	88.2	-28.02	PK
	*	12970	28.51	20.88	49.39	88.2	-38.81	PK
Vertical		5878.2	41.39	14.83	56.22	88.2	-31.98	PK
		5903.4	30.65	14.97	45.62	68.2	-22.58	AVG
	@	6485	82.57	17.15	99.72	N/A	N/A	PK
	@	6485	71.19	17.15	88.34	N/A	N/A	AVG
		7199.8	41.16	20.12	61.28	88.2	-26.92	PK
		7220.8	29.75	20.23	49.98	68.2	-18.22	AVG
	*	12970	28.32	20.88	49.2	88.2	-39	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

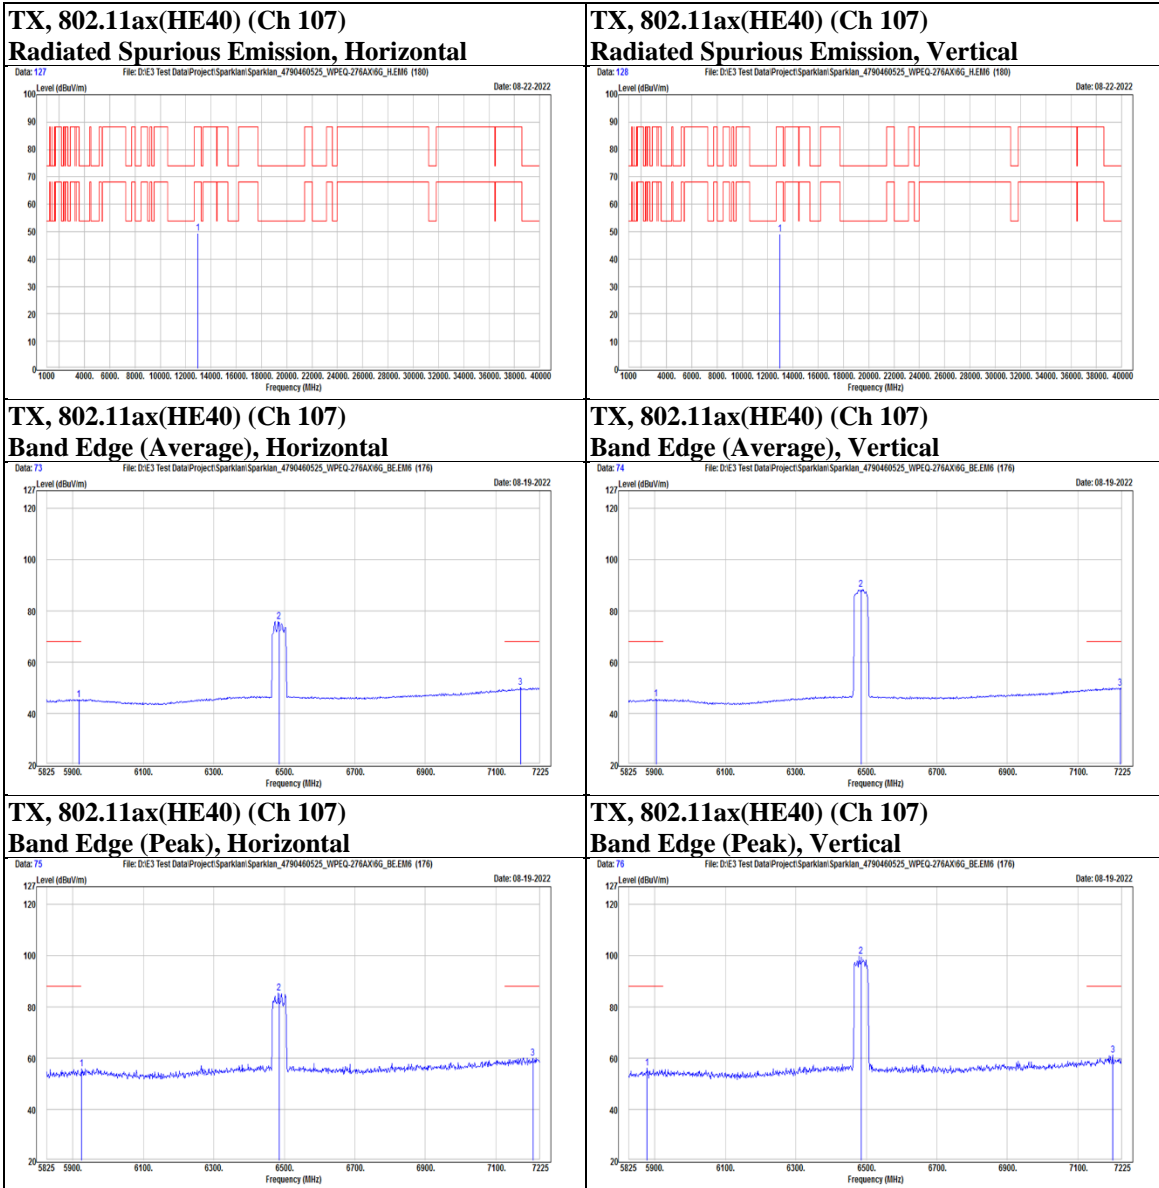

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 145 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE40)	Channel	115
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5914.6	41.06	14.96	56.02	88.2	-32.18	PK
		5920.2	30.6	14.96	45.56	68.2	-22.64	AVG
	@	6525	67.11	17.32	84.43	N/A	N/A	PK
	@	6525	57.86	17.32	75.18	N/A	N/A	AVG
		7202.6	29.75	20.14	49.89	68.2	-18.31	AVG
		7204	41.71	20.15	61.86	88.2	-26.34	PK
	*	13050	28.26	20.98	49.24	88.2	-38.96	PK
Vertical		5844.6	41.22	14.61	55.83	88.2	-32.37	PK
		5886.6	30.84	14.89	45.73	68.2	-22.47	AVG
	@	6525	82.07	17.32	99.39	N/A	N/A	PK
	@	6525	71.31	17.32	88.63	N/A	N/A	AVG
		7138.2	40.45	19.78	60.23	88.2	-27.97	PK
		7213.8	29.96	20.2	50.16	68.2	-18.04	AVG
	*	13050	29.59	20.98	50.57	88.2	-37.63	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

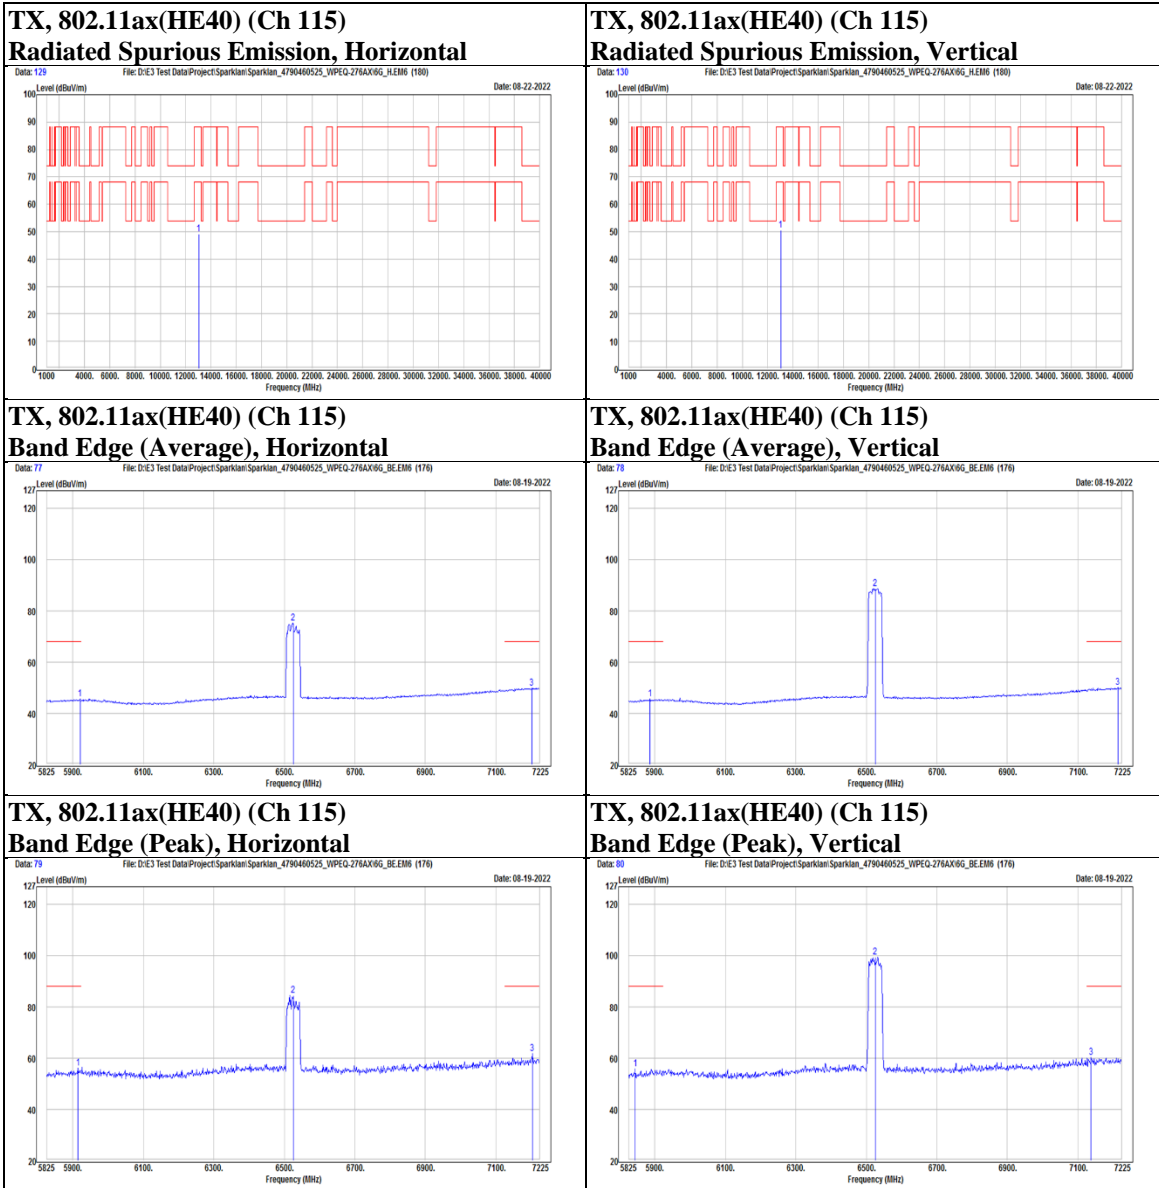

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 147 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE40)	Channel	123
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5897.8	41.61	14.96	56.57	88.2	-31.63	PK
		5916	30.84	14.97	45.81	68.2	-22.39	AVG
	@	6565	67.04	17.37	84.41	N/A	N/A	PK
	@	6565	56.69	17.37	74.06	N/A	N/A	AVG
		7204	40.33	20.15	60.48	88.2	-27.72	PK
		7225	29.65	20.26	49.91	68.2	-18.29	AVG
	*	13130	28.61	21.13	49.74	88.2	-38.46	PK
Vertical		5899.2	40.65	14.97	55.62	88.2	-32.58	PK
		5909	30.75	14.97	45.72	68.2	-22.48	AVG
	@	6565	81.52	17.37	98.89	N/A	N/A	PK
	@	6565	71.27	17.37	88.64	N/A	N/A	AVG
		7212.4	40.98	20.19	61.17	88.2	-27.03	PK
		7213.8	29.83	20.2	50.03	68.2	-18.17	AVG
	*	13130	28.97	21.13	50.1	88.2	-38.1	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

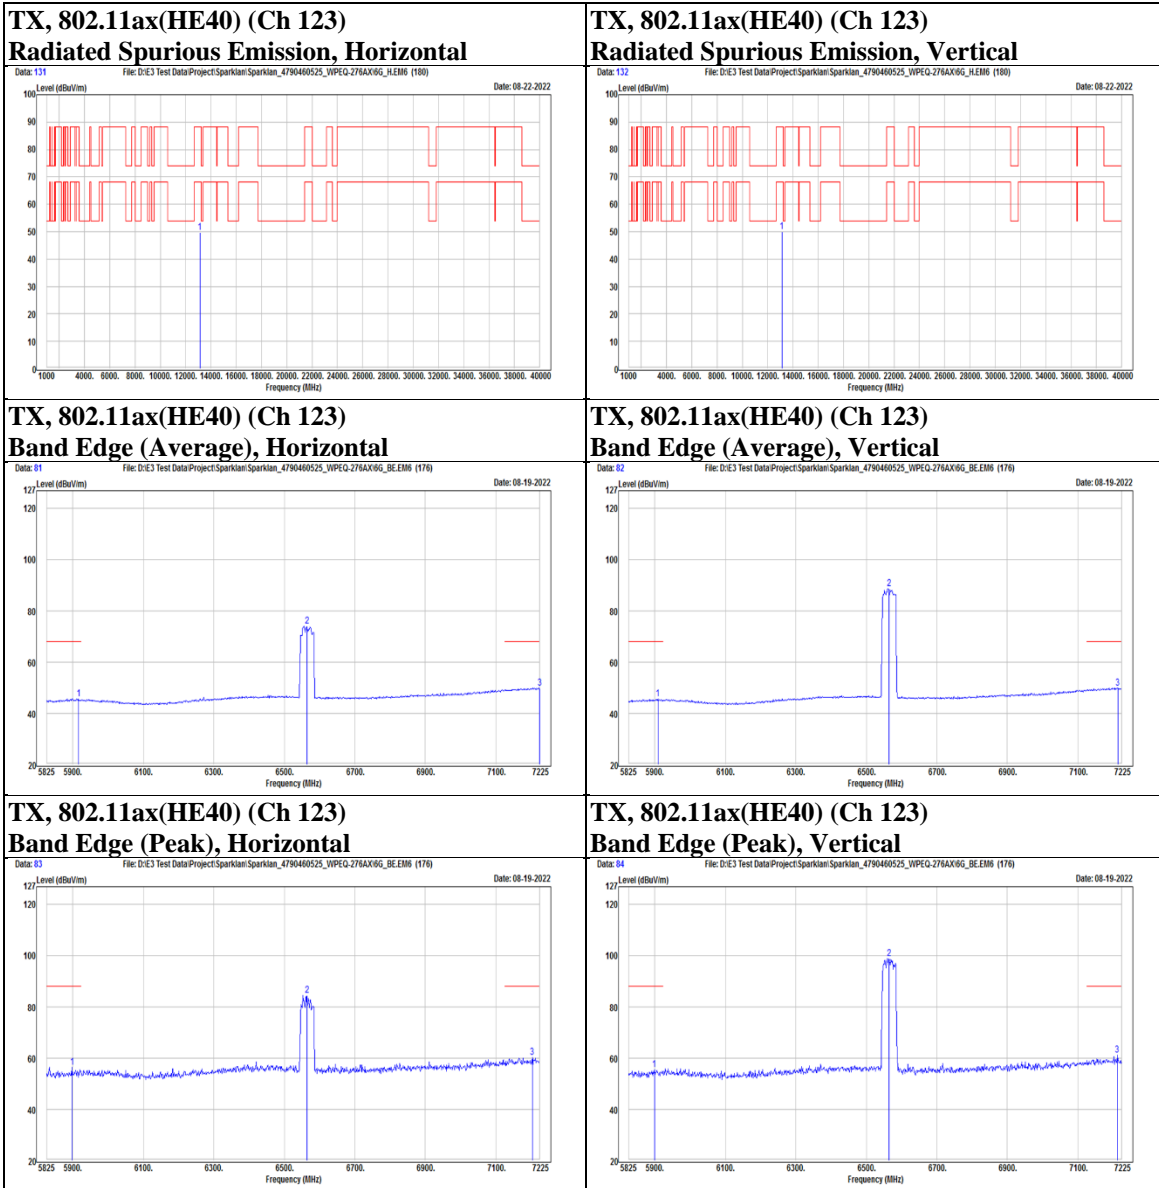

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 149 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE40)	Channel	155
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5893.6	30.55	14.93	45.48	68.2	-22.72	AVG
		5921.6	41.36	14.96	56.32	88.2	-31.88	PK
	@	6725	67.08	17.54	84.62	N/A	N/A	PK
	@	6725	56.56	17.54	74.1	N/A	N/A	AVG
		7150.8	41.07	19.85	60.92	88.2	-27.28	PK
		7225	29.72	20.26	49.98	68.2	-18.22	AVG
	*	13450	29.39	22.34	51.73	88.2	-36.47	PK
Vertical		5913.2	30.67	14.96	45.63	68.2	-22.57	AVG
		5914.6	41.2	14.96	56.16	88.2	-32.04	PK
	@	6725	82.11	17.54	99.65	N/A	N/A	PK
	@	6725	71.28	17.54	88.82	N/A	N/A	AVG
		7208.2	40.1	20.17	60.27	88.2	-27.93	PK
		7223.6	30.13	20.25	50.38	68.2	-17.82	AVG
	*	13450	30.19	22.34	52.53	88.2	-35.67	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

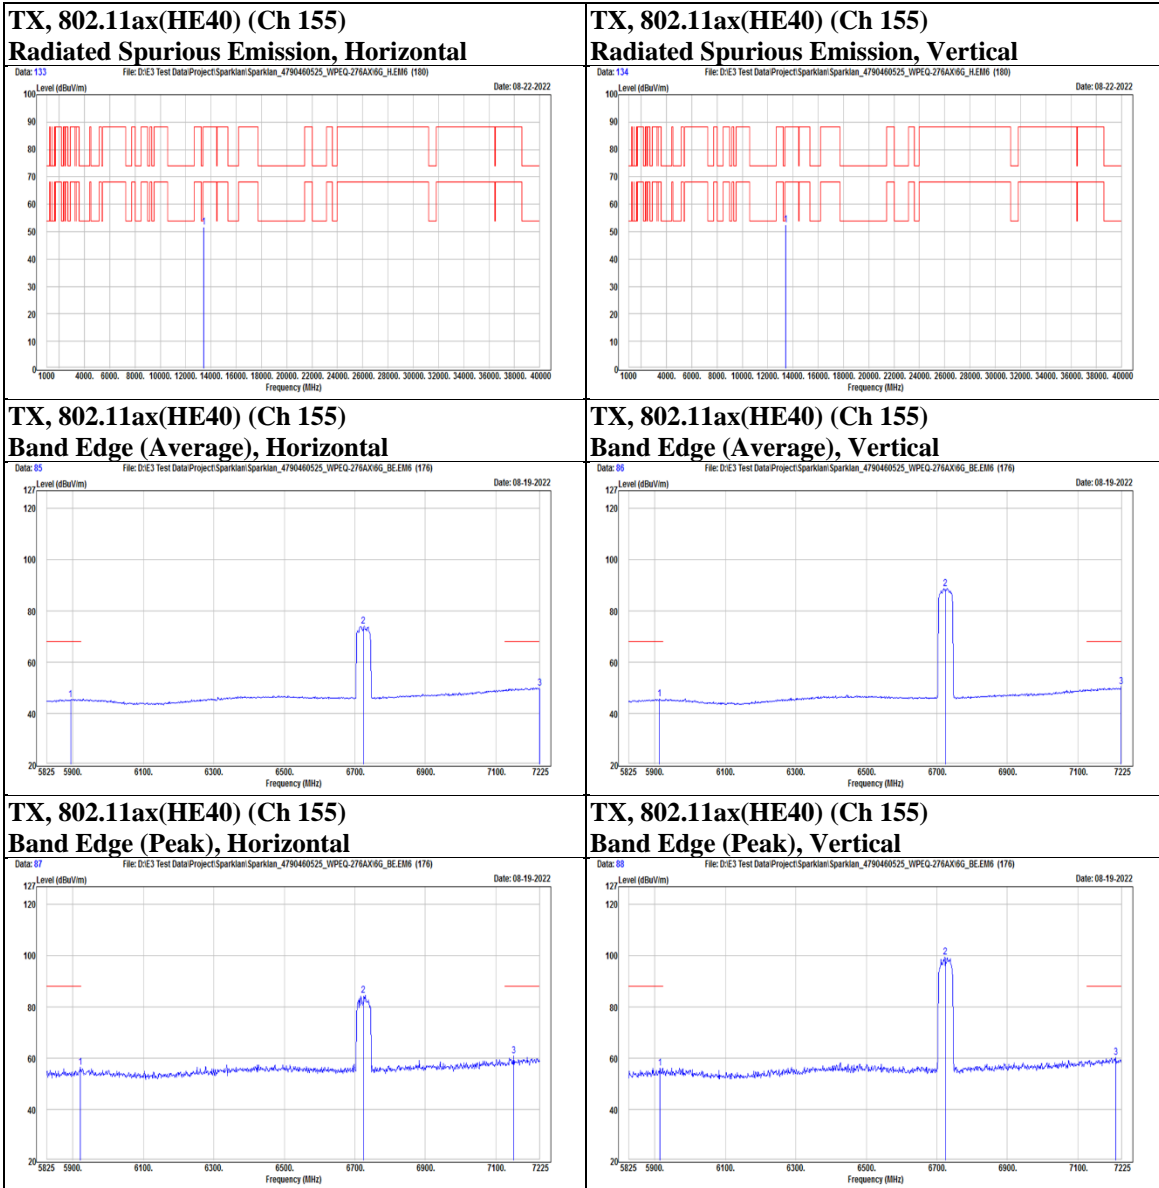



Test report No. : 4790460525-US-R0-V0
Page : 151 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE40)	Channel	179
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5858.6	41.6	14.68	56.28	88.2	-31.92	PK
		5911.8	30.8	14.97	45.77	68.2	-22.43	AVG
	@	6845	65.78	18.24	84.02	N/A	N/A	PK
	@	6845	57.02	18.24	75.26	N/A	N/A	AVG
		7132.6	40.96	19.76	60.72	88.2	-27.48	PK
		7209.6	29.99	20.18	50.17	68.2	-18.03	AVG
	*	13690	29.27	22.77	52.04	88.2	-36.16	PK
Vertical		5857.2	40.63	14.67	55.3	88.2	-32.9	PK
		5902	30.62	14.98	45.6	68.2	-22.6	AVG
	@	6845	81.87	18.24	100.11	N/A	N/A	PK
	@	6845	71.74	18.24	89.98	N/A	N/A	AVG
		7139.6	40.42	19.8	60.22	88.2	-27.98	PK
		7201.2	29.8	20.13	49.93	68.2	-18.27	AVG
	*	13690	28.65	22.77	51.42	88.2	-36.78	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

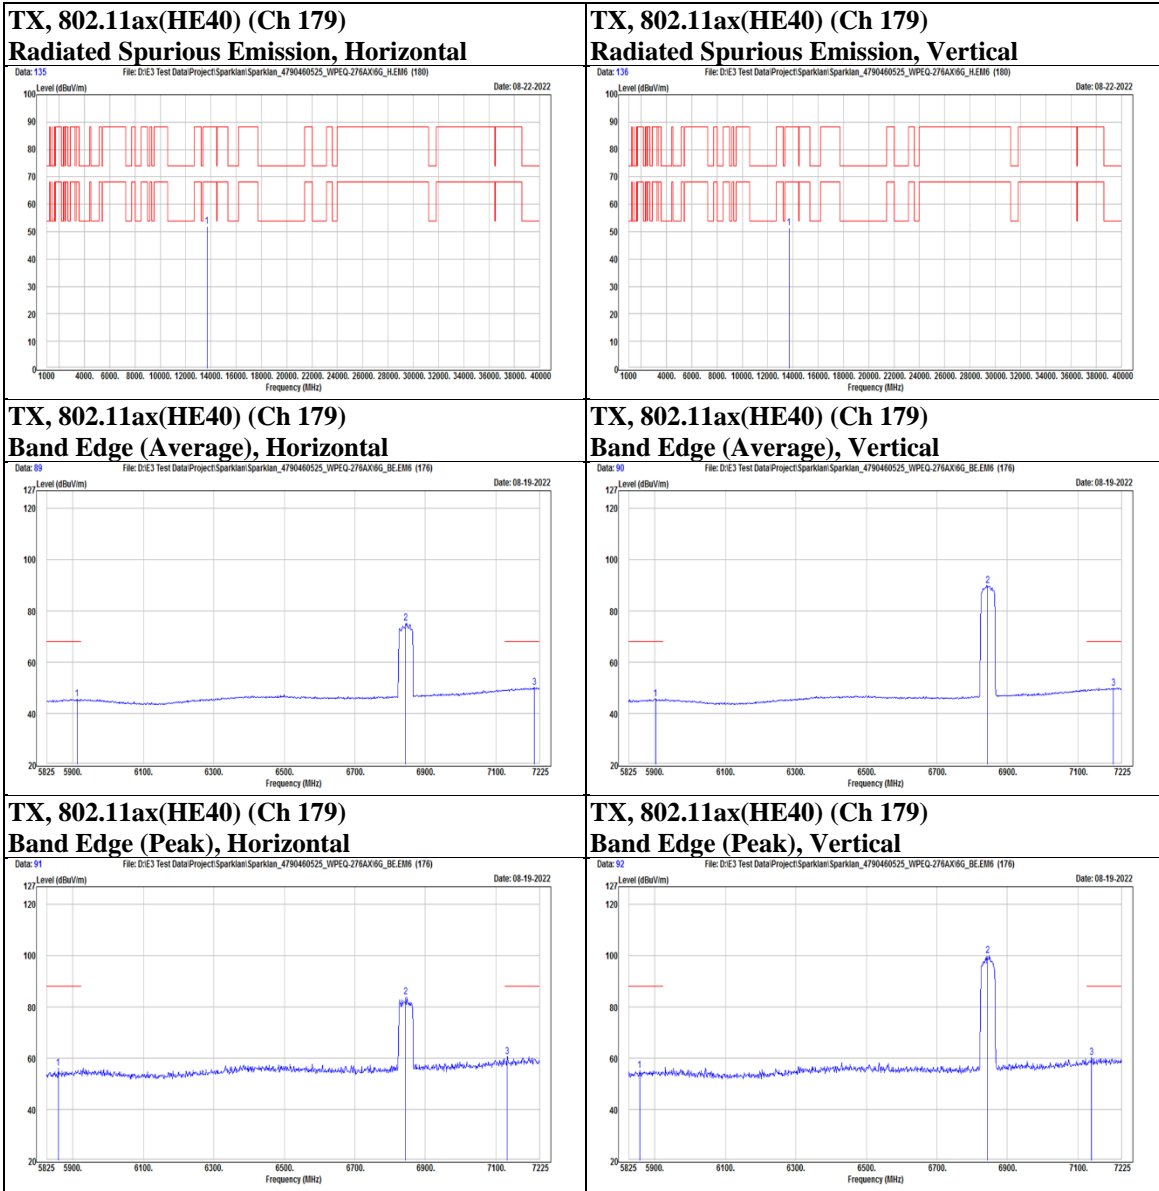

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 153 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE40)	Channel	187
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5847.4	41	14.61	55.61	88.2	-32.59	PK
		5918.8	30.45	14.96	45.41	68.2	-22.79	AVG
	@	6885	66.02	18.3	84.32	N/A	N/A	PK
	@	6885	56.1	18.3	74.4	N/A	N/A	AVG
		7198.4	40.7	20.11	60.81	88.2	-27.39	PK
		7199.8	29.85	20.12	49.97	68.2	-18.23	AVG
	*	13770	27.98	23.01	50.99	88.2	-37.21	PK
Vertical		5832	40.75	14.59	55.34	88.2	-32.86	PK
		5920.2	30.54	14.96	45.5	68.2	-22.7	AVG
	@	6885	82.72	18.3	101.02	N/A	N/A	PK
	@	6885	71.17	18.3	89.47	N/A	N/A	AVG
		7164.8	41.07	19.93	61	88.2	-27.2	PK
		7201.2	29.84	20.13	49.97	68.2	-18.23	AVG
	*	13770	28.67	23.01	51.68	88.2	-36.52	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

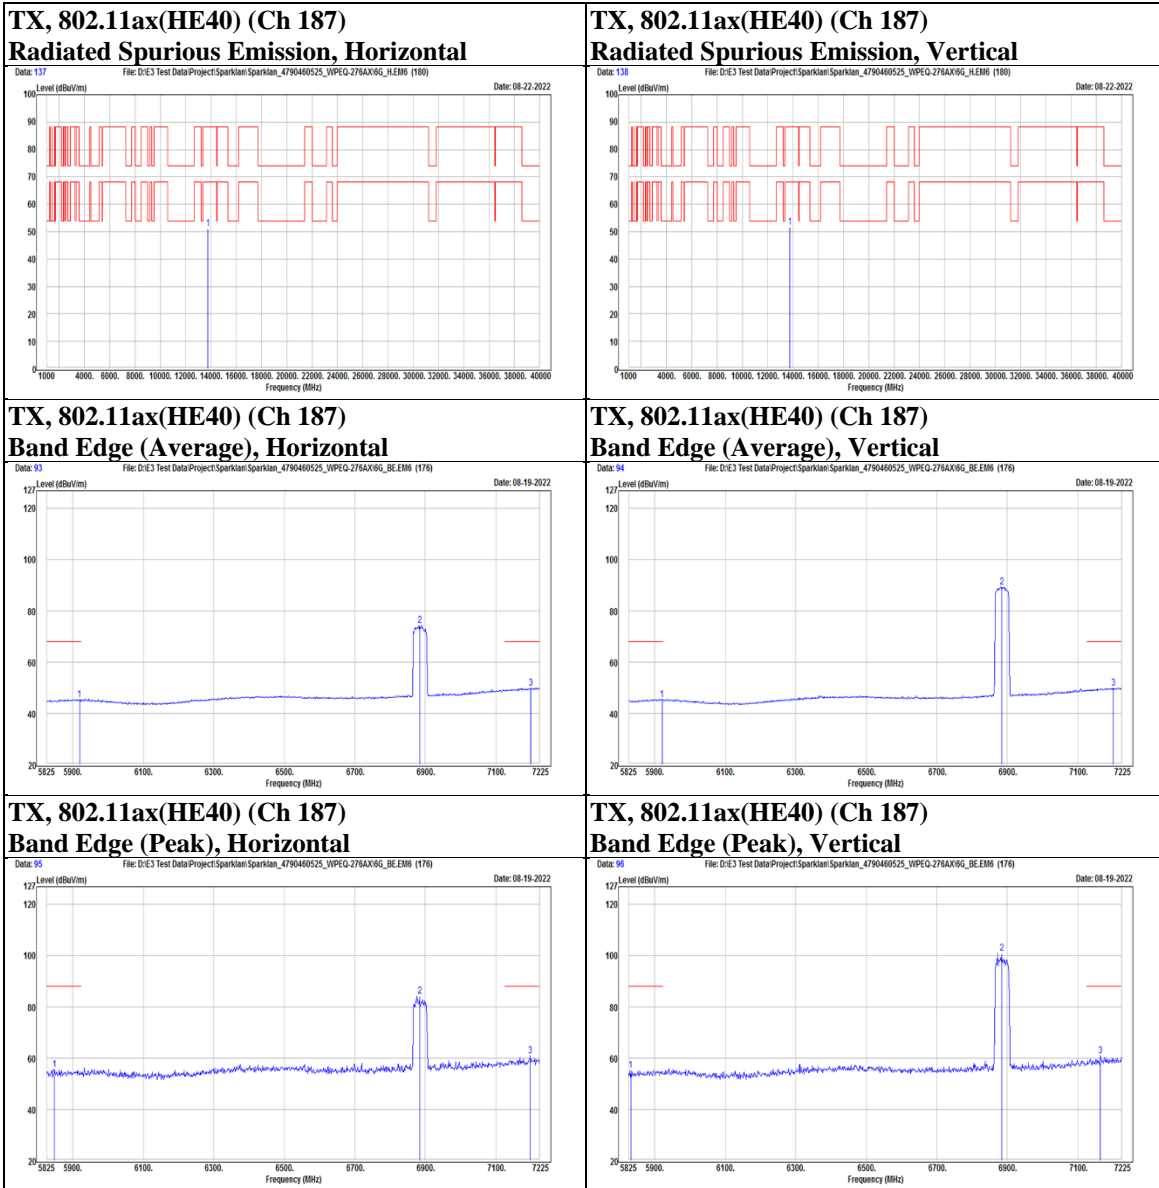

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 155 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE40)	Channel	211
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7005	66.38	18.78	85.16	N/A	N/A	PK
	@	7005	56.93	18.78	75.71	N/A	N/A	AVG
		7148	30.27	19.84	50.11	68.2	-18.09	AVG
		7167.6	41.77	19.95	61.72	88.2	-26.48	PK
	*	14010	29.38	23.96	53.34	88.2	-34.86	PK
Vertical	@	7005	81.54	18.78	100.32	N/A	N/A	PK
	@	7005	71.63	18.78	90.41	N/A	N/A	AVG
		7211	29.9	20.18	50.08	68.2	-18.12	AVG
		7213.8	40.32	20.2	60.52	88.2	-27.68	PK
	*	14010	30.08	23.96	54.04	88.2	-34.16	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

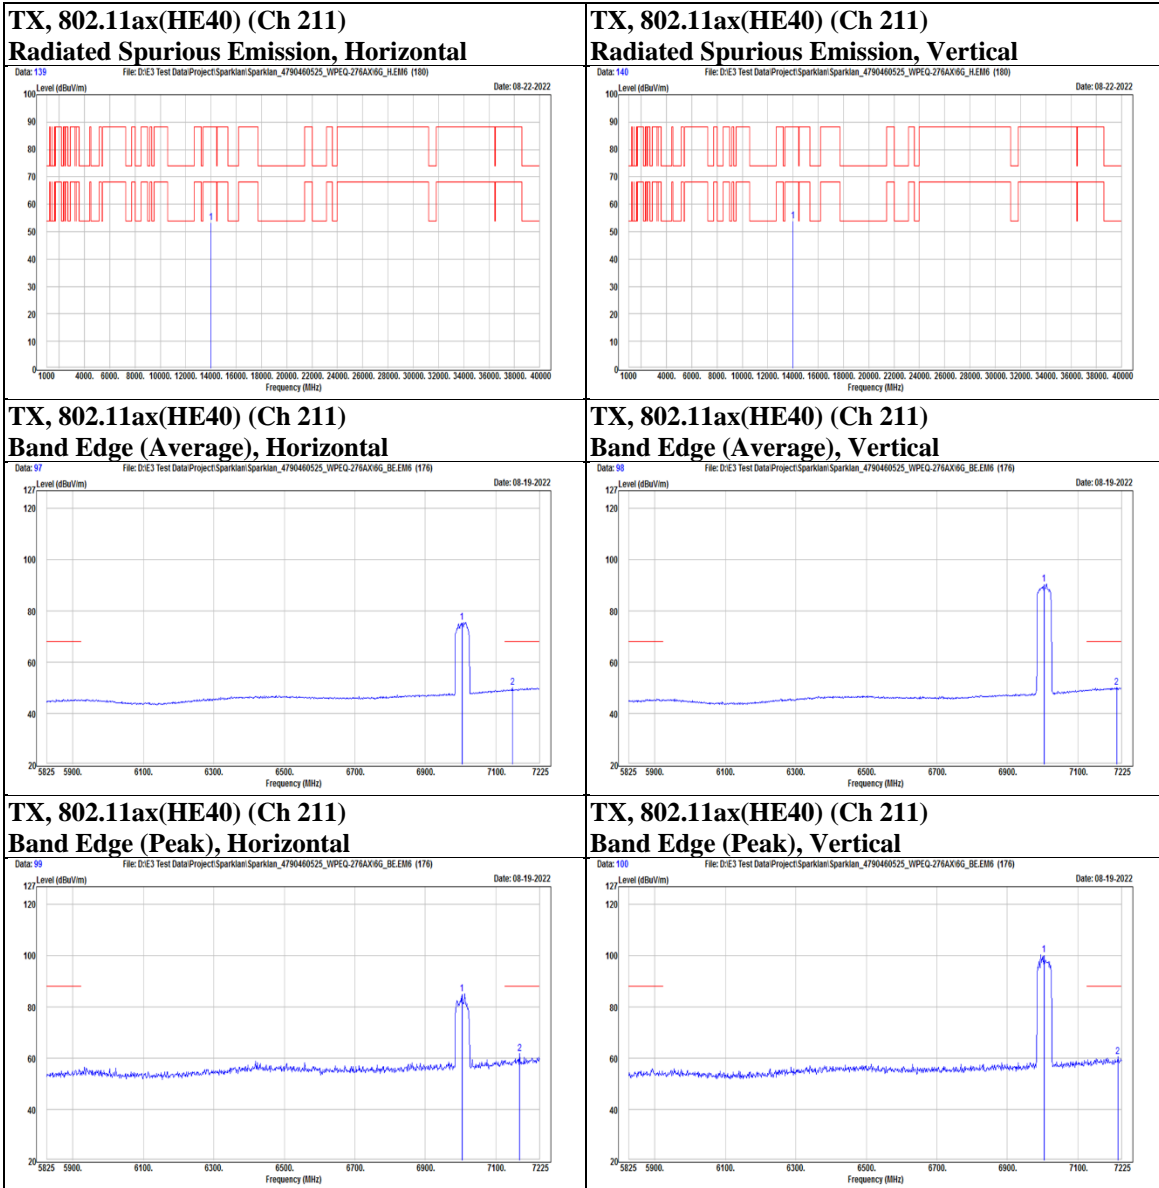

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 157 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE40)	Channel	227
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7085	65.11	19.47	84.58	N/A	N/A	PK
	@	7085	55.56	19.47	75.03	N/A	N/A	AVG
		7205.4	40.87	20.15	61.02	88.2	-27.18	PK
		7211	29.78	20.18	49.96	68.2	-18.24	AVG
	*	14170	28.69	24.64	53.33	88.2	-34.87	PK
Vertical	@	7085	81.56	19.47	101.03	N/A	N/A	PK
	@	7085	71.05	19.47	90.52	N/A	N/A	AVG
		7204	41.14	20.15	61.29	88.2	-26.91	PK
		7225	29.7	20.26	49.96	68.2	-18.24	AVG
	*	14170	28.36	24.64	53	88.2	-35.2	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

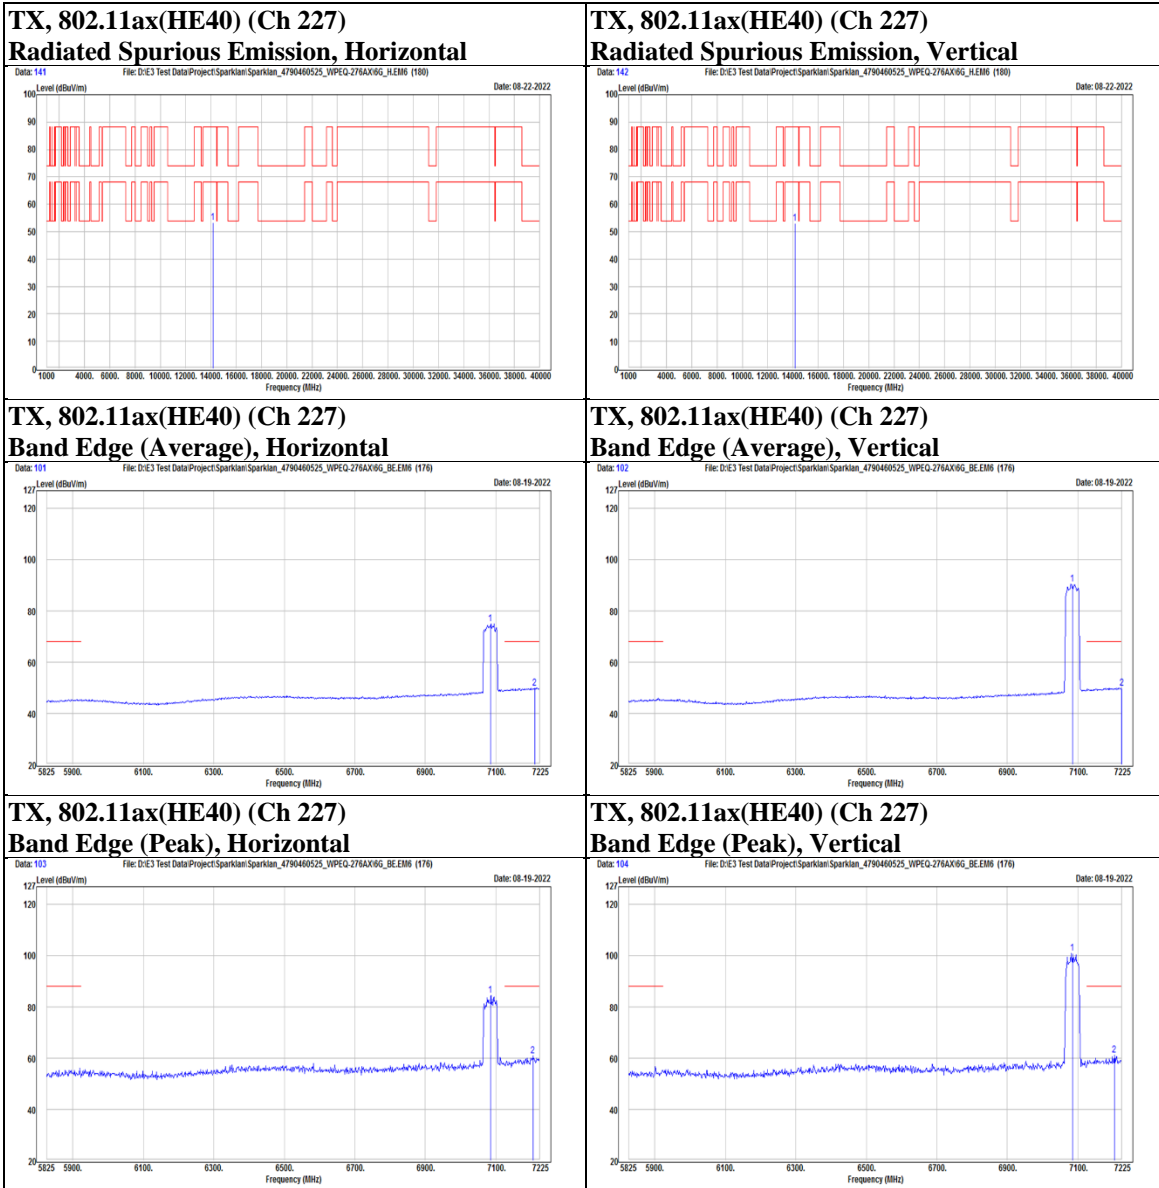



Test report No. : 4790460525-US-R0-V0
Page : 159 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	7
------	----------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5896.4	40.67	14.95	55.62	88.2	-32.58	PK
		5913.2	30.5	14.96	45.46	68.2	-22.74	AVG
	@	5985	72.99	14.98	87.97	N/A	N/A	PK
	@	5985	61.93	14.98	76.91	N/A	N/A	AVG
	*	11970	29.79	18.81	48.6	74	-25.4	PK
Vertical		5903.4	30.92	14.97	45.89	68.2	-22.31	AVG
		5914.6	41.04	14.96	56	88.2	-32.2	PK
	@	5985	84.26	14.98	99.24	N/A	N/A	PK
	@	5985	74.91	14.98	89.89	N/A	N/A	AVG
	*	11970	30.47	18.81	49.28	74	-24.72	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

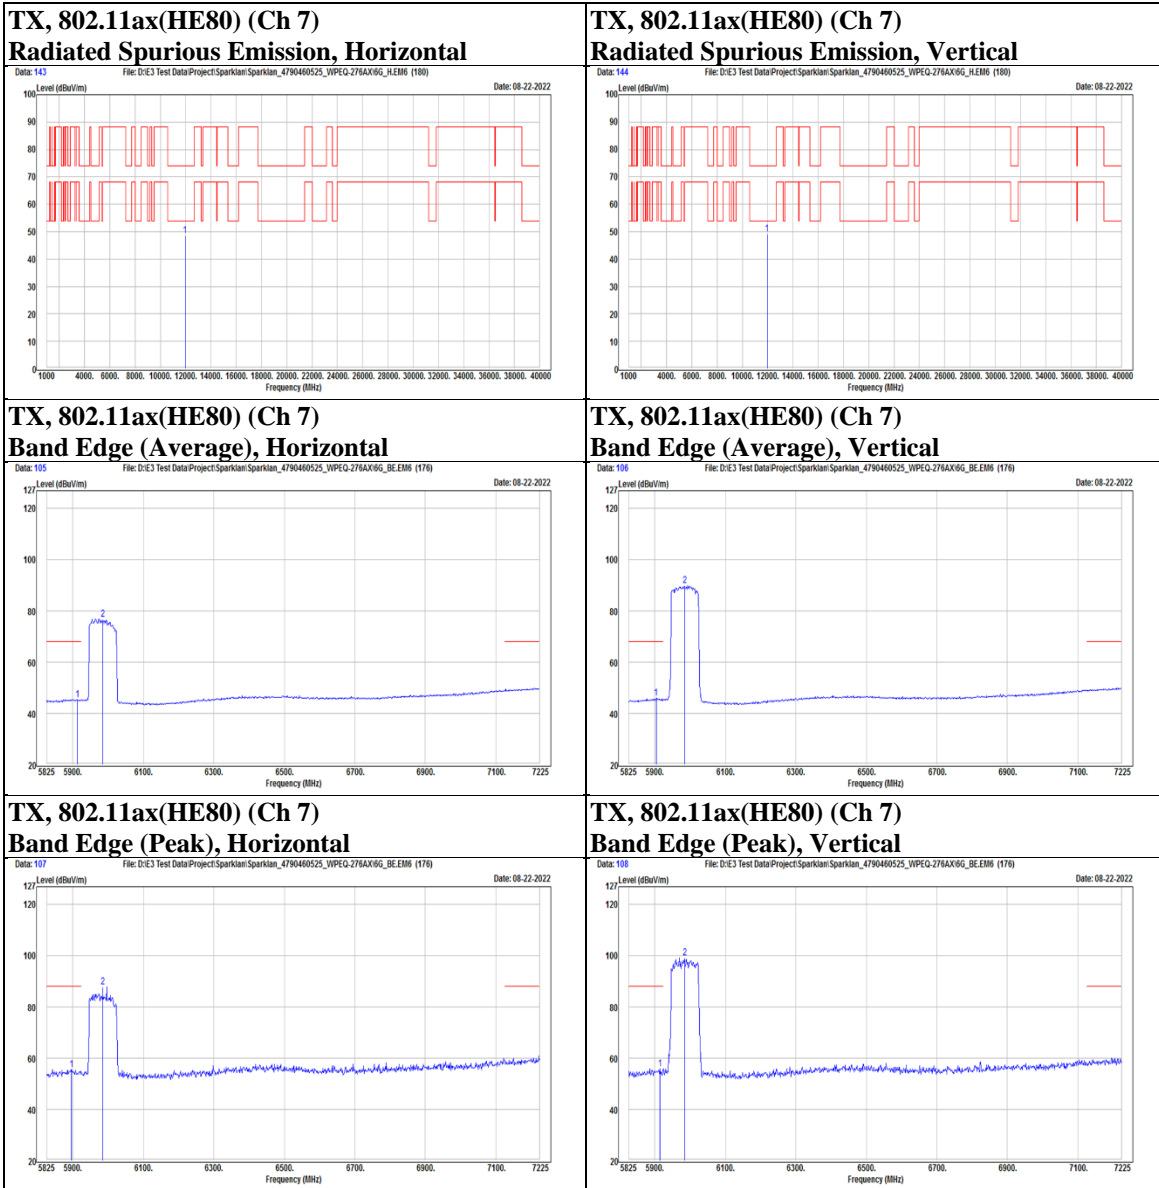

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 161 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	39
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5914.6	41.95	14.96	56.91	88.2	-31.29	PK
		5924.4	30.69	14.96	45.65	68.2	-22.55	AVG
	@	6145	67.72	15.37	83.09	N/A	N/A	PK
	@	6145	58.19	15.37	73.56	N/A	N/A	AVG
	*	12290	29.7	19.38	49.08	74	-24.92	PK
Vertical		5883.8	40.91	14.86	55.77	88.2	-32.43	PK
		5900.6	30.77	14.98	45.75	68.2	-22.45	AVG
	@	6145	83.91	15.37	99.28	N/A	N/A	PK
	@	6145	74.97	15.37	90.34	N/A	N/A	AVG
	*	12290	29.69	19.38	49.07	74	-24.93	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

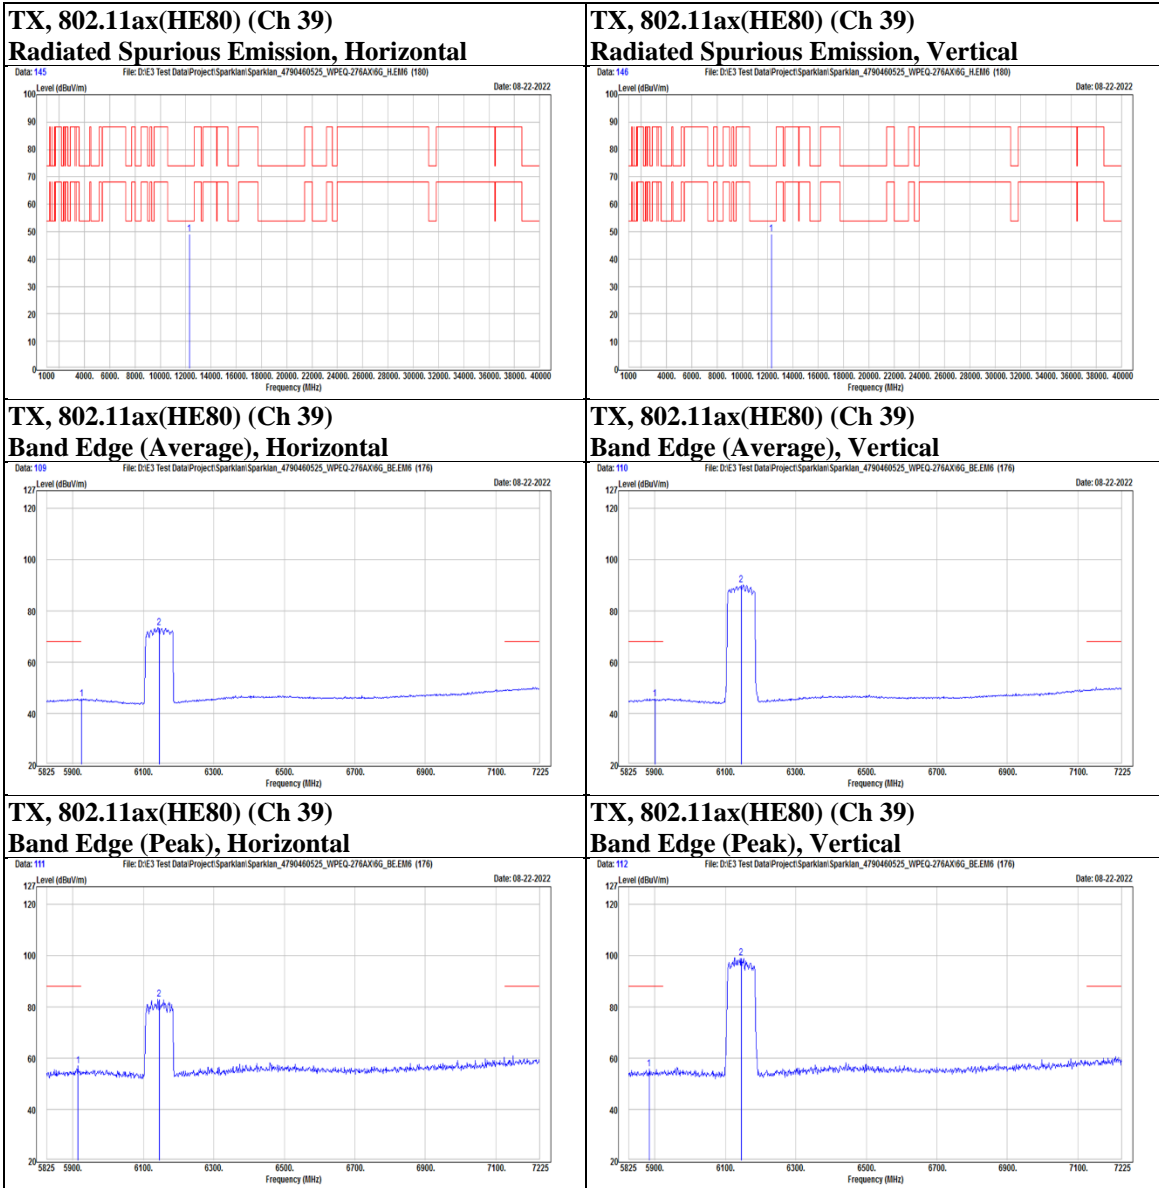

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 163 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	87
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5847.4	41.68	14.61	56.29	88.2	-31.91	PK
		5897.8	30.89	14.96	45.85	68.2	-22.35	AVG
	@	6385	69.94	16.6	86.54	N/A	N/A	PK
	@	6385	61.81	16.6	78.41	N/A	N/A	AVG
		7155	40.93	19.88	60.81	88.2	-27.39	PK
		7225	29.79	20.26	50.05	68.2	-18.15	AVG
	*	12770	28.81	20.39	49.2	88.2	-39	PK
Vertical		5899.2	41.08	14.97	56.05	88.2	-32.15	PK
		5906.2	31.29	14.97	46.26	68.2	-21.94	AVG
	@	6385	84.84	16.6	101.44	N/A	N/A	PK
	@	6385	74.75	16.6	91.35	N/A	N/A	AVG
		7213.8	41.39	20.2	61.59	88.2	-26.61	PK
		7216.6	29.89	20.22	50.11	68.2	-18.09	AVG
	*	12770	29.5	20.39	49.89	88.2	-38.31	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

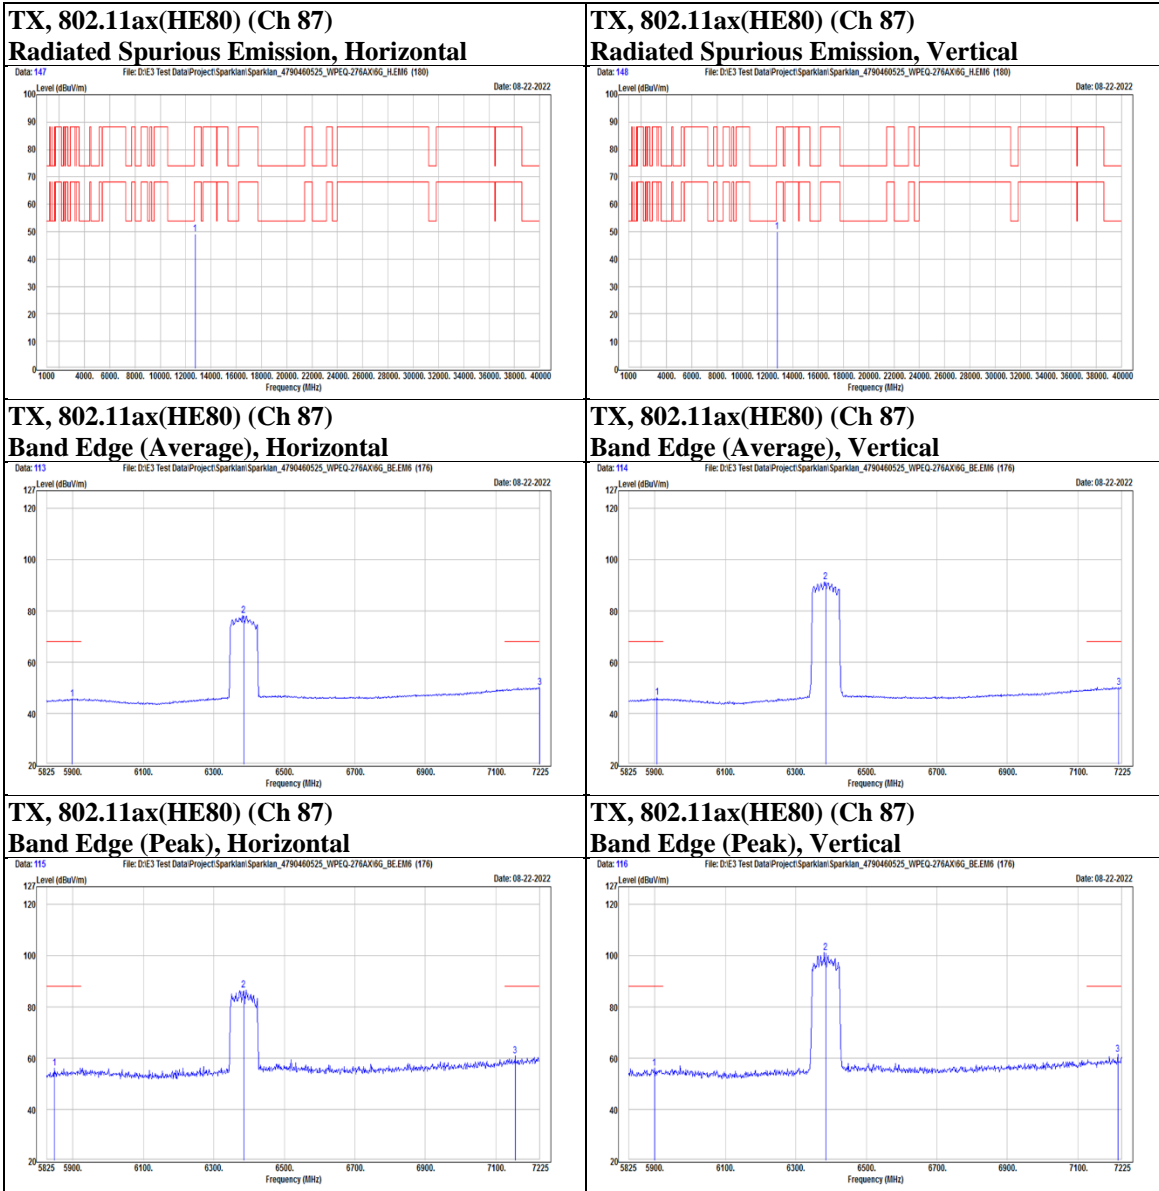

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 165 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	103
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5909	30.72	14.97	45.69	68.2	-22.51	AVG
		5924.4	41.11	14.96	56.07	88.2	-32.13	PK
	@	6465	71.3	16.97	88.27	N/A	N/A	PK
	@	6465	59.85	16.97	76.82	N/A	N/A	AVG
		7176	40.07	19.99	60.06	88.2	-28.14	PK
		7216.6	29.82	20.22	50.04	68.2	-18.16	AVG
	*	12930	29.09	20.84	49.93	88.2	-38.27	PK
Vertical		5872.6	41.09	14.79	55.88	88.2	-32.32	PK
		5897.8	30.86	14.96	45.82	68.2	-22.38	AVG
	@	6465	83.54	16.97	100.51	N/A	N/A	PK
	@	6465	73.83	16.97	90.8	N/A	N/A	AVG
		7216.6	39.75	20.22	59.97	88.2	-28.23	PK
		7223.6	29.86	20.25	50.11	68.2	-18.09	AVG
	*	12930	28.2	20.84	49.04	88.2	-39.16	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

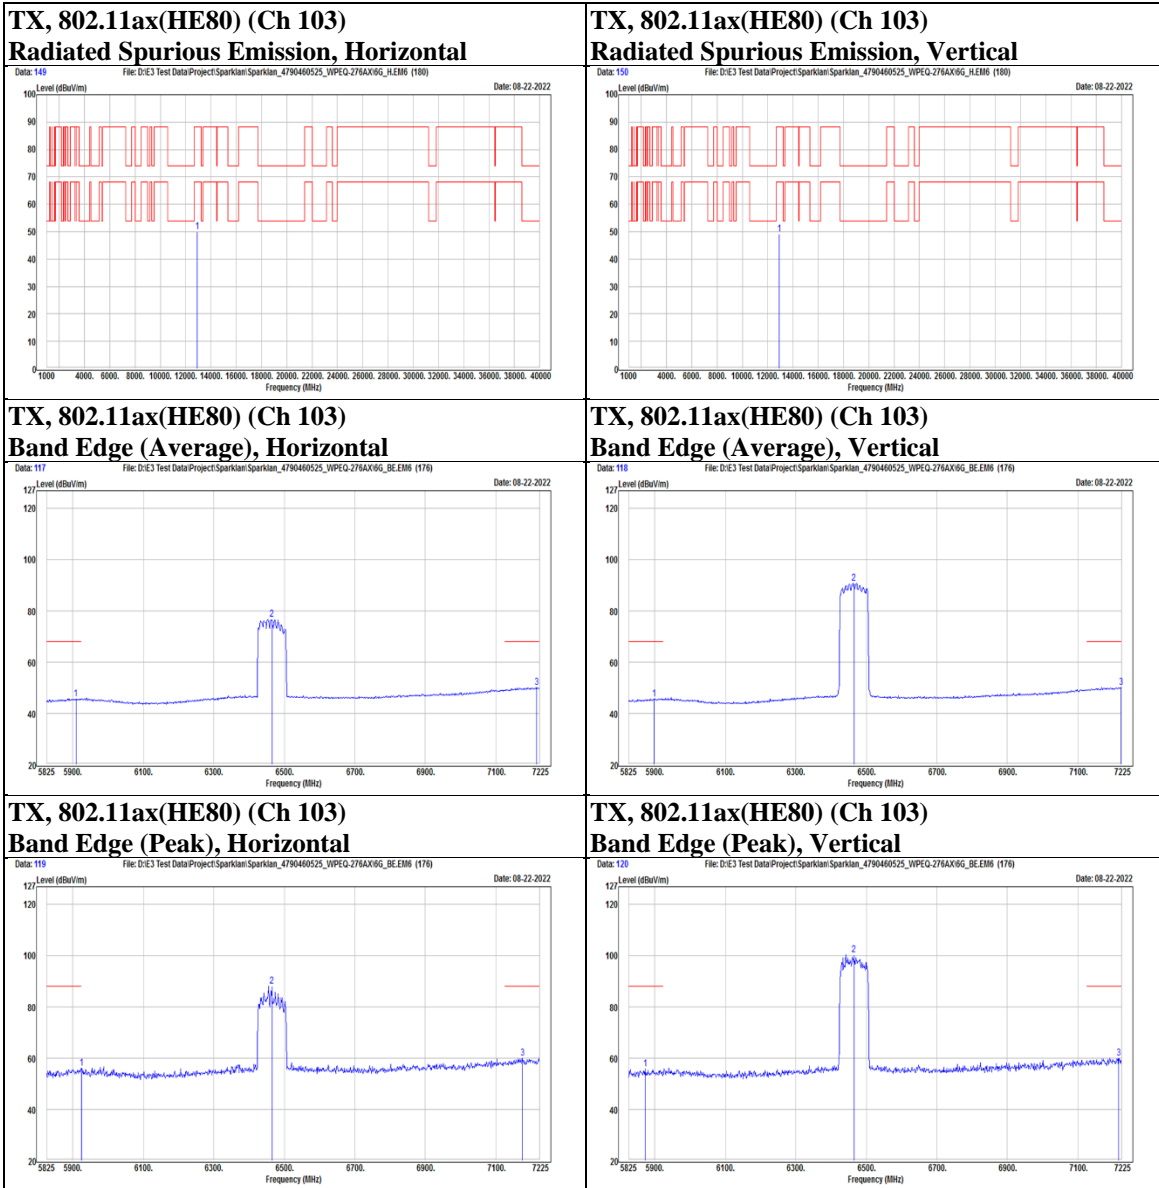

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 167 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	119
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5895	31.19	14.94	46.13	68.2	-22.07	AVG
		5914.6	42	14.96	56.96	88.2	-31.24	PK
	@	6545	65.97	17.34	83.31	N/A	N/A	PK
	@	6545	57.19	17.34	74.53	N/A	N/A	AVG
		7149.4	40.66	19.85	60.51	88.2	-27.69	PK
		7205.4	29.99	20.15	50.14	68.2	-18.06	AVG
	*	13090	28.99	21.03	50.02	88.2	-38.18	PK
Vertical		5906.2	41.09	14.97	56.06	88.2	-32.14	PK
		5917.4	30.93	14.97	45.9	68.2	-22.3	AVG
	@	6545	82.38	17.34	99.72	N/A	N/A	PK
	@	6545	73.55	17.34	90.89	N/A	N/A	AVG
		7164.8	41.05	19.93	60.98	88.2	-27.22	PK
		7206.8	30	20.16	50.16	68.2	-18.04	AVG
	*	13090	28.6	21.03	49.63	88.2	-38.57	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

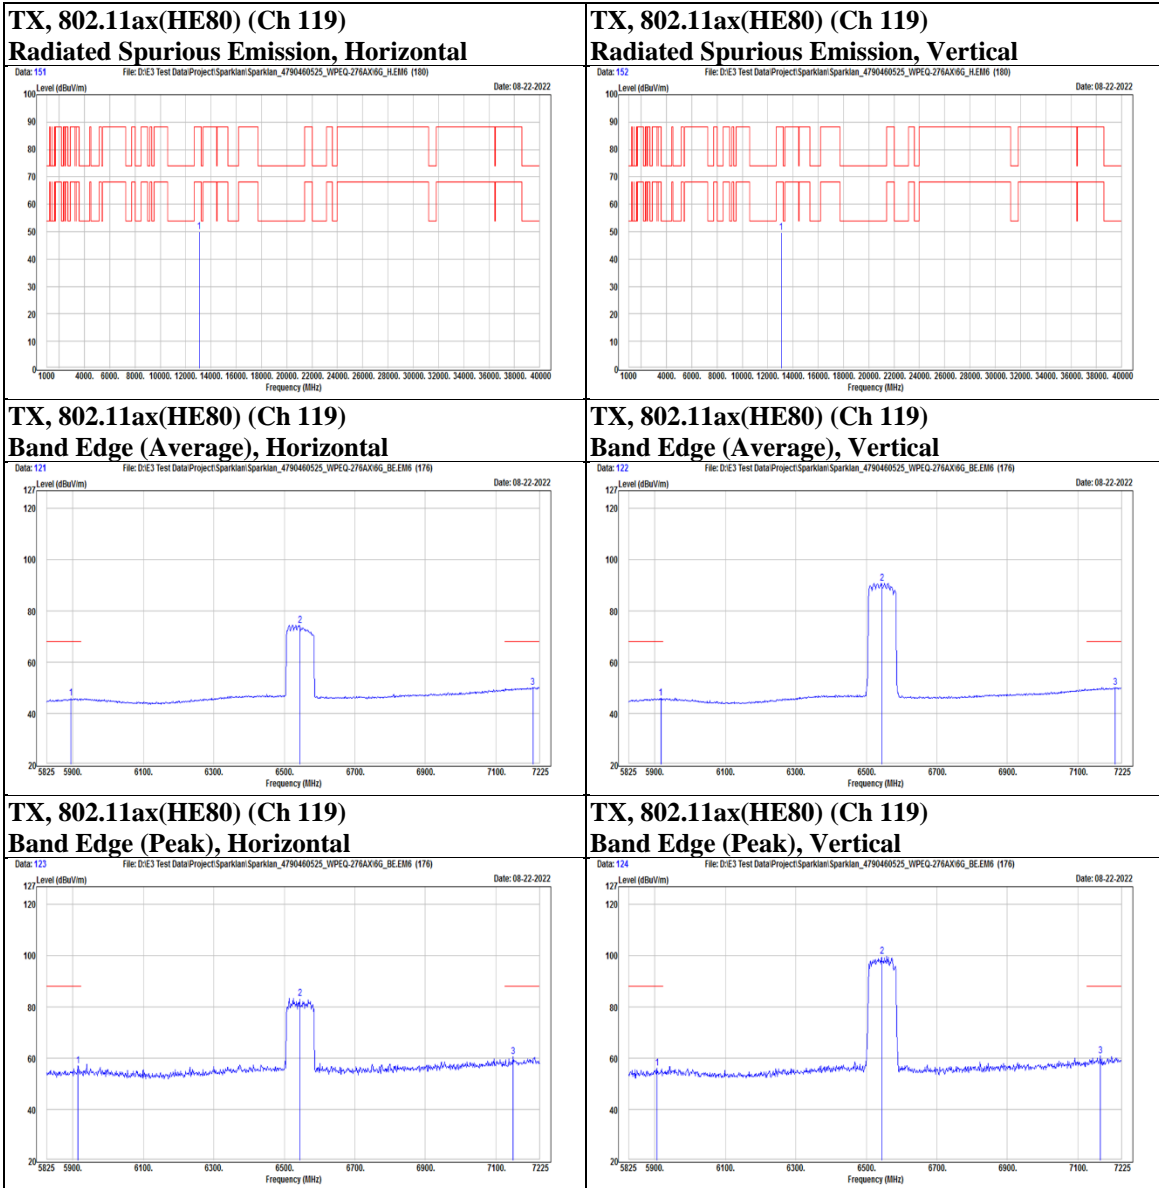

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 169 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	135
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5876.8	41.67	14.81	56.48	88.2	-31.72	PK
		5909	30.81	14.97	45.78	68.2	-22.42	AVG
	@	6625	66.3	17.42	83.72	N/A	N/A	PK
	@	6625	58.05	17.42	75.47	N/A	N/A	AVG
		7125	40.7	19.71	60.41	88.2	-27.79	PK
		7220.8	29.83	20.23	50.06	68.2	-18.14	AVG
	*	13250	28.59	21.49	50.08	74	-23.92	PK
Vertical		5900.6	40.56	14.98	55.54	88.2	-32.66	PK
		5913.2	30.86	14.96	45.82	68.2	-22.38	AVG
	@	6625	82.65	17.42	100.07	N/A	N/A	PK
	@	6625	73.81	17.42	91.23	N/A	N/A	AVG
		7213.8	41.52	20.2	61.72	88.2	-26.48	PK
		7220.8	30.11	20.23	50.34	68.2	-17.86	AVG
	*	13250	29.63	21.49	51.12	74	-22.88	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

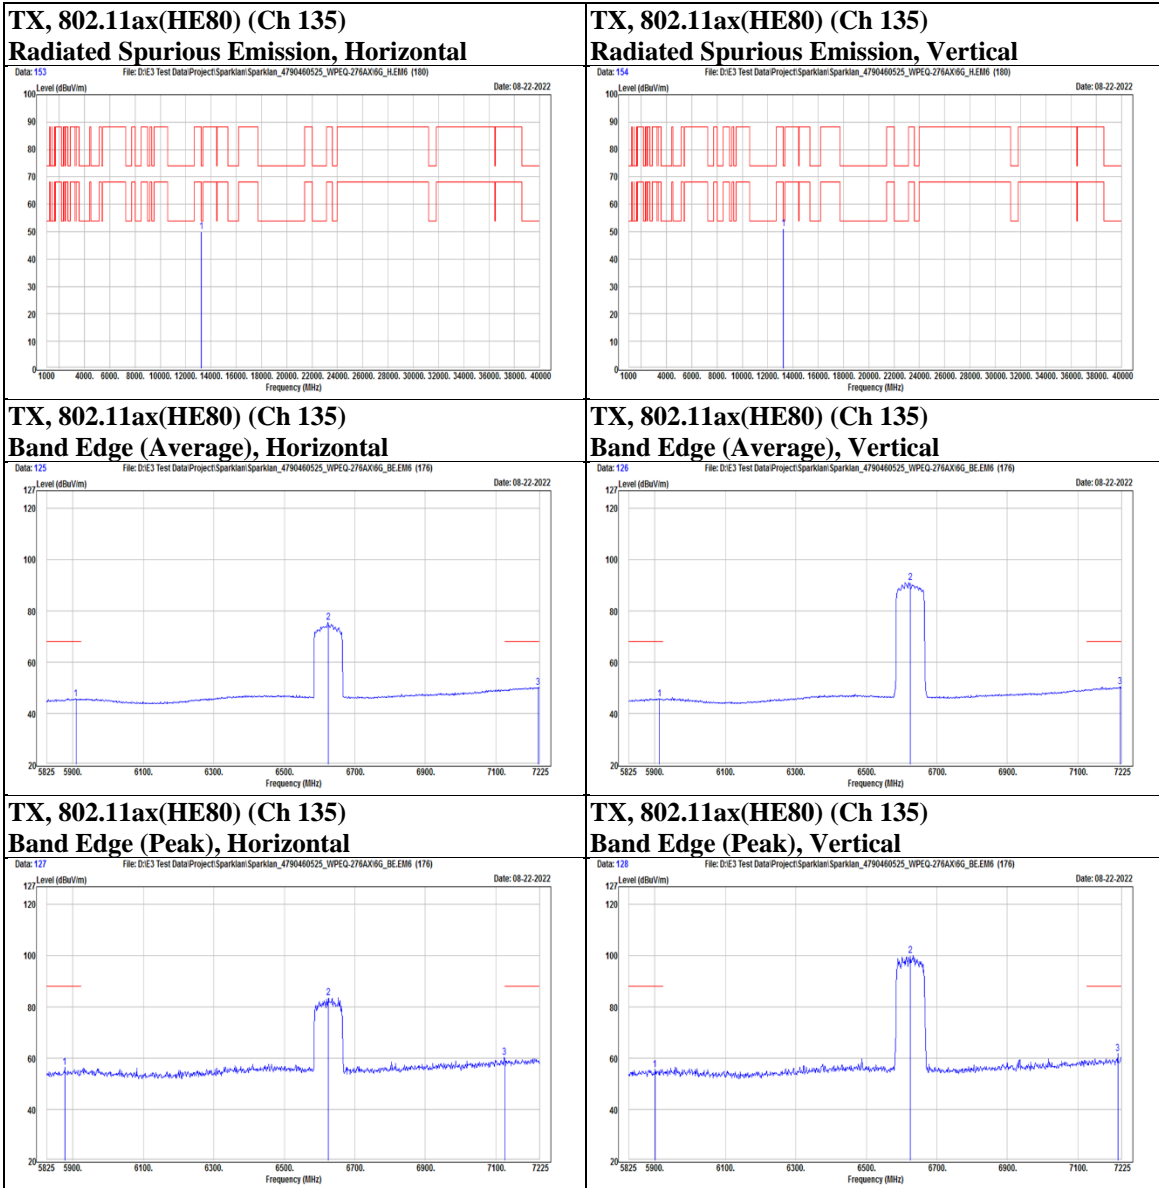

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 171 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	151
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5899.2	41.02	14.97	55.99	88.2	-32.21	PK
		5914.6	30.97	14.96	45.93	68.2	-22.27	AVG
	@	6705	66.95	17.51	84.46	N/A	N/A	PK
	@	6705	59.18	17.51	76.69	N/A	N/A	AVG
		7181.6	40.33	20.03	60.36	88.2	-27.84	PK
		7212.4	30.02	20.19	50.21	68.2	-17.99	AVG
	*	13410	29.6	22.17	51.77	88.2	-36.43	PK
Vertical		5881	41.06	14.85	55.91	88.2	-32.29	PK
		5890.8	31.08	14.91	45.99	68.2	-22.21	AVG
	@	6705	81.73	17.51	99.24	N/A	N/A	PK
	@	6705	73.12	17.51	90.63	N/A	N/A	AVG
		7148	40.92	19.84	60.76	88.2	-27.44	PK
		7195.6	30.08	20.1	50.18	68.2	-18.02	AVG
	*	13410	28.68	22.17	50.85	88.2	-37.35	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

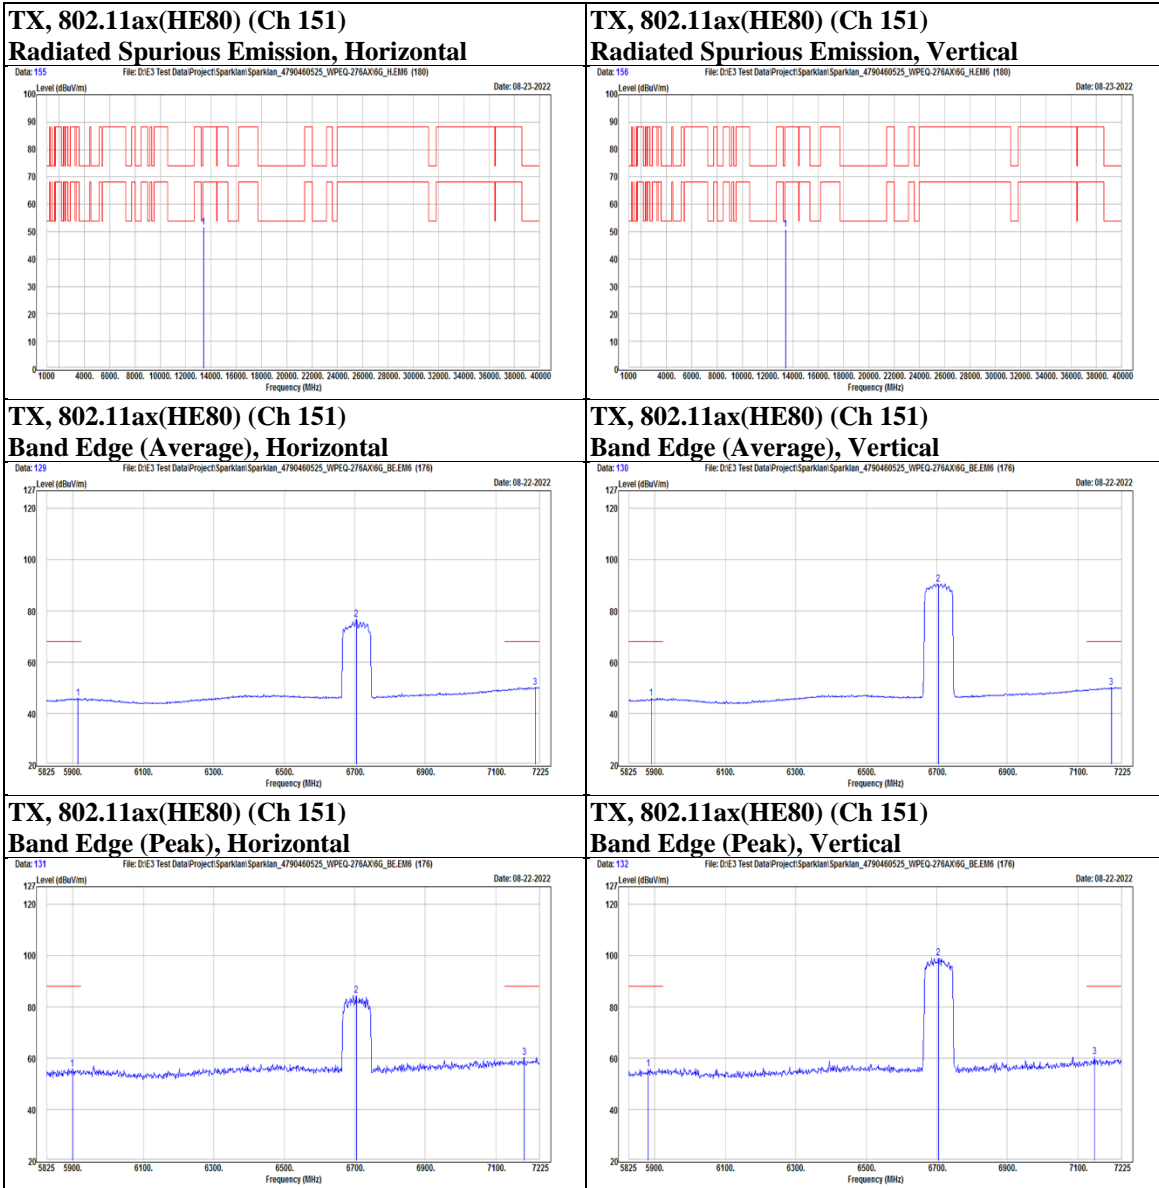

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 173 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	167
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5847.4	41.46	14.61	56.07	88.2	-32.13	PK
		5896.4	30.86	14.95	45.81	68.2	-22.39	AVG
	@	6785	67.68	17.81	85.49	N/A	N/A	PK
	@	6785	58.91	17.81	76.72	N/A	N/A	AVG
		7205.4	40.83	20.15	60.98	88.2	-27.22	PK
		7216.6	30.03	20.22	50.25	68.2	-17.95	AVG
	*	13570	29.61	22.84	52.45	88.2	-35.75	PK
Vertical		5904.8	40.86	14.97	55.83	88.2	-32.37	PK
		5910.4	30.91	14.97	45.88	68.2	-22.32	AVG
	@	6785	82.4	17.81	100.21	N/A	N/A	PK
	@	6785	73.24	17.81	91.05	N/A	N/A	AVG
		7209.6	40.01	20.18	60.19	88.2	-28.01	PK
		7222.2	30.32	20.25	50.57	68.2	-17.63	AVG
	*	13570	29.66	22.84	52.5	88.2	-35.7	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

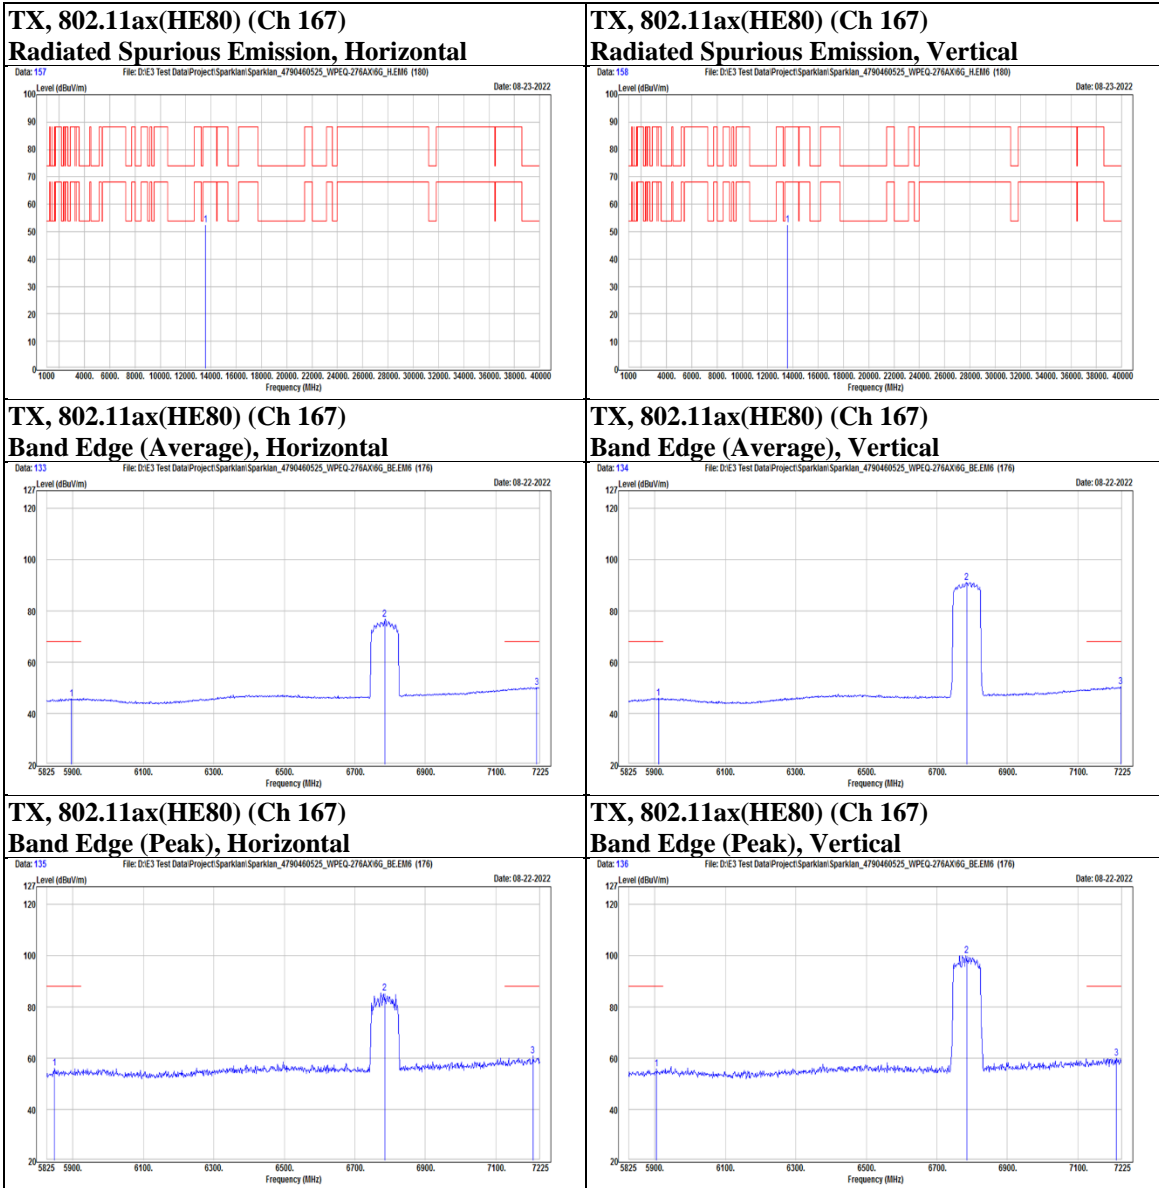

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 175 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	183
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5914.6	41.05	14.96	56.01	88.2	-32.19	PK
		5920.2	31.16	14.96	46.12	68.2	-22.08	AVG
	@	6865	65.38	18.29	83.67	N/A	N/A	PK
	@	6865	56.34	18.29	74.63	N/A	N/A	AVG
		7212.4	39.9	20.19	60.09	88.2	-28.11	PK
		7219.4	30.11	20.23	50.34	68.2	-17.86	AVG
	*	13730	28.67	22.86	51.53	88.2	-36.67	PK
Vertical		5896.4	41.66	14.95	56.61	88.2	-31.59	PK
		5920.2	30.95	14.96	45.91	68.2	-22.29	AVG
	@	6865	82.6	18.29	100.89	N/A	N/A	PK
	@	6865	72.94	18.29	91.23	N/A	N/A	AVG
		7197	39.98	20.11	60.09	88.2	-28.11	PK
		7218	29.9	20.22	50.12	68.2	-18.08	AVG
	*	13730	29.25	22.86	52.11	88.2	-36.09	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

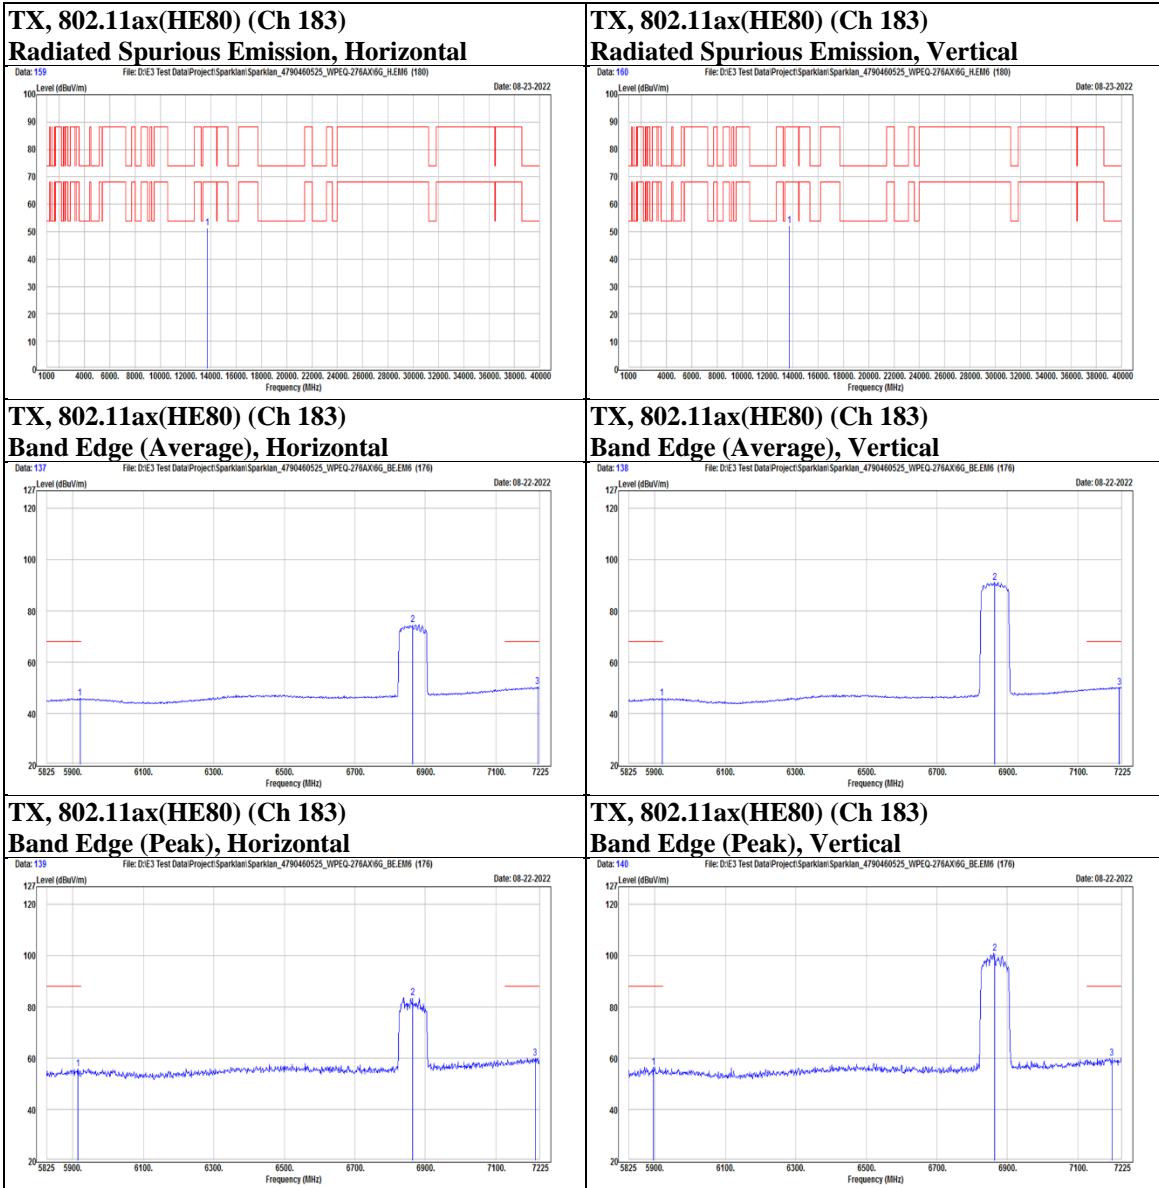

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 177 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	199
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	6945	64.13	18.55	82.68	N/A	N/A	PK
	@	6945	56.8	18.55	75.35	N/A	N/A	AVG
		7219.4	40.12	20.23	60.35	88.2	-27.85	PK
		7225	30.11	20.26	50.37	68.2	-17.83	AVG
	*	13890	29.46	23.56	53.02	88.2	-35.18	PK
Vertical	@	6945	82.32	18.55	100.87	N/A	N/A	PK
	@	6945	72.8	18.55	91.35	N/A	N/A	AVG
		7195.6	30.02	20.1	50.12	68.2	-18.08	AVG
		7205.4	41.29	20.15	61.44	88.2	-26.76	PK
	*	13890	28.48	23.56	52.04	88.2	-36.16	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0

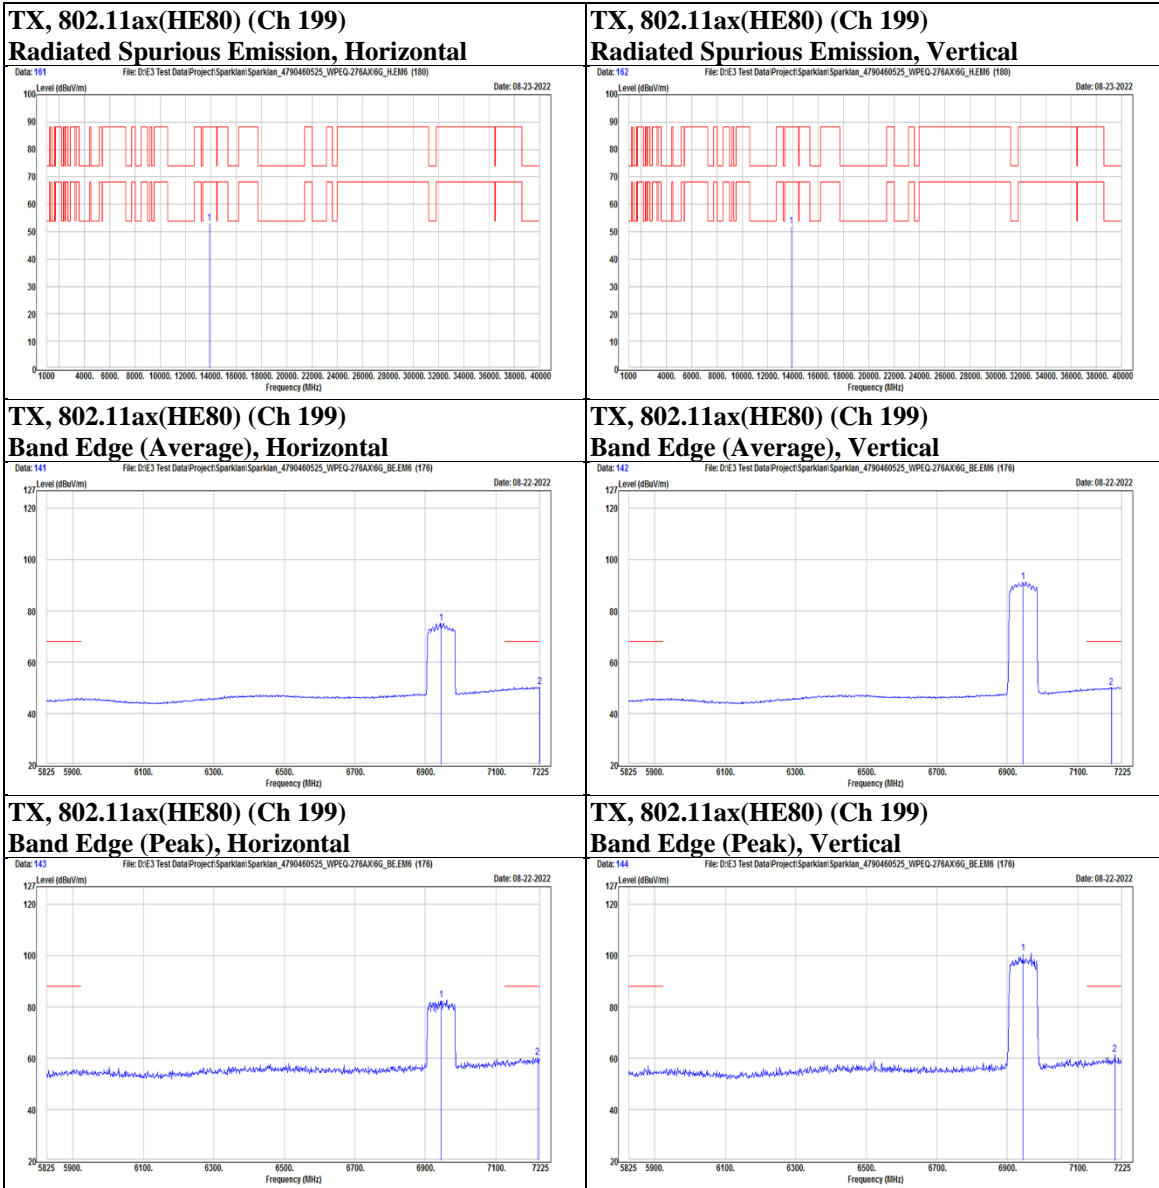

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790460525-US-R0-V0
Page : 179 of 230
Issued date : 2022/10/14
FCC ID : RYK-WPEQ276AX

Mode	802.11ax(HE80)	Channel	215
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	7025	65.26	18.97	84.23	N/A	N/A	PK
	@	7025	55.89	18.97	74.86	N/A	N/A	AVG
		7177.4	40.81	20	60.81	88.2	-27.39	PK
		7199.8	30.33	20.12	50.45	68.2	-17.75	AVG
	*	14050	29.32	24.2	53.52	88.2	-34.68	PK
Vertical	@	7025	82.56	18.97	101.53	N/A	N/A	PK
	@	7025	72.88	18.97	91.85	N/A	N/A	AVG
		7199.8	30.24	20.12	50.36	68.2	-17.84	AVG
		7204	39.86	20.15	60.01	88.2	-28.19	PK
	*	14050	29.58	24.2	53.78	88.2	-34.42	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0988 / 1.0