



Test report No. : 4790038917A-US-R0-V0
Page : 64 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11b	Channel	10
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	2457	98.12	6.12	104.24	N/A	N/A	PK
	@	2457	91.29	6.12	97.41	N/A	N/A	AVG
		2483.85	30.45	6.1	36.55	54	-17.45	AVG
		2484.04	40.91	6.1	47.01	74	-26.99	PK
	*	4914	34.74	2.63	37.37	74	-36.63	PK
Vertical	@	2457	106.93	6.12	113.05	N/A	N/A	PK
	@	2457	98.29	6.12	104.41	N/A	N/A	AVG
		2486.7	53.21	6.1	59.31	74	-14.69	PK
		2487.08	46.6	6.1	52.7	54	-1.3	AVG
	*	4914	35.67	2.63	38.3	74	-35.7	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 65 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

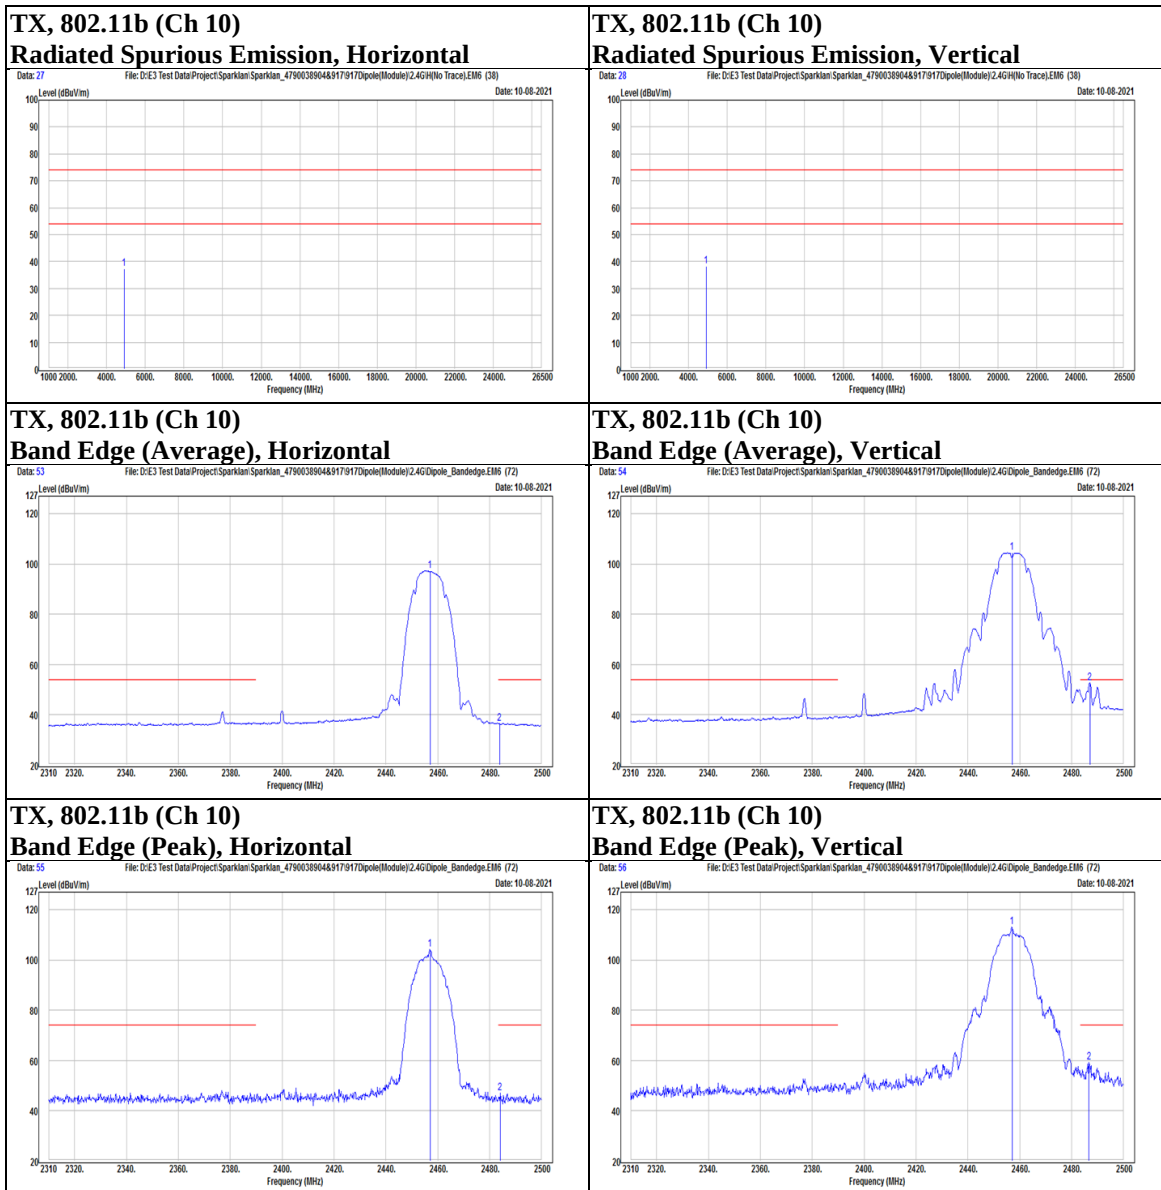

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 66 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11b	Channel	11
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	2462	95.3	6.12	101.42	N/A	N/A	PK
	@	2462	90.65	6.12	96.77	N/A	N/A	AVG
		2487.27	32.79	6.11	38.9	54	-15.1	AVG
		2496.96	42.35	6.1	48.45	74	-25.55	PK
	*	4924	37.57	2.61	40.18	74	-33.82	PK
Vertical	@	2462	104.71	6.12	110.83	N/A	N/A	PK
	@	2462	100.82	6.12	106.94	N/A	N/A	AVG
		2483.66	46.67	6.1	52.77	54	-1.23	AVG
		2484.23	53.4	6.1	59.5	74	-14.5	PK
	*	4924	38.07	2.61	40.68	74	-33.32	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 67 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

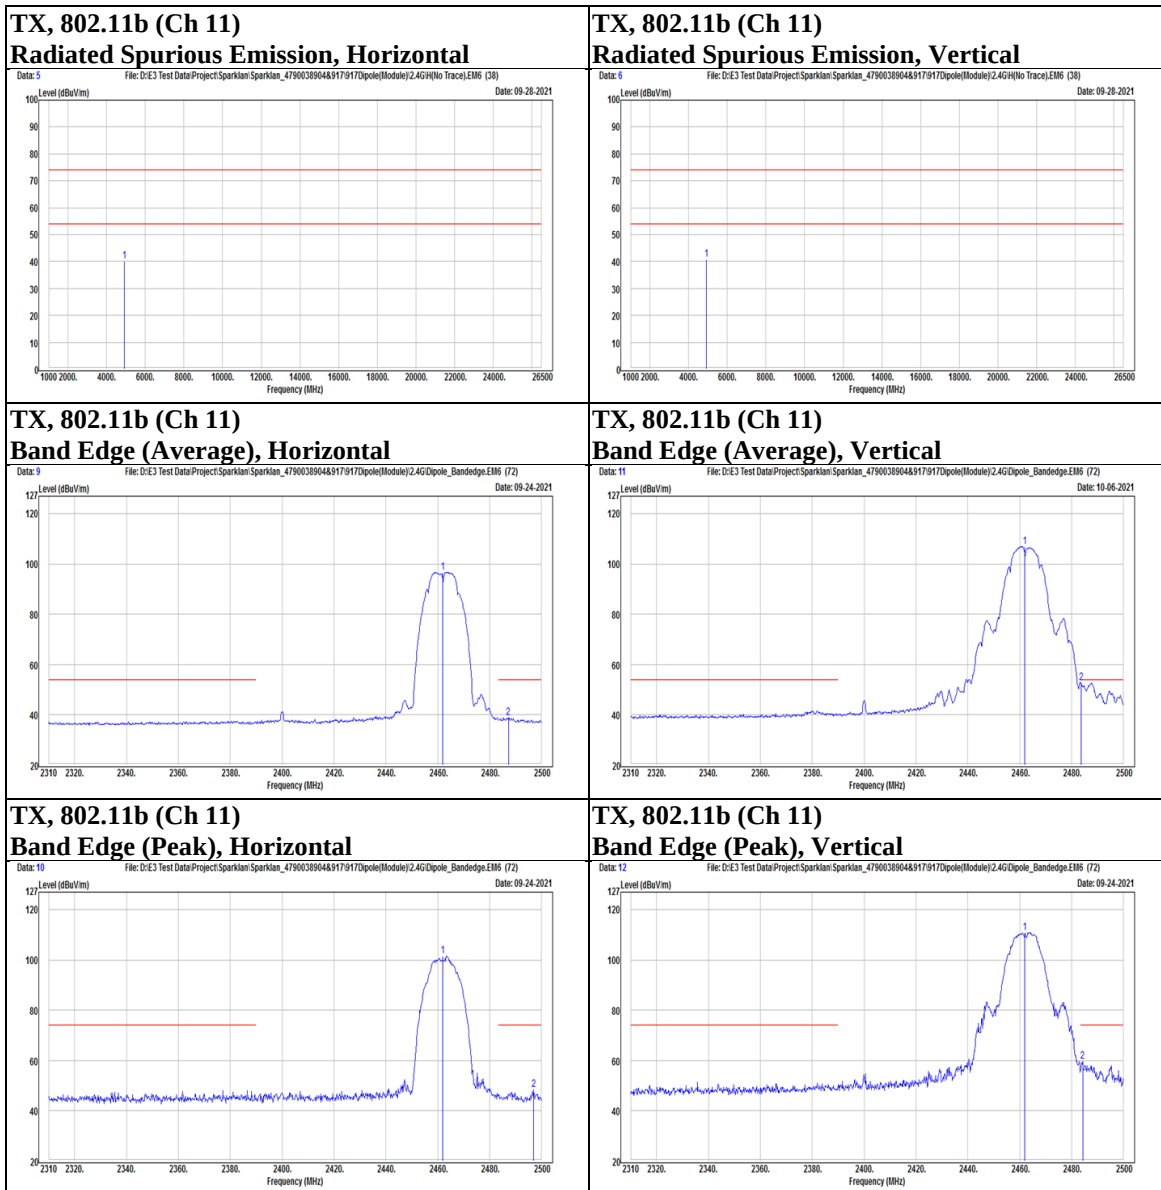

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 68 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11g	Channel	1
------	---------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2379.16	40.98	6.08	47.06	74	-26.94	PK
		2389.99	31.91	6.1	38.01	54	-15.99	AVG
	@	2412	92.5	6.13	98.63	N/A	N/A	PK
	@	2412	86.17	6.13	92.3	N/A	N/A	AVG
	*	4824	37.5	2.55	40.05	74	-33.95	PK
Vertical		2388.66	55.26	6.1	61.36	74	-12.64	PK
		2389.61	46.49	6.1	52.59	54	-1.41	AVG
	@	2412	102.76	6.13	108.89	N/A	N/A	PK
	@	2412	96.04	6.13	102.17	N/A	N/A	AVG
	*	4824	41.72	2.55	44.27	74	-29.73	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

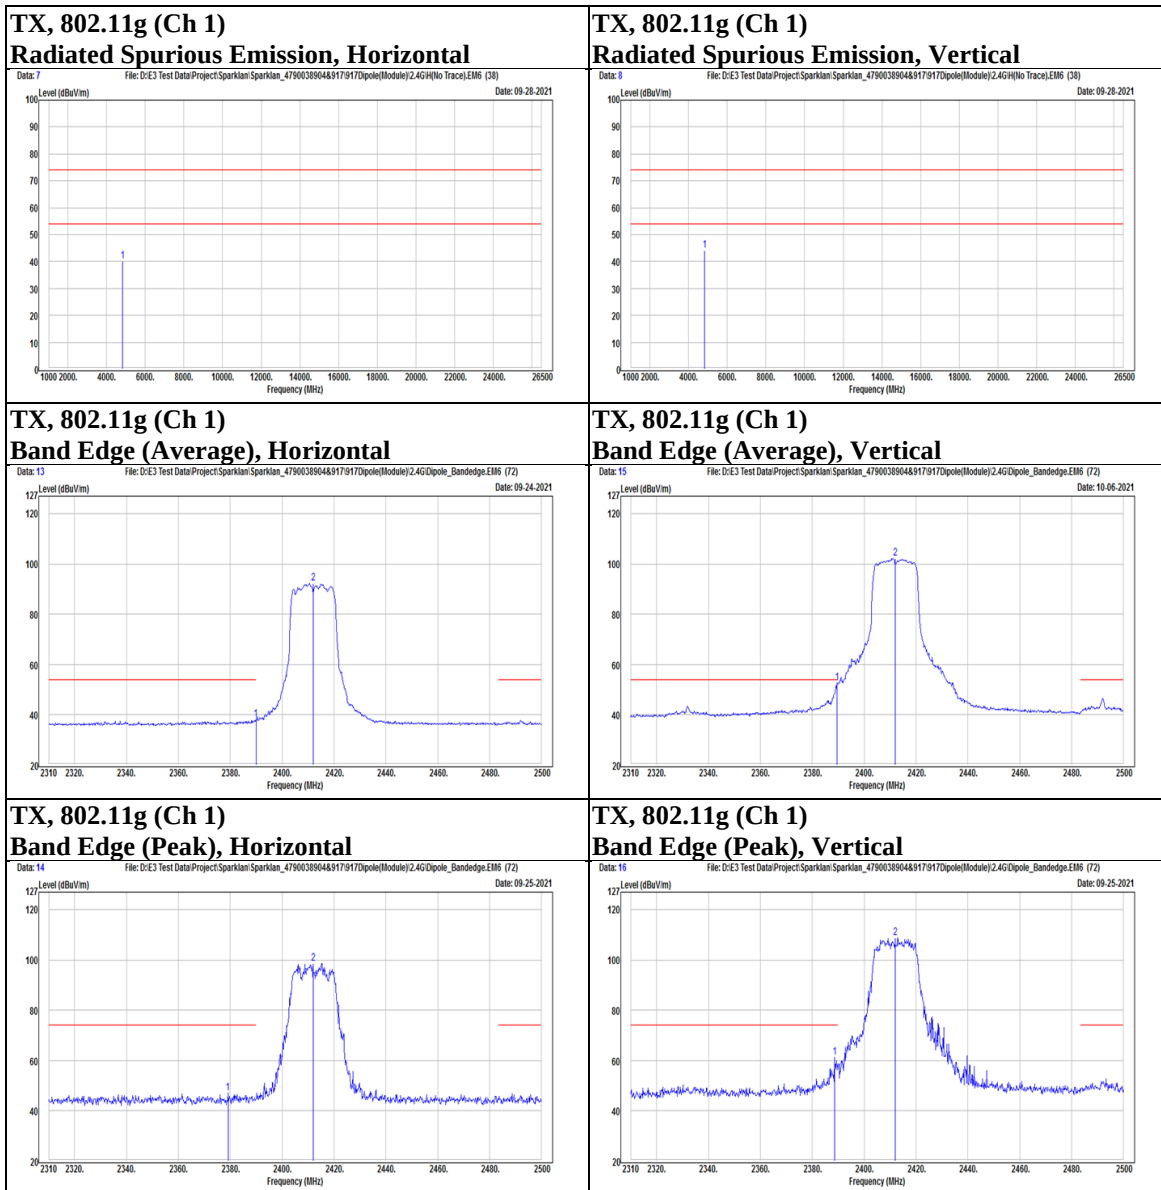



Test report No. : 4790038917A-US-R0-V0
Page : 70 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11g	Channel	2
------	---------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2389.42	35.18	6.1	41.28	54	-12.72	AVG
		2389.61	46.98	6.1	53.08	74	-20.92	PK
	@	2417	97.3	6.13	103.43	N/A	N/A	PK
	@	2417	90.59	6.13	96.72	N/A	N/A	AVG
	*	4834	35.4	2.61	38.01	74	-35.99	PK
Vertical		2388.28	59	6.1	65.1	74	-8.9	PK
		2389.99	46.79	6.1	52.89	54	-1.11	AVG
	@	2417	106.72	6.13	112.85	N/A	N/A	PK
	@	2417	98.85	6.13	104.98	N/A	N/A	AVG
	*	4834	35.93	2.61	38.54	74	-35.46	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

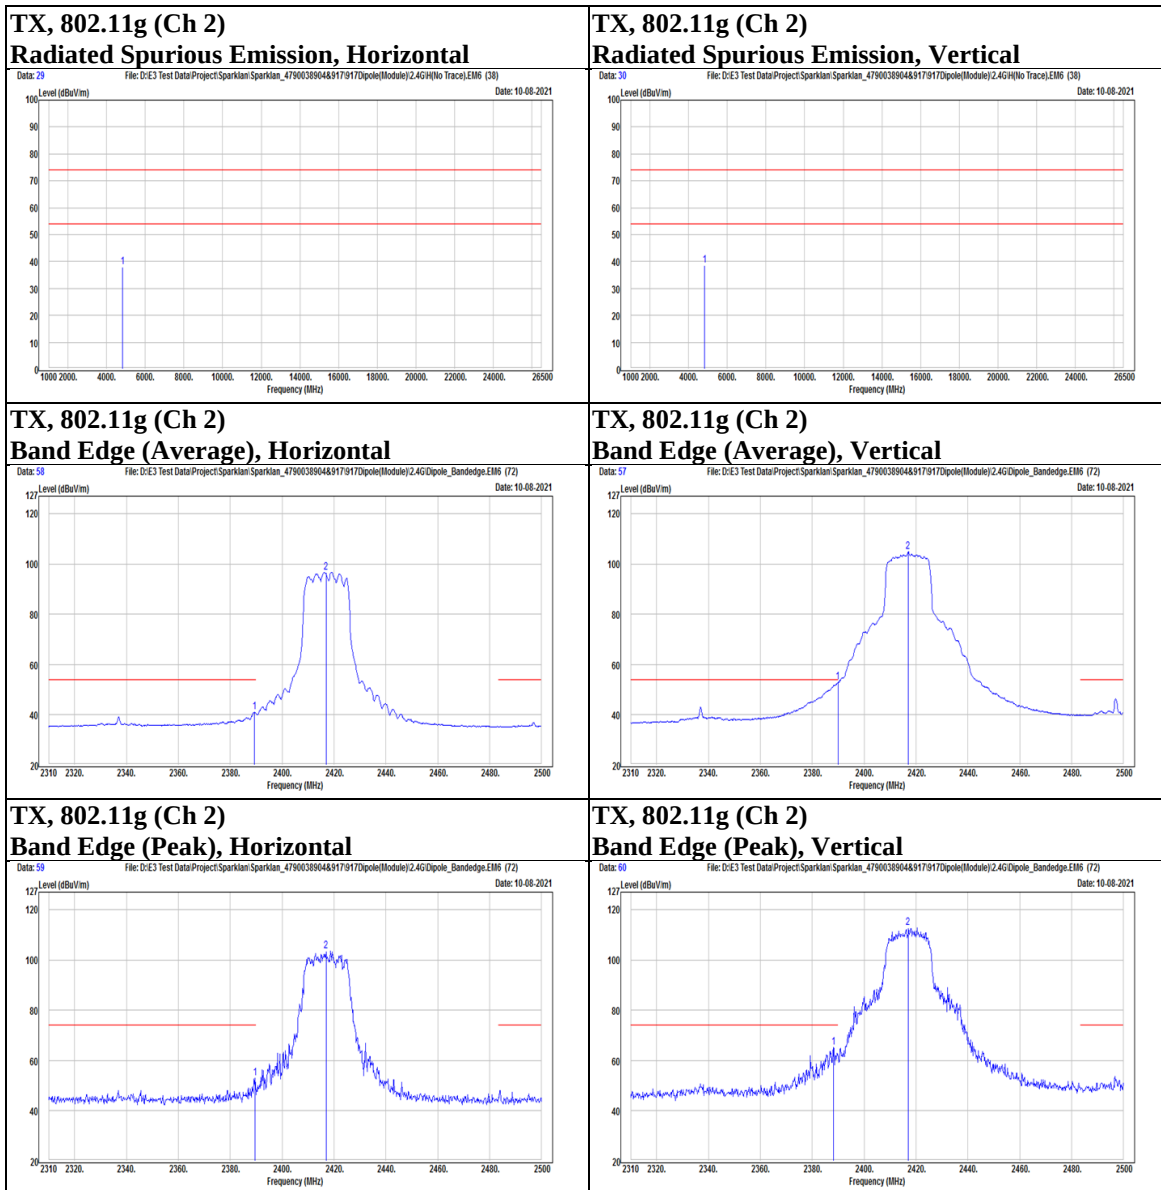



Test report No. : 4790038917A-US-R0-V0
Page : 72 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11g	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2349.52	35.55	6.03	41.58	54	-12.42	AVG
		2351.23	41.89	6.03	47.92	74	-26.08	PK
	@	2437	99.18	6.12	105.3	N/A	N/A	PK
	@	2437	91.21	6.12	97.33	N/A	N/A	AVG
		2487.46	35.79	6.11	41.9	54	-12.1	AVG
		2499.43	39.07	6.1	45.17	74	-28.83	PK
	*	4874	37.5	2.66	40.16	74	-33.84	PK
Vertical		2388.66	49.09	6.1	55.19	74	-18.81	PK
		2389.42	46.43	6.1	52.53	54	-1.47	AVG
	@	2437	107.06	6.12	113.18	N/A	N/A	PK
	@	2437	100.77	6.12	106.89	N/A	N/A	AVG
		2483.66	45.69	6.1	51.79	54	-2.21	AVG
		2484.99	48.63	6.1	54.73	74	-19.27	PK
	*	4874	37.96	2.66	40.62	74	-33.38	PK
	*	7311	41.57	10.62	52.19	74	-21.81	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 73 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

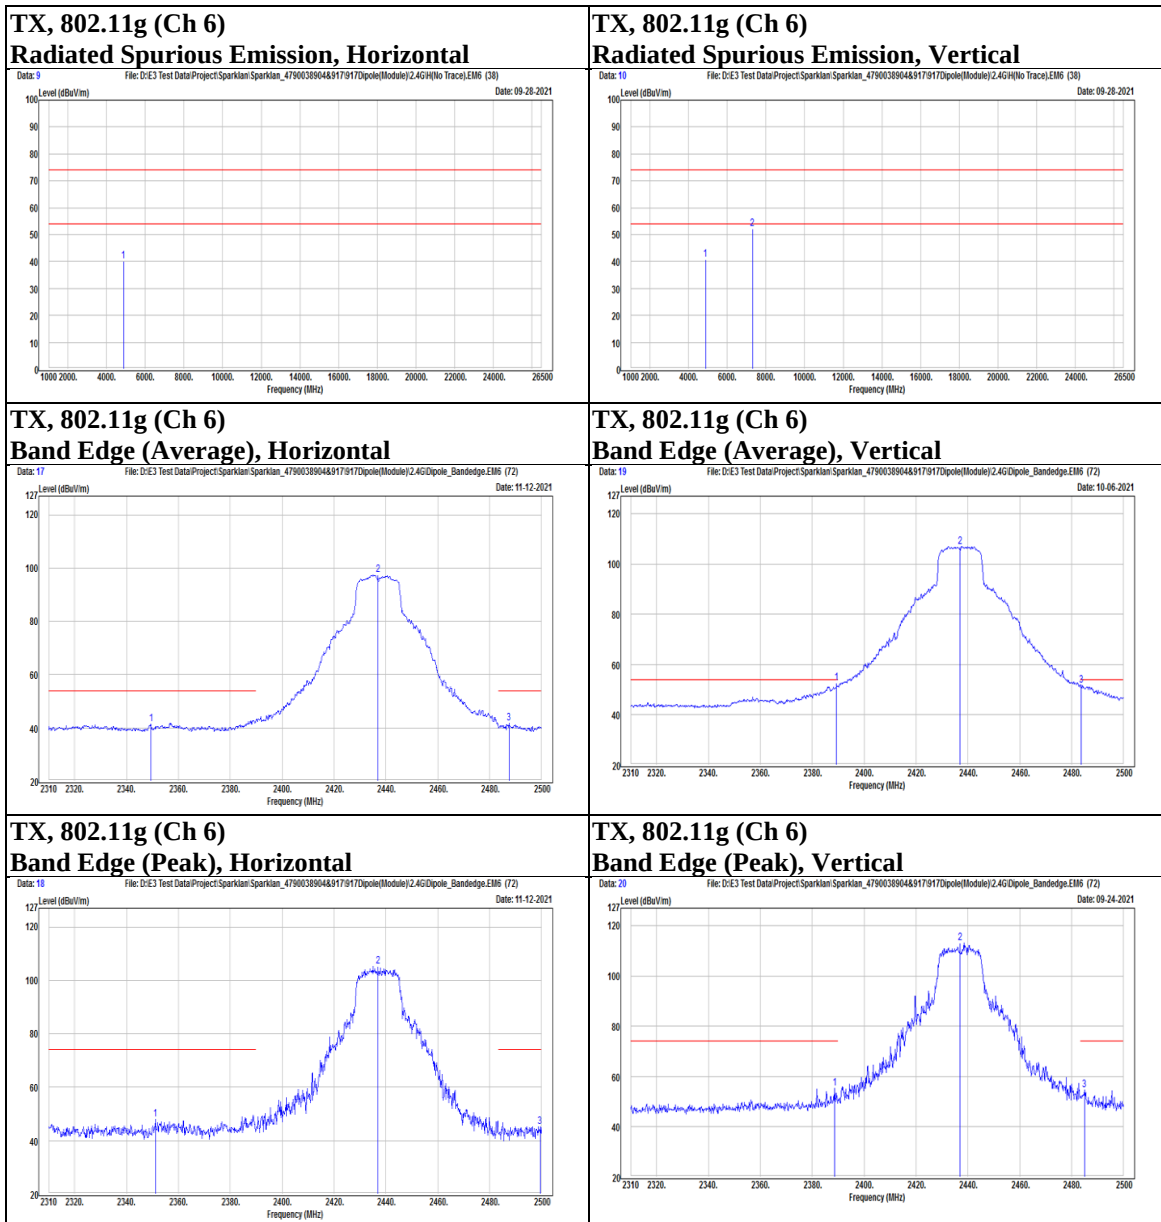

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 74 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11g	Channel	10
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	2457	95.82	6.12	101.94	N/A	N/A	PK
	@	2457	88.56	6.12	94.68	N/A	N/A	AVG
		2485.56	30.49	6.1	36.59	54	-17.41	AVG
		2490.31	40.94	6.1	47.04	74	-26.96	PK
	*	4914	35.56	2.63	38.19	74	-35.81	PK
Vertical	@	2457	106.87	6.12	112.99	N/A	N/A	PK
	@	2457	98.53	6.12	104.65	N/A	N/A	AVG
		2483.66	60.77	6.1	66.87	74	-7.13	PK
		2483.66	46.53	6.1	52.63	54	-1.37	AVG
	*	4914	35.9	2.63	38.53	74	-35.47	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

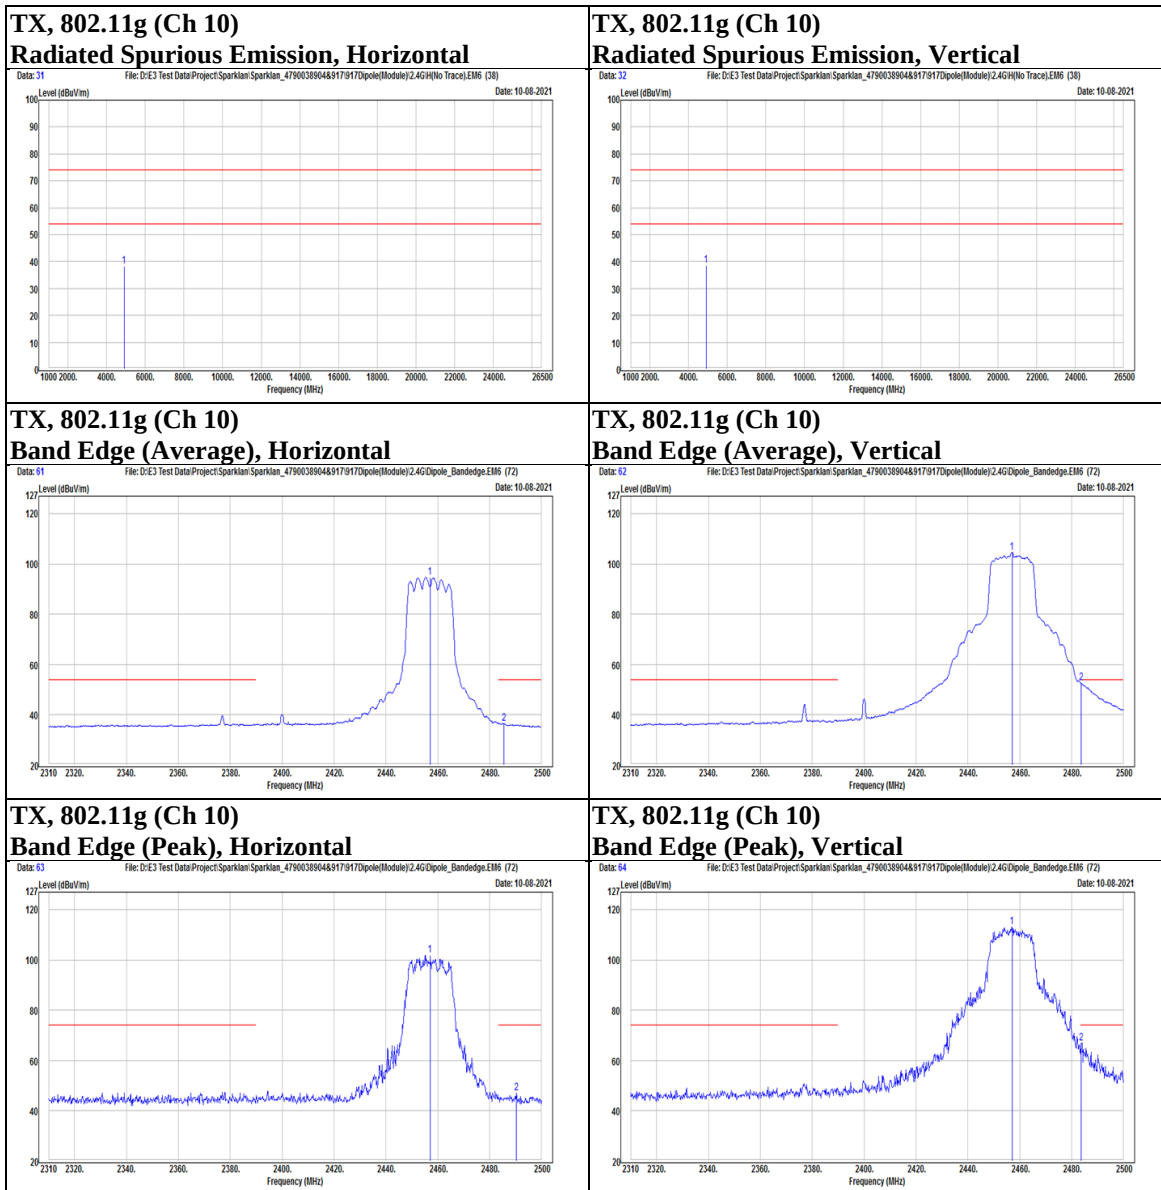



Test report No. : 4790038917A-US-R0-V0
Page : 76 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11g	Channel	11
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	2462	92.81	6.12	98.93	N/A	N/A	PK
	@	2462	84.33	6.12	90.45	N/A	N/A	AVG
		2487.08	41.17	6.1	47.27	74	-26.73	PK
		2495.82	31.28	6.1	37.38	54	-16.62	AVG
	*	4924	37.66	2.61	40.27	74	-33.73	PK
Vertical	@	2462	103.07	6.12	109.19	N/A	N/A	PK
	@	2462	95.56	6.12	101.68	N/A	N/A	AVG
		2483.85	46.22	6.1	52.32	54	-1.68	AVG
		2487.27	57.98	6.11	64.09	74	-9.91	PK
	*	4924	38.02	2.61	40.63	74	-33.37	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 77 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

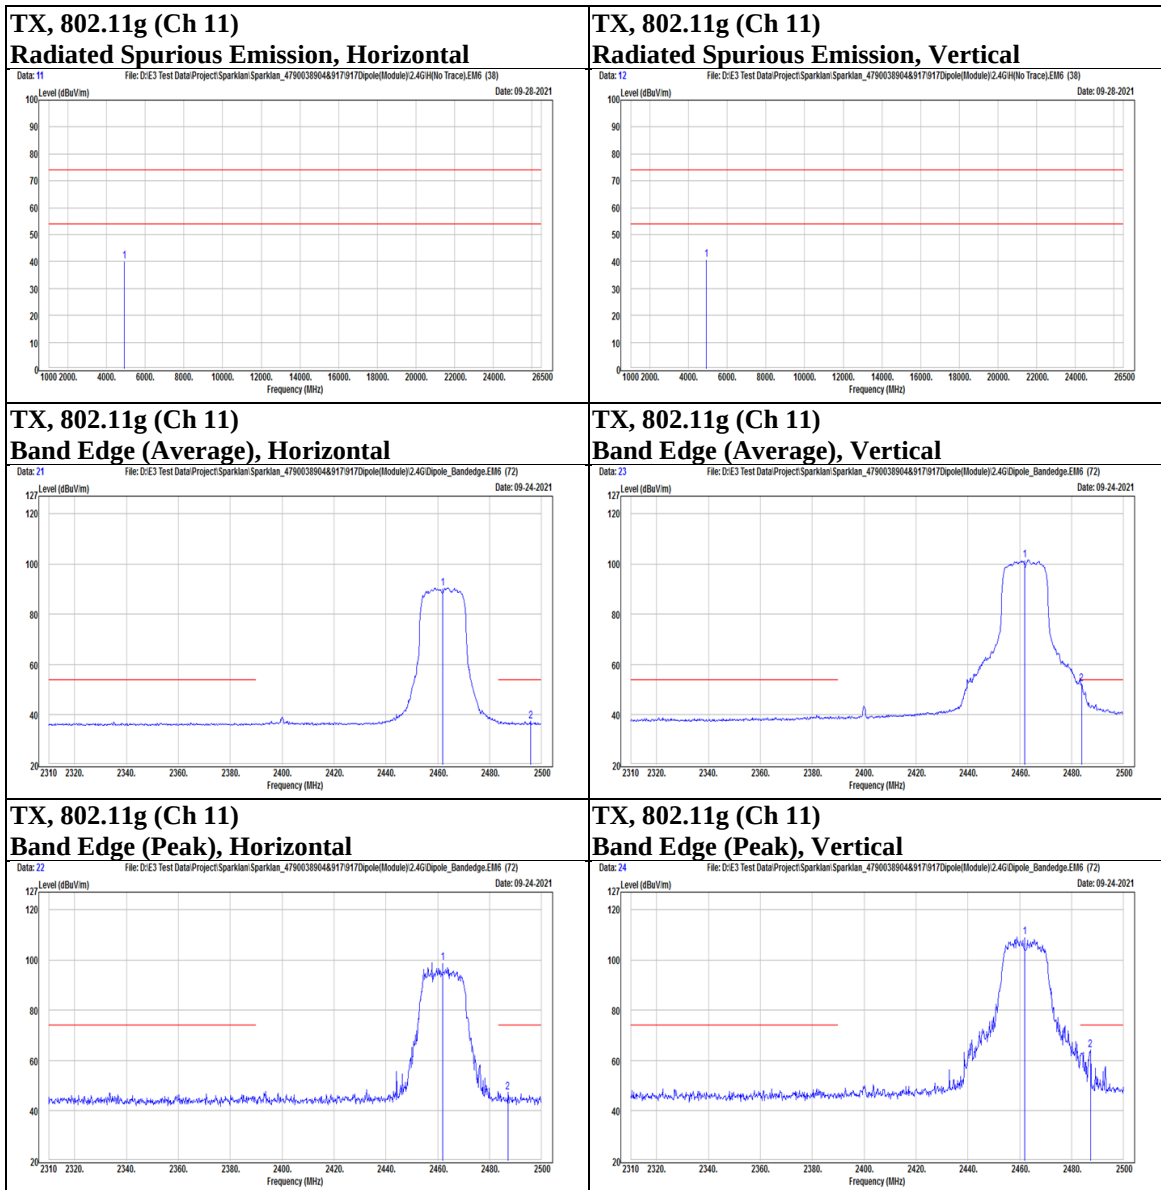

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 78 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11n(HT20)	Channel	1
------	---------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2382.39	46.23	6.09	52.32	74	-21.68	PK
		2389.23	32.67	6.1	38.77	54	-15.23	AVG
	@	2412	92.99	6.13	99.12	N/A	N/A	PK
	@	2412	86.5	6.13	92.63	N/A	N/A	AVG
	*	4824	38.23	2.55	40.78	74	-33.22	PK
Vertical		2389.61	46.73	6.1	52.83	54	-1.17	AVG
		2389.8	54.78	6.1	60.88	74	-13.12	PK
	@	2412	100.73	6.13	106.86	N/A	N/A	PK
	@	2412	93.36	6.13	99.49	N/A	N/A	AVG
	*	4824	40.41	2.55	42.96	74	-31.04	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

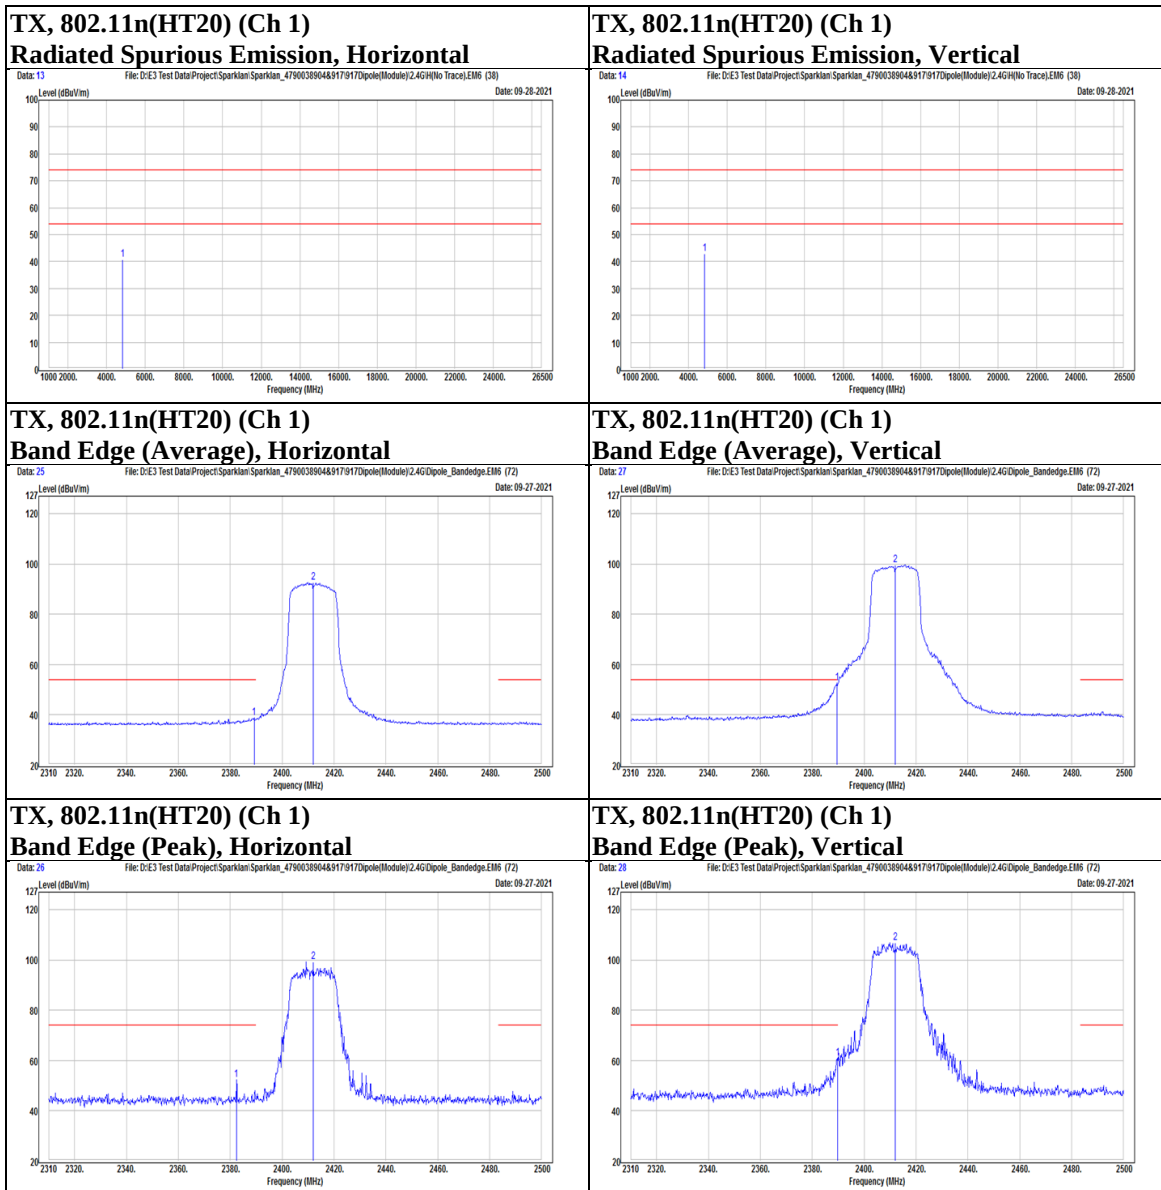



Test report No. : 4790038917A-US-R0-V0
Page : 80 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11n(HT20)	Channel	2
------	---------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2383.53	43	6.09	49.09	74	-24.91	PK
		2389.99	33.58	6.1	39.68	54	-14.32	AVG
	@	2417	98.25	6.13	104.38	N/A	N/A	PK
	@	2417	89.9	6.13	96.03	N/A	N/A	AVG
	*	4834	35.21	2.61	37.82	74	-36.18	PK
Vertical		2386.76	61.04	6.1	67.14	74	-6.86	PK
		2389.8	46.87	6.1	52.97	54	-1.03	AVG
	@	2417	107.69	6.13	113.82	N/A	N/A	PK
	@	2417	98.4	6.13	104.53	N/A	N/A	AVG
	*	4834	34.87	2.61	37.48	74	-36.52	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 81 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

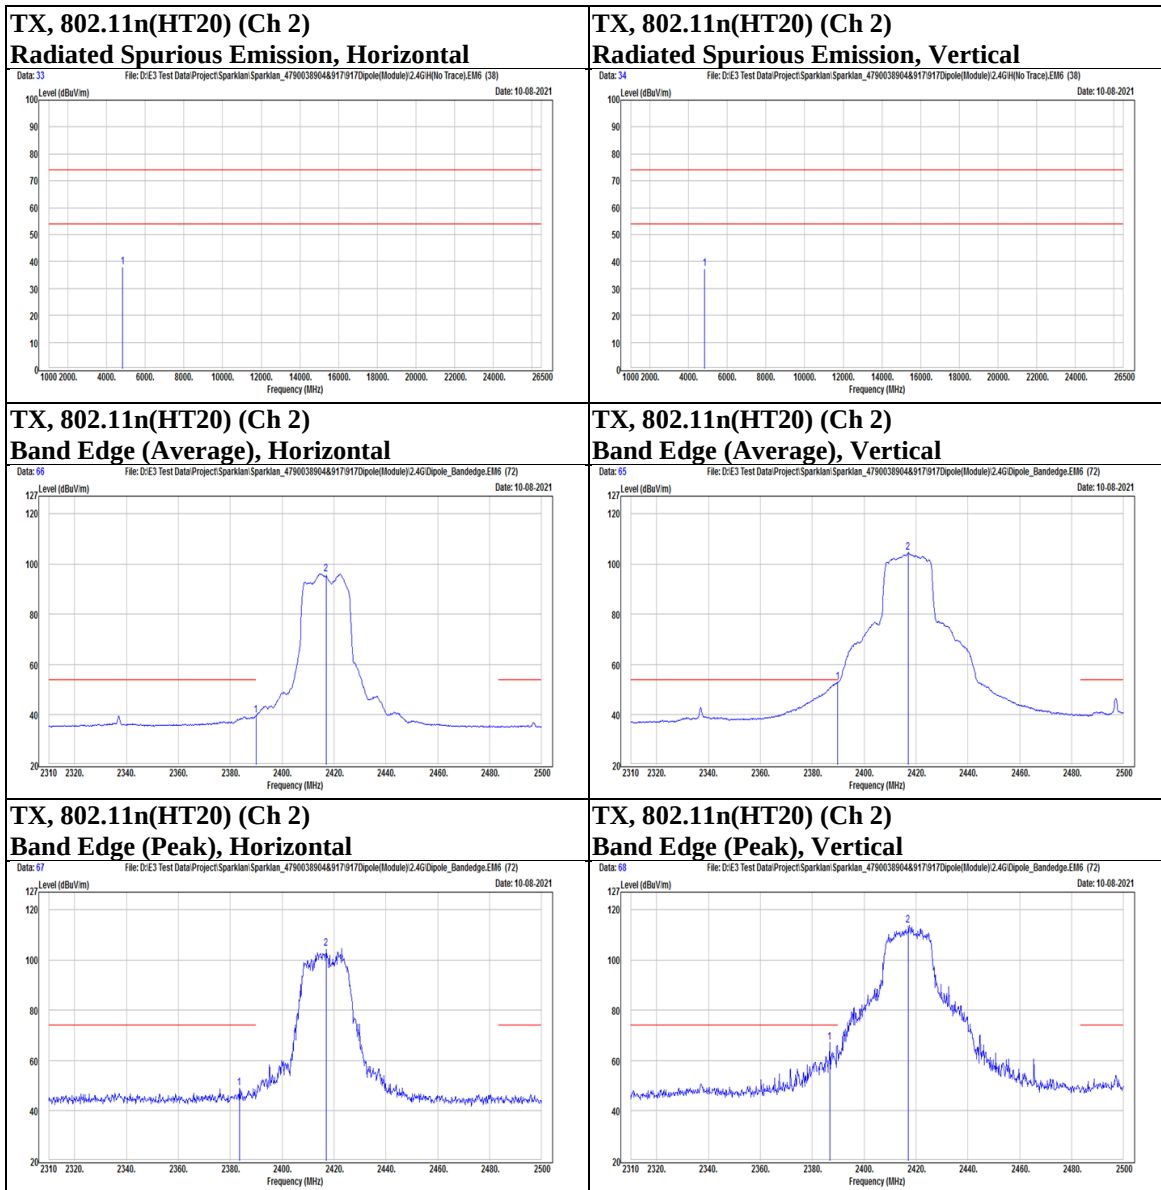

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 82 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11n(HT20)	Channel	6
------	---------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2317.98	41.91	6.16	48.07	74	-25.93	PK
		2389.04	32.05	6.1	38.15	54	-15.85	AVG
	@	2437	100.83	6.12	106.95	N/A	N/A	PK
	@	2437	92.95	6.12	99.07	N/A	N/A	AVG
		2484.8	32.15	6.1	38.25	54	-15.75	AVG
		2485.56	41.31	6.1	47.41	74	-26.59	PK
	*	4874	38.39	2.66	41.05	74	-32.95	PK
Vertical		2389.99	58.98	6.1	65.08	74	-8.92	PK
		2389.99	46.38	6.1	52.48	54	-1.52	AVG
	@	2437	107.5	6.12	113.62	N/A	N/A	PK
	@	2437	100.32	6.12	106.44	N/A	N/A	AVG
		2483.66	55.95	6.1	62.05	74	-11.95	PK
		2483.85	46.73	6.1	52.83	54	-1.17	AVG
	*	4874	37.32	2.66	39.98	74	-34.02	PK
	*	7311	40.39	10.62	51.01	74	-22.99	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 83 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

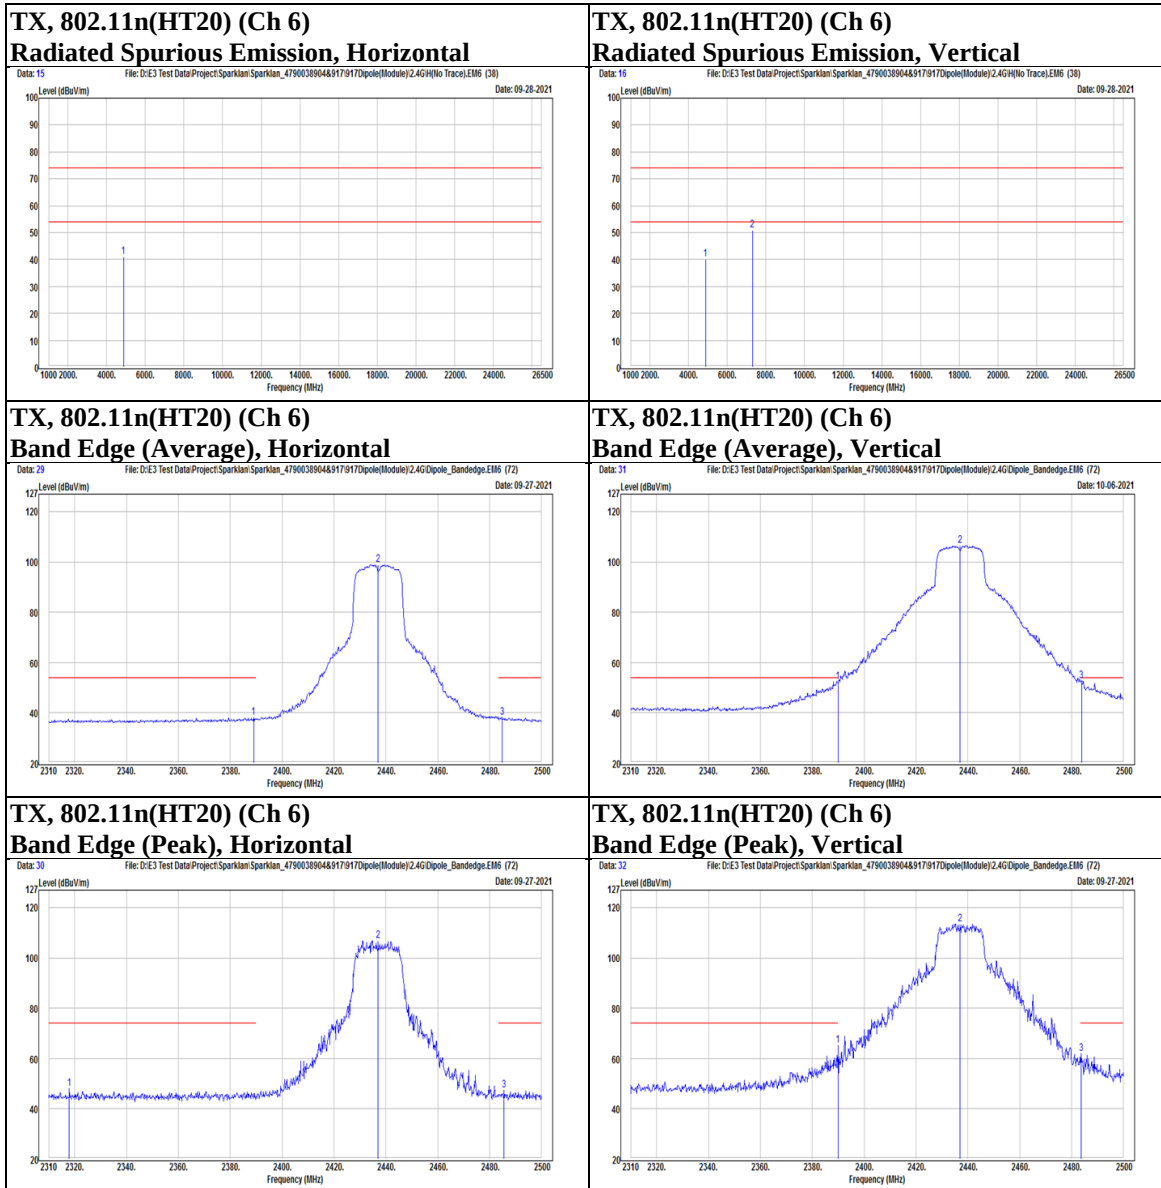

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 84 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11n(HT20)	Channel	10
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	2457	94.93	6.12	101.05	N/A	N/A	PK
	@	2457	87.78	6.12	93.9	N/A	N/A	AVG
		2483.85	30.28	6.1	36.38	54	-17.62	AVG
		2484.42	40.35	6.1	46.45	74	-27.55	PK
	*	4914	34.9	2.63	37.53	74	-36.47	PK
Vertical	@	2457	106.62	6.12	112.74	N/A	N/A	PK
	@	2457	99.85	6.12	105.97	N/A	N/A	AVG
		2483.66	46.89	6.1	52.99	54	-1.01	AVG
		2485.75	60.59	6.1	66.69	74	-7.31	PK
	*	4914	35.41	2.63	38.04	74	-35.96	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 85 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

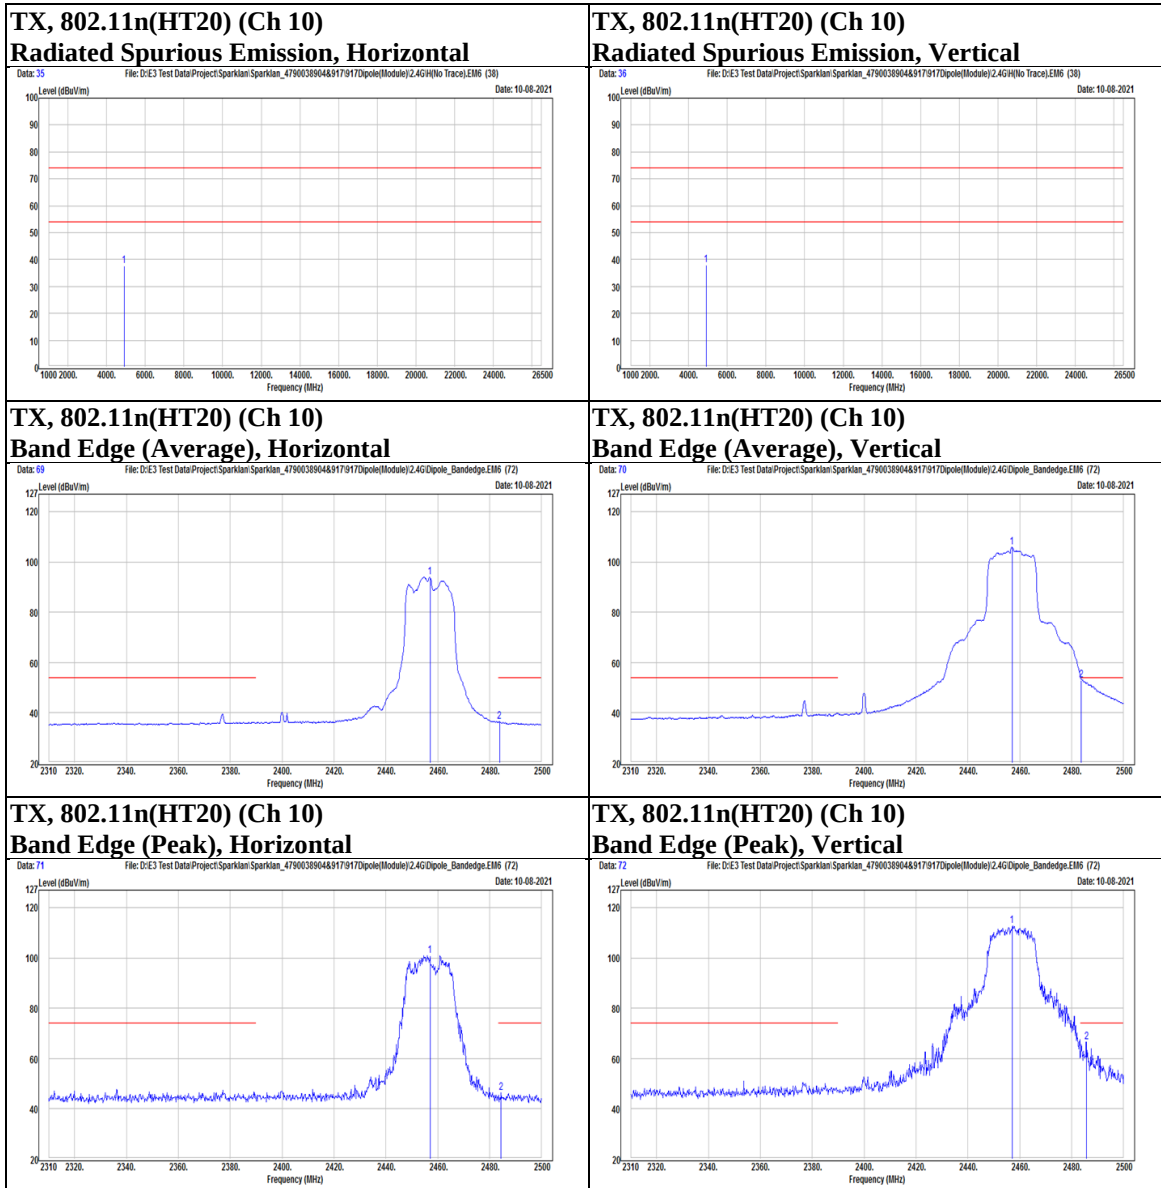

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 86 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11n(HT20)	Channel	11
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	2462	87.24	6.12	93.36	N/A	N/A	PK
	@	2462	82.73	6.12	88.85	N/A	N/A	AVG
		2483.66	31.15	6.1	37.25	54	-16.75	AVG
		2493.35	40.55	6.1	46.65	74	-27.35	PK
	*	4924	37.07	2.61	39.68	74	-34.32	PK
Vertical	@	2462	100.06	6.12	106.18	N/A	N/A	PK
	@	2462	92.45	6.12	98.57	N/A	N/A	AVG
		2483.66	53.95	6.1	60.05	74	-13.95	PK
		2483.66	46.97	6.1	53.07	54	-0.93	AVG
	*	4924	36.74	2.61	39.35	74	-34.65	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

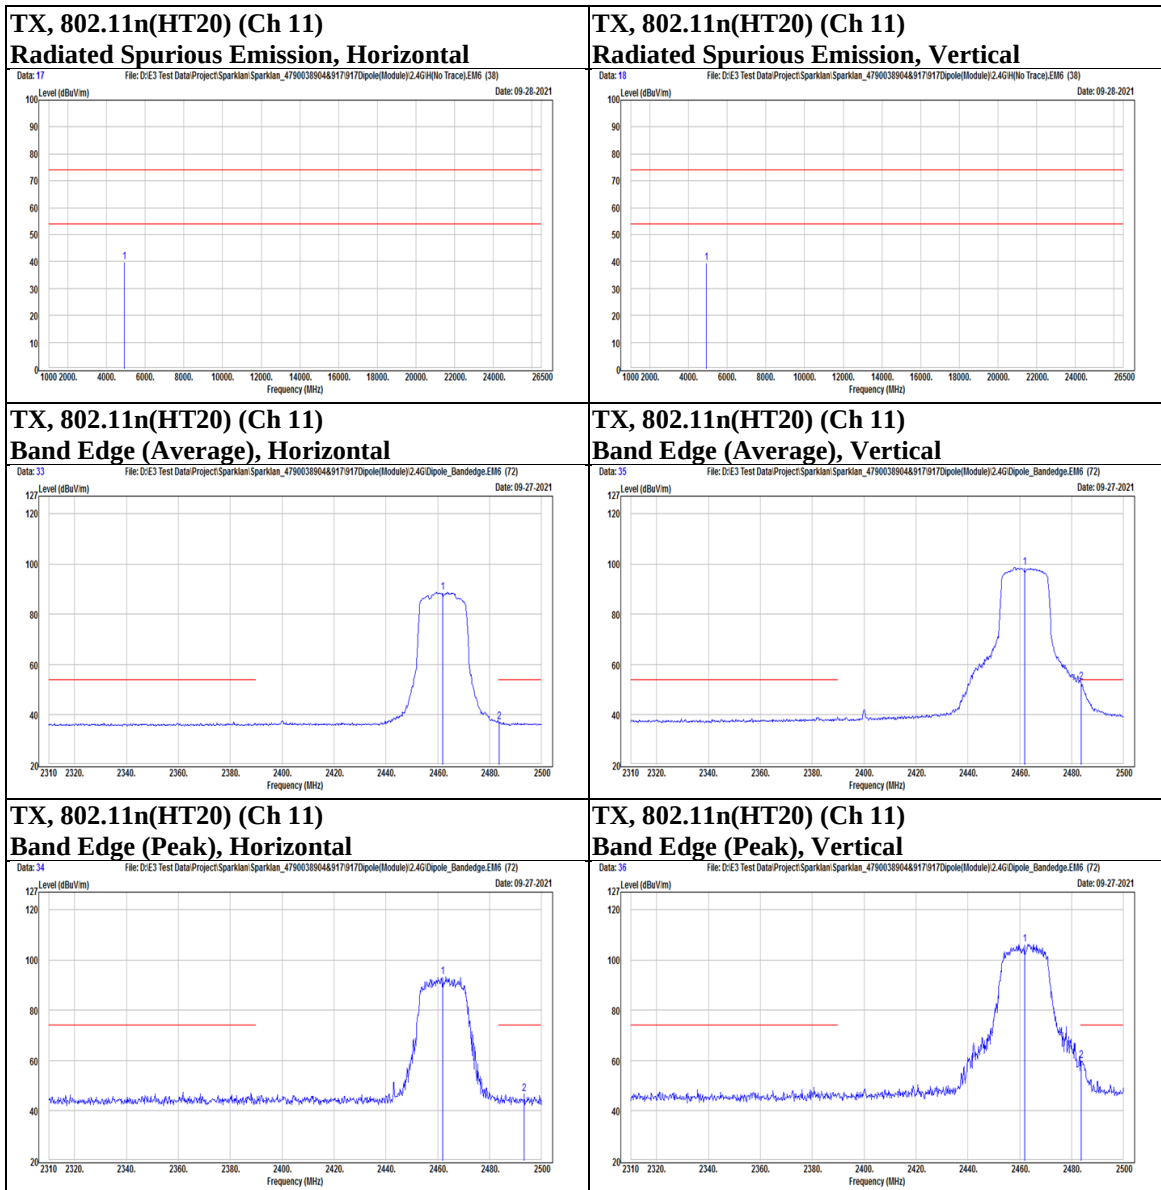



Test report No. : 4790038917A-US-R0-V0
Page : 88 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11n(HT40)	Channel	3
------	---------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2381.25	43.32	6.08	49.4	74	-24.6	PK
		2389.8	31.36	6.1	37.46	54	-16.54	AVG
	@	2422	86.98	6.13	93.11	N/A	N/A	PK
	@	2422	79.81	6.13	85.94	N/A	N/A	AVG
	*	4844	37.06	2.66	39.72	74	-34.28	PK
Vertical		2388.47	46.76	6.1	52.86	54	-1.14	AVG
		2389.23	59.02	6.1	65.12	74	-8.88	PK
	@	2422	97.43	6.13	103.56	N/A	N/A	PK
	@	2422	87.99	6.13	94.12	N/A	N/A	AVG
	*	4844	38.08	2.66	40.74	74	-33.26	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 89 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

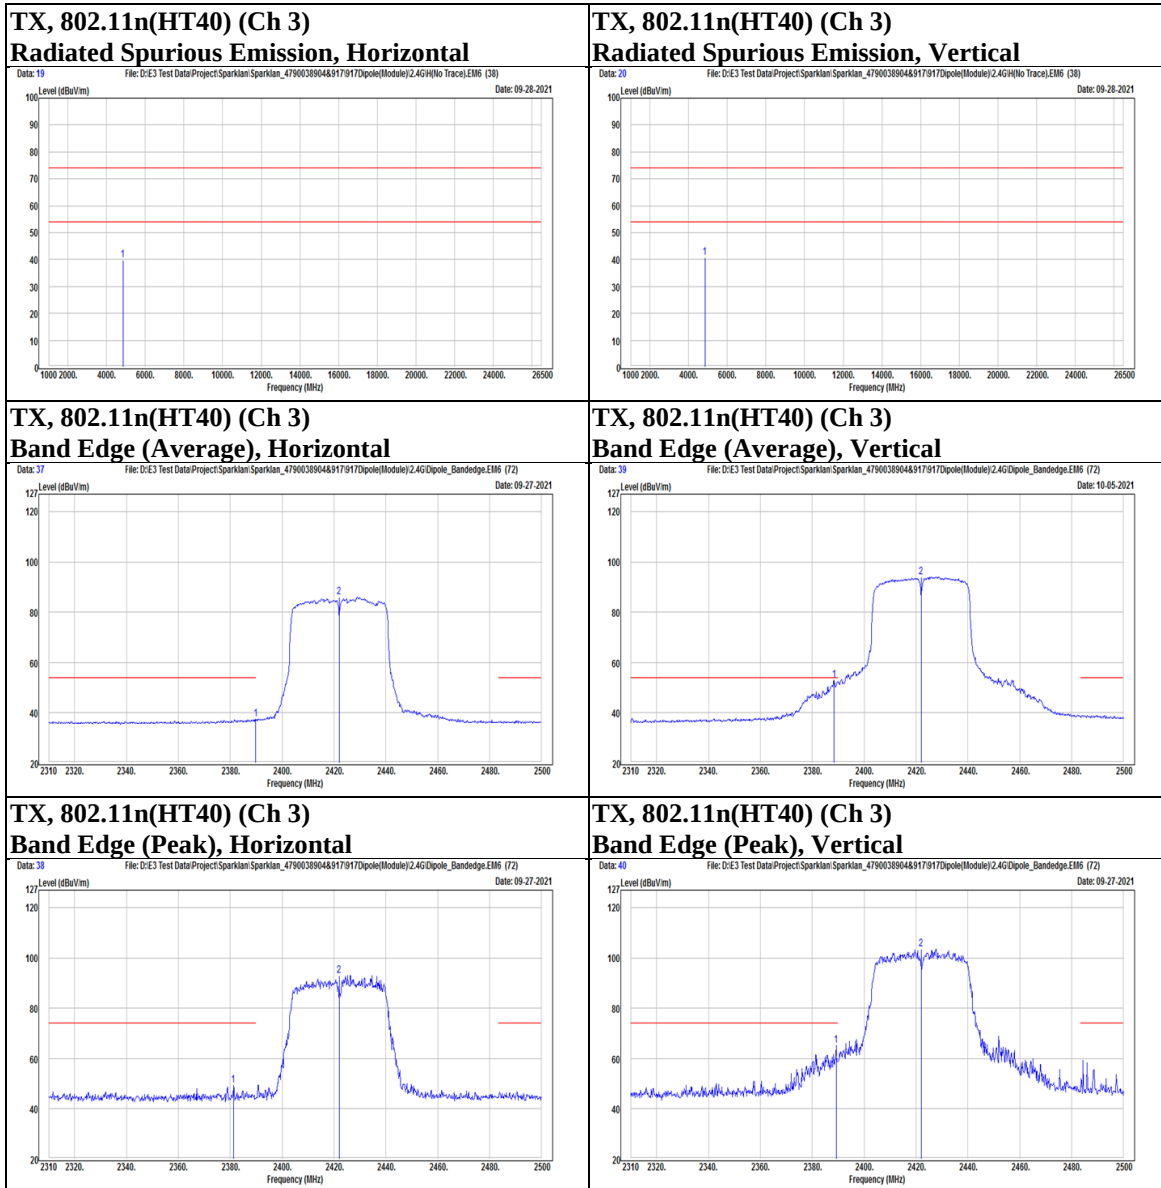

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 90 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11n(HT40)	Channel	6
------	---------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2379.16	34.65	6.08	40.73	54	-13.27	AVG
		2386.57	42.23	6.1	48.33	74	-25.67	PK
	@	2437	91.01	6.12	97.13	N/A	N/A	PK
	@	2437	84.43	6.12	90.55	N/A	N/A	AVG
		2495.63	40.92	6.1	47.02	74	-26.98	PK
		2498.67	34.82	6.1	40.92	54	-13.08	AVG
	*	4874	37.7	2.66	40.36	74	-33.64	PK
Vertical		2389.42	59.74	6.1	65.84	74	-8.16	PK
		2389.99	41.73	6.1	47.83	54	-6.17	AVG
	@	2437	99.68	6.12	105.8	N/A	N/A	PK
	@	2437	90.43	6.12	96.55	N/A	N/A	AVG
		2484.04	42.73	6.1	48.83	54	-5.17	AVG
		2487.46	57.24	6.11	63.35	74	-10.65	PK
	*	4874	37.38	2.66	40.04	74	-33.96	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

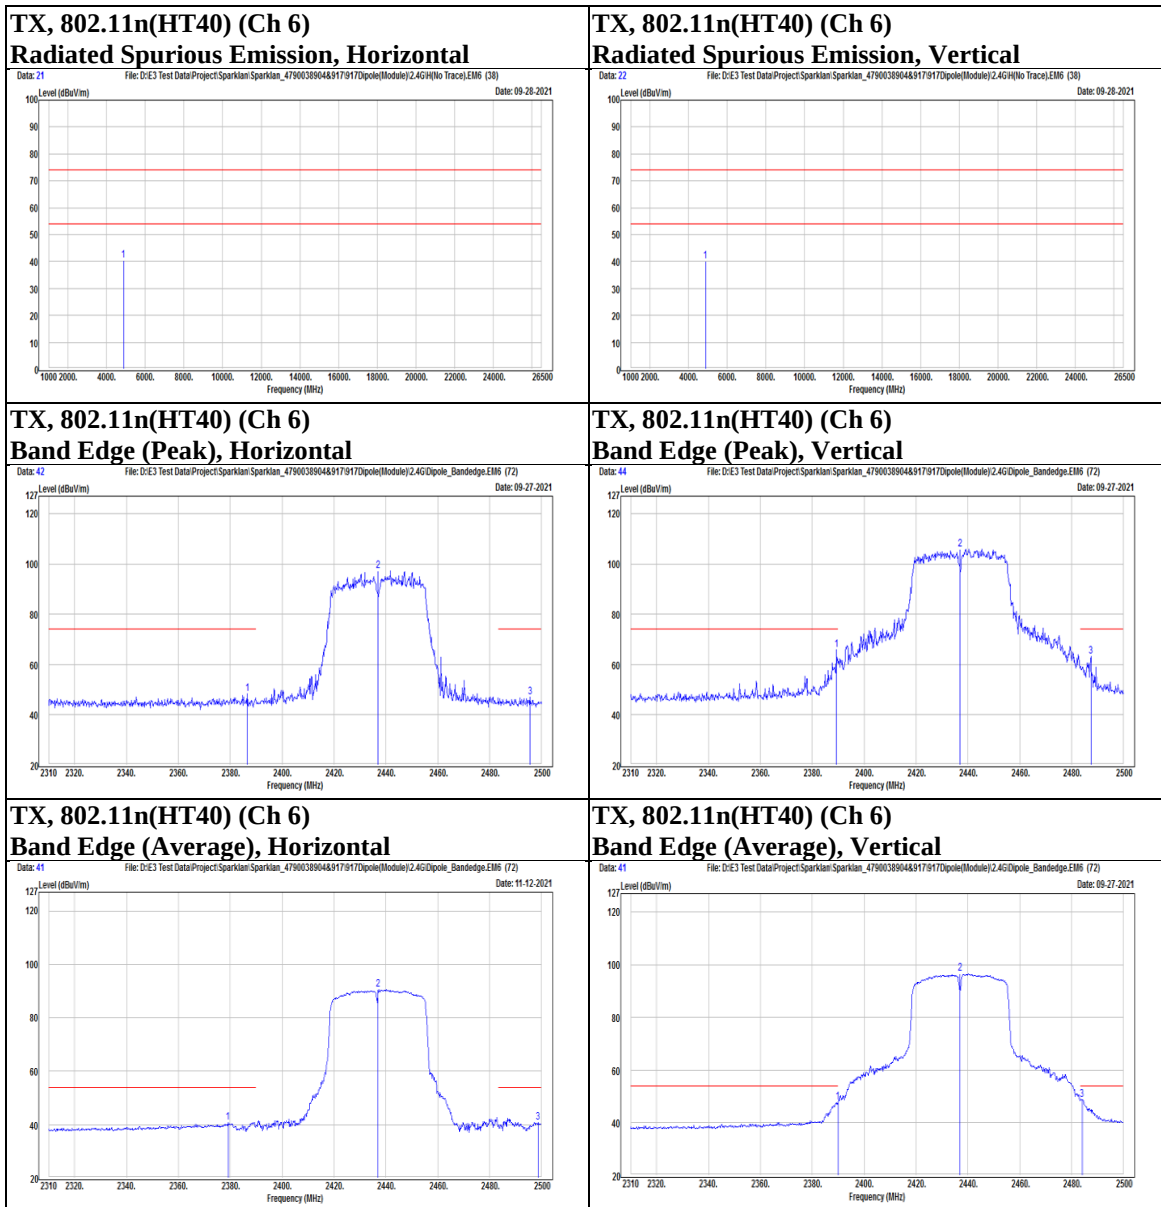



Test report No. : 4790038917A-US-R0-V0
Page : 92 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11n(HT40)	Channel	9
------	---------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	2452	86.16	6.12	92.28	N/A	N/A	PK
	@	2452	78.18	6.12	84.3	N/A	N/A	AVG
		2485.37	31.68	6.1	37.78	54	-16.22	AVG
		2488.22	44.24	6.1	50.34	74	-23.66	PK
	*	4904	37.05	2.63	39.68	74	-34.32	PK
Vertical	@	2452	95.88	6.12	102	N/A	N/A	PK
	@	2452	88.27	6.12	94.39	N/A	N/A	AVG
		2483.66	63.48	6.1	69.58	74	-4.42	PK
		2483.66	46.84	6.1	52.94	54	-1.06	AVG
	*	4904	36.95	2.63	39.58	74	-34.42	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0

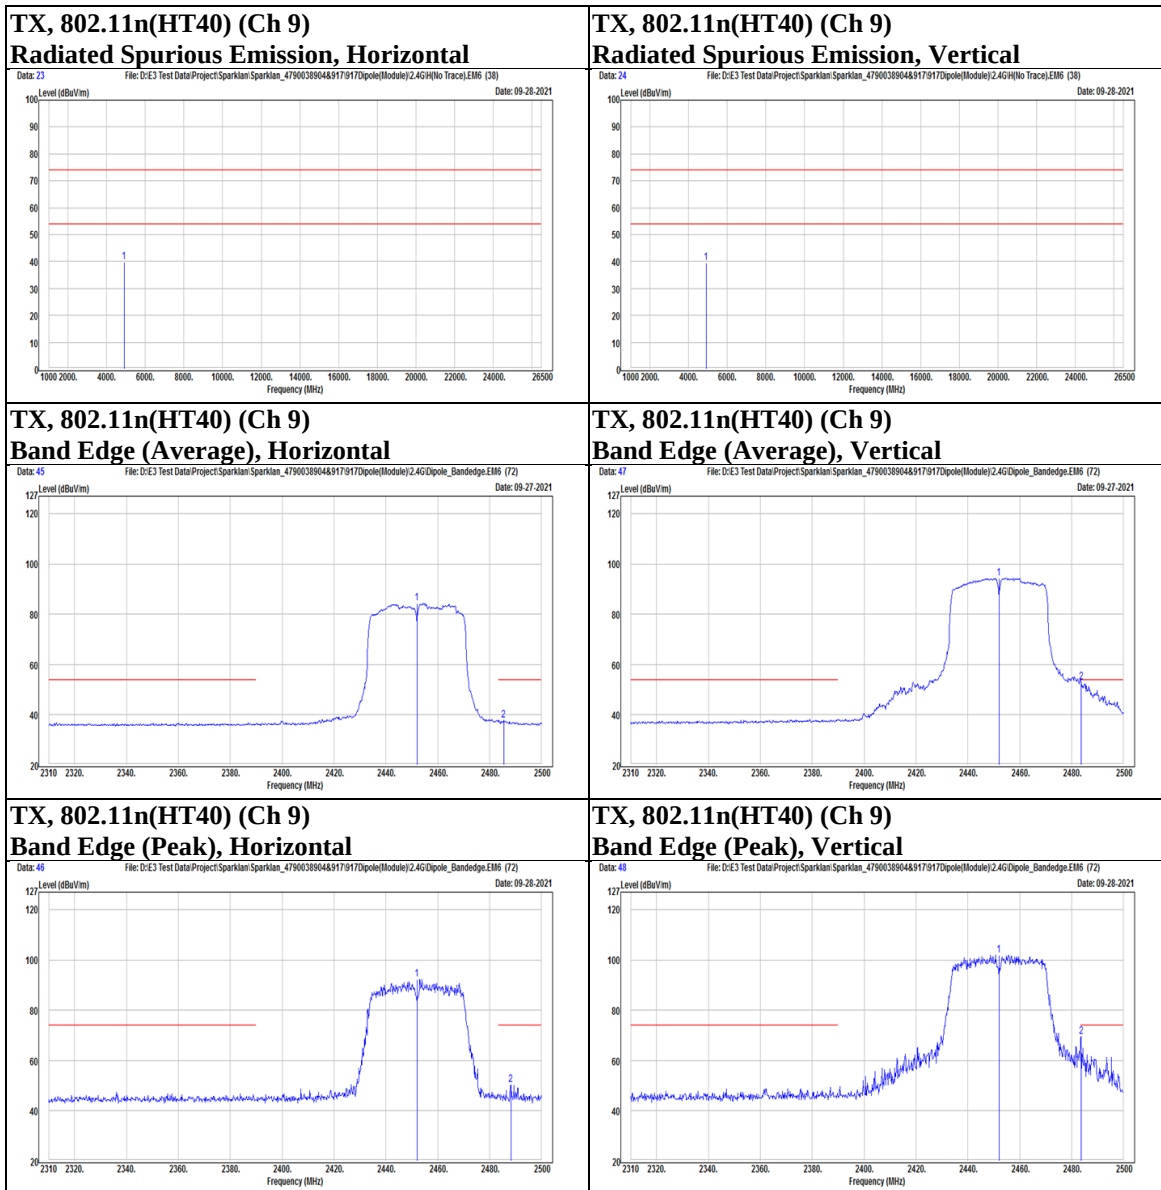



Test report No. : 4790038917A-US-R0-V0
Page : 94 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Below 1G

Mode	802.11g	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		78.5	42.9	-16	26.9	40	-13.1	PK
		206.54	48.92	-13.89	35.03	43.5	-8.47	PK
		236.61	42.83	-12.2	30.63	46	-15.37	PK
		364.65	40.11	-8.01	32.1	46	-13.9	PK
		481.05	37.44	-5.15	32.29	46	-13.71	PK
		955.38	32.48	3.87	36.35	46	-9.65	PK
Vertical		78.5	42.02	-16	26.02	40	-13.98	PK
		240.49	35.9	-12.1	23.8	46	-22.2	PK
		323.91	36.51	-9.18	27.33	46	-18.67	PK
		482.02	42.51	-5.1	37.41	46	-8.59	PK
		663.41	32.64	-1.23	31.41	46	-14.59	PK
		961.2	33.25	3.9	37.15	54	-16.85	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 95 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

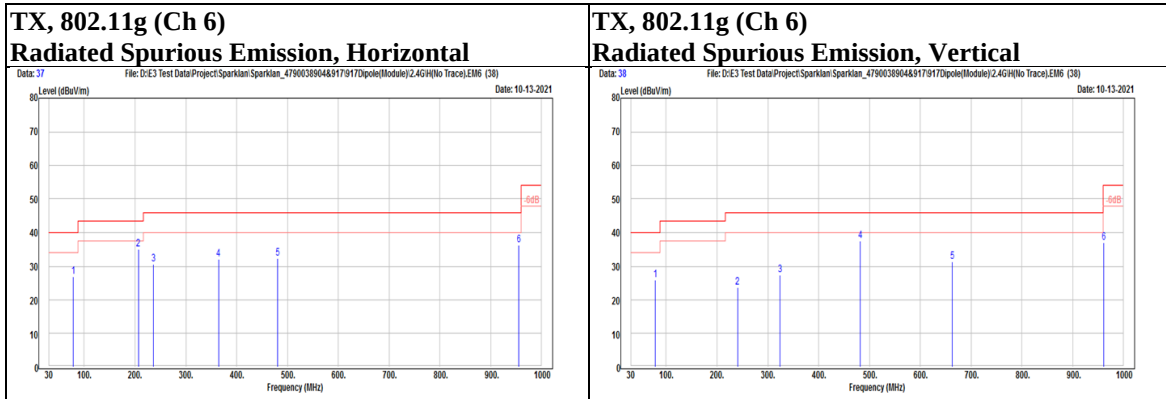

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 96 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

PCB Antenna

Above 1G

Mode	802.11b	Channel	1
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2379.16	42.12	6.08	48.2	74	-25.8	PK
		2389.61	34.82	6.1	40.92	54	-13.08	AVG
	@	2412	99.53	6.13	105.66	N/A	N/A	PK
	@	2412	94.54	6.13	100.67	N/A	N/A	AVG
	*	4824	35.46	2.55	38.01	74	-35.99	PK
Vertical		2389.04	43.26	6.1	49.36	74	-24.64	PK
		2389.99	34.5	6.1	40.6	54	-13.4	AVG
	@	2412	98.26	6.13	104.39	N/A	N/A	PK
	@	2412	92.24	6.13	98.37	N/A	N/A	AVG
	*	4824	35.21	2.55	37.76	74	-36.24	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 97 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

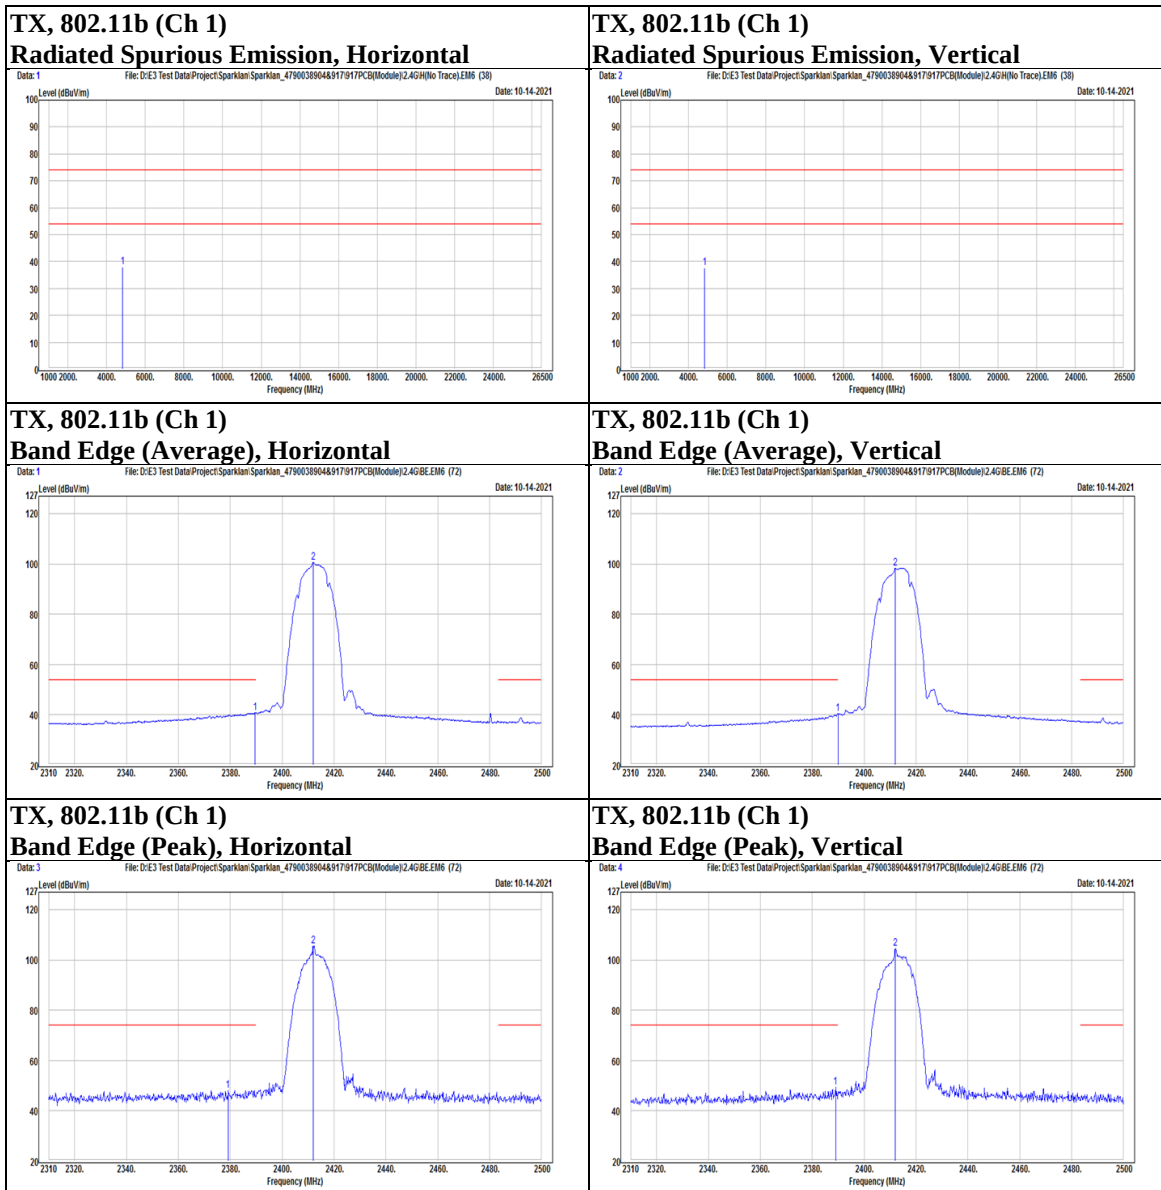

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 98 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11b	Channel	2
------	---------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2375.93	42.57	6.07	48.64	74	-25.36	PK
		2389.99	34.19	6.1	40.29	54	-13.71	AVG
	@	2417	92.56	6.13	98.69	N/A	N/A	PK
	@	2417	90.15	6.13	96.28	N/A	N/A	AVG
	*	4834	34.95	2.61	37.56	74	-36.44	PK
Vertical		2377.07	41.51	6.08	47.59	74	-26.41	PK
		2389.8	33.04	6.1	39.14	54	-14.86	AVG
	@	2417	94.66	6.13	100.79	N/A	N/A	PK
	@	2417	88.96	6.13	95.09	N/A	N/A	AVG
	*	4834	34.94	2.61	37.55	74	-36.45	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 99 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

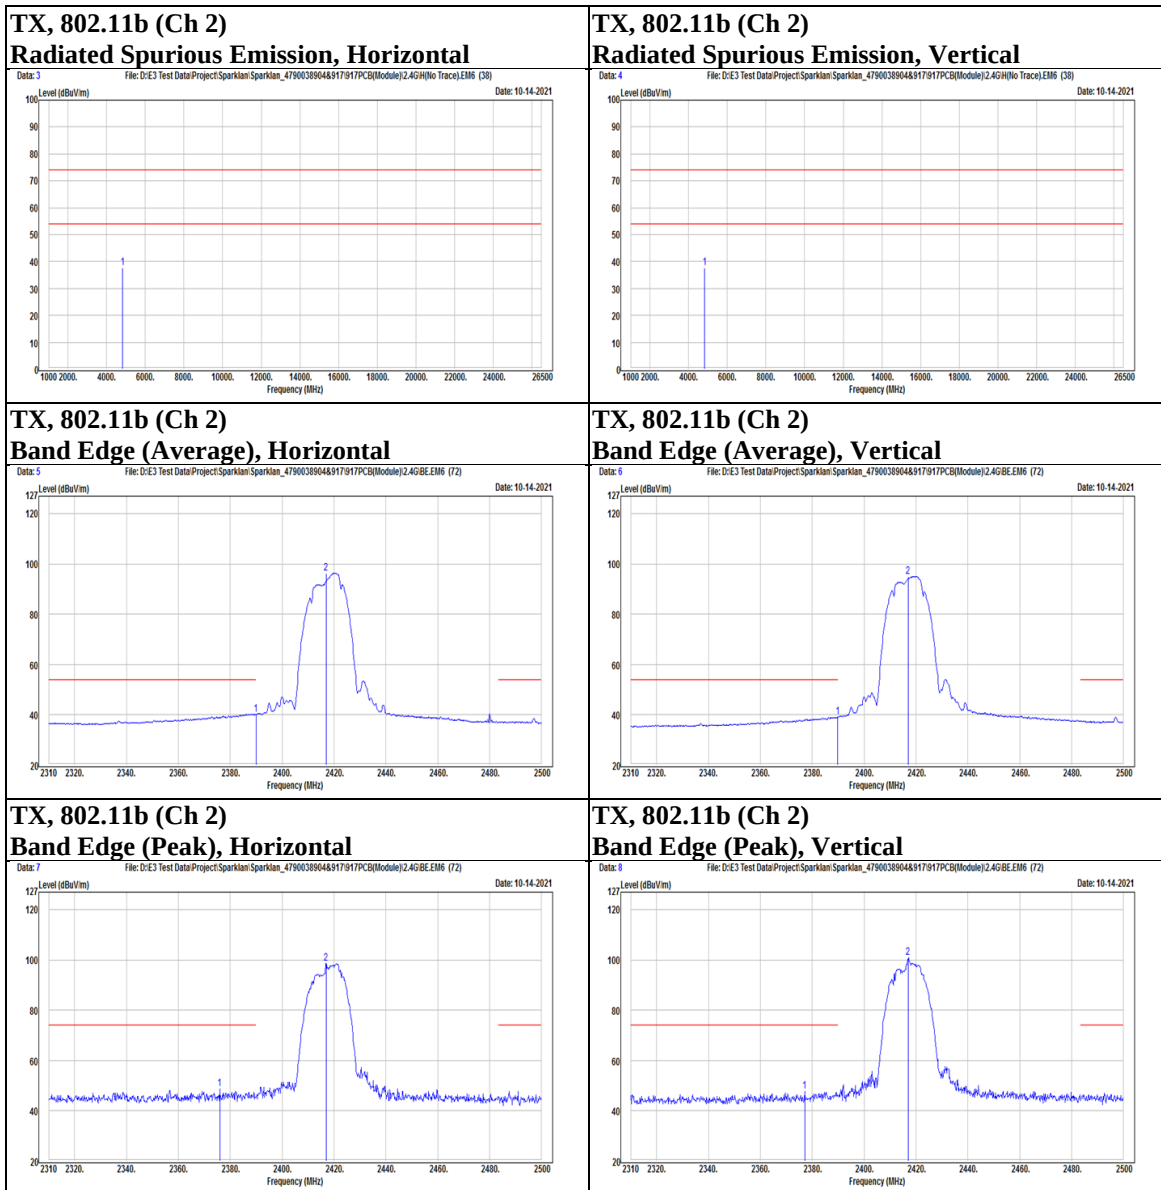

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 100 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11b	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		2352.37	41.62	6.04	47.66	74	-26.34	PK
		2389.04	32.92	6.1	39.02	54	-14.98	AVG
	@	2437	95.38	6.12	101.5	N/A	N/A	PK
	@	2437	92.25	6.12	98.37	N/A	N/A	AVG
		2483.85	32.06	6.1	38.16	54	-15.84	AVG
		2491.45	41.91	6.1	48.01	74	-25.99	PK
	*	4874	35.52	2.66	38.18	74	-35.82	PK
Vertical		2381.25	41.69	6.08	47.77	74	-26.23	PK
		2389.8	32.46	6.1	38.56	54	-15.44	AVG
	@	2437	95.71	6.12	101.83	N/A	N/A	PK
	@	2437	91.64	6.12	97.76	N/A	N/A	AVG
		2483.66	32.14	6.1	38.24	54	-15.76	AVG
		2497.91	40.84	6.1	46.94	74	-27.06	PK
	*	4874	35.52	2.66	38.18	74	-35.82	PK
	*	7311	41.37	10.62	51.99	74	-22.01	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 101 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

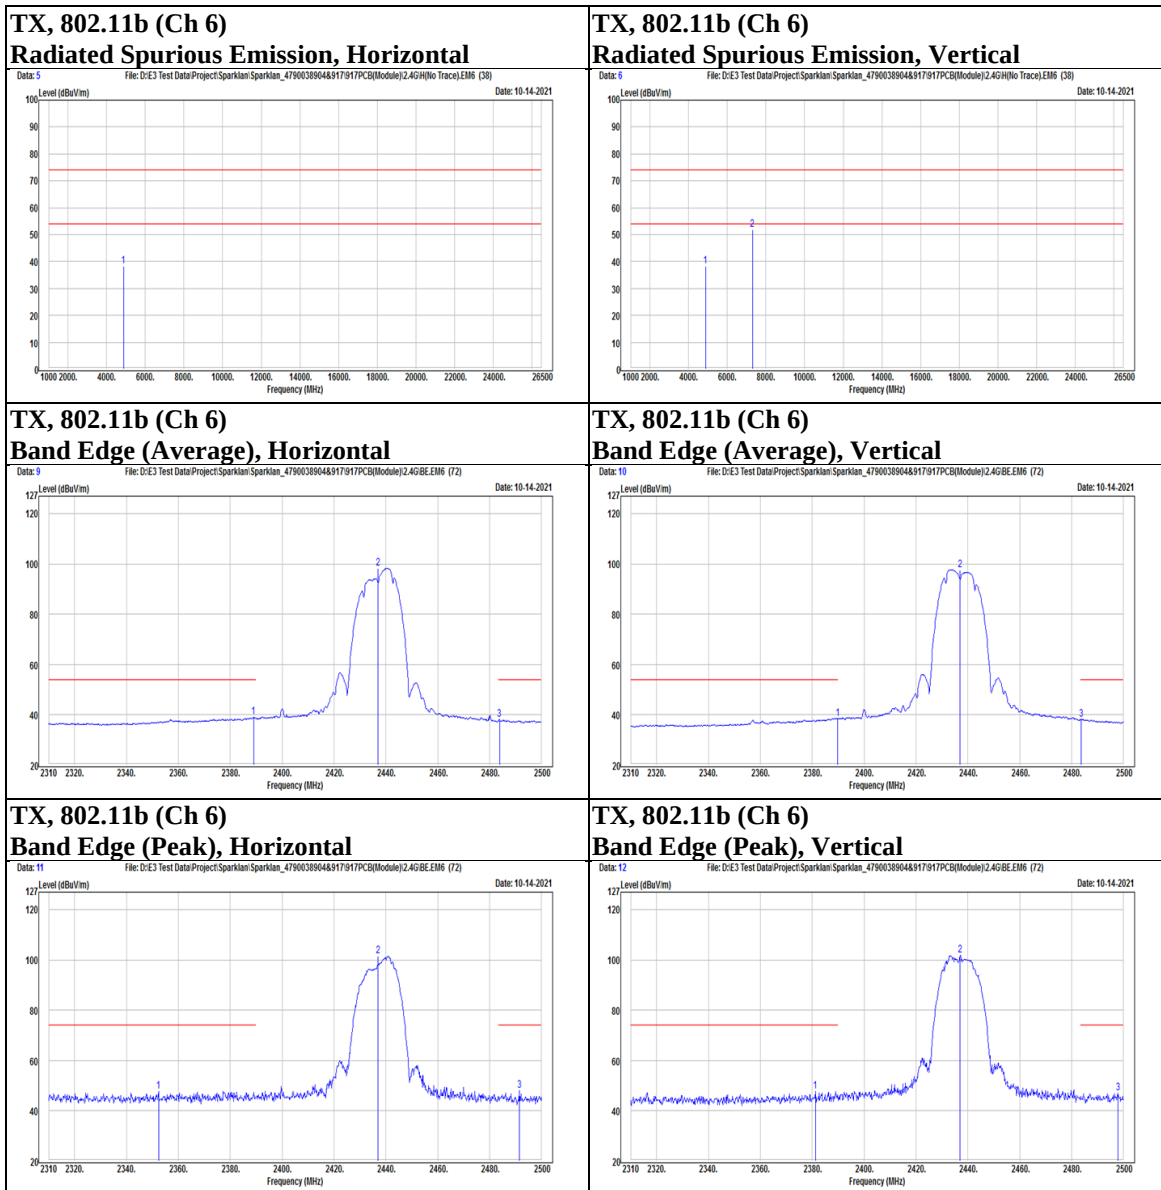

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 102 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11b	Channel	10
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	2457	100.74	6.12	106.86	N/A	N/A	PK
	@	2457	94.08	6.12	100.2	N/A	N/A	AVG
		2483.66	32.59	6.1	38.69	54	-15.31	AVG
		2496.77	42	6.1	48.1	74	-25.9	PK
	*	4914	35.91	2.63	38.54	74	-35.46	PK
Vertical	@	2457	100.62	6.12	106.74	N/A	N/A	PK
	@	2457	95.21	6.12	101.33	N/A	N/A	AVG
		2483.66	32.92	6.1	39.02	54	-14.98	AVG
		2485.75	41.7	6.1	47.8	74	-26.2	PK
	*	4914	35.43	2.63	38.06	74	-35.94	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0876 / 6.0



Test report No. : 4790038917A-US-R0-V0
Page : 103 of 137
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

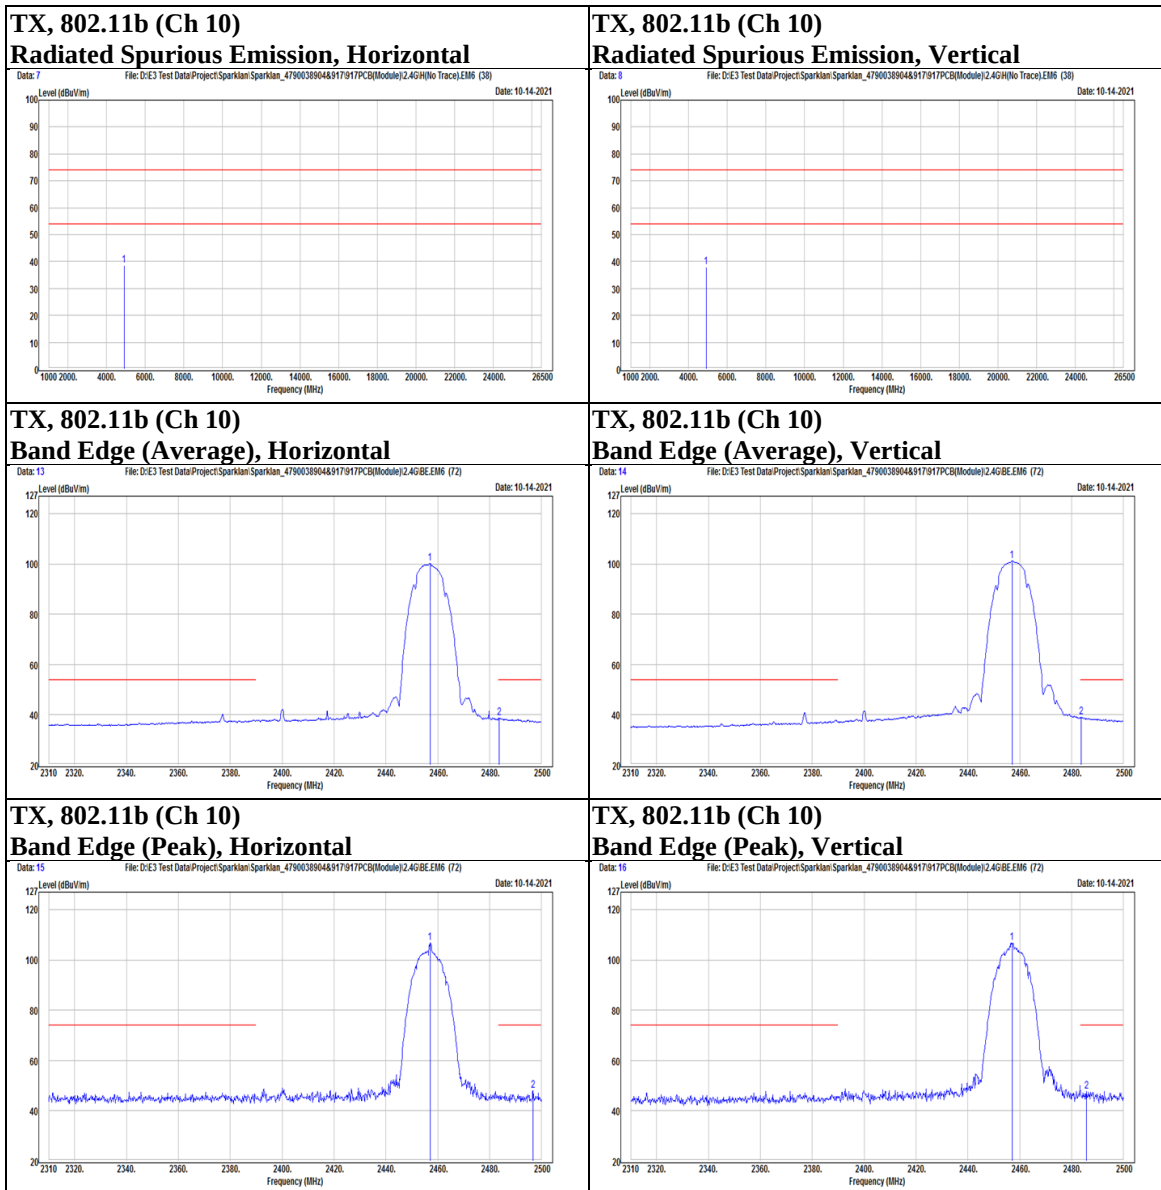

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0876 / 6.0