

Prüfbericht - Nr.:

50104295 001


Seite 1 von 43

Test Report No.

Page 1 of 43


6 dB Bandwidth Measurement

TX frequency: 2402MHz (BLE)

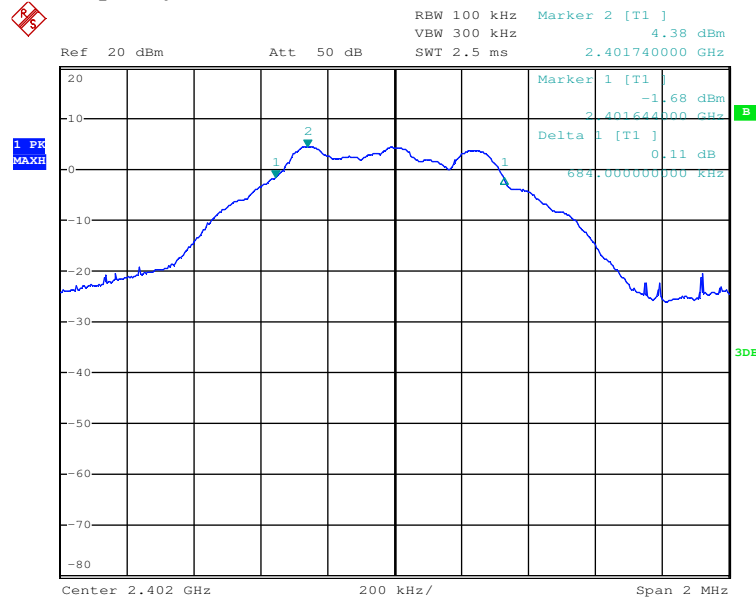

Date: 23.OCT.2017 15:01:40

TX frequency: 2440MHz (BLE)

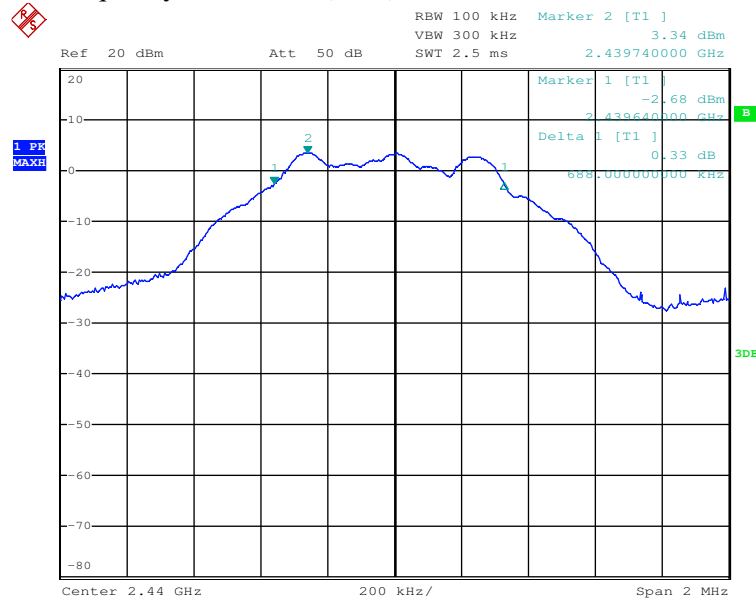

Date: 23.OCT.2017 15:05:34

Prüfbericht - Nr.:


50104295 001

Seite 2 von 43

Test Report No.


Page 2 of 43

TX frequency: 2480MHz (BLE)

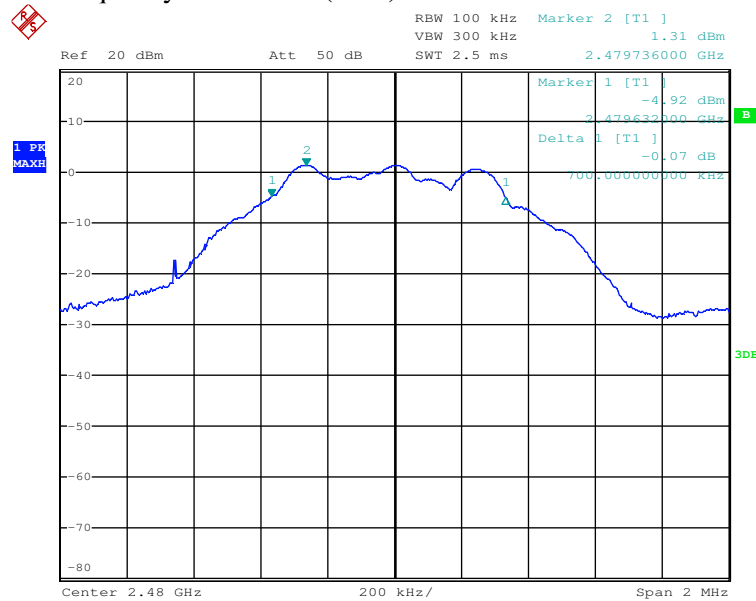

Date: 23.OCT.2017 15:07:08

TX frequency: 2412MHz (802.11b)

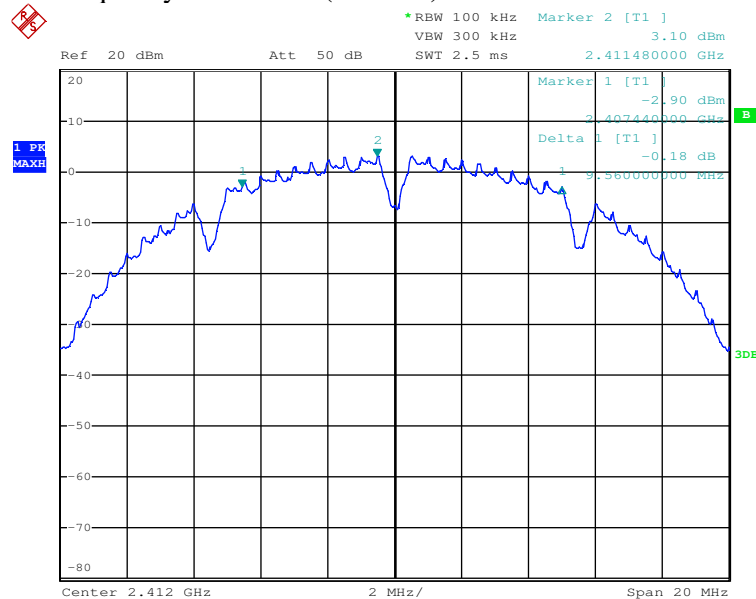

Date: 23.OCT.2017 17:23:48

Prüfbericht - Nr.:


50104295 001

Seite 3 von 43

Test Report No.


Page 3 of 43

TX frequency: 2437MHz (802.11b)

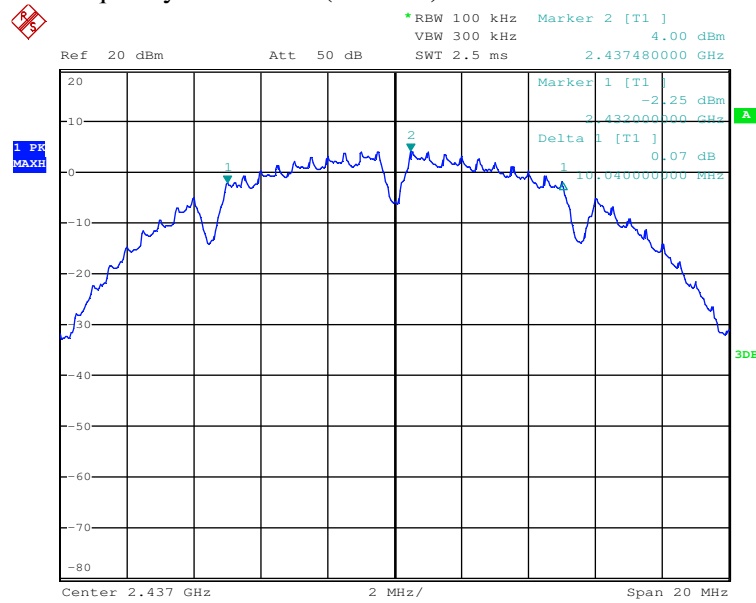

Date: 23.OCT.2017 18:21:56

TX frequency: 2462MHz (802.11b)

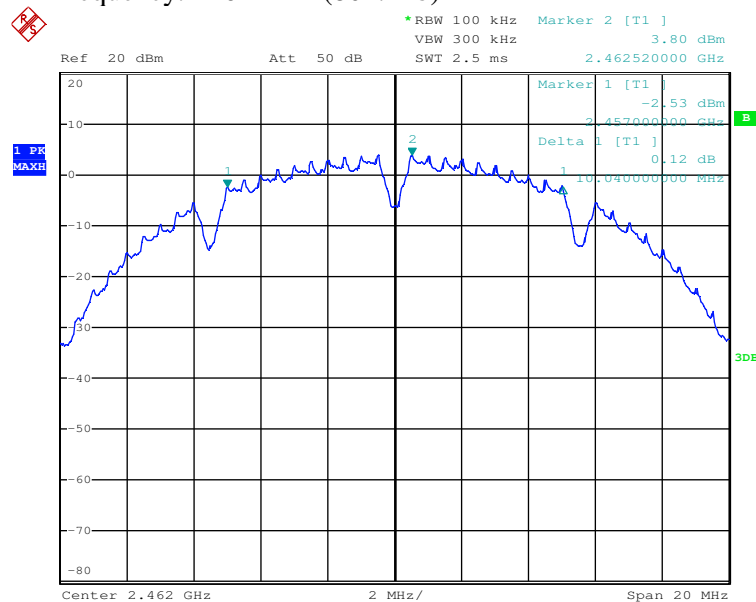

Date: 23.OCT.2017 17:51:00

Prüfbericht - Nr.:


50104295 001

Seite 4 von 43

Test Report No.


Page 4 of 43

TX frequency: 2412MHz (802.11g)

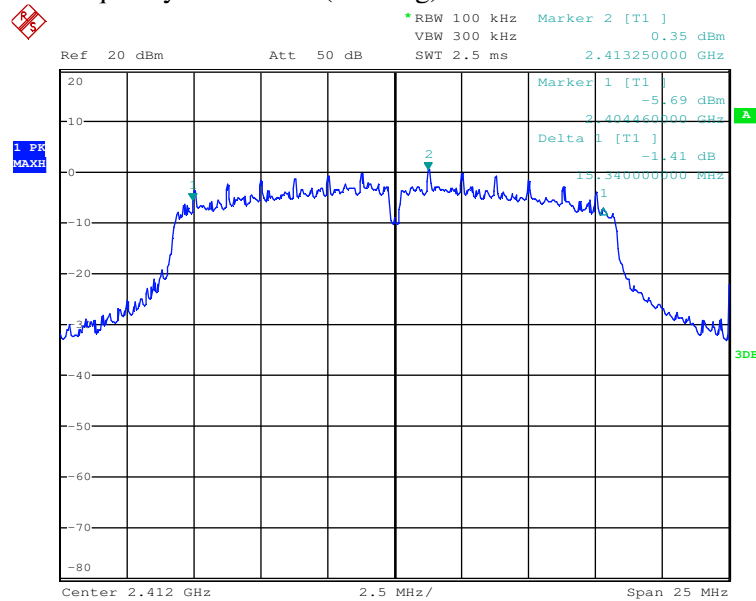

Date: 24.OCT.2017 14:14:24

TX frequency: 2437MHz (802.11g)

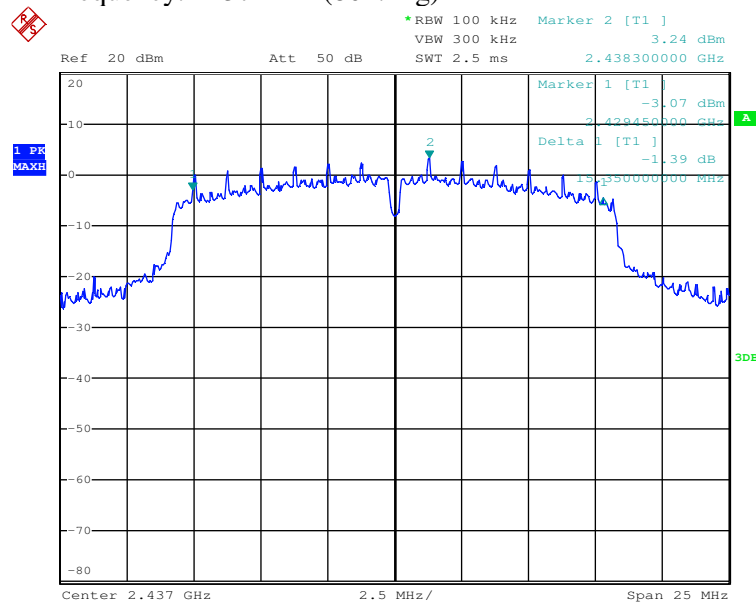

Date: 24.OCT.2017 14:16:11

Prüfbericht - Nr.:


50104295 001

Seite 5 von 43

Test Report No.


Page 5 of 43

TX frequency: 2462MHz (802.11g)

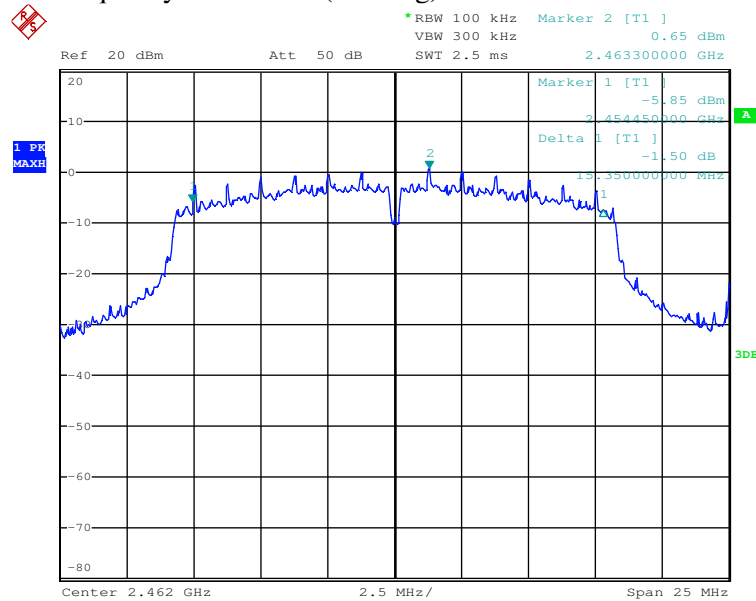

Date: 24.OCT.2017 14:18:11

TX frequency: 2412MHz (802.11n)

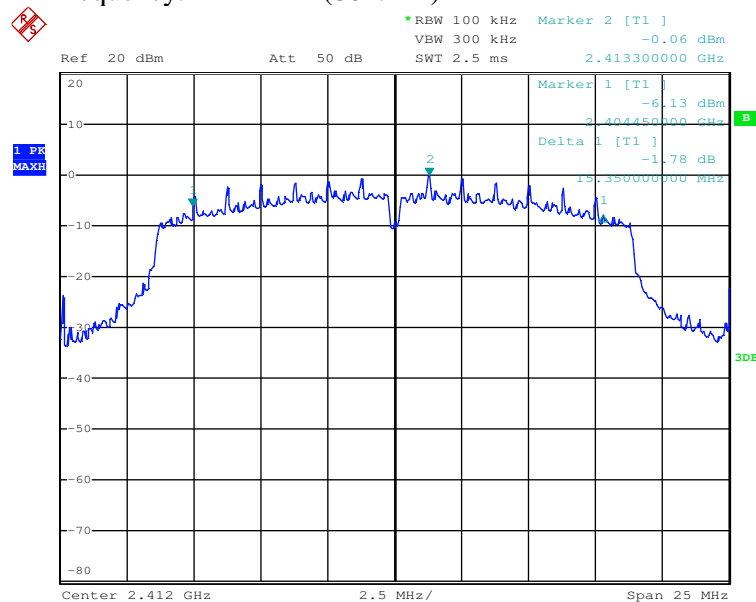

Date: 24.OCT.2017 14:33:28

Prüfbericht - Nr.:


50104295 001

Seite 6 von 43

Test Report No.


Page 6 of 43

TX frequency: 2437MHz (802.11n)

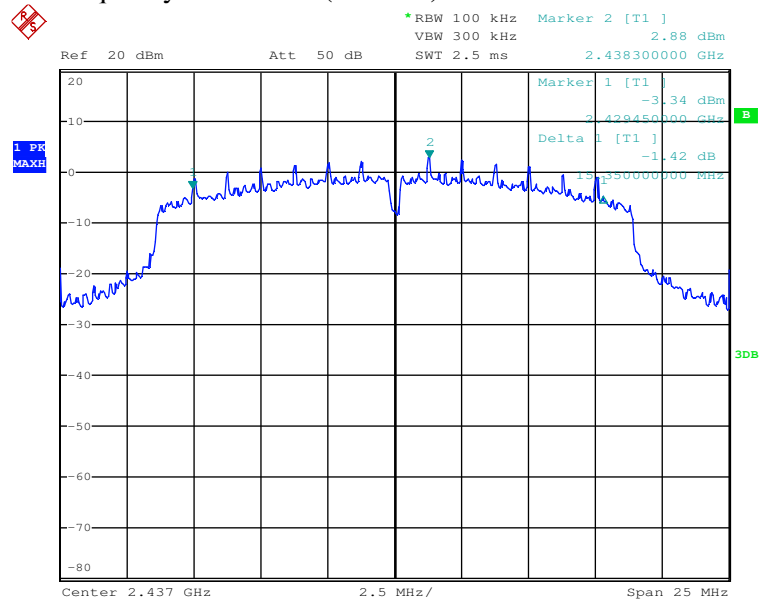

Date: 24.OCT.2017 14:35:26

TX frequency: 2462MHz (802.11n)

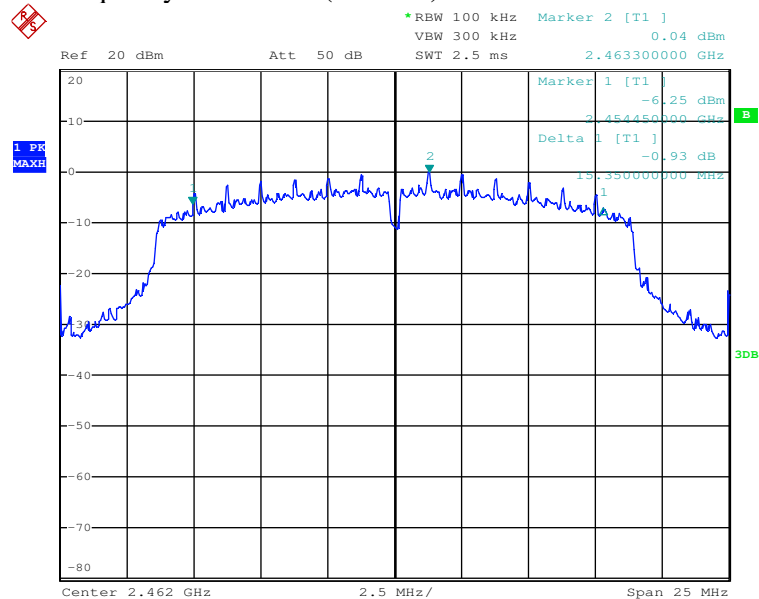

Date: 24.OCT.2017 14:37:58

Prüfbericht - Nr.:

50104295 001

Seite 7 von 43

Test Report No.


Page 7 of 43

Maximum Conducted Output Power

TX frequency: 2402MHz (BLE)



Ref 20 dBm Att 50 dB RBW 1 MHz Marker 1 [T1] 4.31 dBm
VBW 3 MHz SWT 2.5 ms 2.401760000 GHz

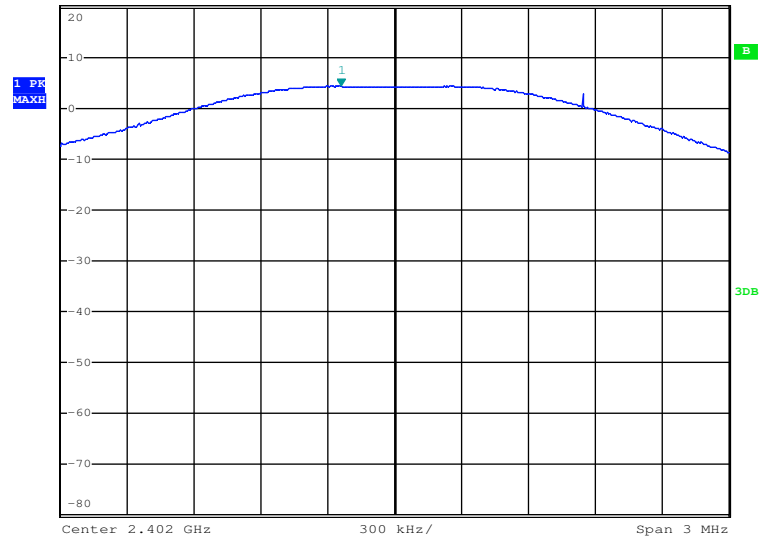

Date: 23.OCT.2017 15:10:42

Prüfbericht - Nr.:


50104295 001

Seite 8 von 43

Test Report No.


Page 8 of 43

TX frequency: 2440MHz (BLE)

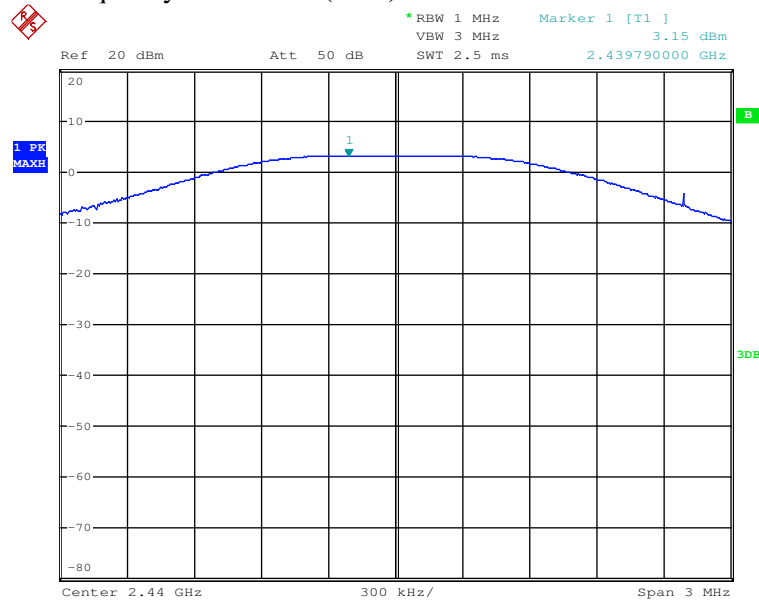

Date: 23.OCT.2017 15:09:56

TX frequency: 2480MHz (BLE)

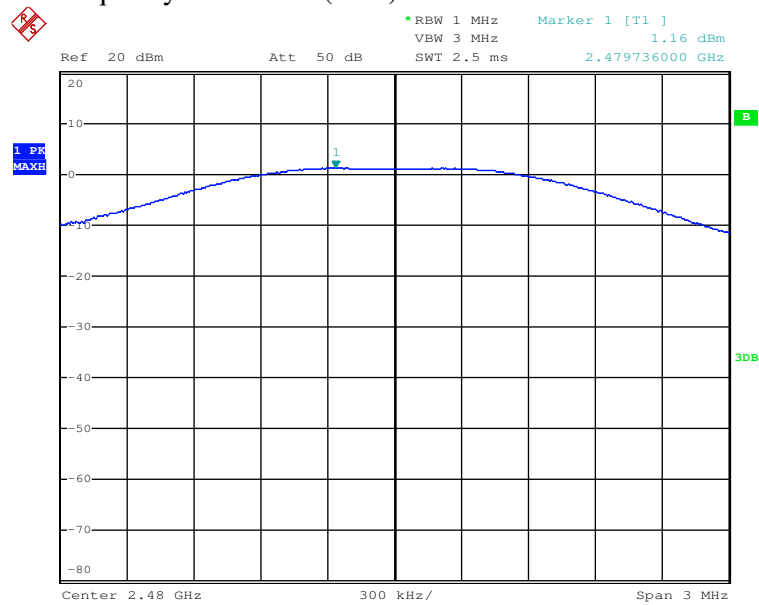

Date: 23.OCT.2017 15:08:54

Prüfbericht - Nr.:

50104295 001


Seite 9 von 43

Test Report No.

Page 9 of 43


Power Spectral Density

TX frequency: 2402MHz (BLE)

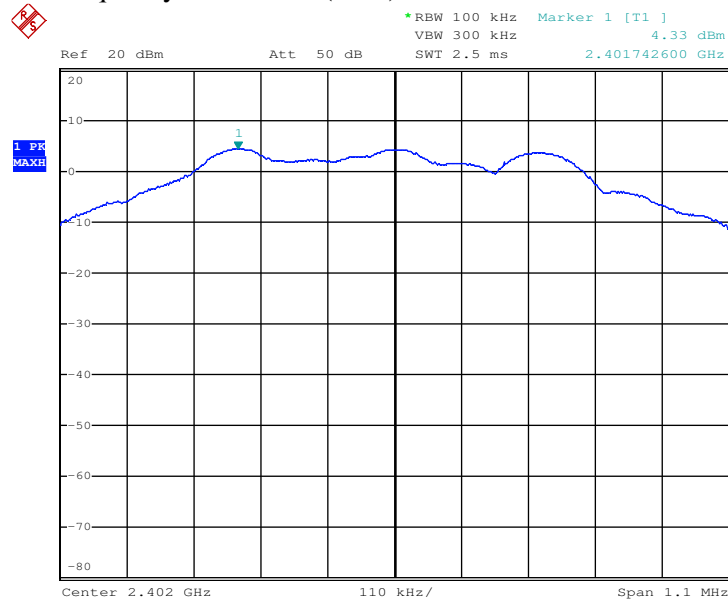

Date: 23.OCT.2017 15:14:45

TX frequency: 2440MHz (BLE)

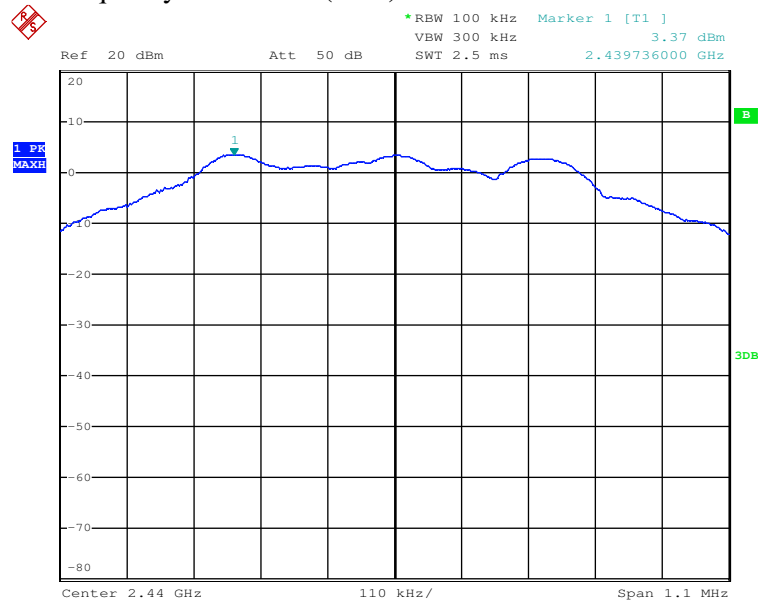

Date: 23.OCT.2017 15:15:56

Prüfbericht - Nr.:


50104295 001

Seite 10 von 43

Test Report No.


Page 10 of 43

TX frequency: 2480MHz (BLE)

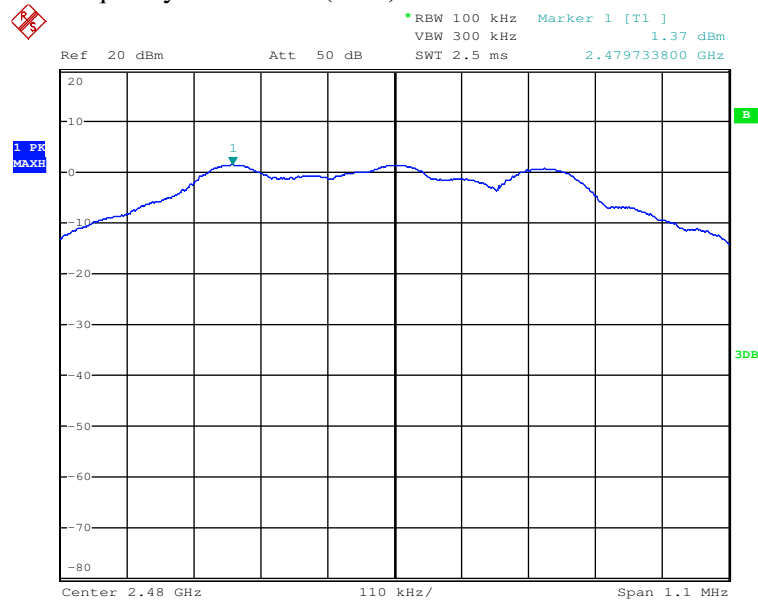

Date: 23.OCT.2017 15:17:01

TX frequency: 2412MHz (802.11b)

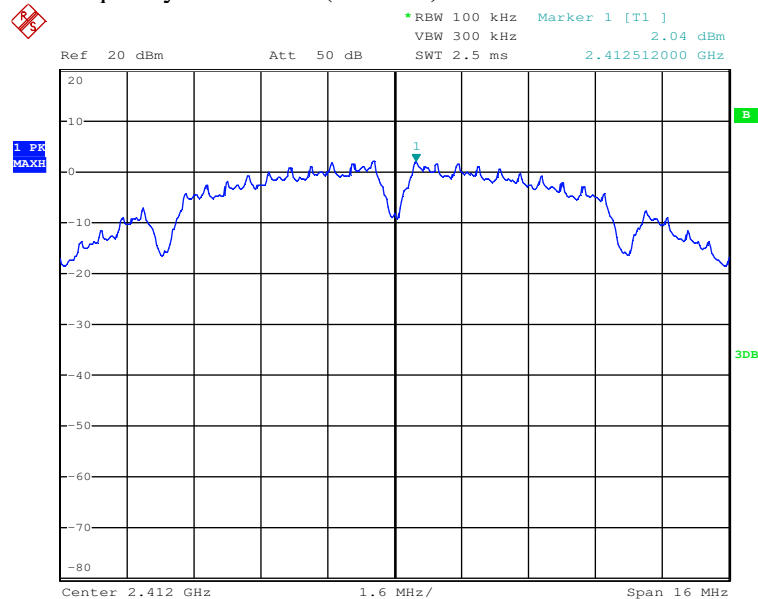

Date: 24.OCT.2017 16:04:35

Prüfbericht - Nr.:


50104295 001

Seite 11 von 43

Test Report No.


Page 11 of 43

TX frequency: 2437MHz (802.11b)

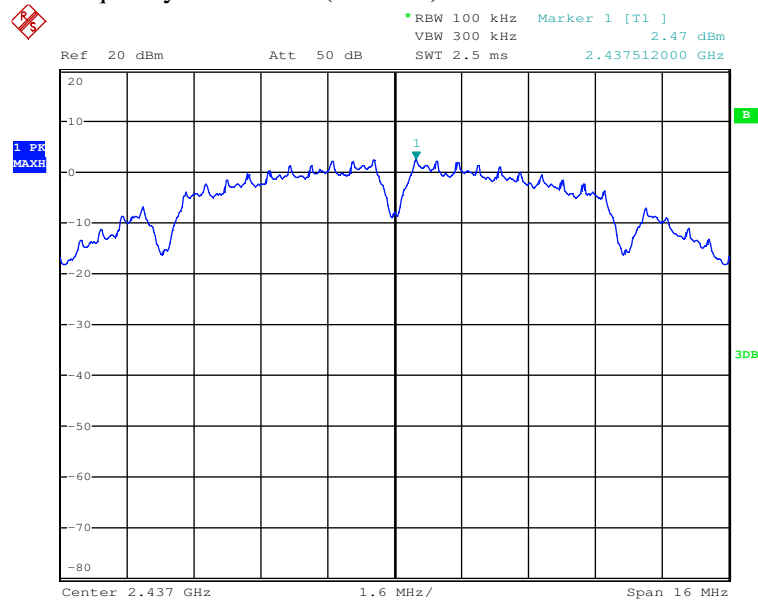

Date: 24.OCT.2017 16:03:36

TX frequency: 2462MHz (802.11b)

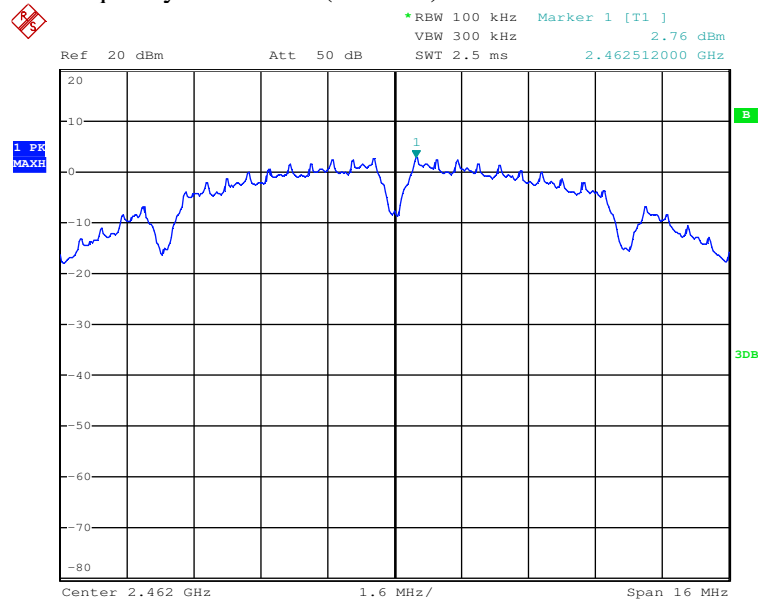

Date: 24.OCT.2017 16:05:53

Prüfbericht - Nr.:


50104295 001

Seite 12 von 43

Test Report No.


Page 12 of 43

TX frequency: 2412MHz (802.11g)

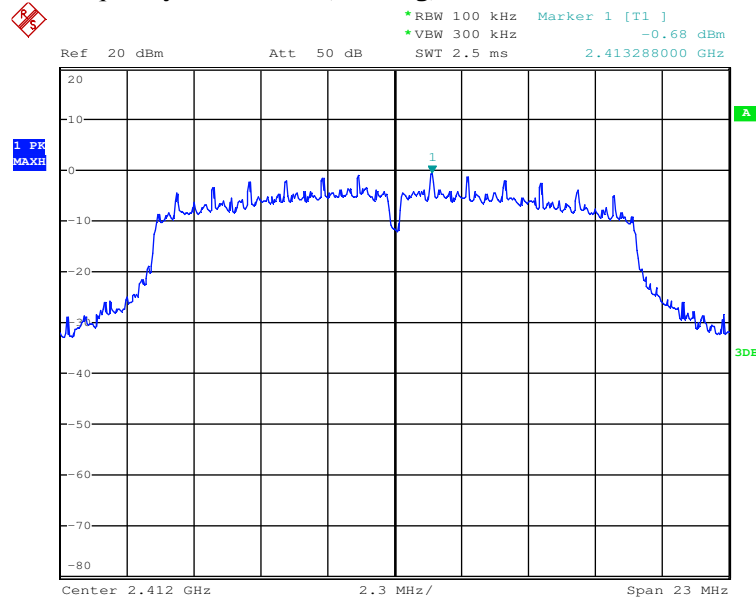

Date: 24.OCT.2017 16:36:57

TX frequency: 2437MHz (802.11g)

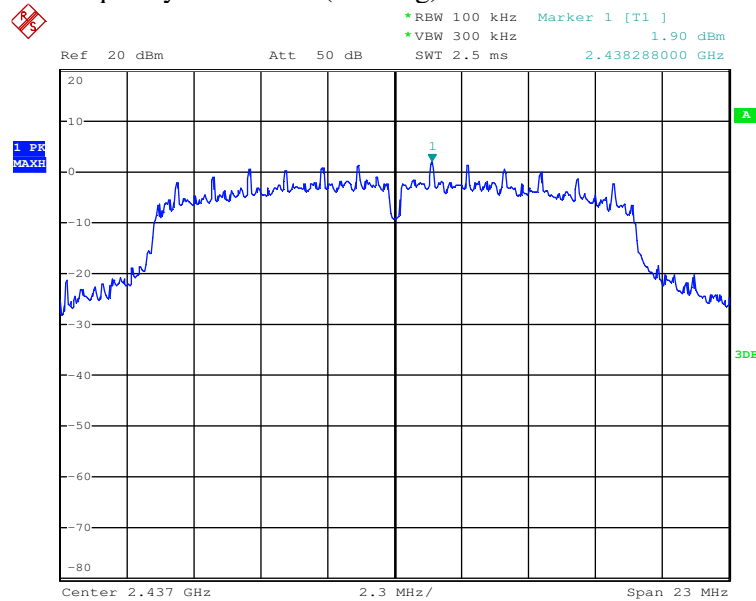

Date: 24.OCT.2017 16:37:58

Prüfbericht - Nr.:


50104295 001

Seite 13 von 43

Test Report No.


Page 13 of 43

TX frequency: 2462MHz (802.11g)

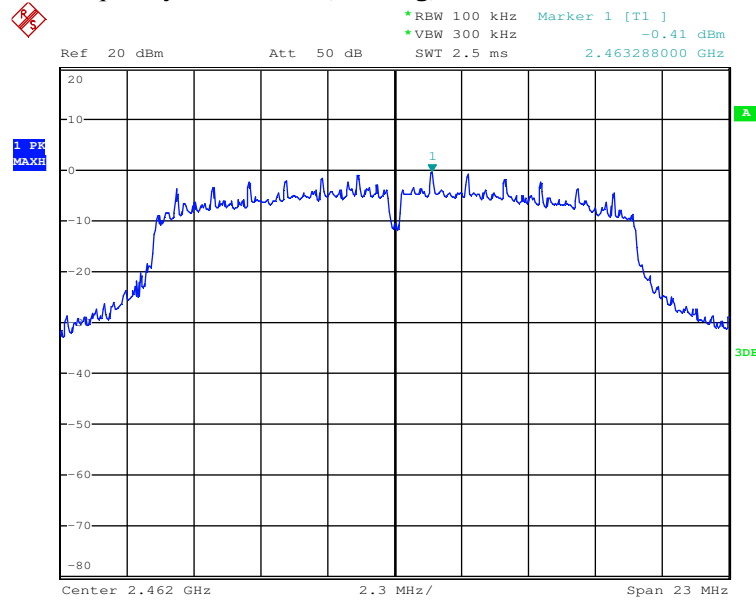

Date: 24.OCT.2017 16:38:47

TX frequency: 2412MHz (802.11n)

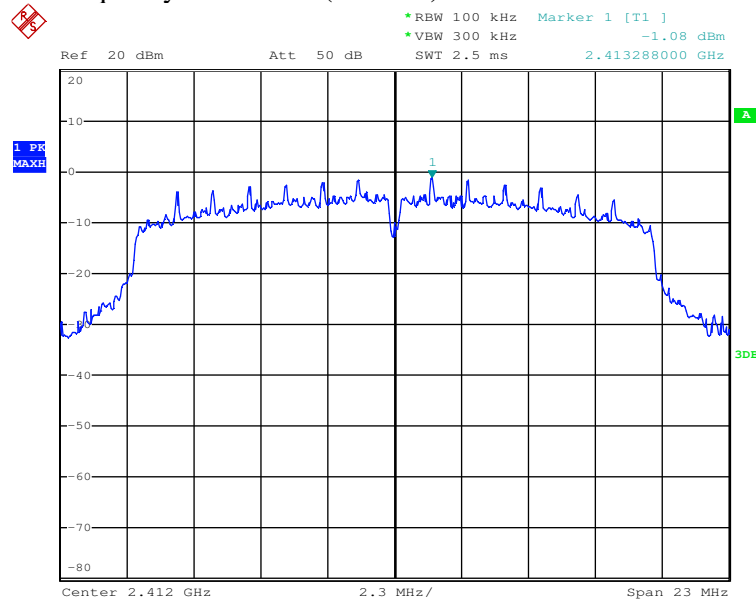

Date: 24.OCT.2017 16:54:43

Prüfbericht - Nr.:


50104295 001

Seite 14 von 43

Test Report No.


Page 14 of 43

TX frequency: 2437MHz (802.11n)

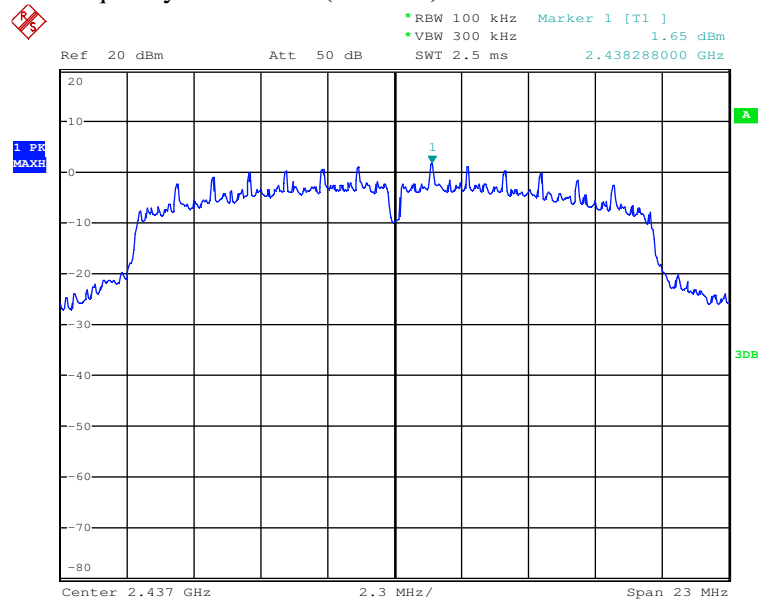

Date: 24.OCT.2017 16:55:47

TX frequency: 2462MHz (802.11n)

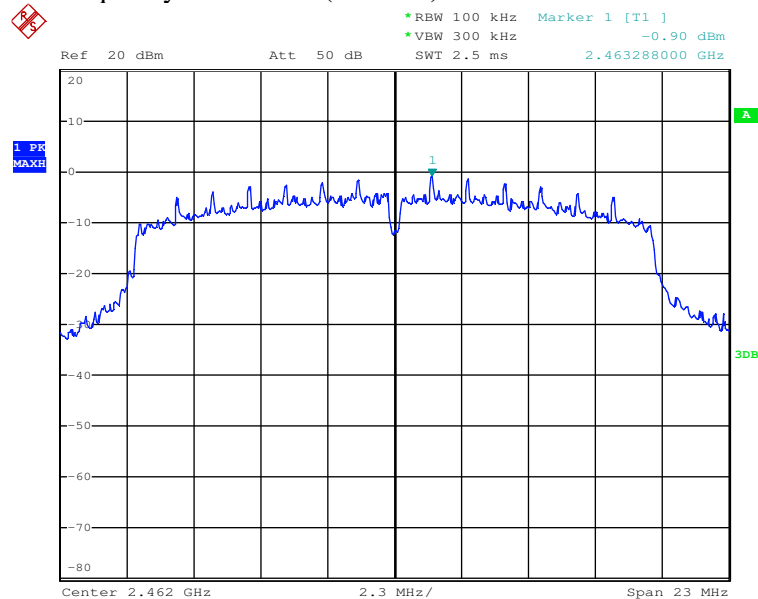

Date: 24.OCT.2017 16:56:33

Prüfbericht - Nr.:

50104295 001

Seite 15 von 43

Test Report No.


Page 15 of 43

Conducted Spurious Emissions

TX frequency: 2402MHz (BLE)




Ref -10 dBm Att 20 dB RBW 100 kHz Marker 1 [T1]
VBW 300 kHz -59.13 dBm
SWT 100 ms 664.33600000 MHz

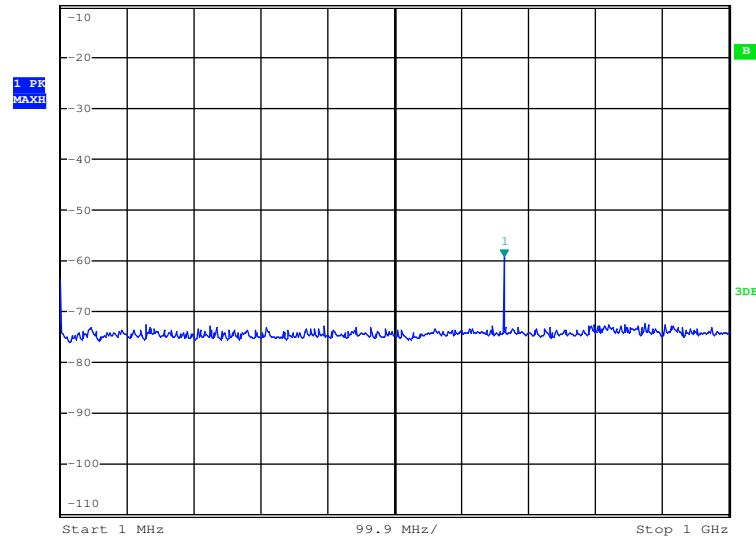

Date: 23.OCT.2017 15:38:27



Ref 10 dBm Att 40 dB RBW 100 kHz Marker 1 [T1]
VBW 300 kHz -43.74 dBm
SWT 200 ms 2.50000000 GHz

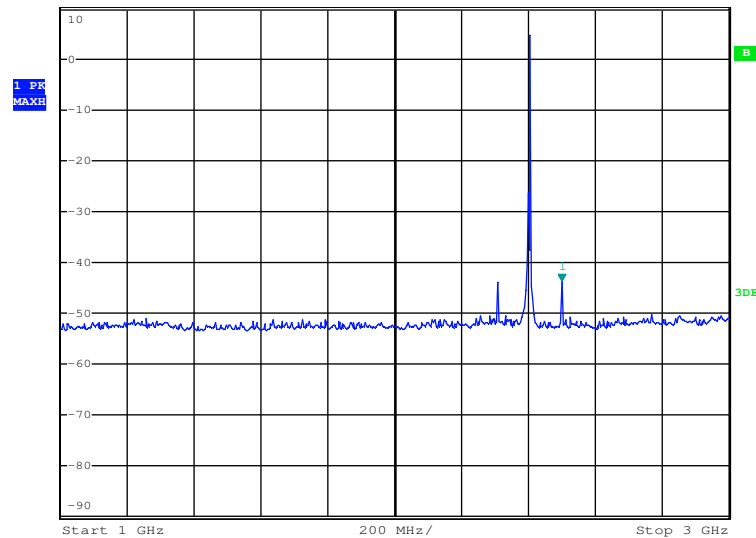


Date: 23.OCT.2017 15:48:07


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 16 von 43
Page 16 of 43

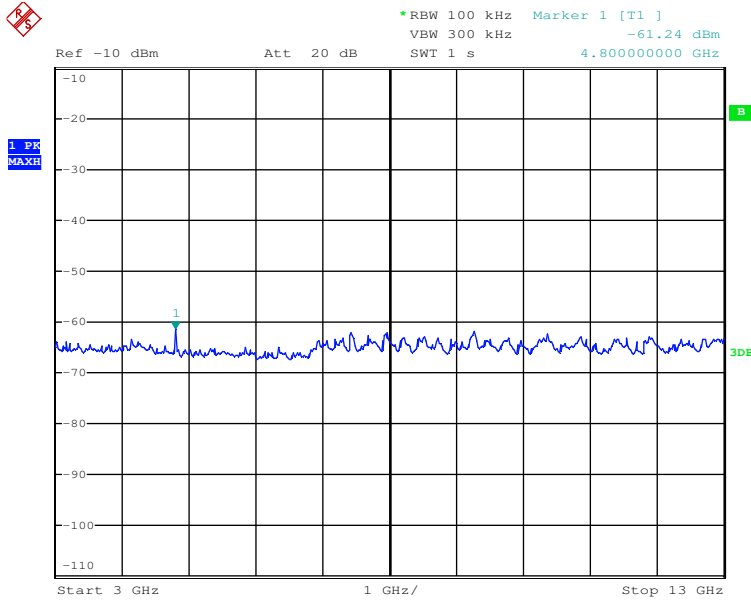

Date: 23.OCT.2017 15:53:05

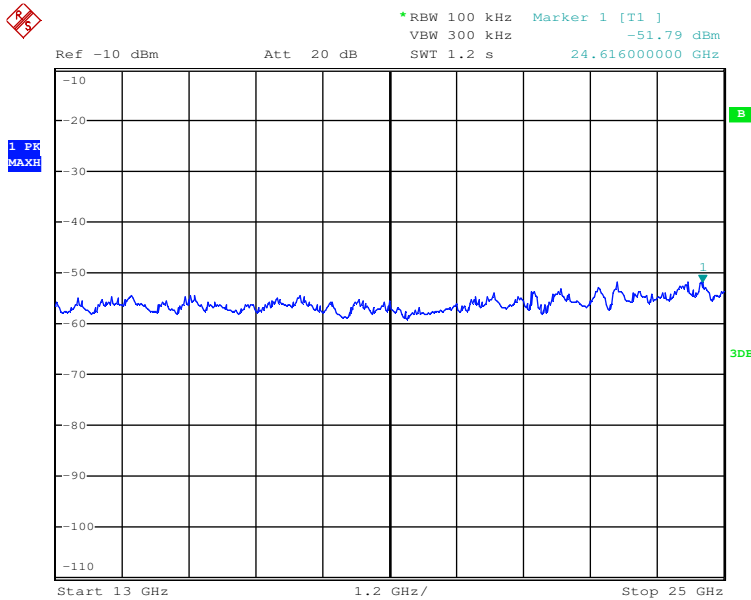

Date: 23.OCT.2017 15:54:25


Prüfbericht - Nr.:

50104295 001

Seite 17 von 43


Test Report No.

Page 17 of 43

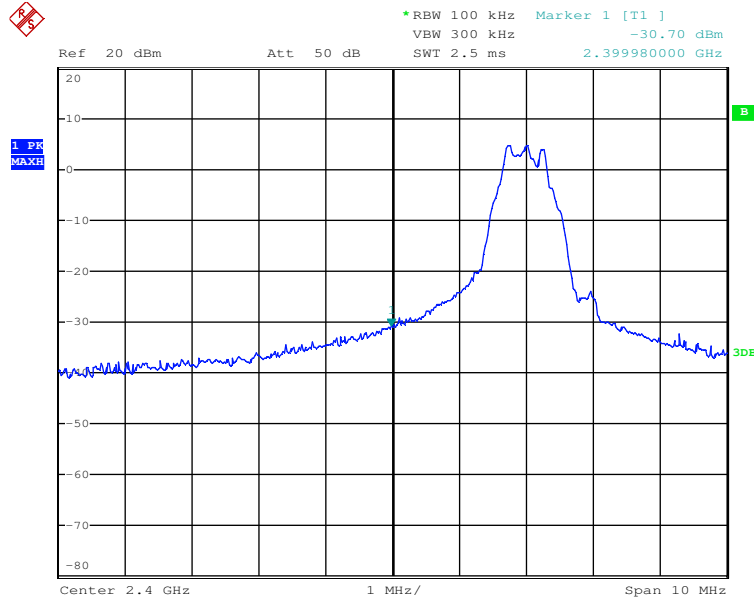

Date: 23.OCT.2017 15:33:16

TX frequency: 2440MHz (BLE)

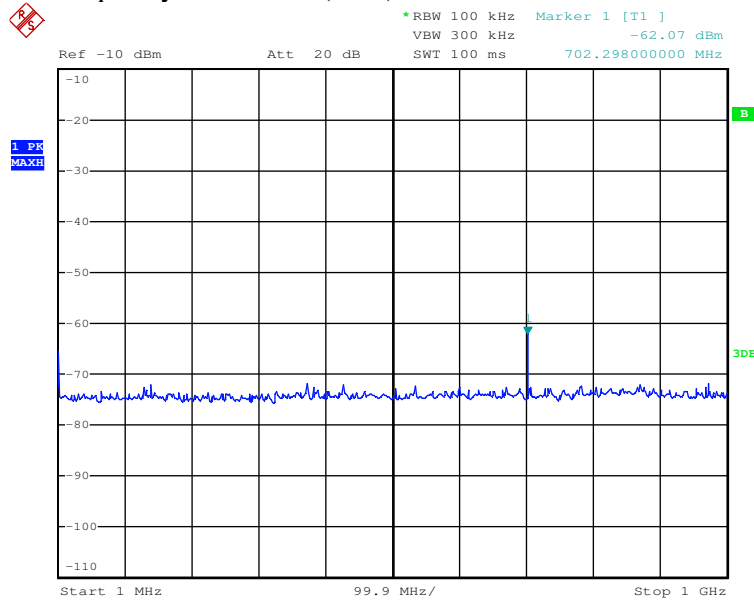


Date: 23.OCT.2017 16:09:32


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 18 von 43
Page 18 of 43

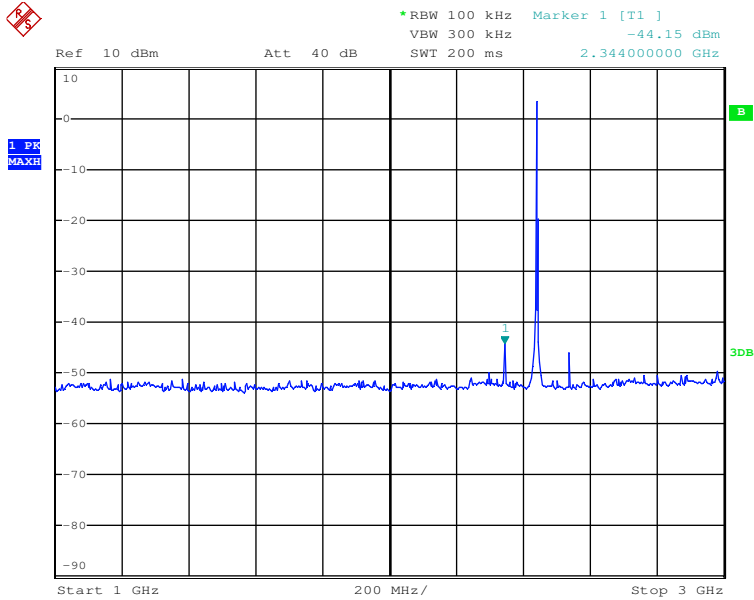

Date: 23.OCT.2017 16:08:32

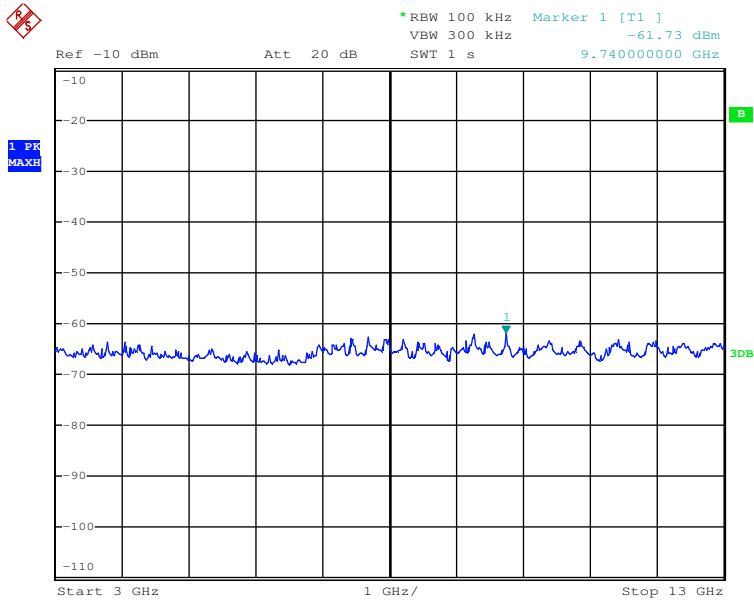


Date: 23.OCT.2017 15:57:46

Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 19 von 43
Page 19 of 43

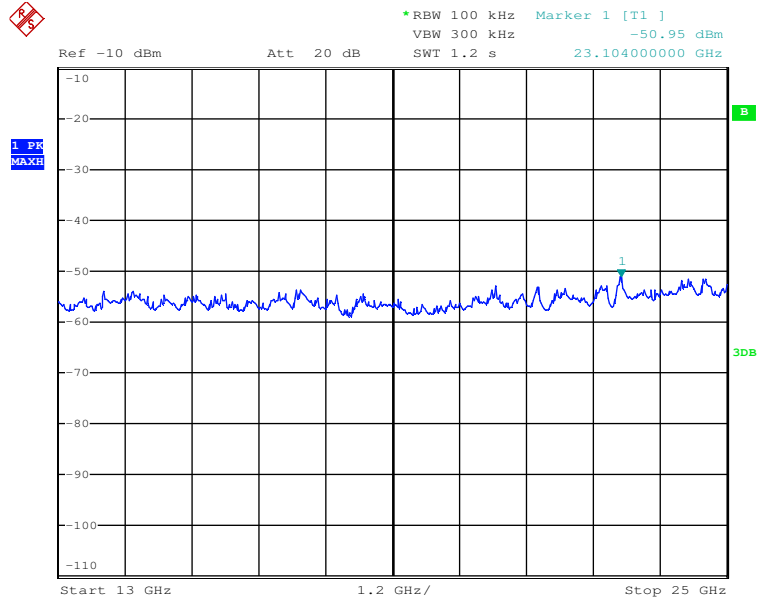

Date: 23.OCT.2017 15:56:34

Prüfbericht - Nr.:


50104295 001

Seite 20 von 43


Test Report No.

Page 20 of 43

TX frequency: 2480MHz (BLE)

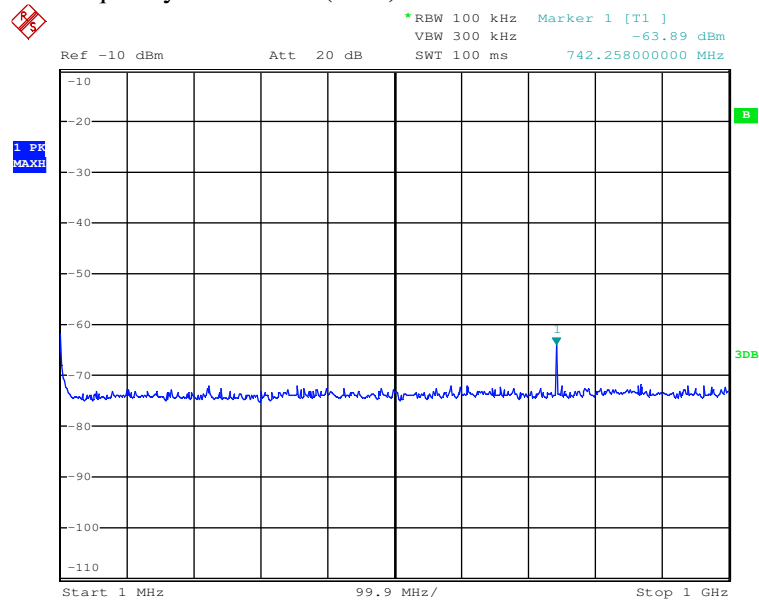


Date: 23.OCT.2017 15:21:15

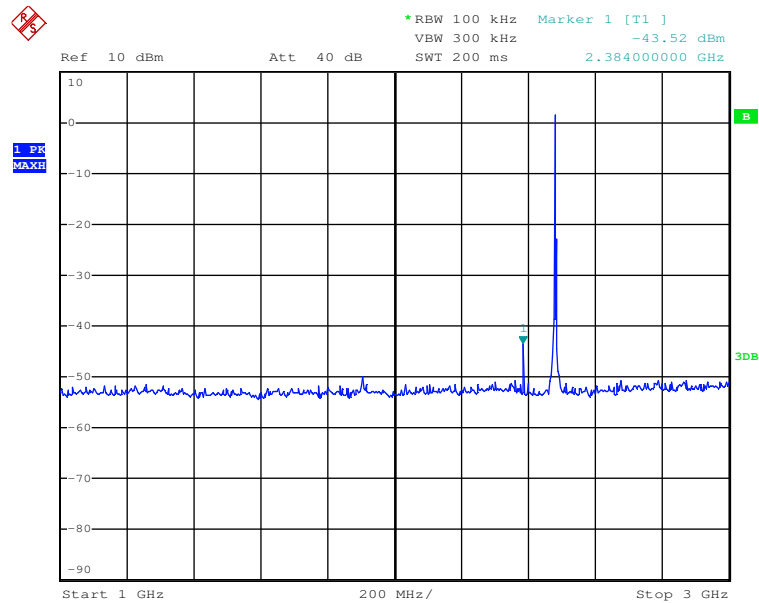


Date: 23.OCT.2017 15:23:05

Prüfbericht - Nr.: 50104295 001
Test Report No.

Seite 21 von 43
Page 21 of 43

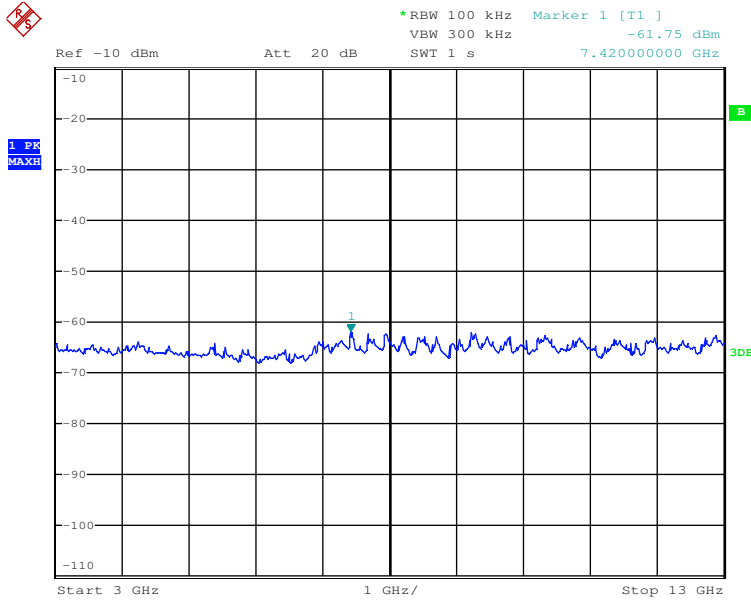

Date: 23.OCT.2017 15:25:42

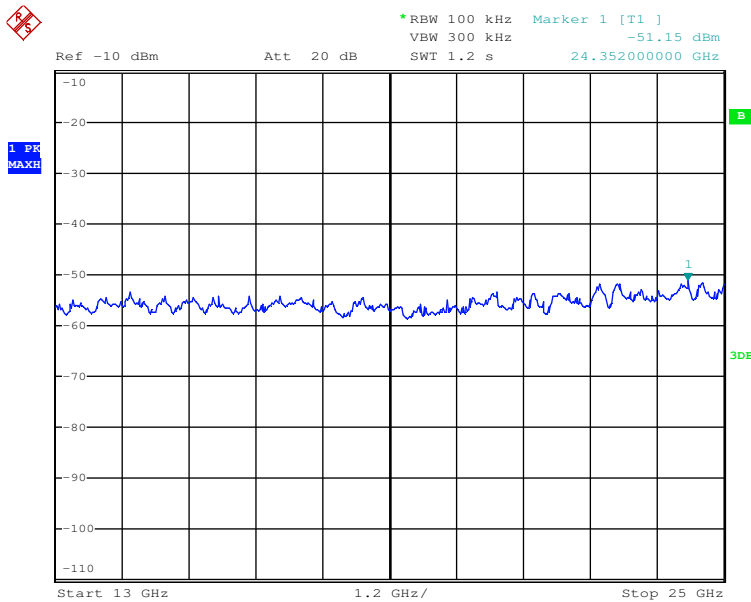


Date: 23.OCT.2017 15:28:37

Prüfbericht - Nr.:
Test Report No.


50104295 001

Seite 22 von 43
Page 22 of 43

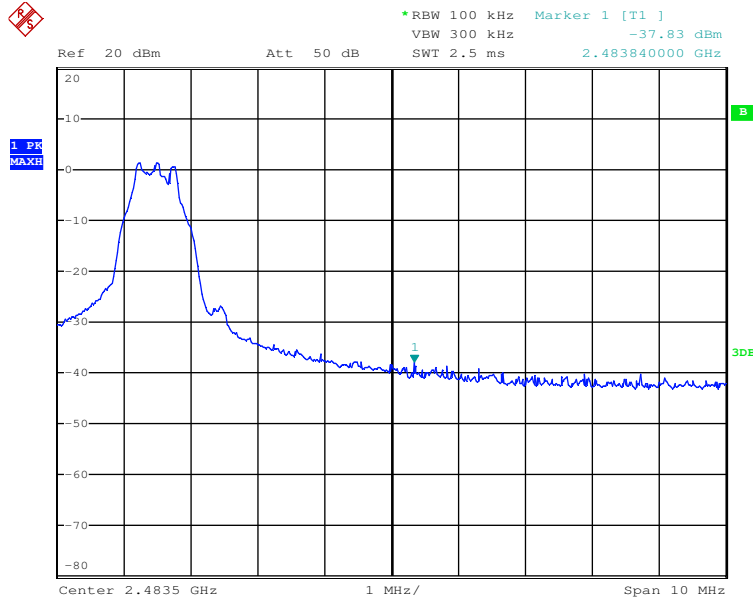

Date: 23.OCT.2017 15:37:12

TX frequency: 2412MHz (802.11b)

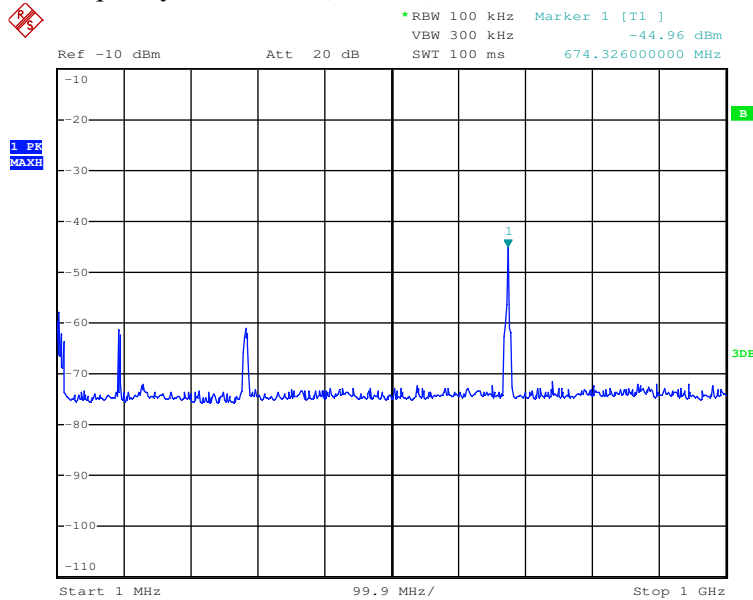


Date: 24.OCT.2017 16:20:21


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 23 von 43
Page 23 of 43

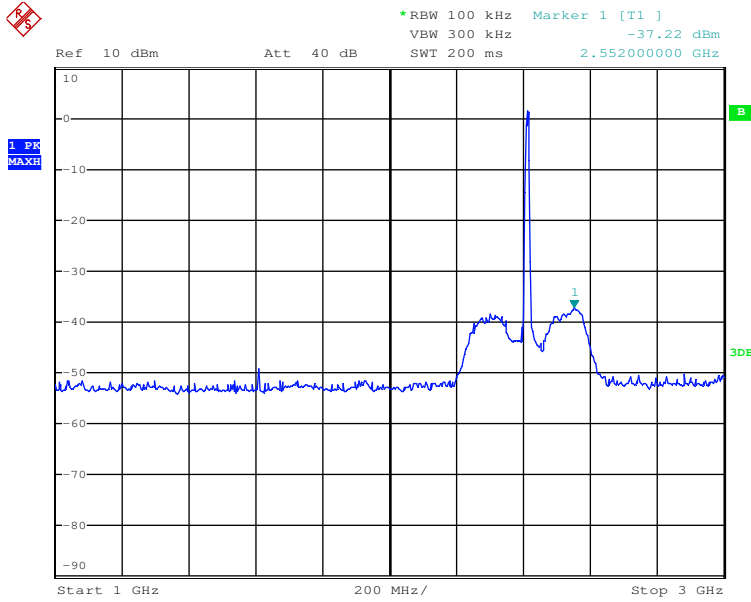

Date: 24.OCT.2017 16:19:41

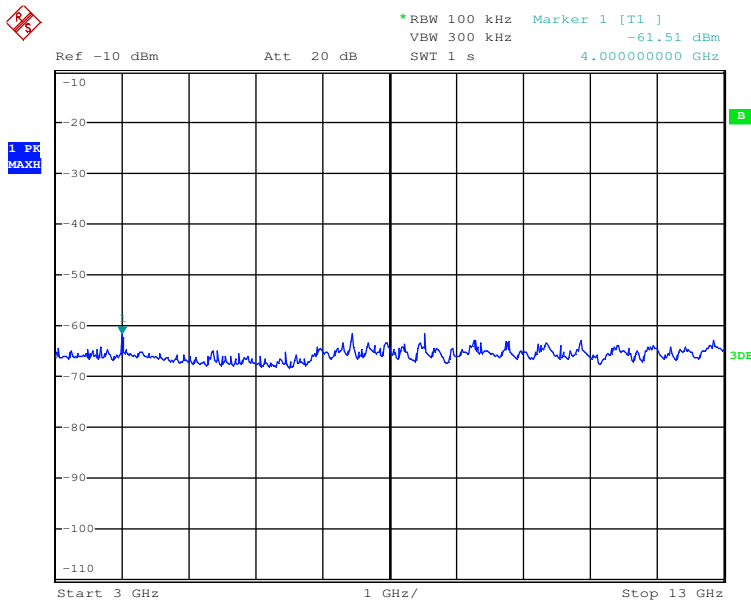


Date: 24.OCT.2017 16:17:58


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 24 von 43
Page 24 of 43

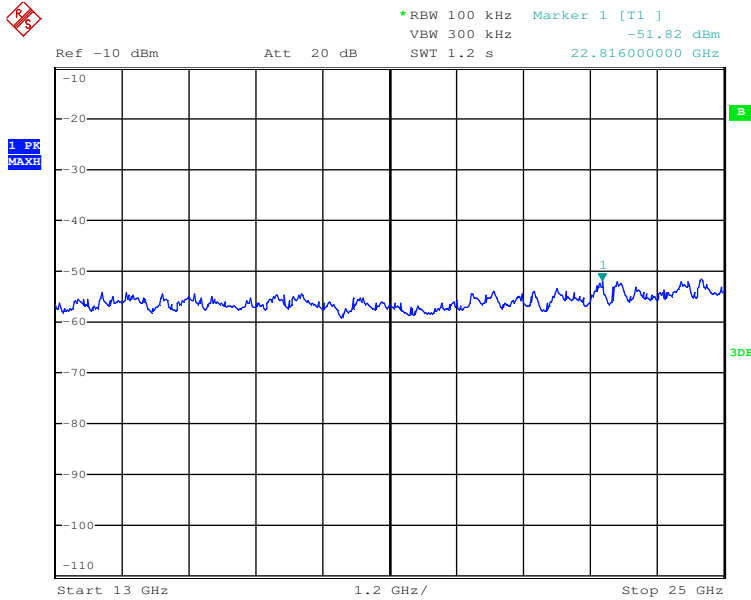

Date: 24.OCT.2017 16:16:34

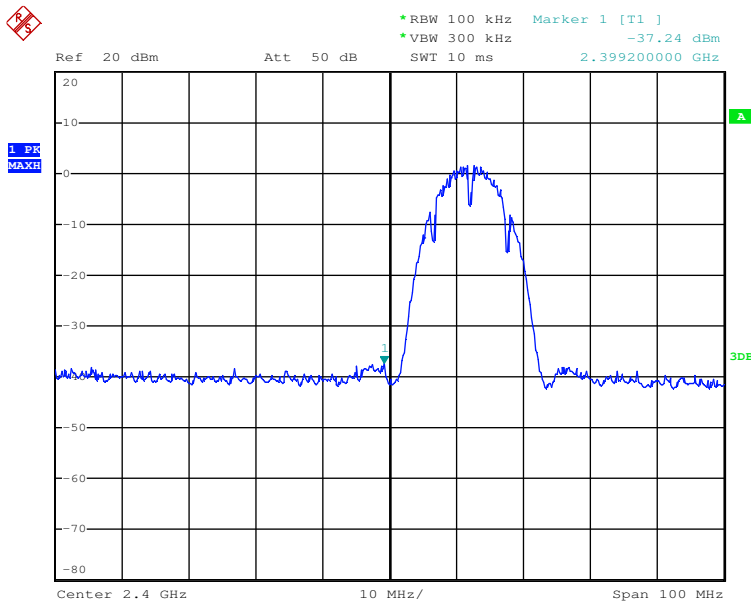


Date: 24.OCT.2017 16:14:55

Prüfbericht - Nr.: 50104295 001
Test Report No.

Seite 25 von 43
Page 25 of 43

TX frequency: 2437MHz (802.11b)

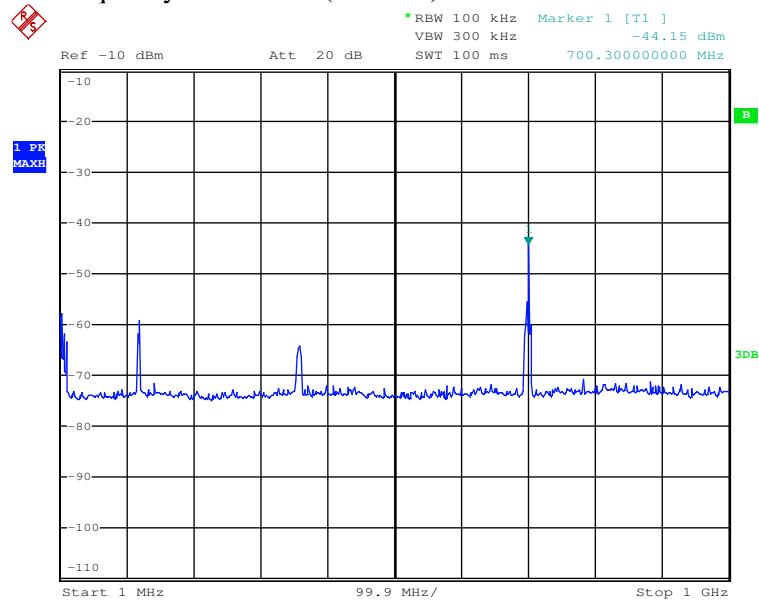


Date: 24.OCT.2017 16:22:26


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 26 von 43
Page 26 of 43

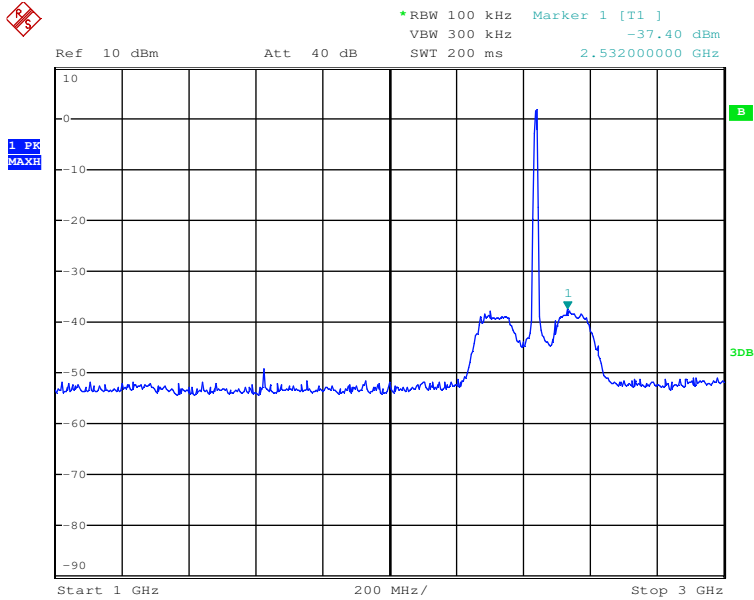

Date: 24.OCT.2017 16:23:24

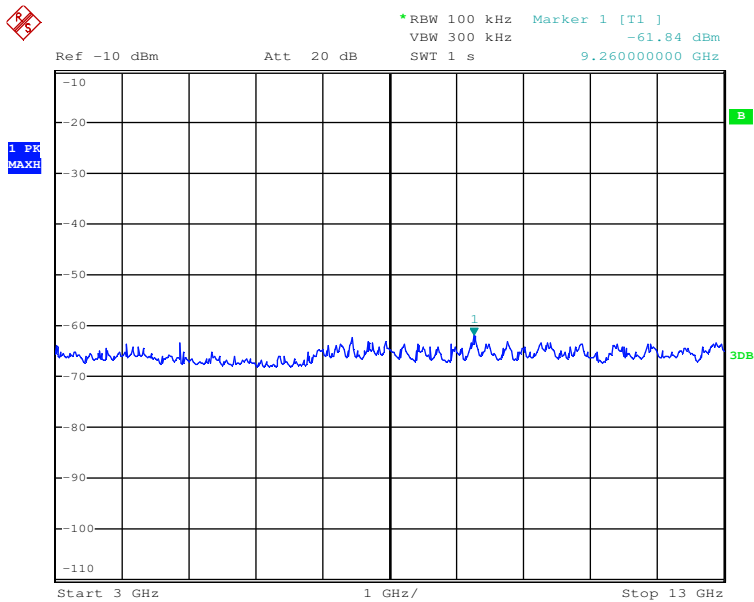


Date: 24.OCT.2017 16:27:33

Prüfbericht - Nr.:
Test Report No.


50104295 001

Seite 27 von 43
Page 27 of 43

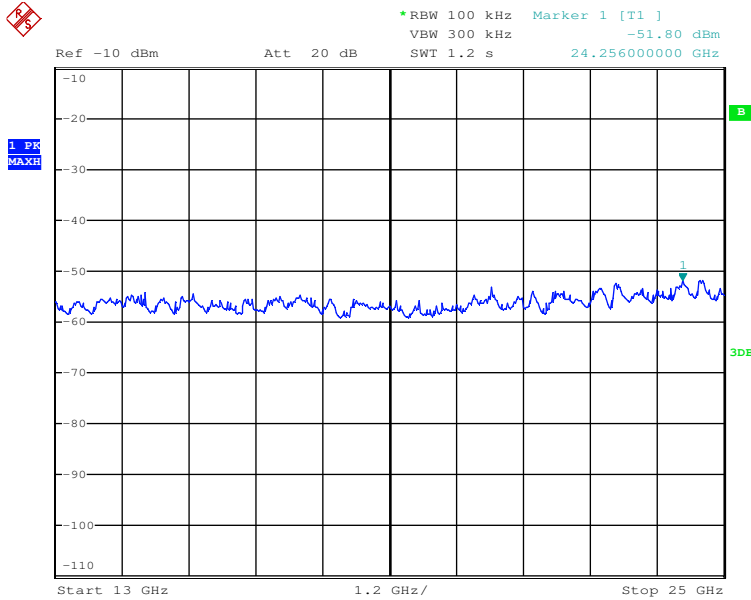

Date: 24.OCT.2017 16:26:26

TX frequency: 2462MHz (802.11b)

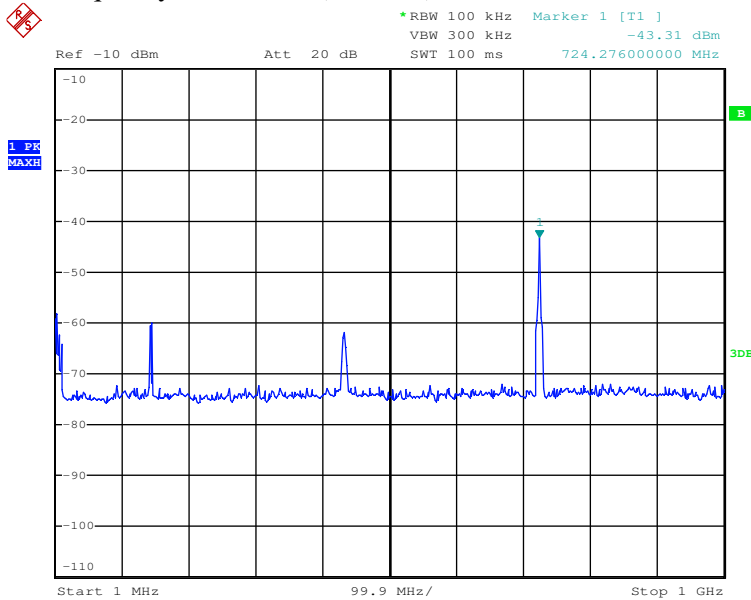


Date: 24.OCT.2017 16:07:15


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 28 von 43
Page 28 of 43

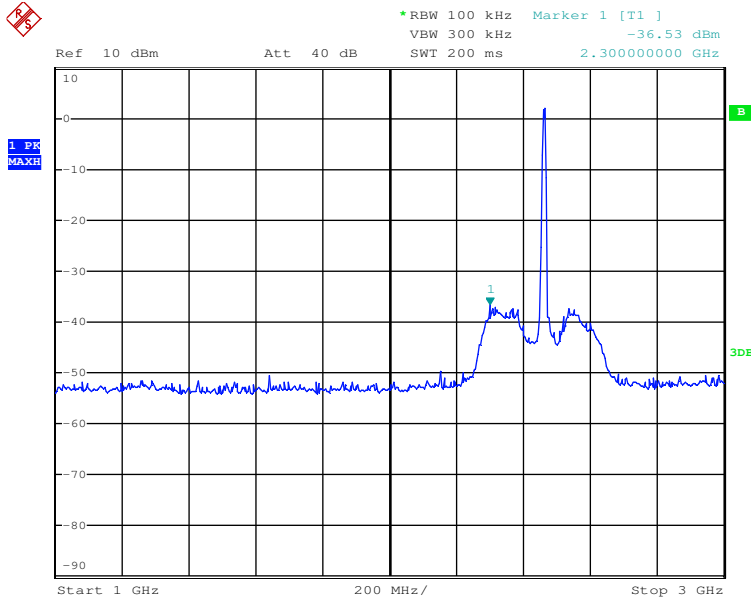

Date: 24.OCT.2017 16:08:42

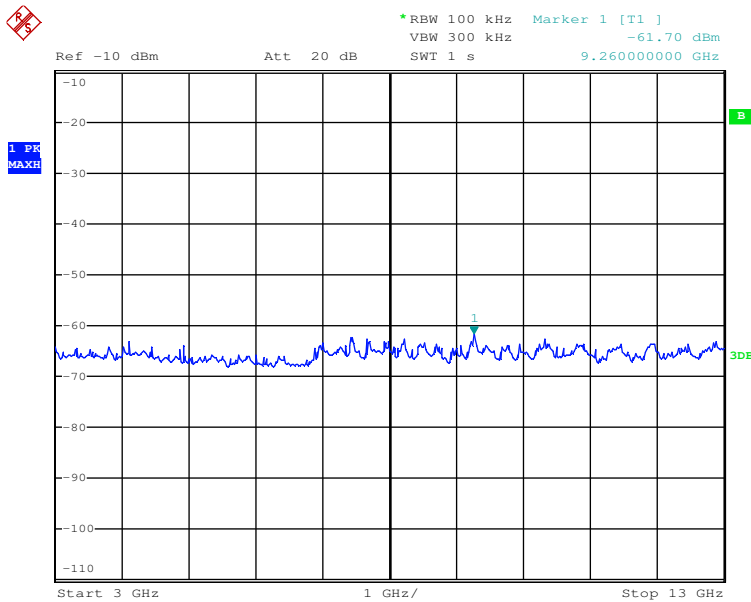


Date: 24.OCT.2017 16:10:01


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 29 von 43
Page 29 of 43

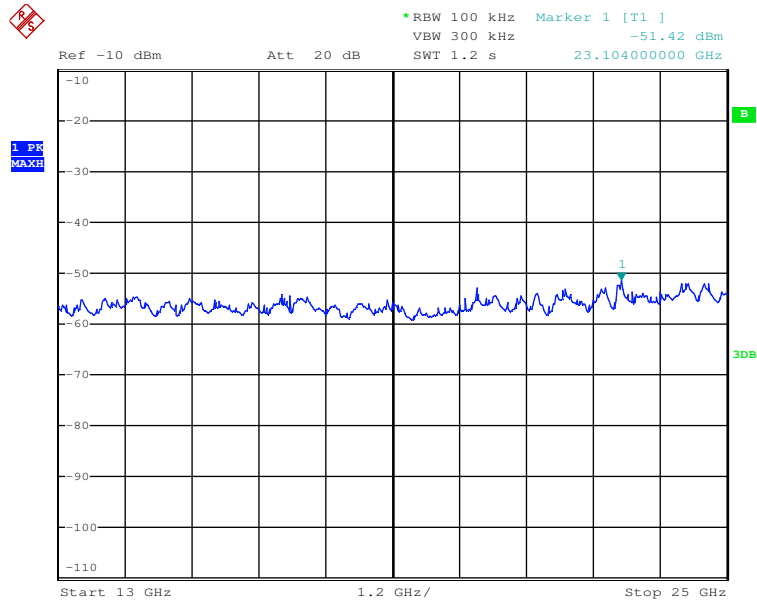

Date: 24.OCT.2017 16:10:59

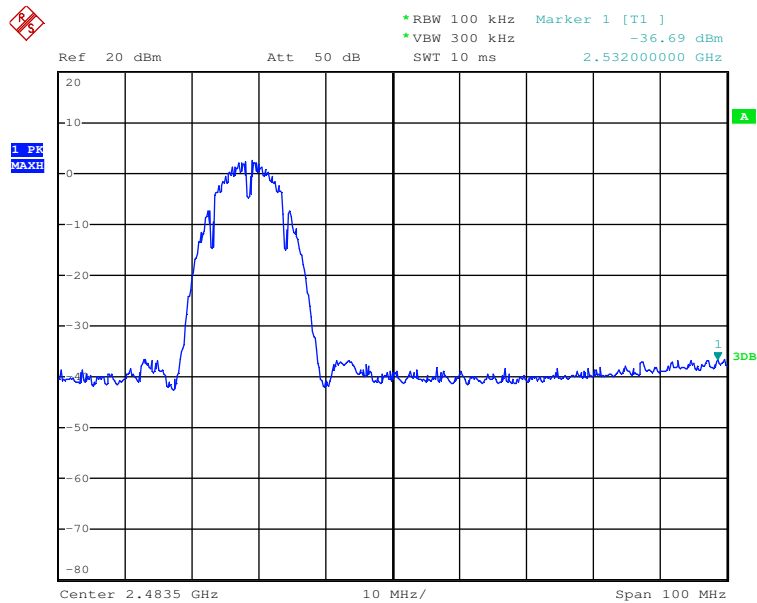


Date: 24.OCT.2017 17:44:37

Prüfbericht - Nr.:
Test Report No.


50104295 001

Seite 30 von 43
Page 30 of 43

TX frequency: 2412MHz (802.11g)

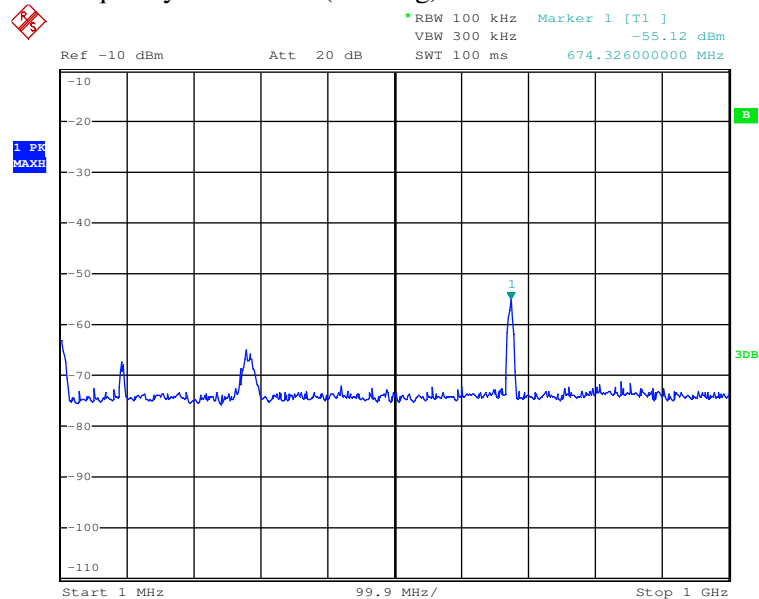


Date: 24.OCT.2017 16:29:22

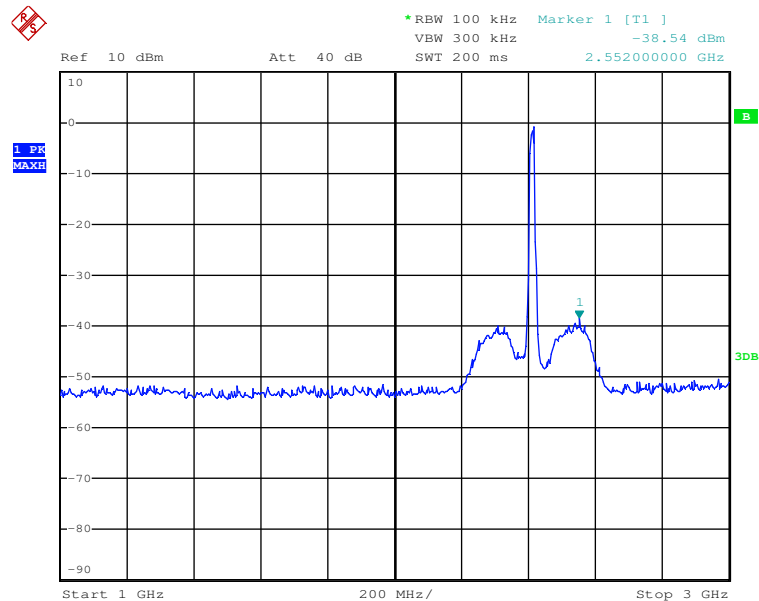


Date: 24.OCT.2017 16:31:02

Prüfbericht - Nr.: 50104295 001
Test Report No.

Seite 31 von 43
Page 31 of 43

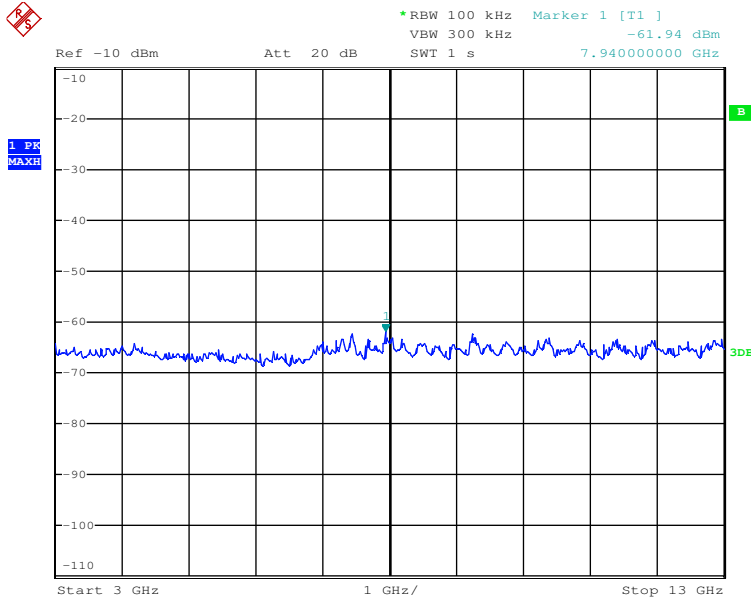

Date: 24.OCT.2017 16:32:00

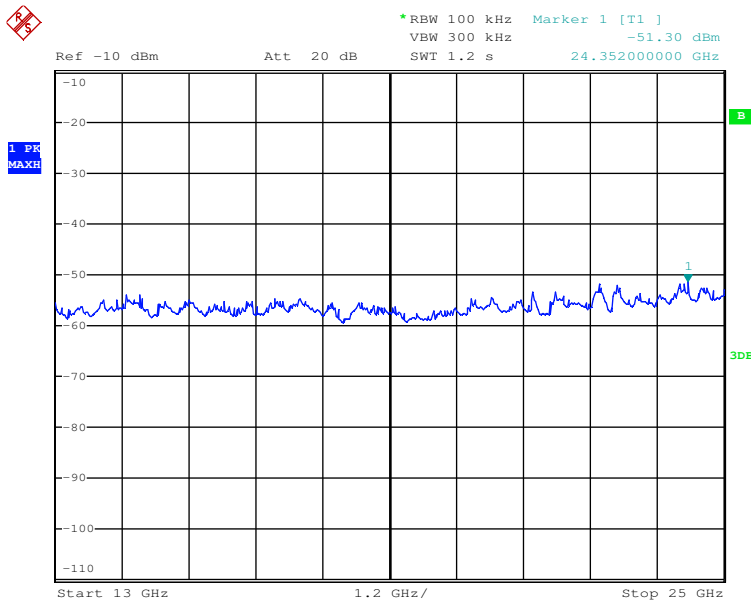

Date: 24.OCT.2017 16:32:52


Prüfbericht - Nr.:

50104295 001

Seite 32 von 43


Test Report No.

Page 32 of 43

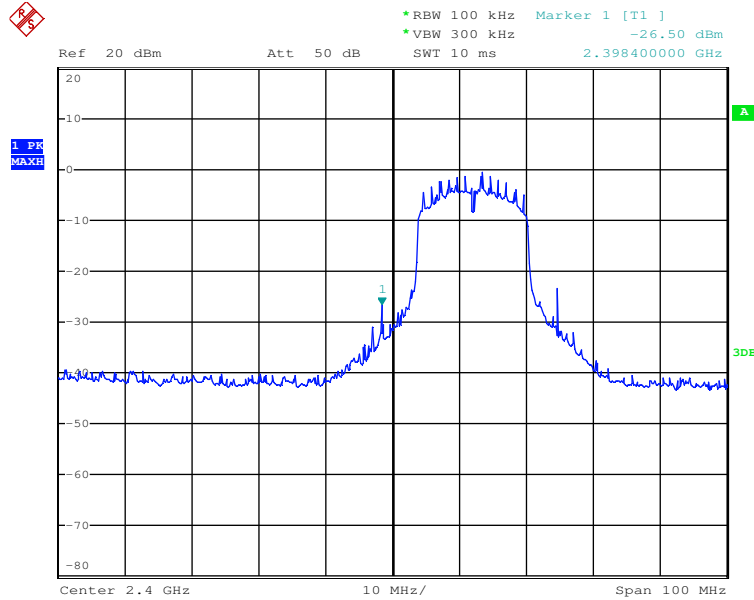

Date: 24.OCT.2017 16:34:34

TX frequency: 2437MHz (802.11g)

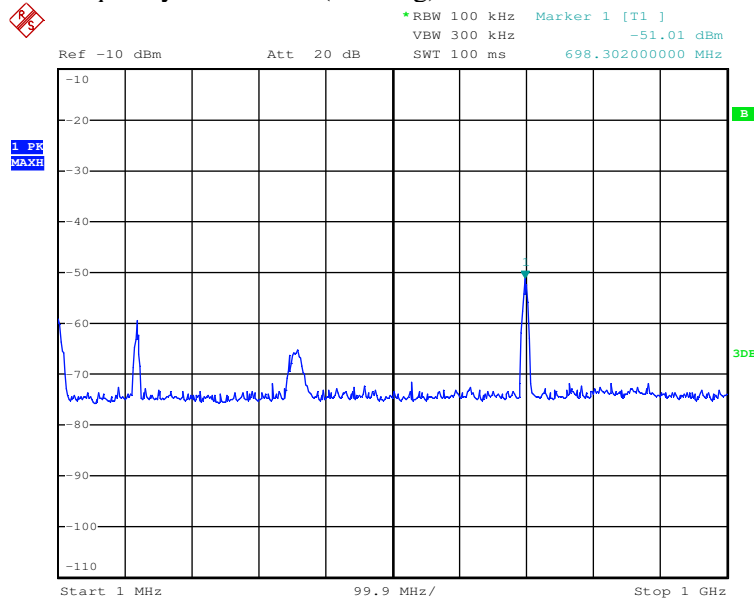


Date: 24.OCT.2017 16:44:00


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 33 von 43
Page 33 of 43

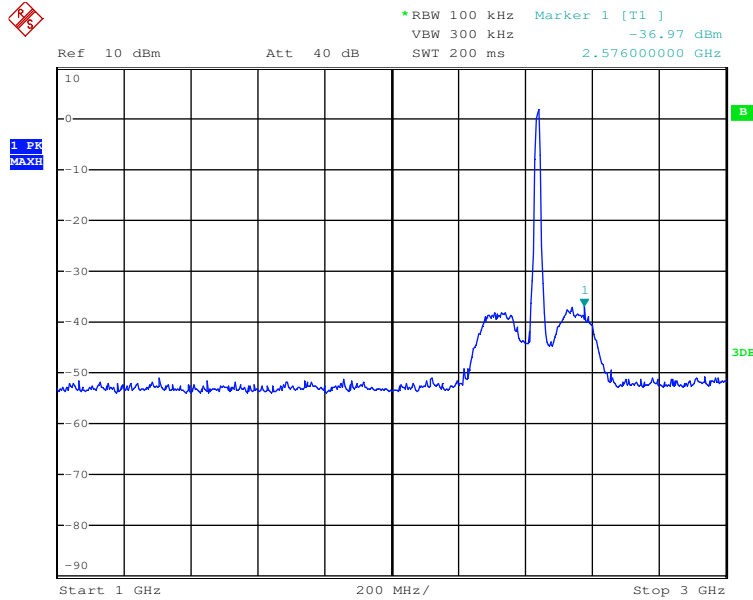

Date: 24.OCT.2017 16:43:15

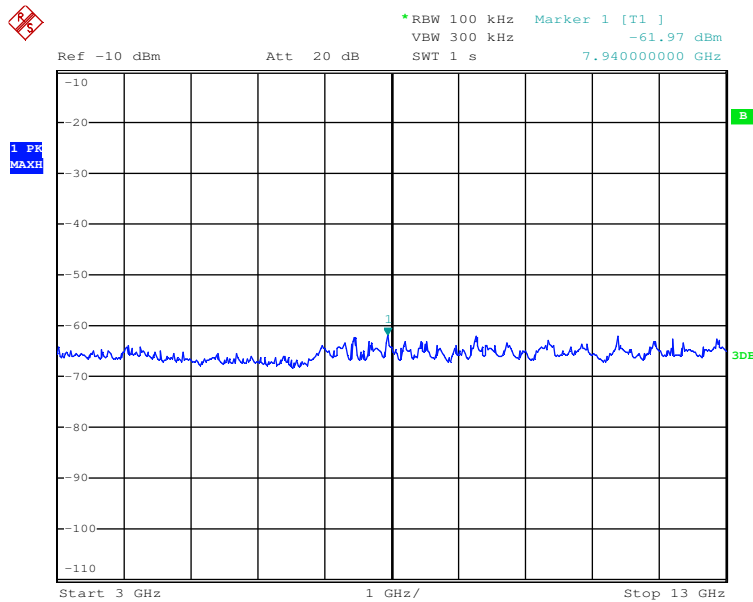

Date: 24.OCT.2017 16:41:43


Prüfbericht - Nr.:

50104295 001

Seite 34 von 43


Test Report No.

Page 34 of 43

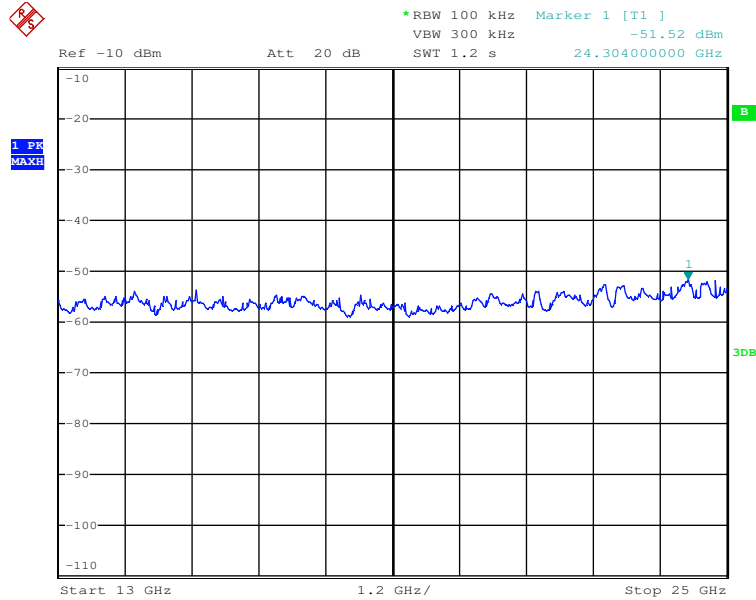

Date: 24.OCT.2017 16:40:14

TX frequency: 2462MHz (802.11g)

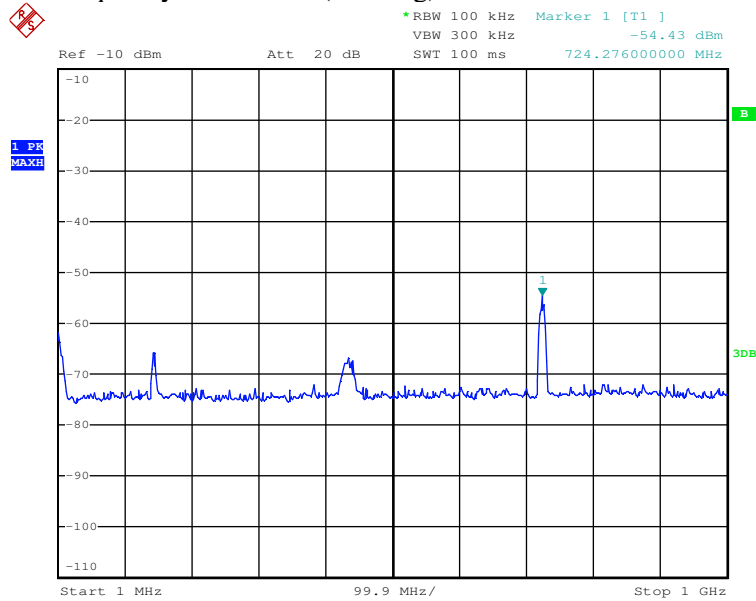


Date: 24.OCT.2017 16:45:05


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 35 von 43
Page 35 of 43

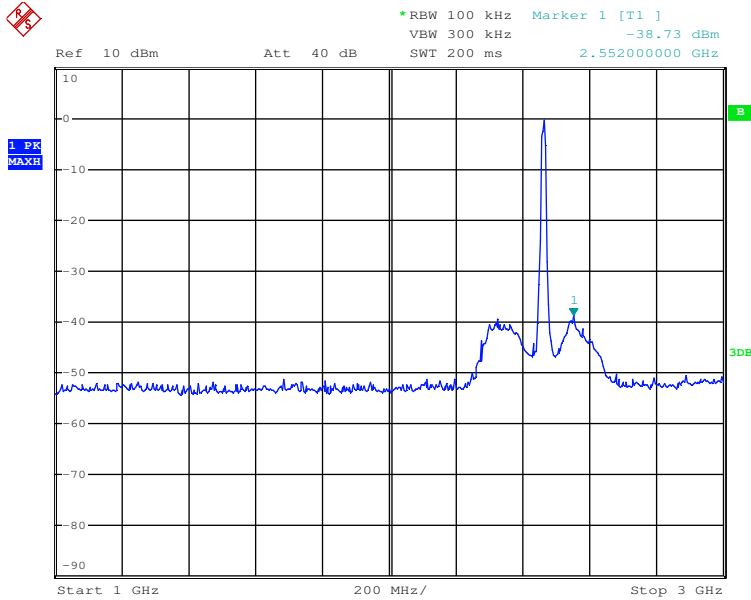

Date: 24.OCT.2017 16:46:32

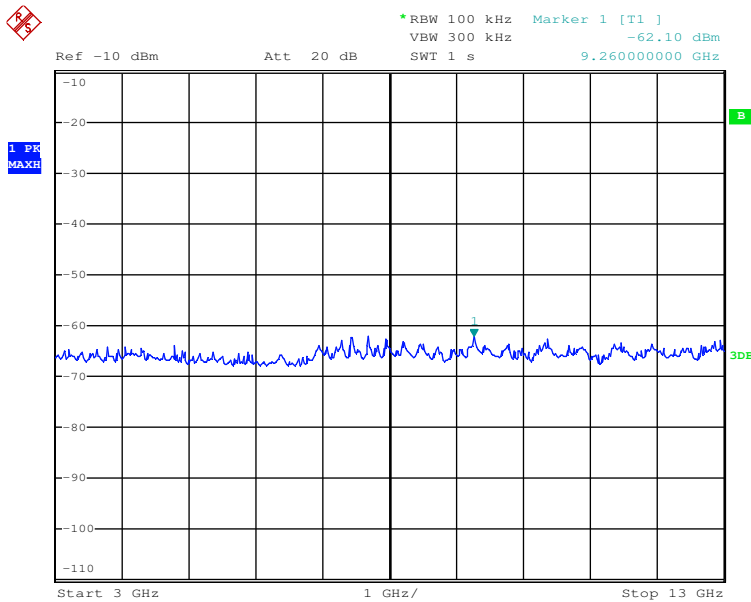

Date: 24.OCT.2017 16:47:48


Prüfbericht - Nr.:

50104295 001


Seite 36 von 43

Test Report No.

Page 36 of 43

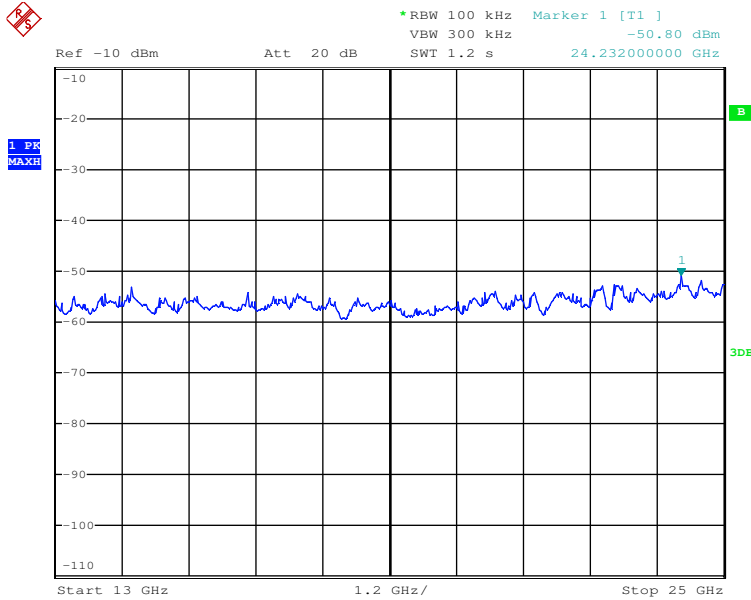

Date: 24.OCT.2017 16:48:50

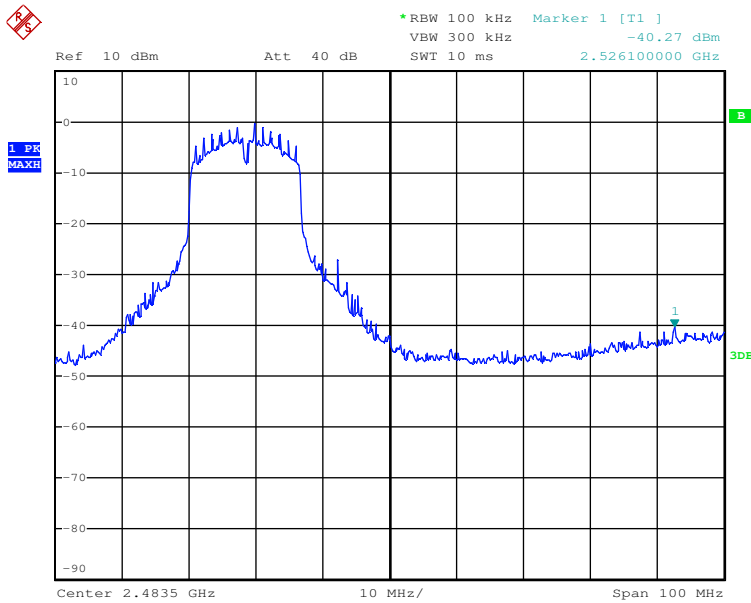


Date: 24.OCT.2017 16:50:54


Prüfbericht - Nr.: 50104295 001
Test Report No.

Seite 37 von 43
Page 37 of 43

TX frequency: 2412MHz (802.11n)

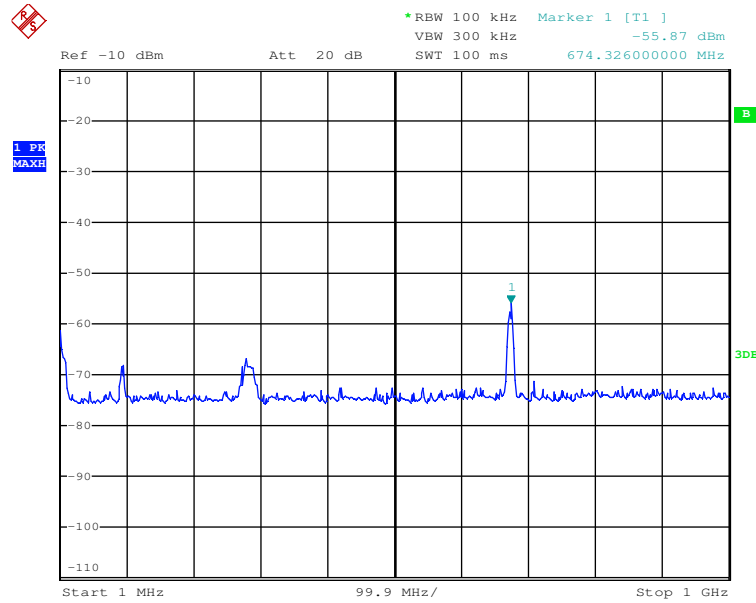

Date: 24.OCT.2017 17:36:35

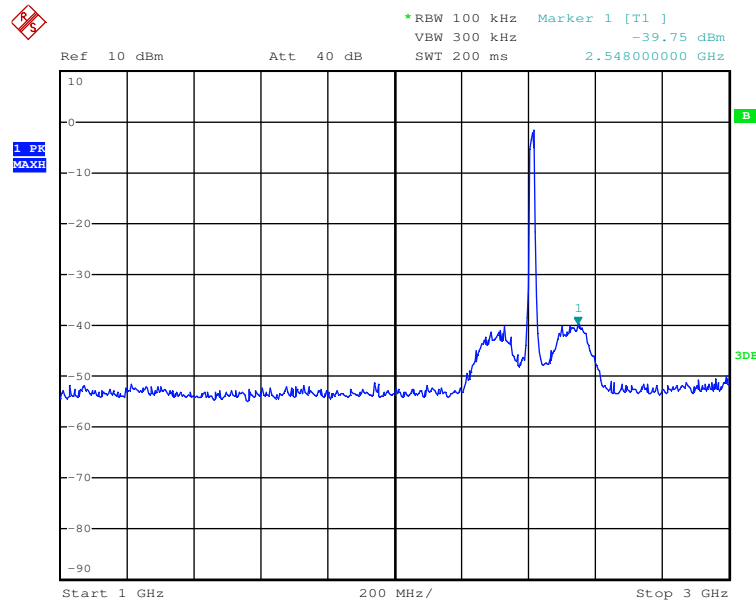

Date: 24.OCT.2017 17:37:30


Prüfbericht - Nr.:

50104295 001


Seite 38 von 43

Test Report No.

Page 38 of 43

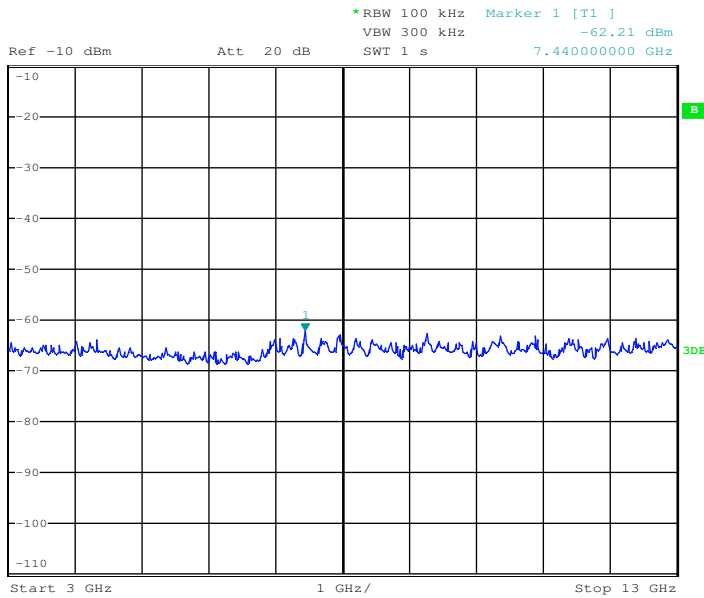

Date: 24.OCT.2017 17:38:29

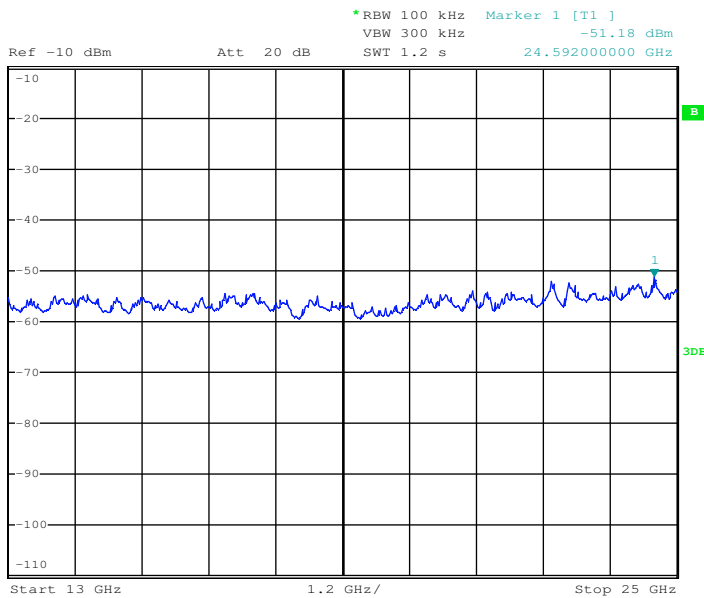

Date: 24.OCT.2017 17:39:22


Prüfbericht - Nr.:

50104295 001

Seite 39 von 43


Test Report No.

Page 39 of 43

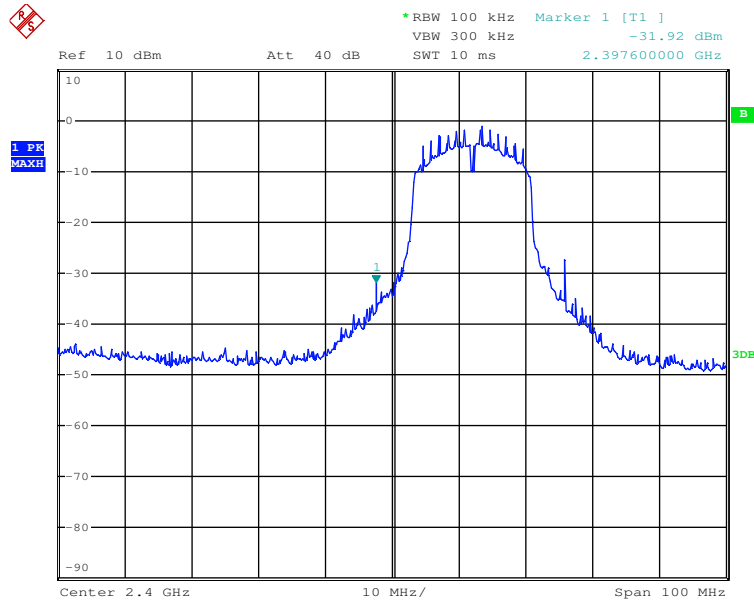

Date: 24.OCT.2017 16:53:45

TX frequency: 2437MHz (802.11n)

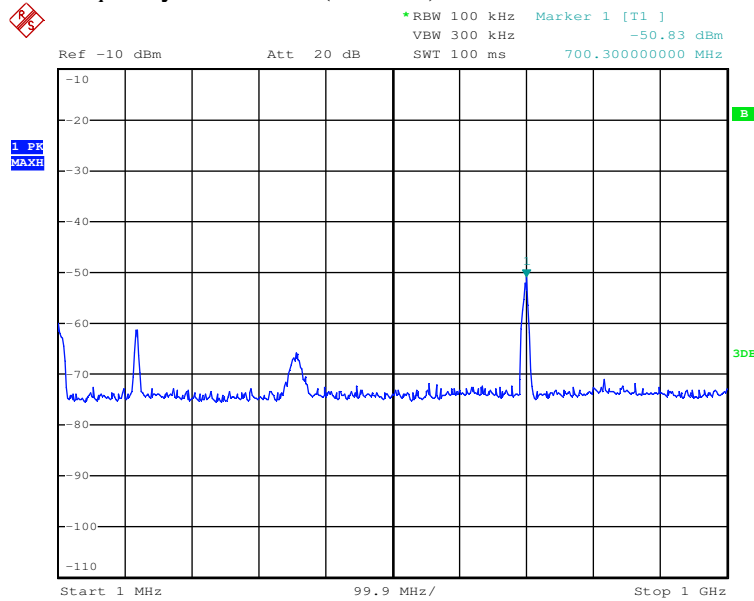


Date: 24.OCT.2017 17:35:53


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 40 von 43
Page 40 of 43

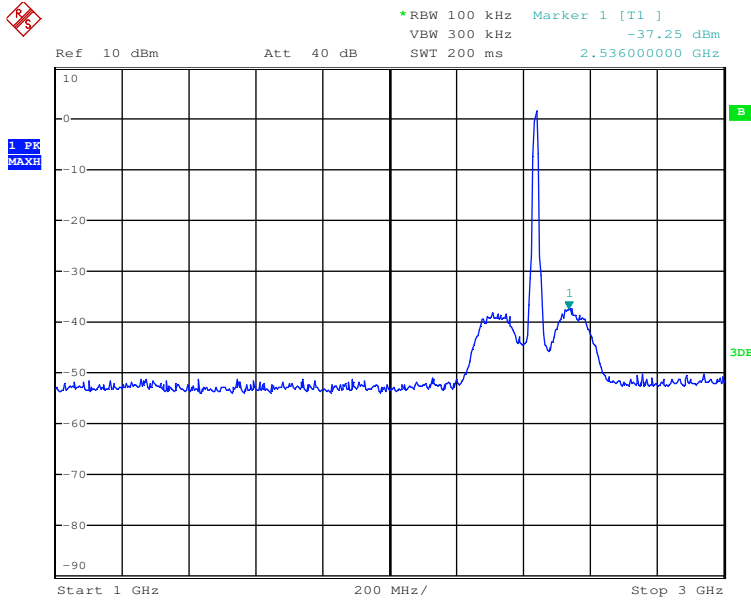

Date: 24.OCT.2017 17:34:53

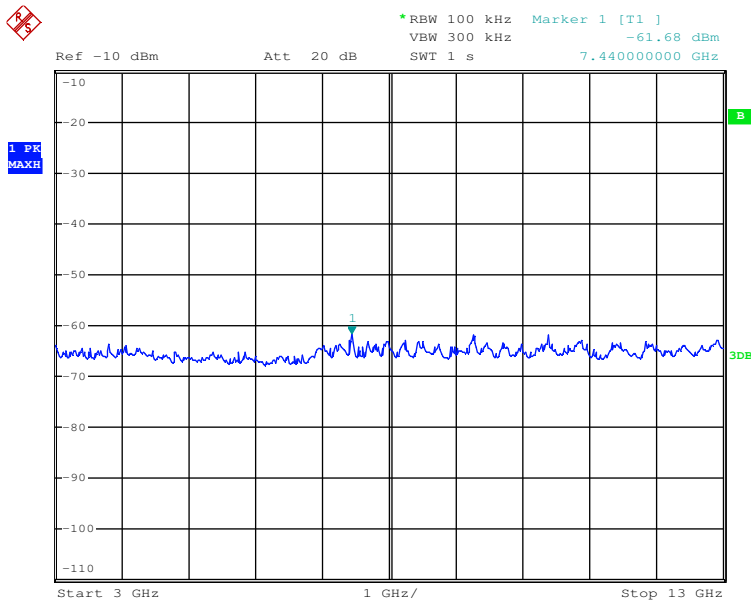

Date: 24.OCT.2017 17:30:41


Prüfbericht - Nr.:

50104295 001

Seite 41 von 43


Test Report No.

Page 41 of 43

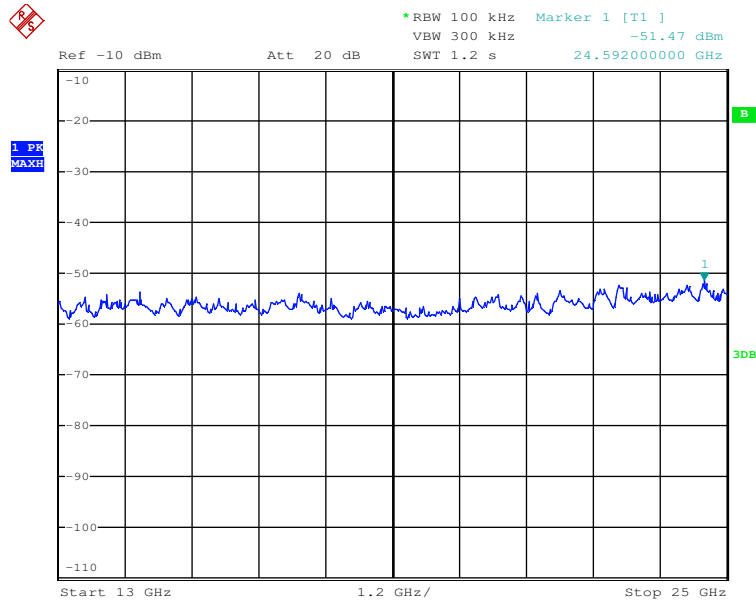

Date: 24.OCT.2017 17:28:09

TX frequency: 2462MHz (802.11n)

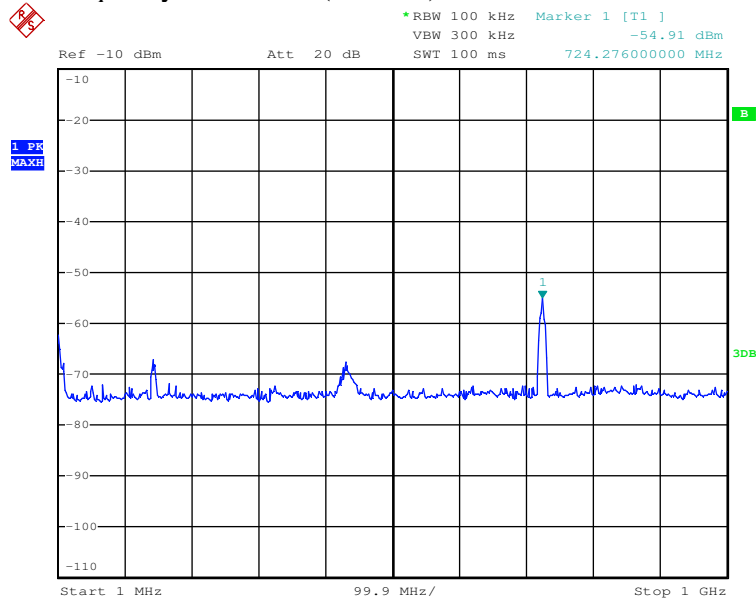


Date: 24.OCT.2017 17:12:11


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 42 von 43
Page 42 of 43

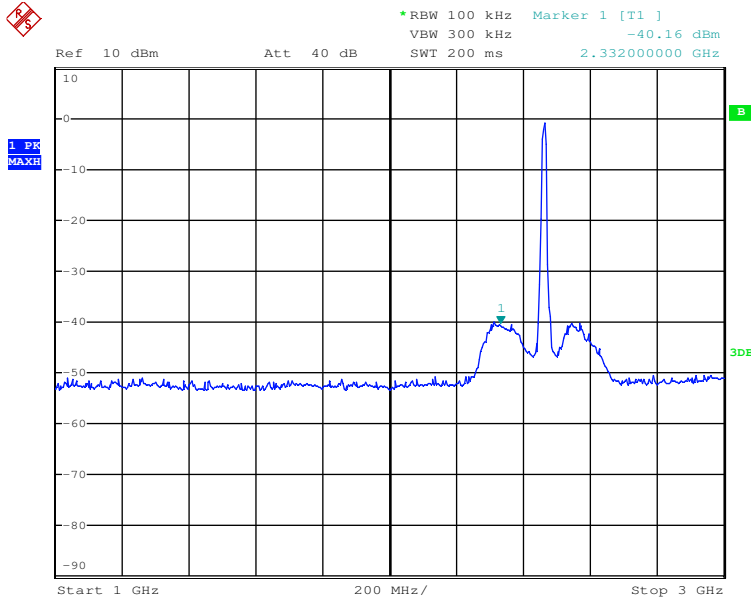

Date: 24.OCT.2017 17:11:02

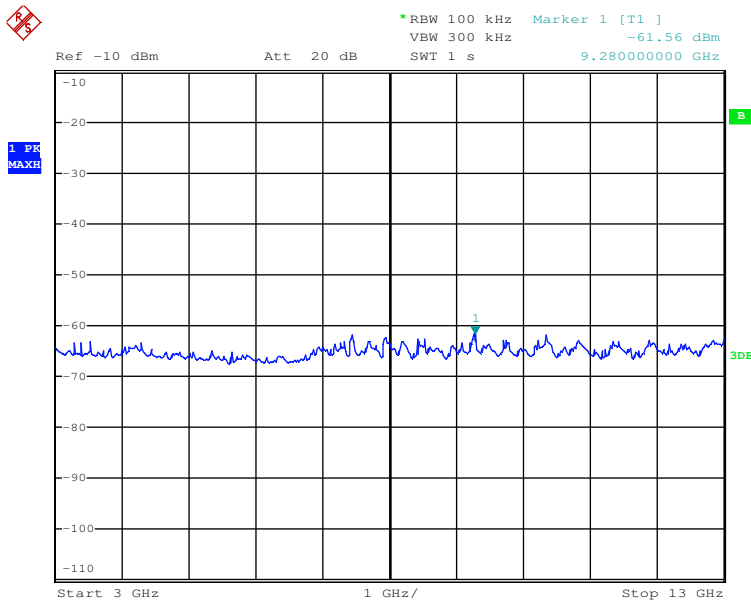


Date: 24.OCT.2017 17:15:34


Prüfbericht - Nr.:
Test Report No.

50104295 001

Seite 43 von 43
Page 43 of 43

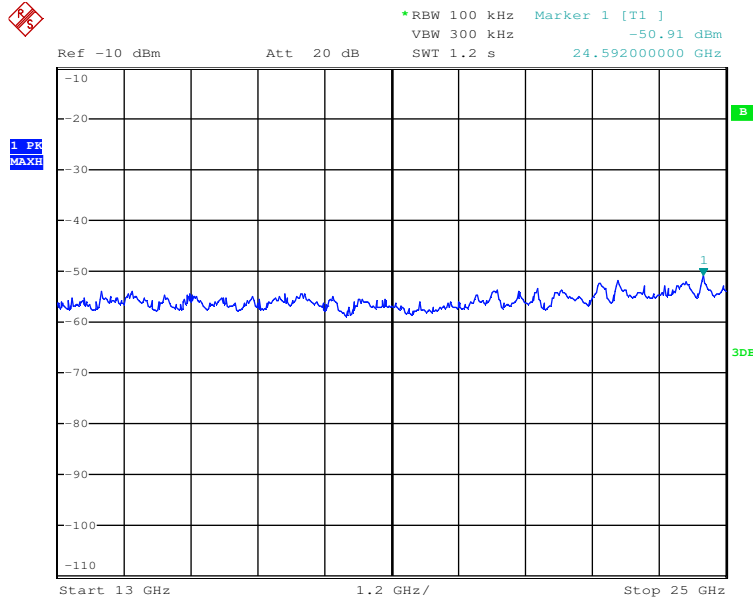

Date: 24.OCT.2017 17:42:33

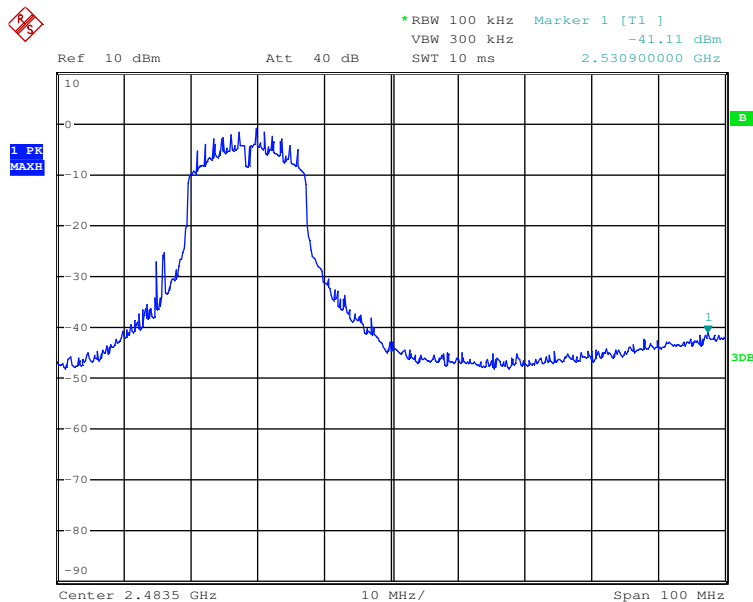

Date: 24.OCT.2017 16:52:01