FCC/IC RF Test Report

APPLICANT : NetComm Wireless Limited

EQUIPMENT : 4G WiFi M2M Router
BRAND NAME : NetComm Wireless

MODEL NAME : NTC-140W-01

MARKETING NAME : 4G WiFi M2M Router

FCC ID : XIA-NTC140W

STANDARD : FCC 47 CFR Part 2, and 90(S)
CLASSIFICATION : PCS Licensed Transmitter (PCB)

The product was received on Apr. 11, 2014 and testing was completed on Jul. 24, 2014. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the procedures given in ANSI / TIA / EIA-603-C-2004 and shown compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 1 of 30 Report Issued Date : Oct. 07, 2014

Report Version

1190

: Rev. 01

Report No.: FW441109

TABLE OF CONTENTS

RE	EVISIO	N HISTORY	3
ÇI	I N A N A A I	RY OF TEST RESULT	4
30			
1	GEN	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Feature of Equipment Under Test	5
	1.4	Product Specification of Equipment Under Test	
	1.5	Modification of EUT	5
	1.6	Maximum Conducted Power, Frequency Tolerance, and Emission Designator	6
	1.7	Testing Site	
	1.8	Applied Standards	7
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	8
	2.1	Test Mode	8
	2.2	Connection Diagram of Test System	
	2.3	Support Unit used in test configuration	9
	2.4	Measurement Results Explanation Example	9
3	TEST	「RESULT	10
	3.1	Conducted Output Power Measurement	10
	3.2	Bandwidth Limitations Measurement	
	3.3	Emissions Mask Measurement	16
	3.4	Emissions Mask – Out Of Band Emissions Measurement	19
	3.5	Field Strength of Spurious Radiation Measurement	22
	3.6	Frequency Stability Measurement	27
4	LIST	OF MEASURING EQUIPMENT	29
5	UNC	ERTAINTY OF EVALUATION	30

APPENDIX A. SETUP PHOTOGRAPHS

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 2 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FW441109	Rev. 01	Initial issue of report	Oct. 07, 2014

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 3 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

SUMMARY OF TEST RESULT

Report Section	FCC Rule	Description	Limit	Result	Remark
3.1	3.1 §2.1046 §90.635 Conducted Output Power 3.2 §2.1049 §90.209 Bandwidth limitations 3.3 §2.1051 §90.691 Emission masks – In-band emissions 3.4 §2.1051 §90.691 Emission masks – Out of band emissions 3.5 §2.1053 §90.691 Field Strength of Spurious Radiation		< 100 Watts	PASS	-
3.2			N/A (Reporting only)	PASS	-
3.3			< 50+10log ₁₀ (P[Watts])	PASS	-
3.4			< 43+10log ₁₀ (P[Watts])	PASS	-
3.5			< 43+10log ₁₀ (P[Watts])	PASS	Under limit 16.96 dB at 1648.000 MHz
3.6	§2.1055 §90.213	Frequency Stability for Temperature & Voltage	< 2.5 ppm	PASS	-

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 4 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

1 General Description

1.1 Applicant

NetComm Wireless Limited

Level 2, 18-20 Orion Road Lane Cove NSW Australia

1.2 Manufacturer

NetComm Wireless Limited

Level 2, 18-20 Orion Road Lane Cove NSW Australia

1.3 Feature of Equipment Under Test

Product Feature & Specification				
Equipment 4G WiFi M2M Router				
Brand Name	NetComm Wireless			
Model Name	NTC-140W-01			
Marketing Name	4G WiFi M2M Router			
FCC ID	XIA-NTC140W			
EUT supports Radios application	GSM/EGPRS/WCDMA/HSPA/LTE			
EOT Supports Radios application	WLAN 11b/g/n HT20/HT40			
HW Version	V1.0			
SW Version	v2.0.5.0			
EUT Stage	Identical Prototype			

Remark: The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

1.4 Product Specification of Equipment Under Test

Product Specification subjective to this standard					
Tx Frequency	817.9 MHz ~ 822.9 MHz				
Rx Frequency	862.9 MHz ~ 867.9 MHz				
Maximum Output Power to Antenna	23.72 dBm				
Antenna Type	Dipole Antenna				
Type of Modulation	CDMA2000 : QPSK				
	CDMA2000 1xEV-DO : QPSK/8PSK				

Remark: This test report recorded only product characteristics and test results of PCS Licensed Transmitter (PCB).

1.5 Modification of EUT

No modifications are made to the EUT during all test items.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 5 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Oct. 07, 2014

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

FCC ID: XIA-NTC140W

Report Template No.: BU5-FWCDMA Version 1.0

Report No.: FW441109

1.6 Maximum Conducted Power, Frequency Tolerance, and Emission Designator

FCC Rule	System	Type of Modulation	Maximum Conducted Power (W)	Frequency Tolerance (ppm)	Emission Designator
Part 90(S)	CDMA2000 BC10 1xEV-DO Rev. A	QPSK	0.24	0.02 ppm	1M28F9W

1.7 Testing Site

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1022 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC Test.

Test Site	SPORTON INTERNATIONAL INC.				
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park,				
Took Cita Lagation	Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C.				
Test Site Location	TEL: +886-3-327-3456				
	FAX: +886-3-328-4978				
Took Site No.	Sporton Site No.				
Test Site No.	TH02-HY	03CH07-HY			

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 6 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

1.8 Applied Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC 47 CFR Part 2, 90
- ANSI / TIA / EIA-603-C-2004
- FCC KDB 971168 D01 Power Meas. License Digital Systems v02r01

Remark:

- 1. All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 7 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

2 Test Configuration of Equipment Under Test

2.1 Test Mode

Antenna port conducted and radiated test items were performed according to KDB 971168 D01 Power Meas. License Digital Systems v02r01 with maximum output power.

Radiated measurements were performed with rotating EUT in different three orthogonal test planes to find the maximum emission.

Frequency range investigated for radiated emission is 30 MHz to 9000 MHz for CDMA2000 BC10.

Test Modes					
Band	Radiated TCs	Conducted TCs			
CDMA2000 BC10	■ 1xEV-DO Rev. A Link	■ 1xEV-DO Rev. A Link			

Note: The maximum power levels are 1xRTT RC3 SO55 mode for CDMA2000 BC10; only these modes were used for all tests.

The conducted power table is as follows:

Conducted Power (*Unit: dBm)					
Band		CDMA2000 BC10			
Channel	476	476 580 676			
Frequency	817.90	820.50	822.90		
1xRTT RC1 SO55	23.58	23.55	23.69		
1xRTT RC3 SO55	23.54	23.61	23.66		
1xRTT RC3 SO32 (+ F-SCH)	23.60	23.52	23.67		
1xRTT RC3 SO32 (+SCH)	23.52	23.59	23.70		
1xEV-DO RTAP 153.6kbps	23.59	23.69	23.67		
1xEV-DO RETAP 4096Bits	23.60	23.62	<mark>23.72</mark>		

 SPORTON INTERNATIONAL INC.
 Page Number
 : 8 of 30

 TEL: 886-3-327-3456
 Report Issued Date
 : Oct. 07, 2014


 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

FAX: 886-3-328-4978 FCC ID: XIA-NTC140W

Report Template No.: BU5-FWCDMA Version 1.0

Report No. : FW441109

2.2 Connection Diagram of Test System

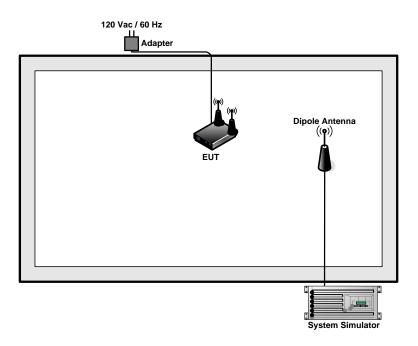

2.3 Support Unit used in test configuration

ltem	Equipment	Trade Name	Model No.	FCC ID	Data Cable	Power Cord
1.	System Simulator	R&S	CMU 200	N/A	N/A	Unshielded, 1.8 m

2.4 Measurement Results Explanation Example

For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between RF conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level will be exactly the RF output level.

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

The following shows an offset computation example with RF cable loss 4.2 dB and a 10dB attenuator.

Example:

 $Offset(dB) = RF \ cable \ loss(dB) + attenuator \ factor(dB).$

= 4.2 + 10 = 14.2 (dB)

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 9 of 30
Report Issued Date : Oct. 07, 2014

Report No. : FW441109

Report Version : Rev. 01

3 Test Result

3.1 Conducted Output Power Measurement

3.1.1 Description of the Conducted Output Power Measurement

A system simulator was used to establish communication with the EUT. Its parameters were set to enforce EUT transmitting at the maximum power. The measured power in the radio frequency on the transmitter output terminals shall be reported.

3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.1.3 Test Procedures

- 1. The transmitter output port was connected to the system simulator.
- 2. Set EUT at maximum power through system simulator.
- 3. Select lowest, middle, and highest channels for each band and different modulation.
- 4. Measure the maximum burst average power for GSM and maximum average power for other modulation signal.

3.1.4 Test Setup



3.1.5 Test Result of Conducted Output Power

CDMA 2000 BC10					
Modes CDMA 2000 1xEV-DO Rev. A					
Test Status	RETAP 4096K				
Channel	476 (Low) 580 (Mid) 676 (High) 817.9 820.5 822.9 23.60 23.62 23.72				
Frequency (MHz)					
Conducted Power (dBm)					

Note: maximum average power for CDMA2000.

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 10 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

3.2 Bandwidth Limitations Measurement

3.2.1 Description of (Occupied) Bandwidth Limitations Measurement

The 99% occupied bandwidth is the width of a frequency band such that, below the lower and above the upper frequency limits, the mean powers emitted are each equal to a specified percentage 0.5% of the total mean transmitted power.

The emission bandwidth is defined as the width of the signal between two points, located at the 2 sides of the carrier frequency, outside of which all emissions are attenuated at least 26 dB below the transmitter power.


3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.2.3 Test Procedures

- 1. The EUT was connected to the spectrum analyzer and system simulator via a power divider.
- The RF output of the EUT was connected to the spectrum analyzer by RF cable and attenuator.
 The path loss was compensated to the results for each measurement.
- 3. The 99% occupied bandwidth were measured, set RBW= 1% of span, VBW≥ 3*RBW, sample detector, trace maximum hold.
- The 26dB bandwidth were measured, set RBW= 1% of EBW, VBW≥ 3*RBW, peak detector, trace maximum hold.

3.2.4 Test Setup

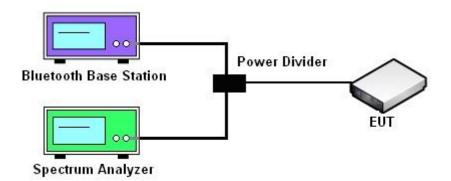

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 11 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

3.2.5 Test Result of Occupied Bandwidth and 26dB Bandwidth

CDMA2000 BC10					
Test Mode	Test Mode CDMA 2000 1xEV-DO Rev. A				
Test Status	RETAP 4096K				
Channel	476 (Low) 580 (Mid) 676 (High) 817.9 820.5 822.9				
Frequency (MHz)					
99% OBW (MHz)	1.28	1.28	1.28		
26dB BW (MHz)	1.42 1.44 1.42				

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 12 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

3.2.6 Test Result (Plots) of Occupied Bandwidth and 26dB Bandwidth


Band: CDMA2000 BC 10 Test Mode: 1xEV-DO Rev. A_RETAP 4096K

99% Occupied Bandwidth Plot on Channel 476 (817.9 MHz)

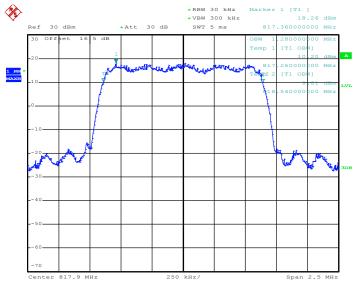

Date: 9.JUN.2014 13:38:25

26dB Bandwidth Plot on Channel 476 (817.9 MHz)

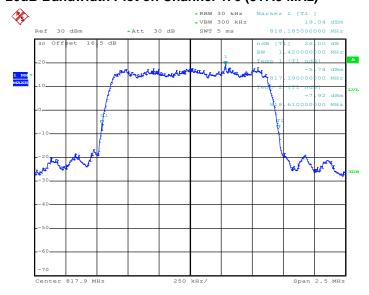


Date: 9.JUN.2014 13:22:12

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 13 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01


Report No. : FW441109

99% Occupied Bandwidth Plot on Channel 580 (820.5 MHz)

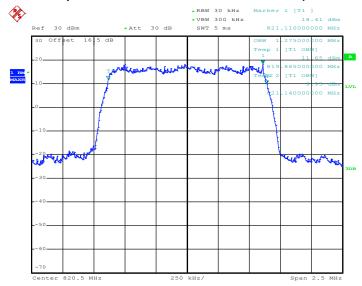

Date: 9.JUN.2014 13:37:27

26dB Bandwidth Plot on Channel 580 (820.5 MHz)

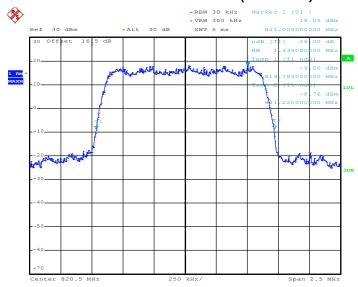


Date: 9.JUN.2014 13:22:58

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 14 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01


Report No.: FW441109

99% Occupied Bandwidth Plot on Channel 684 (823.1 MHz)

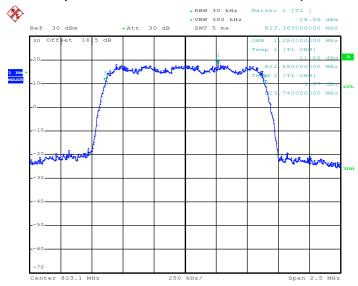

Date: 9.JUN.2014 13:35:37

26dB Bandwidth Plot on Channel 684 (823.1 MHz)

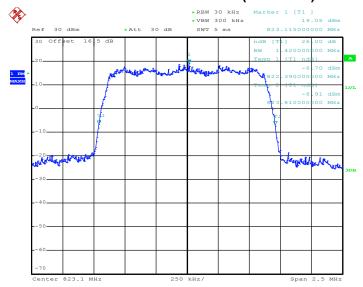

Date: 9.JUN.2014 13:23:28

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 15 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

3.3 Emissions Mask Measurement

3.3.1 Description of Emissions Mask Measurement

Equipment used in this licensed to EA or non-EA systems shall comply with the emission mask provisions of FCC Part 90.691.(a)(1)

- (a). Out-of-band emission requirement shall apply only to the "outer" channels included in an EA license and to spectrum adjacent to interior channels used by incumbent licensees. The emission limits are as follows:
 - (1) For any frequency removed from the EA licensee's frequency block by up to and including 37.5 kHz, the power of any emission shall be attenuated below the transmitter power (P) in watts by at least 116 Log10(f/6.1) decibels or 50 + 10 Log10(P) decibels or 80 decibels, whichever is the lesser attenuation, where f is the frequency removed from the center of the outer channel in the block in kilohertz and where f is greater than 12.5 kHz.


3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.3.3 Test Procedures

- 1. The EUT was connected to spectrum analyzer and system simulator via power divider.
- 2. The emissions mask of low and high channels for the highest RF powers were measured.
- 3. The measured RBW and the VBW set 3 times of RBW are then set in spectrum analyzer, and the RBW correction factor 10log (1% of OBW/measured RBW)(dB) was compensated, if required.
- 4. The test results were shown below plots with a correction offset factor including cable loss, insertion loss of power divider.

3.3.4 Test Setup

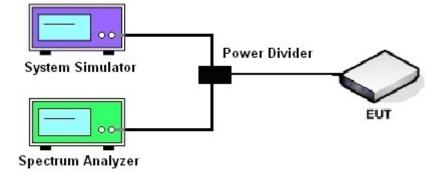


SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 16 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

3.3.5 Test Result (Plots) of Conducted Emissions Mask

Lower Band Edge Plot on Channel 476 (817.9 MHz)

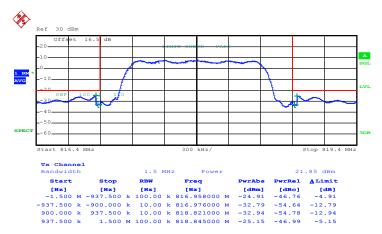

Date: 9.JUN.2014 13:01:56

Remark:

Test Result(dBm) = PwrAbs(dBm) + (1% of OBW/measured RBW) (dB)

= PwrAbs(dBm) +10*LOG(13kHz/10KHz)(dB)

= PwrAbs(dBm) +1.14 (dB)


<1> Test result of 816.976MHz: - 32.79(dBm) + 1.14(dB)= -31.65 (dBm)

<2> Test result of 818.821MHz: - 32.94(dBm) + 1.14(dB)= -31.80 (dBm)

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 17 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

Higher Band Edge Plot on Channel Channel 684 (823.1 MHz)

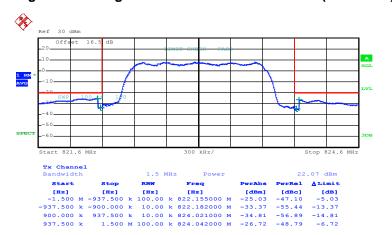

Date: 9.JUN.2014 13:03:38

Remark:

Test Result(dBm) = PwrAbs(dBm) + (1% of OBW/measured RBW) (dB)
= PwrAbs(dBm) +10*LOG(13kHz/10KHz)(dB)
= PwrAbs(dBm) +1.14 (dB)

<1> Test result of 822.182MHz: - 33.37(dBm) + 1.14(dB)= -32.23 (dBm)

<2> Test result of 824.021MHz: - 34.81(dBm) + 1.14(dB)= -33.67 (dBm)

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 18 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

3.4 Emissions Mask - Out Of Band Emissions Measurement

3.4.1 Description of Conducted Spurious Emissions Out of band emissions measurement

The power of any emission FCC Part 90.691 (a)(2) on any frequency removed from the assigned frequency by more than 250 percent of the authorized bandwidth at least 43 + 10 log (P) dB.

It is measured by means of a calibrated spectrum analyzer and scanned from 30 MHz up to a frequency including its 10th harmonic.


3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.4.3 Test Procedures

- 1. The EUT was connected to the spectrum analyzer and system simulator via a power divider.
- The RF output of EUT was connected to the spectrum analyzer by an RF cable and attenuator.
 The path loss was compensated to the results for each measurement.
- 3. The middle channel for the highest RF power within the transmitting frequency was measured.
- 4. The conducted spurious emission for the whole frequency range was taken.
- The RF fundamental frequency should be excluded against the limit line in the operating frequency band.
- 6. The limit line is derived from 43 + 10log(P) dB below the transmitter power P(Watts)
 - = P(W) [43 + 10log(P)] (dB)
 - = [30 + 10log(P)] (dBm) [43 + 10log(P)] (dB)
 - = -13dBm.

3.4.4 Test Setup

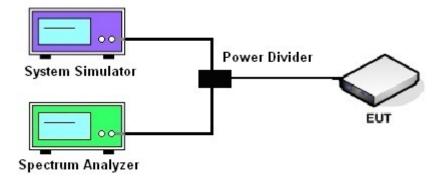

SPORTON INTERNATIOINAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 19 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

3.4.5 Test Result (Plots) of Conducted Spurious Emission


Band: CDMA2000 BC 10 Test Mode: 1xEV-DO Rev. A_RETAP 4096K

Conducted Spurious Emission Plot on Channel 476 (817.9 MHz)

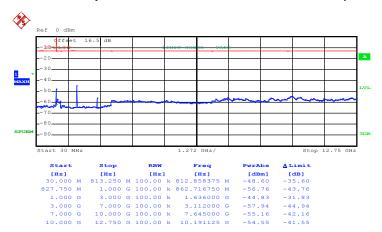

Date: 9.JUN.2014 13:13:21

Conducted Spurious Emission Plot on Channel 580 (820.5 MHz)

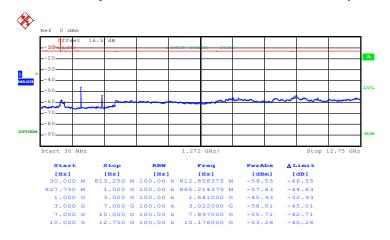


Date: 9.JUN.2014 13:15:09

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 20 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

Conducted Spurious Emission Plot on Channel 684 (823.1 MHz)

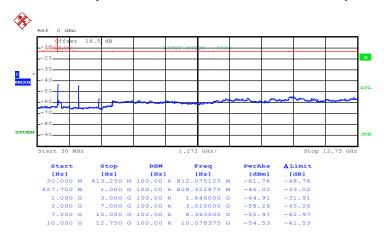

Date: 9.JUN.2014 13:15:44

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 21 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

3.5 Field Strength of Spurious Radiation Measurement

3.5.1 Description of Field Strength of Spurious Radiated Measurement

The radiated spurious emission was measured by substitution method according to ANSI / TIA / EIA-603-C-2004. The power of any emission FCC Part 90.691 on any frequency removed from the assigned frequency by more than 250 percent of the authorized bandwidth at least 43 + 10 log (P) dB. The spectrum is scanned from 30 MHz up to a frequency including its 10th harmonic.

The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitter power (P) by a factor of at least 43+10log₁₀(P[Watts]) dB. The spectrum is scanned from 30 MHz up to a frequency including its 10th harmonic.

3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.5.3 Test Procedures

- The EUT was placed on a rotatable wooden table with 0.8 meter about ground.
- 2. The EUT was set 3 meters from the receiving antenna, which was mounted on the antenna tower.
- The table was rotated 360 degrees to determine the position of the highest spurious emission. 3.
- 4. The height of the receiving antenna is varied between one meter and four meters to search the maximum spurious emission for both horizontal and vertical polarizations.
- Make the measurement with the spectrum analyzer's RBW = 1MHz, VBW = 3MHz, Sweep = 5. 500ms, Taking the record of maximum spurious emission.
- A horn antenna was substituted in place of the EUT and was driven by a signal generator. 6.
- 7. Tune the output power of signal generator to the same emission level with EUT maximum spurious emission.
- 8. Taking the record of output power at antenna port.
- 9. Repeat step 7 to step 8 for another polarization.
- 10. EIRP (dBm) = S.G. Power Tx Cable Loss + Tx Antenna Gain
- 11. ERP (dBm) = EIRP 2.15
- 12. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.
- 13. The limit line is derived from 43 + 10log(P) dB below the transmitter power P(Watts)
 - = P(W) [43 + 10log(P)] (dB)
 - = [30 + 10log(P)] (dBm) [43 + 10log(P)] (dB)
 - = -13dBm.

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number Report Issued Date: Oct. 07, 2014 Report Version : Rev. 01

: 22 of 30


Report No.: FW441109

3.5.4 Test Setup

For radiated emissions from 30MHz to 1GHz

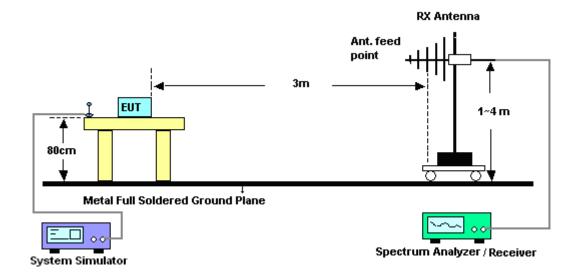

For radiated emissions above 1GHz

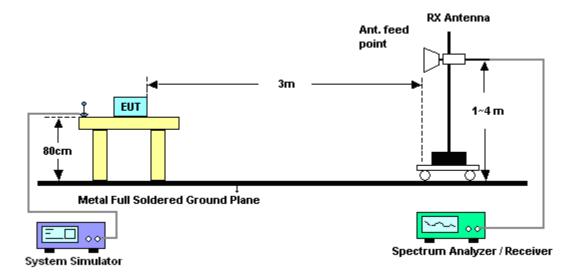

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 23 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

3.5.5 Test Result of Field Strength of Spurious Radiated

<Low Channel>

Band :		CDMA2000	BC10				Temperature :	22~24	°C
Test Mode		1xEV-DO F	Rev. A_R	ETAP 4096	6K		Relative Humidi	i ty : 47~49	%
Test Engine	eer :	Abi Lin and	Lin and Kai Wang Polarization : Horizonta						ntal
Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.									
Frequency	ERF	Limit	Over	SPA	S.G.	TX Cal	ole TX Antenna	Polarization	Result
			Limit	Reading	Power	loss	Gain		
(MHz)	(dBm	n) (dBm)	(dB)	(dBm)	(dBm)	(dB) (dBi)	(H/V)	
1640	-36.6	3 -13	-23.63	-40.75	-38.55	1.43	5.50	Н	Pass
2456	-44.7	7 -13	-31.77	-52.58	-46.74	2	6.12	Н	Pass
3272	-45.2	6 -13	-32.26	-56.3	-48.55	2.4	7.84	Н	Pass
4088	-40.7	0 -13	-27.70	-54.74	-45.11	2.5	9.06	Н	Pass

Donale		<u>CDM40000</u>	DO40				T	00.046	
Band :		CDMA2000	BC10				Temperature :	22~24°	C
Test Mode	:	1xEV-DO F	Rev. A_R	ETAP 4096	SK .		Relative Humidi	ity: 47~499	%
Test Engine	eer:	Abi Lin and	n and Kai Wang Polarization : Vertical						
Remark :		Spurious emissions within 30-1000MHz were found more than 20dB below limit line.							
Frequency	ERP	Limit	Over	SPA	S.G.	TX Cal	ble TX Antenna	Polarization	Result
			Limit	Reading	Power	loss	Gain		
(MHz)	(dBm	n) (dBm)	(dB)	(dBm)	(dBm)	(dB) (dBi)	(H/V)	
1640	-40.7	5 -13	17.07	-44.38	-42.67	1.43	5.50	V	Pass
2456	-46.6	9 -13	17.12	-56.13	-48.66	2	6.12	V	Pass
3272	-43.5	9 -13	18.44	-54.22	-46.88	2.4	7.84	V	Pass
4088	-37.9	5 -13	19.56	-51.5	-42.36	2.5	9.06	V	Pass

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 24 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

<Middle Channel>

Band :		CDMA2000	MA2000 BC10					perature :	2	2~24°(С
Test Mode	:	1xEV-DO F	Rev. A_R	ETAP 4096	SK		Rela	ative Humidi	ty : 4	7~49%	, D
Test Engine	eer:	Abi Lin and	l Kai Wa	ng			Pola	arization :	Н	Horizontal	
Remark :		Spurious emissions within 30-1000MHz were found more than 20dB below limit line.									
Frequency	ERP	Limit	Over	SPA	S.G.	TX Ca	ble	TX Antenna	Polaria	zation	Result
			Limit	Reading	Power	loss	3	Gain			
(MHz)	(dBm	n) (dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H/	V)	
1640	-37.7	1 -13	-24.71	-42.17	-39.55	1.51		5.50	H	1	Pass
2464	-42.2	0 -13	-29.20	-50.51	-44.12	2.04	1	6.11	H	1	Pass
3280	-43.7	7 -13	-30.77	-54.8	-47.02	2.45	5	7.85	H	1	Pass
4104	-40.7	1 -13	-27.71	-54.83	-45.08	2.53	3	9.05	H	ł	Pass

Band :		CDMA2000	BC10				Temperature :	22~	24°C
Test Mode		1xEV-DO F	DO Rev. A_RETAP 4096K Relative Humidity: 47~49%						49%
Test Engine	er:	Abi Lin and	and Kai Wang Polarization : Vertical						ical
Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.									
Frequency	ERP	Limit	Over	SPA	S.G.	TX Ca	ble TX Antenna	Polarizat	ion Result
			Limit	Reading	Power	loss	s Gain		
(MHz)	(dBm) (dBm)	(dB)	(dBm)	(dBm)	(dB) (dBi)	(H/V)	
1640	-41.3	8 -13	-28.38	-44.66	-43.22	1.51	1 5.50	V	Pass
2464	-41.8	5 -13	-28.85	-51.25	-43.77	2.04	4 6.11	V	Pass
3280	-42.9	3 -13	-29.93	-53.84	-46.18	2.45	7.85	V	Pass
4104	-38.1	8 -13	-25.18	-51.63	-42.55	2.53	9.05	V	Pass

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 25 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

<High Channel>

Band :		CDMA2000	BC10				Tem	perature :	2	22~24°	С
Test Mode	:	1xEV-DO F	Rev. A_R	ETAP 4096	SK		Rela	ative Humidi	ty:	47~49%	6
Test Engine	eer:	Abi Lin and	Lin and Kai Wang Polarization : Horizontal						ıtal		
Remark :	Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.										
Frequency	ERP	Limit	Over	SPA	S.G.	TX Ca	ble	TX Antenna	Polar	ization	Result
			Limit	Reading	Power	loss	5	Gain			
(MHz)	(dBm	n) (dBm)	(dB)	(dBm)	(dBm)	(dB)	(dBi)	(H	I/V)	
1648	-42.7	4 -13	-29.74	-47.54	-44.55	1.54	ļ	5.50		Н	Pass
2472	-44.4	9 -13	-31.49	-52.51	-46.33	2.12	2	6.11		Н	Pass
3288	-45.8	3 -13	-32.83	-56.78	-49.02	2.51		7.85		Н	Pass
4120	-43.0	5 -13	-30.05	-56.95	-47.33	2.62	2	9.05		Н	Pass

Band :		CDMA2000	BC10				Temperati	ıre :	22~24°	22~24°C	
Test Mode		1xEV-DO R	DO Rev. A_RETAP 4096K Relative Humidity: 47~49%						6		
Test Engine	er:	Abi Lin and	n and Kai Wang Polarization : Vertical								
Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.											
Frequency	ERP	Limit	Over	SPA	S.G.	TX Ca	ble TX An	tenna P	olarization	Result	
			Limit	Reading	Power	loss	s Ga	iin			
(MHz)	(dBm) (dBm)	(dB)	(dBm)	(dBm)	(dB) (d	Bi)	(H/V)		
1648	-45.4	1 -13	16.96	-49.47	-47.22	1.54	5.	50	V	Pass	
2472	-43.6	8 -13	16.99	-53.22	-45.52	2.12	2 6.	11	V	Pass	
3296	-44.4	4 -13	18.34	-54.94	-47.63	2.5	7.	85	V	Pass	
4112	-39.9	3 -13	19.43	-53.51	-44.21	2.62	<u>9</u> .	05	V	Pass	

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 26 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

3.6 Frequency Stability Measurement

3.6.1 Description of Frequency Stability Measurement

The frequency stability shall be measured by variation of ambient temperature and variation of primary supply voltage to ensure that the fundamental emission stays within the authorized frequency block. The frequency stability of the transmitter shall be maintained within ±0.00025% (±2.5ppm) of the center frequency according to FCC Part 90.213.

3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.6.3 Test Procedures for Temperature Variation

- 1. The EUT was set up in the thermal chamber and connected with the base station.
- With power OFF, the temperature was decreased to -30°C and the EUT was stabilized for three
 hours. Power was applied and the maximum change in frequency was recorded within one
 minute.
- 3. With power OFF, the temperature was raised in 10°C step up to 50°C. The EUT was stabilized at each step for at least half an hour. Power was applied and the maximum frequency change was recorded within one minute.

3.6.4 Test Procedures for Voltage Variation


- 1. The EUT was placed in a temperature chamber at 25±5° C and connected with the base station.
- 2. The power supply voltage to the EUT was varied from BEP to 115% of the nominal value measured at the input to the EUT.
- 3. The variation in frequency was measured for the worst case.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 27 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

3.6.5 Test Setup

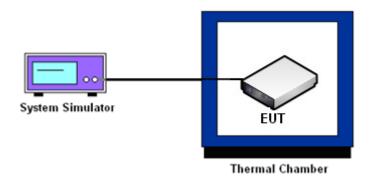

3.6.6 Test Result of Temperature Variation

Band :	CDMA2000 BC10 1xEV-DO Rev. A_RETAP 4096K	Channel:	580
Limit (ppm):	2.5	Frequency:	820.5

Temperature (°C)	Deviation (ppm)	Result
50	0.0171	
40	0.0195	
30	0.0146	
20 (Ref.)	0.0122	
10	0.0134	PASS
0	0.0110	
-10	0.0158	
-20	0.0195	
-30	0.0183	

3.6.7 Test Result of Voltage Variation

Band & Channel	Mode	Voltage (Volt)	Deviation (ppm)	Limit (ppm)	Result
		40.00	0.0110		
CDMA2000 BC10 CH580	1xEV-DO Rev. A RETAP 4096K	12.00	0.0146	2.5	PASS
011300	/_KE1/A 4000K	BEP	0.0134		

Note:

1. Normal Voltage = 12.00V.

2. Battery End Point (BEP) = 8.00 V.

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 28 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No. : FW441109

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
System Simulator	Rohde & Schwarz	CMU200	117995	N/A	Aug. 01, 2013	Jun. 09, 2014~ Jul. 24, 2014	Jul. 31, 2014	Conducted (TH02-HY)
Spectrum Analyzer	Rohde & Schwarz	FSP40	100055	9kHz~40GHz	Jun. 09, 2014	Jun. 09, 2014~ Jul. 24, 2014	Jun. 08, 2015	Conducted (TH02-HY)
Thermal Chamber	Ten Billion	TTH-D3SP	TBN-930701	N/A	Jul. 19, 2013	Jun. 09, 2014	Jul. 18, 2014	Conducted (TH02-HY)
Thermal Chamber	Ten Billion	TTH-D3SP	TBN-930701	N/A	Jul. 17, 2014	Jul. 24, 2014	Jul. 16, 2014	Conducted (TH02-HY)
Spectrum Analyzer	Rohde & Schwarz	FSV30	101749	10Hz ~ 30GHz	Feb. 10, 2014	Jul. 16, 2014~ Jul. 18, 2014	Feb. 09, 2015	Radiation (03CH07-HY)
Bilog Antenna	Schaffner	CBL6111C	2726	30MHz ~ 1GHz	Oct. 10, 2013	Jul. 16, 2014~ Jul. 18, 2014	Oct. 09, 2014	Radiation (03CH07-HY)
Double Ridge Horn Antenna	ESCO	3117	75962	1GHz~18GHz	Aug. 22, 2013	Jul. 16, 2014~ Jul. 18, 2014	Aug. 21, 2014	Radiation (03CH07-HY)
Preamplifier	COM-POWER	PA-103A	161241	10 MHz ~ 1000MHz	Mar. 17, 2014	Jul. 16, 2014~ Jul. 18, 2014	Mar. 16, 2015	Radiation (03CH07-HY)
Preamplifier	Agilent	8449B	3008A02362	1 GHz~26.5 GHz	Nov. 29, 2013	Jul. 16, 2014~ Jul. 18, 2014	Nov. 28, 2014	Radiation (03CH07-HY)
Turn Table	ChainTek	ChainTek 3000	N/A	0 ~ 360 degree	N/A	Jul. 16, 2014~ Jul. 18, 2014	N/A	Radiation (03CH07-HY)
Antenna Mast	ChainTek	ChainTek 3000	N/A	N/A	N/A	Jul. 16, 2014~ Jul. 18, 2014	N/A	Radiation (03CH07-HY)

SPORTON INTERNATIOINAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 29 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109

5 Uncertainty of Evaluation

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of	4.50
Confidence of 95% (U = 2Uc(y))	4.50

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XIA-NTC140W Page Number : 30 of 30
Report Issued Date : Oct. 07, 2014
Report Version : Rev. 01

Report No.: FW441109