# **FCC RF Test Report**

APPLICANT : Quectel Wireless Solutions Co., Ltd.

**EQUIPMENT**: Wi-Fi & Bluetooth Module

BRAND NAME : Quectel MODEL NAME : FCS866R

FCC ID : XMR2023FCS866R

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

TEST DATE(S) : Jan. 09, 2024 ~ Mar. 08, 2024

We, Sporton International Inc. (Shenzhen), would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

This report contains data that were produced under subcontract by Sporton International Inc. (Kunshan).

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. (Shenzhen), the test report shall not be reproduced except in full.









Report No.: FR3D2611A

# Sporton International Inc. (ShenZhen)

1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055

People's Republic of China

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 1 of 89

Report Issued Date : Mar. 11, 2024

Report Version : Rev. 01

# **TABLE OF CONTENTS**

RE'	VISIO	N HISTORY	3
SU	MMAR	Y OF TEST RESULT	4
1	GENE	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Product Specification of Equipment Under Test	6
	1.5	Modification of EUT	6
	1.6	Testing Location	7
	1.7	Test Software	8
	1.8	Applicable Standards	8
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	9
	2.1	Carrier Frequency Channel	9
	2.2	Test Mode	.10
	2.3	Connection Diagram of Test System	.11
	2.4	Support Unit used in test configuration and system	.11
	2.5	EUT Operation Test Setup	.11
	2.6	Measurement Results Explanation Example	.12
3	TEST	RESULT	.13
	3.1	Number of Channel Measurement	.13
	3.2	Hopping Channel Separation Measurement	.16
	3.3	Dwell Time Measurement	.26
	3.4	20dB and 99% Bandwidth Measurement	.28
	3.5	Output Power Measurement	.48
	3.6	Conducted Band Edges Measurement	.49
	3.7	Conducted Spurious Emission Measurement	.62
	3.8	Radiated Band Edges and Spurious Emission Measurement	.81
	3.9	AC Conducted Emission Measurement	.85
	3.10	Antenna Requirements	.87
4	LIST	OF MEASURING EQUIPMENT	.88
5	MEAS	SUREMENT UNCERTAINTY	.89
AP	PENDI	X A. CONDUCTED TEST RESULTS	
AP	PENDI	X B. AC CONDUCTED EMISSION TEST RESULT	
AP	PENDI	X C. RADIATED SPURIOUS EMISSION AND PLOTS	
AP	PENDI	X D. DUTY CYCLE PLOTS	
AP	PENDI	X E. SETUP PHOTOGRAPHS	

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 2 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

# **REVISION HISTORY**

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR3D2611A	Rev. 01	Initial issue of report	Mar. 11, 2024

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 3 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR3D2611A

# **SUMMARY OF TEST RESULT**

Report Section	FCC Rule	Description	Limit	Result	Remark
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	20dB Bandwidth	-	Report only	-
3.4	- 99% Bandwidth		-	Report only	-
3.5	15.247(b)(1)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	3.7 Conducted Spurious Emission		≤ 20dBc	Pass	-
		Radiated Band Edges and Radiated Spurious Emission	15.209(a) & 15.247(d)	Pass	Under limit 0.85 dB at 675.050 MHz
3.9 15.207 AC Conducted Emission		15.207(a)	Pass	Under limit 10.05 dB at 0.404 MHz	
3.10	15.203 & 15.247(b)	Antenna Requirement	15.203 & 15.247(b)	Pass	-

#### **Conformity Assessment Condition:**

- The test results (PASS/FAIL) with all measurement uncertainty excluded are presented against the regulation limits or
  in accordance with the requirements stipulated by the applicant/manufacturer who shall bear all the risks of
  non-compliance that may potentially occur if measurement uncertainty is taken into account.
- 2. The measurement uncertainty please refer to each test result in the section "Measurement Uncertainty"

#### Disclaimer:

The product specifications of the EUT presented in the test report that may affect the test assessments are declared by the manufacturer who shall take full responsibility for the authenticity.

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 4 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

# 1 General Description

# 1.1 Applicant

#### **Quectel Wireless Solutions Co., Ltd.**

Building 5, Shanghai Business Park Phase III (Area B), No.1016 Tianlin Road, Minhang District, Shanghai 200233, China

# 1.2 Manufacturer

### Quectel Wireless Solutions Co., Ltd.

Building 5, Shanghai Business Park Phase III (Area B), No.1016 Tianlin Road, Minhang District, Shanghai 200233, China

# 1.3 Product Feature of Equipment Under Test

Product Feature					
Equipment	Wi-Fi & Bluetooth Module				
Brand Name	Quectel				
Model Name	FCS866R				
FCC ID XMR2023FCS866R					
SN Code	Conducted: E1M23KL03000093 Conduction: E1M23KL03000085				
HW Version	Radiation: E1M23KL03000054				
SW Version	NA				
EUT Stage	Identical Prototype				

**Remark:** The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 5 of 89

Report Issued Date : Mar. 11, 2024

Report Version : Rev. 01

Report No.: FR3D2611A

# 1.4 Product Specification of Equipment Under Test

Standards-related Product Specification				
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz			
Number of Channels	79			
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78			
Maximum Output Power to Antenna	<b><ant.0></ant.0></b> Bluetooth BR(1Mbps): 8.30 dBm (0.0068 W) Bluetooth EDR (2Mbps): 10.80 dBm (0.0120 W) Bluetooth EDR (3Mbps): 11.40 dBm (0.0138 W) <b><ant.2></ant.2></b> Bluetooth BR(1Mbps): 8.50 dBm (0.0071 W) Bluetooth EDR (2Mbps): 10.80 dBm (0.0120 W) Bluetooth EDR (3Mbps): 11.20 dBm (0.0132 W)			
99% Occupied Bandwidth	<ahref="#"><ant.0> Bluetooth BR(1Mbps): 0.865MHz Bluetooth EDR (2Mbps): 1.163MHz Bluetooth EDR (3Mbps): 1.169MHz <ahref="#"><ant.2></ant.2></ahref="#"><ant.2> Bluetooth BR(1Mbps): 0.865MHz Bluetooth EDR (2Mbps): 1.173MHz Bluetooth EDR (3Mbps): 1.175MHz</ant.2></ant.0></ahref="#">			
Antenna Type / Gain	<ant.0 2=""> Dipole Antenna type with gain -0.10 dBi</ant.0>			
Type of Modulation	Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) :π/4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK			

Note: The device supports Bluetooth BR/EDR SISO mode only.

# 1.5 Modification of EUT

No modifications are made to the EUT during all test items.

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 6 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR3D2611A

# 1.6 Testing Location

Sporton International Inc. (Kunshan) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.02.

Test Firm	Sporton International Inc. (Kunshan)					
	No. 1098, Pengxi North	n Road, Kunshan Econom	ic Development Zone			
Test Site Location	Jiangsu Province 215300 People's Republic of China					
	TEL: +86-512-57900158					
	Sporton Site No.	FCC Designation No.	FCC Test Firm			
Test Site No.	Sporton Site No.	rec besignation No.	Registration No.			
	CO01-KS	CN1257	314309			

Sporton International Inc. (Shenzhen) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.01.

Test Firm	Sporton International Inc. (Shenzhen)						
Test Site Location	1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055 People's Republic of China TEL: +86-755-86379589 FAX: +86-755-86379595						
	Sporton Site No.	FCC Test Fire FCC Designation No.					
Test Site No.	oporton one no.	1 00 Designation No.	Registration No.				
	TH01-SZ	CN1256	421272				

Test Firm	Sporton International Inc. (Shenzhen)					
Test Site Location	101, 1st Floor, Block B, Building 1, No. 2, Tengfeng 4th Road, Fenghuang Community, Fuyong Street, Baoan District, Shenzhen City, Guangdong Province 518103 People's Republic of China TEL: +86-755-86066985					
Test Site No.	Sporton Site No.	FCC Designation No.	FCC Test Firm Registration No.			
	03CH04-SZ	CN1256	421272			

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 7 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

# 1.7 Test Software

Item	Site	Manufacturer	Name	Version
1.	CO01-KS	AUDIX	E3	6.2009-8-24
2.	03CH04-SZ	AUDIX	E3	6.2009-8-24

# 1.8 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 15 Subpart C §15.247
- FCC KDB 558074 D01 15.247 Meas Guidance v05r02
- ANSI C63.10-2013

#### Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 8 of 89

Report Issued Date : Mar. 11, 2024

Report Version : Rev. 01

Report No.: FR3D2611A

# 2 Test Configuration of Equipment Under Test

# 2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 9 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### 2.2 Test Mode

- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction emission (150 kHz to 30 MHz), radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Y plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 3Mbps mode, and recorded in this report.
- b. AC power line Conducted Emission was tested under maximum output power.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

	Summary table of Test Cases							
	Data Rate / Modulation							
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps					
	GFSK	π/4-DQPSK	8-DPSK					
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz					
	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz					
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz					
	В	luetooth EDR 3Mbps 8-DPS	K					
Radiated	Mode 1: CH00_2402 MHz							
Test Cases	Mode 2: CH39_2441 MHz							
	Mode 3: CH78_2480 MHz							
AC		W AND : 1 (0.40) I : 1 : 125	0.11.701 : 5 57.70					
Conducted		VLAN Link (2.4G) Link + USB	Cable (Charging From EVB					
Emission	Adapter)							

#### Remark:


- 1. For radiated test cases, the worst mode data rate 3Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and no other significantly frequencies found in conducted spurious emission.
- 2. For Radiated Test Cases, The tests were performed with Adapter and test jig.

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 10 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

# 2.3 Connection Diagram of Test System

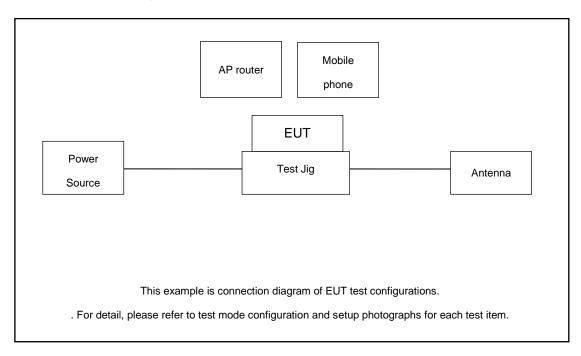

# 2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	WLAN AP	D-link	DIR-655	KA21R655B1	N/A	Unshielded,1.8m
2.	Mobile phone	мото	XT1952-1	N/A	N/A	N/A
3.	Antenna	N/A	N/A	N/A	N/A	N/A
4.	Test Jig	N/A	N/A	N/A	N/A	N/A

# 2.5 EUT Operation Test Setup

For Bluetooth function, the engineering test program was provided and enabled to make EUT connect with Bluetooth base station to continuous transmit.

For AC power line conducted emissions, the EUT was set to connect with the WLAN AP under large package sizes transmission.

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 11 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

# 2.6 Measurement Results Explanation Example

#### For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

#### Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 11 dB and 10dB attenuator.

Offset(dB) = RF cable loss(dB) + attenuator factor(dB).  
= 
$$11 + 10 = 21$$
 (dB)

Page Number : 12 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

# 3 Test Result

### 3.1 Number of Channel Measurement

# 3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.


# 3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = the frequency band of operation; RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

### 3.1.4 Test Setup



Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 13 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

# 3.1.5 Test Result of Number of Hopping Frequency

Please refer to Appendix A.


#### <Ant.0>

### **Number of Hopping Channel Plot on Channel 00**

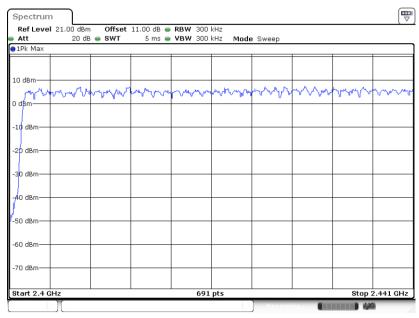

#### Date: 6.MAR.2024 12:52:34

### **Number of Hopping Channel Plot on Channel 78**

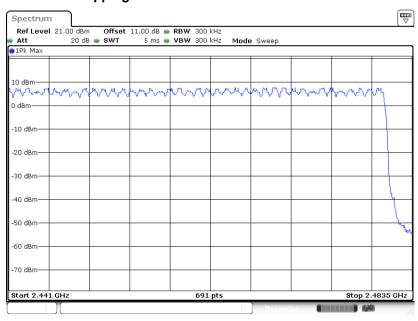

Date: 6.MAR.2024 12:52:59


Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 14 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A


#### <Ant.2>

# **Number of Hopping Channel Plot on Channel 00**

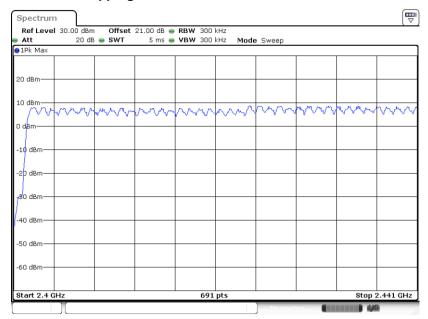

Date: 24.JAN.2024 19:50:50

# **Number of Hopping Channel Plot on Channel 78**

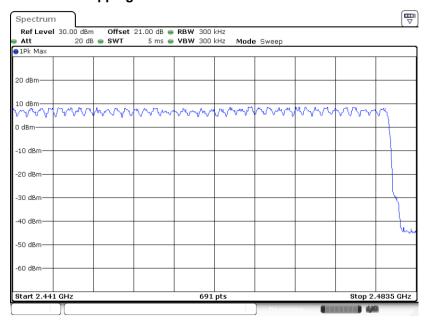

Date: 24.JAN.2024 19:51:18

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 15 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

# 3.2 Hopping Channel Separation Measurement

# 3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.


# 3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings:
   Span = wide enough to capture the peaks of two adjacent channels;
   RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

### 3.2.4 Test Setup



# 3.2.5 Test Result of Hopping Channel Separation

Please refer to Appendix A.

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 16 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A




Report No. : FR3D2611A

#### <Ant. 0>


#### <1Mbps>

# Channel Separation Plot on Channel 00 - 01

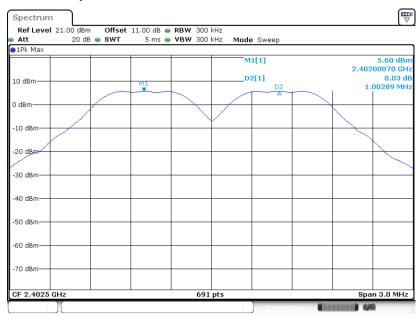

Date: 6.MAR.2024 10:38:51

# Channel Separation Plot on Channel 39 - 40

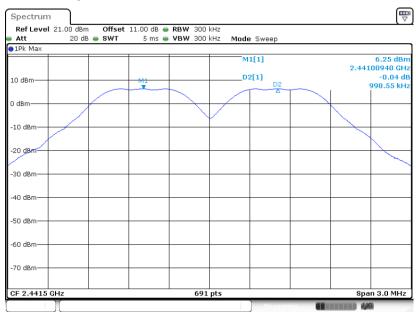


Date: 6.MAR.2024 10:41:47

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 17 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


### Channel Separation Plot on Channel 77 - 78

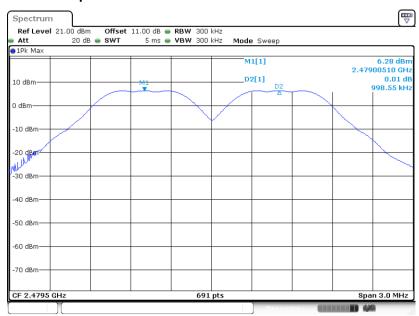

Date: 6.MAR.2024 10:43:42

### <2Mbps>

# Channel Separation Plot on Channel 00 - 01

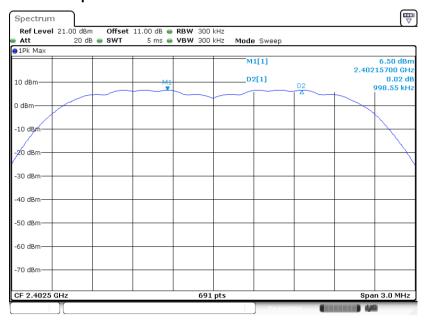


Date: 6.MAR.2024 10:56:19

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 18 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### Channel Separation Plot on Channel 39 - 40

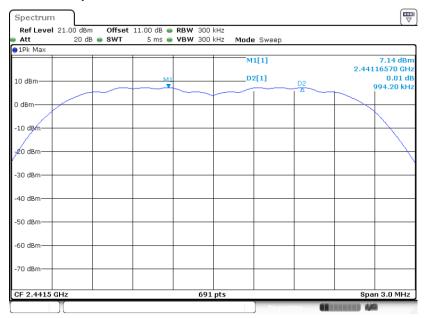

Date: 6.MAR.2024 11:04:08

### Channel Separation Plot on Channel 77 - 78



Date: 6.MAR.2024 11:15:24


Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 19 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### <3Mbps>

# Channel Separation Plot on Channel 00 - 01

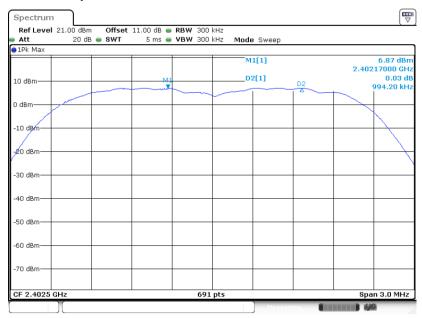

Date: 6.MAR.2024 11:39:46

# Channel Separation Plot on Channel 39 - 40




Date: 6.MAR.2024 11:42:10

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 20 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### Channel Separation Plot on Channel 77 - 78

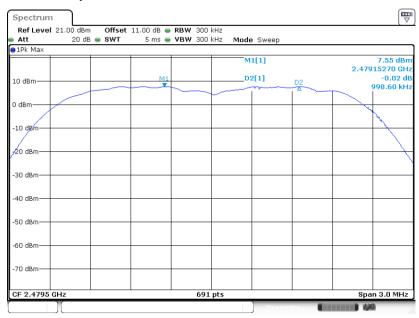


Date: 6.MAR.2024 11:45:00

#### <Ant. 2>

### <1Mbps>

#### Channel Separation Plot on Channel 00 - 01

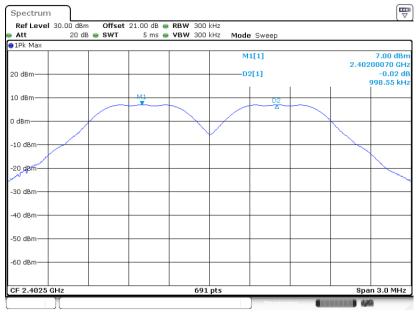


Date: 24.JAN.2024 19:22:06

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 21 of 89 Report Issued Date: Mar. 11, 2024 Report Version : Rev. 01


Report No.: FR3D2611A

### Channel Separation Plot on Channel 39 - 40

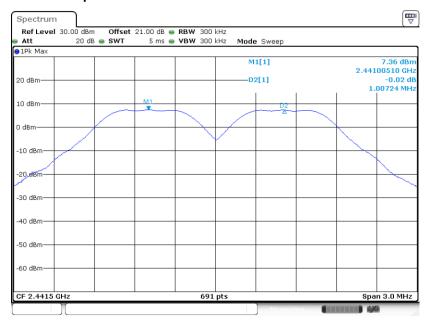

Date: 24.JAN.2024 19:29:00

### Channel Separation Plot on Channel 77 - 78

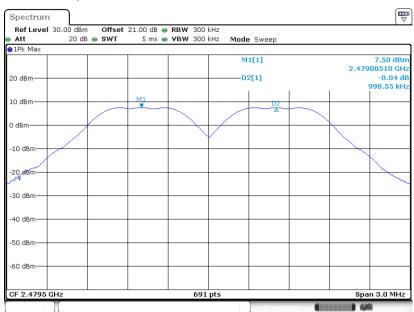

Date: 24.JAN.2024 19:27:39


Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 22 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### <2Mbps>

# Channel Separation Plot on Channel 00 - 01

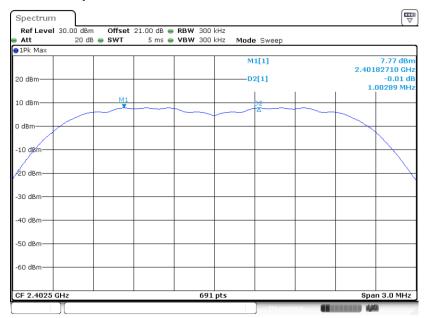

Date: 24.JAN.2024 19:34:01

# Channel Separation Plot on Channel 39 - 40




Date: 24.JAN.2024 19:36:34

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 23 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A


### Channel Separation Plot on Channel 77 - 78

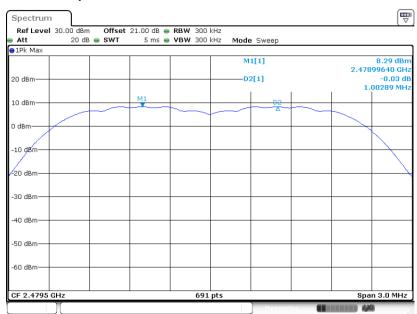

Date: 24.JAN.2024 19:39:24

#### <3Mbps>

# Channel Separation Plot on Channel 00 - 01

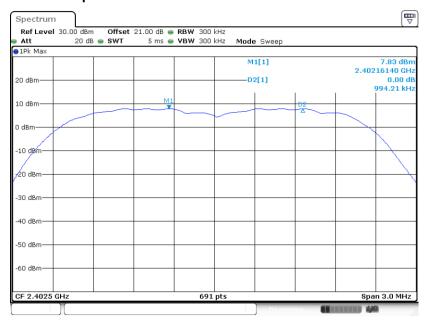


Date: 24.JAN.2024 20:05:06

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 24 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### Channel Separation Plot on Channel 39 - 40

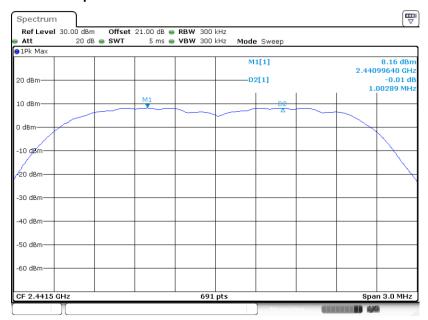

Date: 24.JAN.2024 19:44:49

### Channel Separation Plot on Channel 77 - 78



Date: 24.JAN.2024 19:42:16

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 25 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### 3.3 Dwell Time Measurement

#### 3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.


# 3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
   The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

### 3.3.4 Test Setup

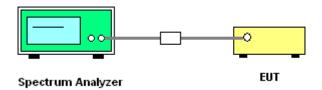

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 26 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

#### 3.3.5 Test Result of Dwell Time

Please refer to Appendix A.

#### **Package Transfer Time Plot** Spectrum Offset 22.80 dB @ RBW 10 MHz Att 25 dB . SWT 10 ms VBW 10 MHz ●1Pk Max D3[1] -0.01 di 10 dBm 1.4522 m 0 dBn -10 dB -20 dBm merly by fresh -30 dBm -40 dBr -50 dBn -60 dBm CF 2.402 GHz 691 pts 1.0 ms/ Marker Y-value 59 dBm Type | Ref | Trc 1.4522 ms 2.9014 ms **Function Result** 0.09 dB 0.09 dB -0.01 dB 3.7478 ms

#### Date: 16.JAN.2024 11:59:36

### Remark:

In normal mode, hopping rate is 1600 hops/s with 6 slots (5 Transmit and 1 Receive slot)
 in 79 hopping channels.

With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit  $(0.4 \times 79)$  (s), Hops Over Occupancy Time comes to  $(1600 / 6 / 79) \times (0.4 \times 79) = 106.67$  hops.

- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels.
  With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4 x 20) (s),
  Hops Over Occupancy Time comes to (800 / 6 / 20) x (0.4 x 20) = 53.33 hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 27 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### 3.4 20dB and 99% Bandwidth Measurement

#### 3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only

# 3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.

Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;

The RBW is set to 1% to 5% of the 99% OBW, the VBW is set to 3 times the RBW;

Sweep = auto; Detector function = peak;

Trace = max hold.

5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.

Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;


The RBW is set to 1% to 5% of the 99% OBW, the VBW is set to 3 times the RBW;

Sweep = auto; Detector function = peak;

Trace = max hold.

6. Measure and record the results in the test report.

#### 3.4.4 Test Setup

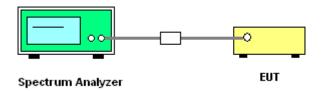

#### 3.4.5 Test Result of 20dB Bandwidth

Please refer to Appendix A.

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 28 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

#### <Ant.0>


#### <1Mbps>

#### 20 dB Bandwidth Plot on Channel 00



#### Date: 6.MAR.2024 10:36:13

### 20 dB Bandwidth Plot on Channel 39

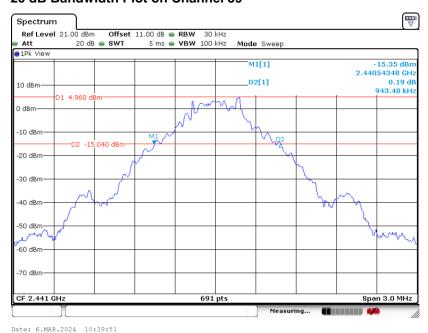

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 29 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

#### 20 dB Bandwidth Plot on Channel 78



Date: 6.MAR.2024 10:44:46

# <2Mbps>

### 20 dB Bandwidth Plot on Channel 00




Date: 6.MAR.2024 10:51:36

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 30 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

#### 20 dB Bandwidth Plot on Channel 39

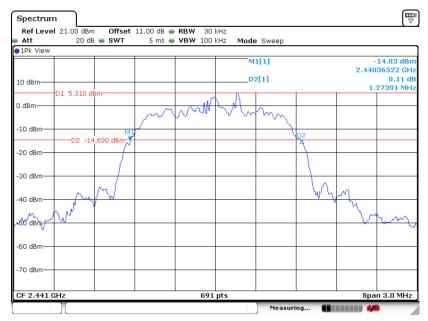

Date: 6.MAR.2024 10:56:59

#### 20 dB Bandwidth Plot on Channel 78

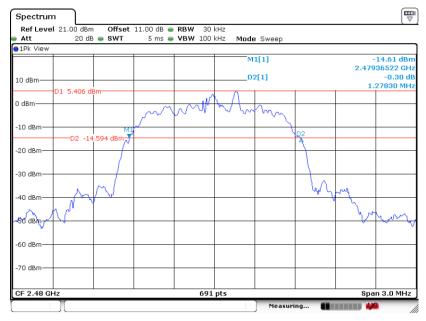

Date: 6.MAR.2024 11:16:34

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 31 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### <3Mbps>

### 20 dB Bandwidth Plot on Channel 00



Date: 6.MAR.2024 11:37:50

### 20 dB Bandwidth Plot on Channel 39



Date: 6.MAR.2024 11:40:21

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 32 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### 20 dB Bandwidth Plot on Channel 78



Date: 6.MAR.2024 11:46:07


TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 33 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

#### <Ant. 2>

#### <1Mbps>

#### 20 dB Bandwidth Plot on Channel 00

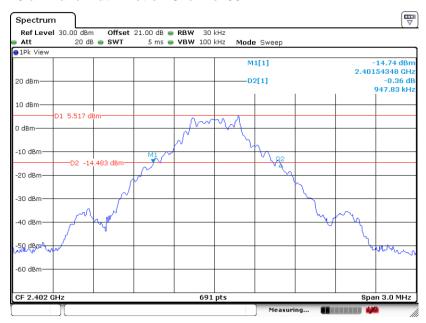

Date: 24.JAN.2024 19:19:46

### 20 dB Bandwidth Plot on Channel 39




Date: 24.JAN.2024 19:23:27

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 34 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A


#### 20 dB Bandwidth Plot on Channel 78

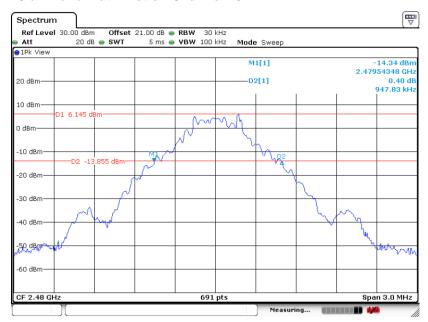

Date: 24.JAN.2024 19:25:45

#### <2Mbps>

### 20 dB Bandwidth Plot on Channel 00

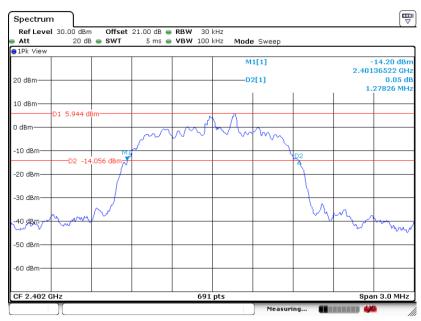


Date: 24.JAN.2024 19:31:09

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 35 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

#### 20 dB Bandwidth Plot on Channel 39

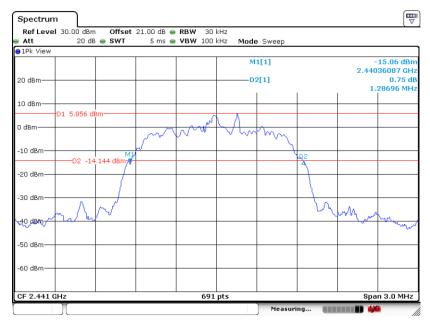

Date: 24.JAN.2024 19:34:44

#### 20 dB Bandwidth Plot on Channel 78

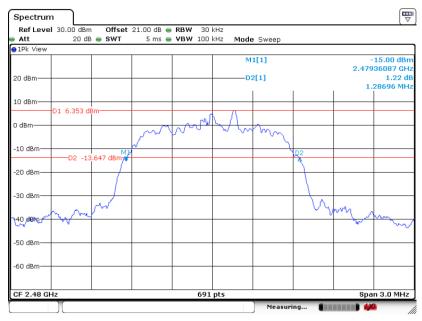


Date: 24.JAN.2024 19:37:35

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 36 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

### 20 dB Bandwidth Plot on Channel 00

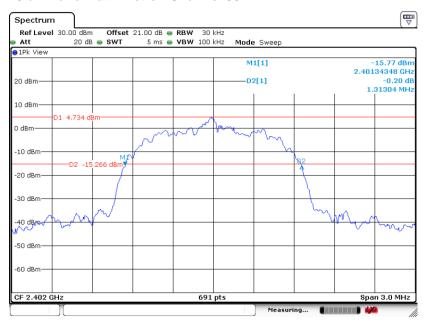

Date: 24.JAN.2024 19:45:49

#### 20 dB Bandwidth Plot on Channel 39

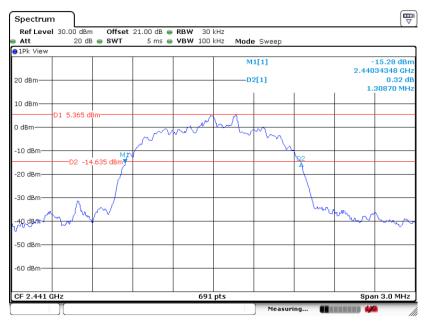


Date: 24.JAN.2024 19:42:48

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 37 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### 20 dB Bandwidth Plot on Channel 78

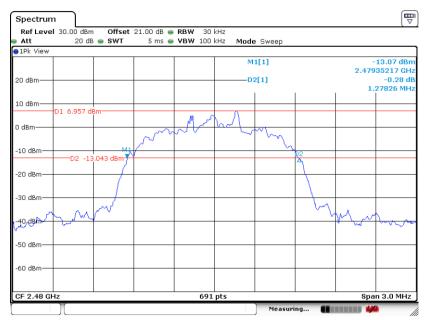

Date: 24.JAN.2024 19:40:28

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 38 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A


## 3.4.6 Test Result of 99% Occupied Bandwidth

Please refer to Appendix A.

#### <Ant. 0>


### <1Mbps>

### 99% Occupied Bandwidth Plot on Channel 00

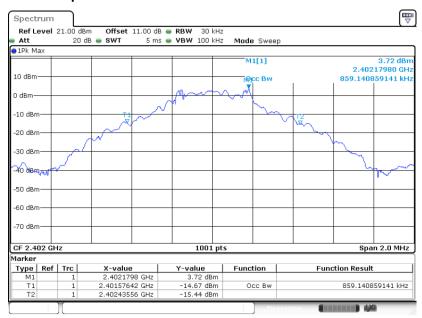

Date: 6.MAR.2024 10:35:08

### 99% Occupied Bandwidth Plot on Channel 39

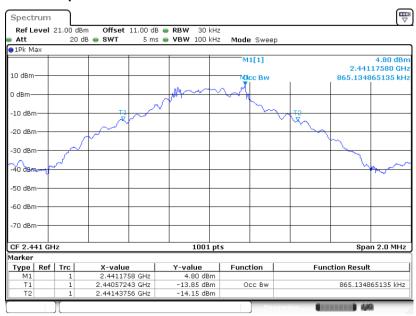


Date: 6.MAR.2024 10:39:35

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 39 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

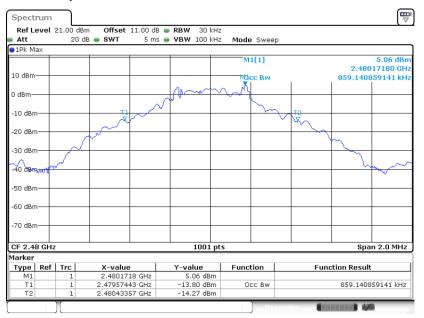

Date: 6.MAR.2024 10:43:55

#### <2Mbps>

### 99% Occupied Bandwidth Plot on Channel 00

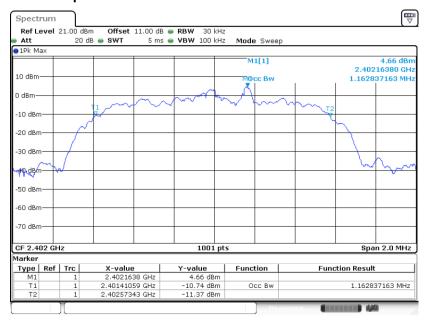


Date: 6.MAR.2024 10:49:56

Sporton International Inc. (ShenZhen)


TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 40 of 89 Report Issued Date: Mar. 11, 2024 Report Version : Rev. 01

Report No.: FR3D2611A

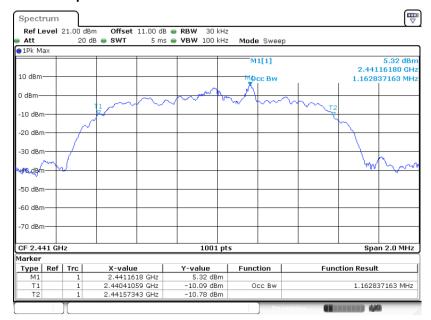

Date: 6.MAR.2024 10:56:44

#### 99% Occupied Bandwidth Plot on Channel 78

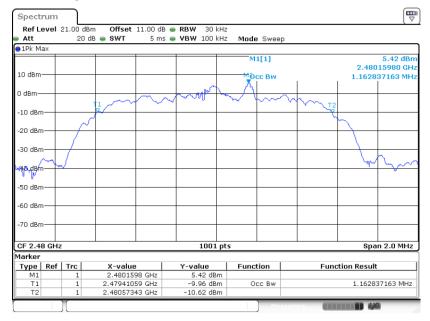


Date: 6.MAR.2024 11:15:57

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 41 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

#### 99% Occupied Bandwidth Plot on Channel 00

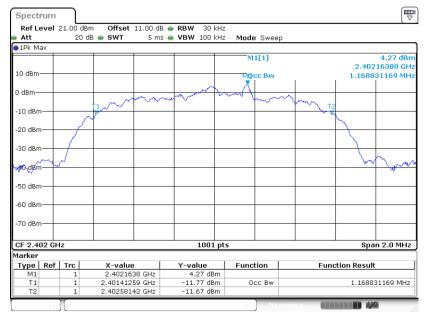

Date: 6.MAR.2024 11:37:13

#### 99% Occupied Bandwidth Plot on Channel 39

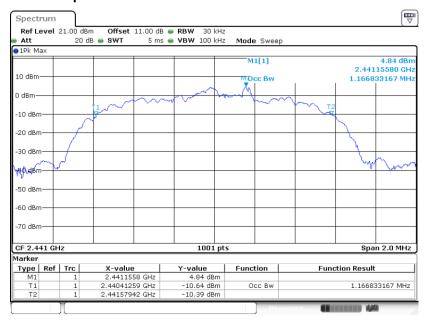


Date: 6.MAR.2024 11:40:06

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 42 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

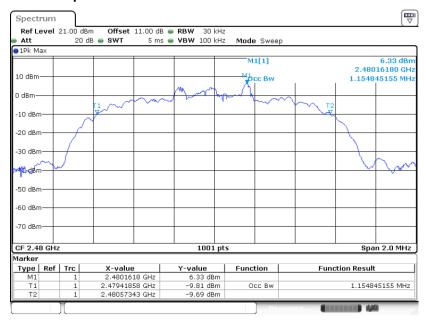


Date: 6.MAR.2024 11:45:24

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

#### <Ant.2>

#### <1Mbps>

### 99% Occupied Bandwidth Plot on Channel 00

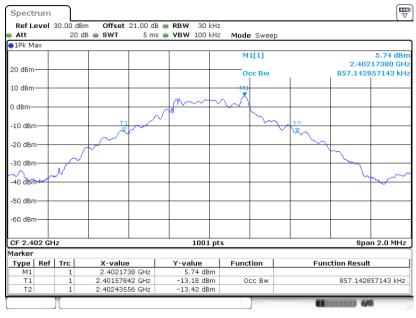


Date: 24.JAN.2024 19:15:45

Sporton International Inc. (ShenZhen)


TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 43 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

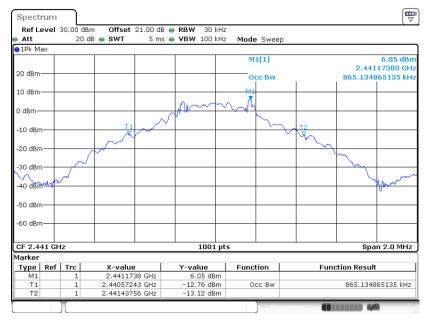

Date: 24.JAN.2024 19:22:39

#### 99% Occupied Bandwidth Plot on Channel 78

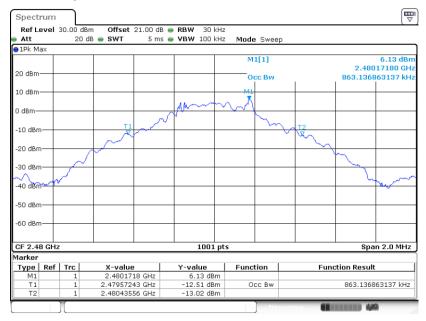

Date: 24.JAN.2024 19:25:05


Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 44 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A


### <2Mbps>

#### 99% Occupied Bandwidth Plot on Channel 00

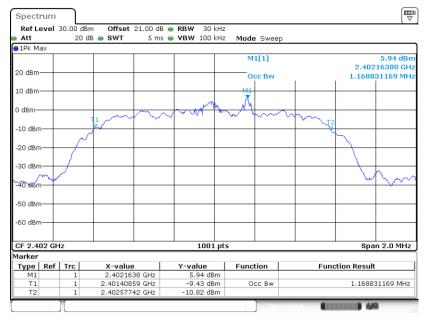

Date: 24.JAN.2024 19:29:56

#### 99% Occupied Bandwidth Plot on Channel 39

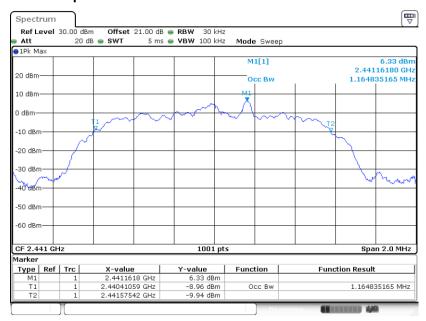


Date: 24.JAN.2024 19:34:32

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 45 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

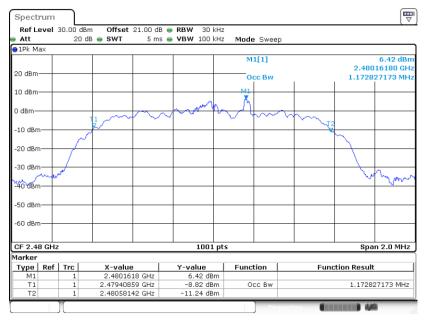

Date: 24.JAN.2024 19:36:57

#### <3Mbps>

#### 99% Occupied Bandwidth Plot on Channel 00

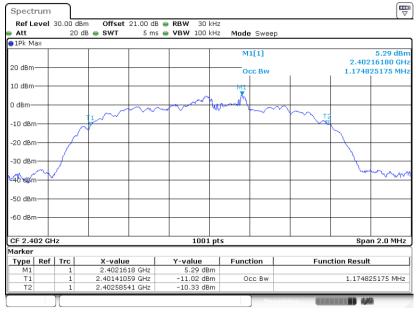


Date: 24.JAN.2024 19:45:09

Sporton International Inc. (ShenZhen)


TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 46 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

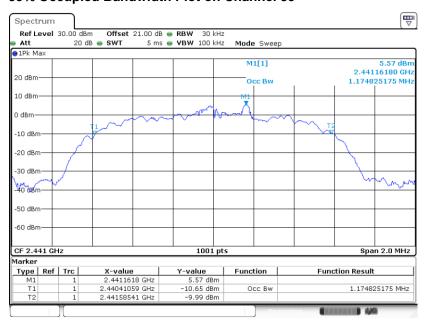

Date: 24.JAN.2024 19:42:32

#### 99% Occupied Bandwidth Plot on Channel 78

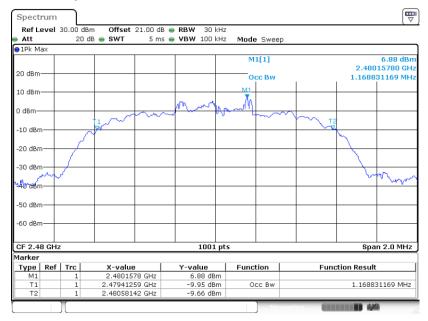

Date: 24.JAN.2024 19:39:49

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 47 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

## 3.5 Output Power Measurement

## 3.5.1 Limit of Output Power

The maximum peak conducted output power of the intentional radiator shall not exceed the following: For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts. The power limit for 1Mbps, 2Mbps, 3Mbps and AFH modes are 0.125 watts.


### 3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

### 3.5.4 Test Setup

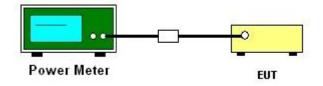

### 3.5.5 Test Result of Peak Output Power

Please refer to Appendix A.

### 3.5.6 Test Result of Average Output Power (Reporting Only)

Please refer to Appendix A.

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 48 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

## 3.6 Conducted Band Edges Measurement

## 3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


### 3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

### 3.6.4 Test Setup



TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 49 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

## 3.6.5 Test Result of Conducted Band Edges

#### <Ant.0>


### <1Mbps>

### Low Band Edge Plot on Channel 00

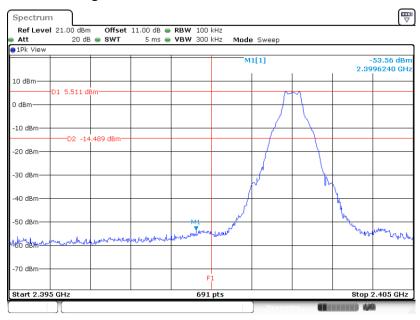

#### Date: 6.MAR.2024 10:35:58

### **High Band Edge Plot on Channel 78**

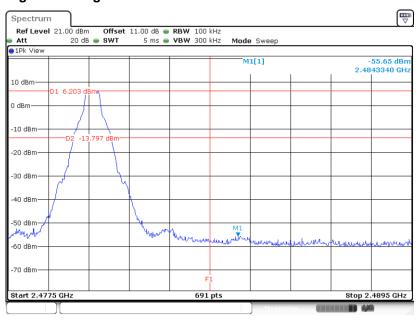


Date: 6.MAR.2024 10:44:30

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 50 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A


### <2Mbps>

### Low Band Edge Plot on Channel 00

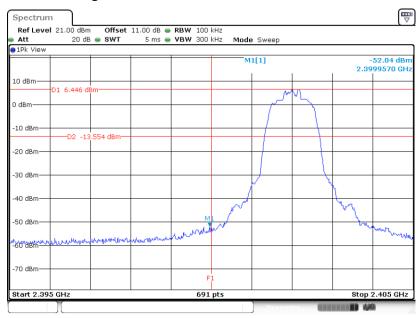

#### Date: 6.MAR.2024 10:51:22

### **High Band Edge Plot on Channel 78**

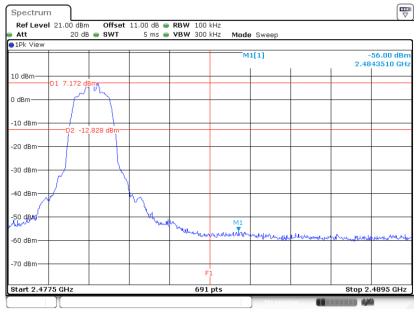


Date: 6.MAR.2024 11:16:23

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 51 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

### Low Band Edge Plot on Channel 00

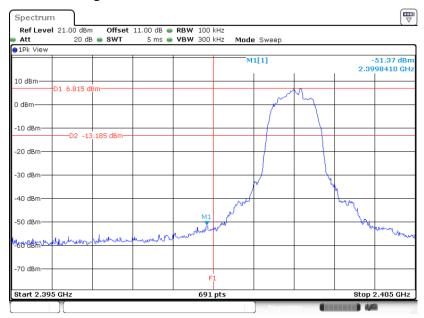

Date: 6.MAR.2024 11:37:38

### **High Band Edge Plot on Channel 78**

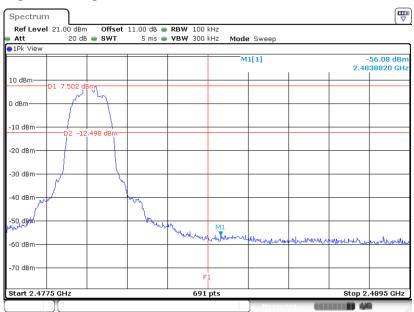

Date: 6.MAR.2024 11:45:53

Sporton International Inc. (ShenZhen)


TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 52 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

#### <Ant.2>


#### <1Mbps>

### Low Band Edge Plot on Channel 00

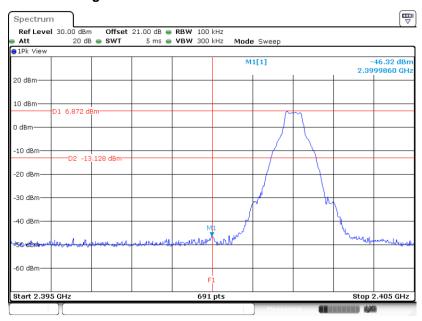

#### Date: 24.JAN.2024 19:18:59

### **High Band Edge Plot on Channel 78**

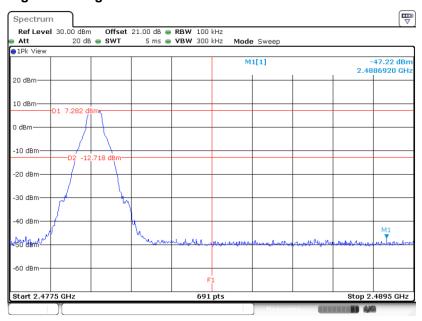


Date: 24.JAN.2024 19:25:32

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 53 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A


### <2Mbps>

### Low Band Edge Plot on Channel 00

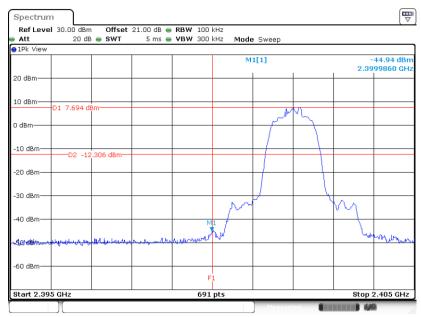

#### Date: 24.JAN.2024 19:30:55

### **High Band Edge Plot on Channel 78**

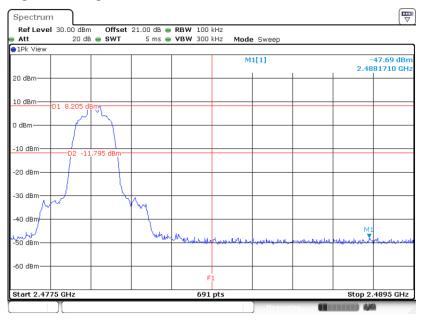


Date: 24.JAN.2024 19:37:24


TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 54 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### Low Band Edge Plot on Channel 00

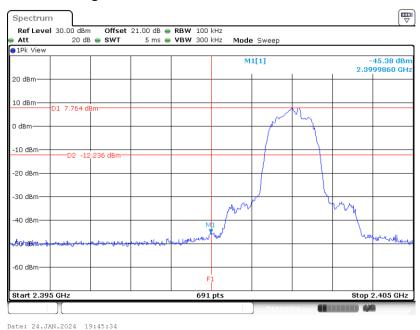

### **High Band Edge Plot on Channel 78**

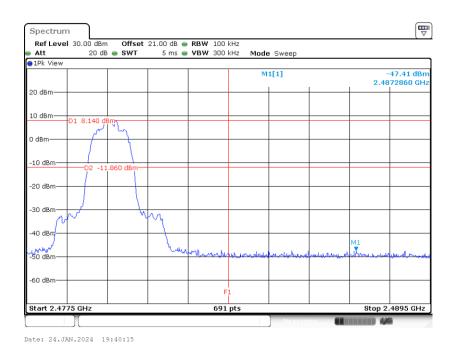

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 55 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

## 3.6.6 Test Result of Conducted Hopping Mode Band Edges

#### <Ant. 0>


### <1Mbps>

### **Hopping Mode Low Band Edge Plot**

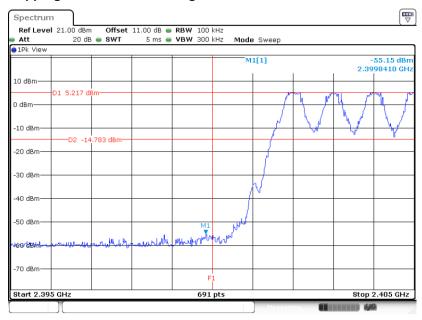

#### Date: 6.MAR.2024 11:50:22

### **Hopping Mode High Band Edge Plot**

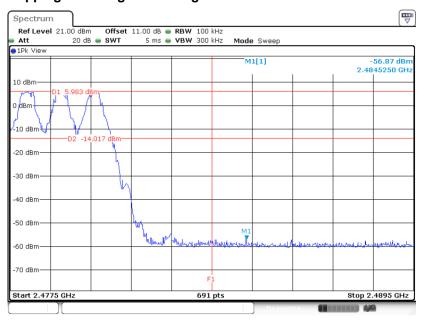


Date: 6.MAR.2024 11:50:49

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 56 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A


### <2Mbps>

### **Hopping Mode Low Band Edge Plot**

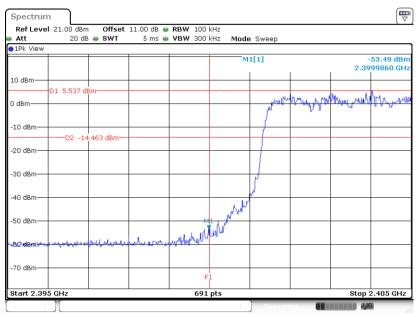

#### Date: 6.MAR.2024 11:49:52

### **Hopping Mode High Band Edge Plot**

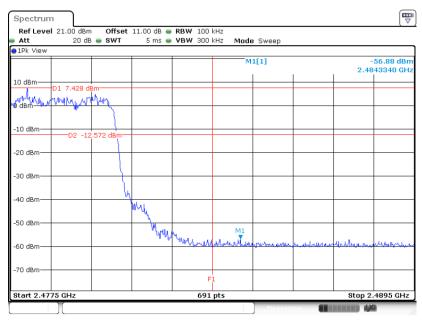


Date: 6.MAR.2024 11:49:25

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 57 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

### **Hopping Mode Low Band Edge Plot**

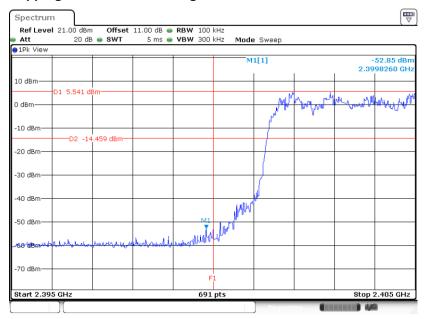

#### Date: 6.MAR.2024 11:47:45

### **Hopping Mode High Band Edge Plot**

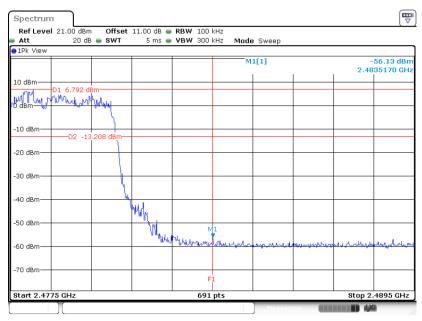

Date: 6.MAR.2024 11:48:14


TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 58 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

#### <Ant.2>


#### <1Mbps>

### **Hopping Mode Low Band Edge Plot**

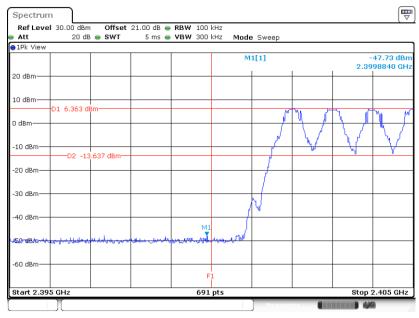

#### Date: 24.JAN.2024 19:54:46

### **Hopping Mode High Band Edge Plot**

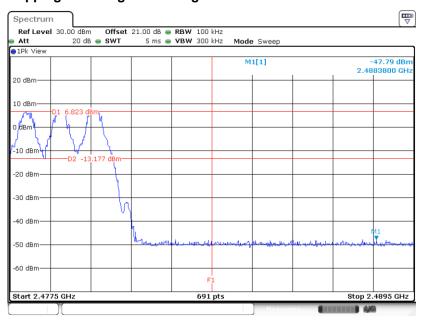


Date: 24.JAN.2024 19:55:12

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 59 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A


### <2Mbps>

### **Hopping Mode Low Band Edge Plot**

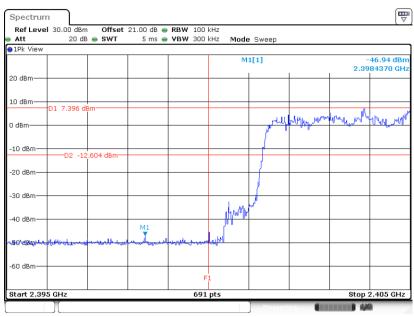

#### Date: 24.JAN.2024 19:54:11

### **Hopping Mode High Band Edge Plot**

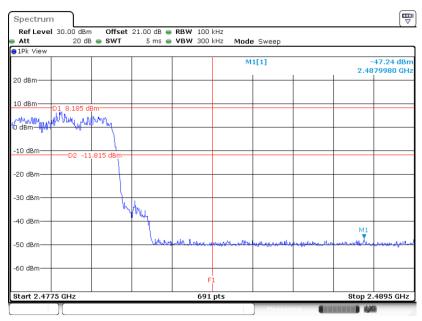


Date: 24.JAN.2024 19:53:09


TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 60 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

### **Hopping Mode Low Band Edge Plot**

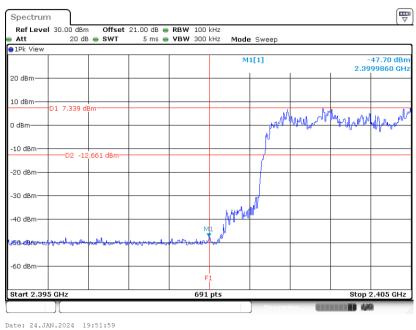

### **Hopping Mode High Band Edge Plot**

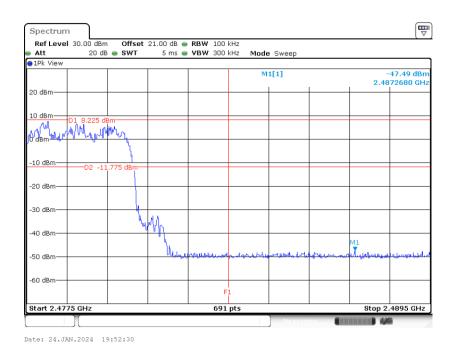

Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 61 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01

Report No.: FR3D2611A

## 3.7 Conducted Spurious Emission Measurement

### 3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


### 3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

### 3.7.4 Test Setup



Sporton International Inc. (ShenZhen)

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 62 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

## 3.7.5 Test Result of Conducted Spurious Emission

#### <Ant 0>


### <1Mbps>

#### **CSE Plot on Ch 00**

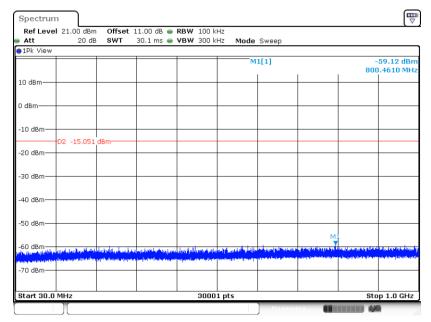

Date: 6.MAR.2024 10:37:08

### **CSE Plot on Ch 00**

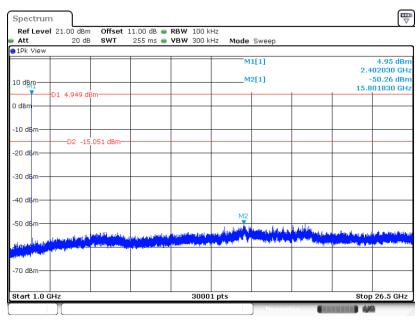


Date: 6.MAR.2024 10:36:42

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 63 of 89
Report Issued Date : Mar. 11, 2024
Report Version : Rev. 01


Report No.: FR3D2611A

### **CSE Plot on Ch 39**

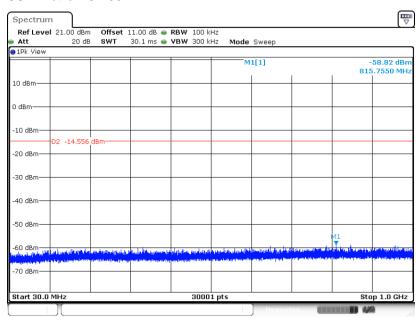

Date: 6.MAR.2024 10:40:46

#### CSE Plot on Ch 39

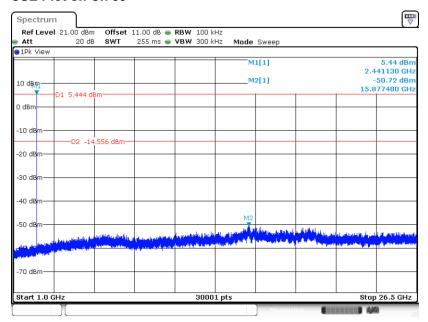

Date: 6.MAR.2024 10:40:20

TEL: +86-755-8637-9589 FAX: +86-755-8637-9595 FCC ID: XMR2023FCS866R Page Number : 64 of 89 Report Issued Date: Mar. 11, 2024 Report Version : Rev. 01

Report No.: FR3D2611A