

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790446225-US-R1-V0
Page : 102 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	64
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	85.78	18.86	104.64	N/A	N/A	PK
	@	5320	79.14	18.86	98	N/A	N/A	AVG
		5367	40.54	19.11	59.65	74	-14.35	PK
		5459.4	28.94	19.57	48.51	54	-5.49	AVG
	*	10640	34.31	18.03	52.34	74	-21.66	PK
Vertical	@	5320	96.75	18.86	115.61	N/A	N/A	PK
	@	5320	88.12	18.86	106.98	N/A	N/A	AVG
		5350.2	31.97	19.01	50.98	54	-3.02	AVG
		5352	41.78	19.03	60.81	74	-13.19	PK
		10640	40.33	18.03	58.36	74	-15.64	PK
		10640	34.9	18.03	52.93	54	-1.07	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

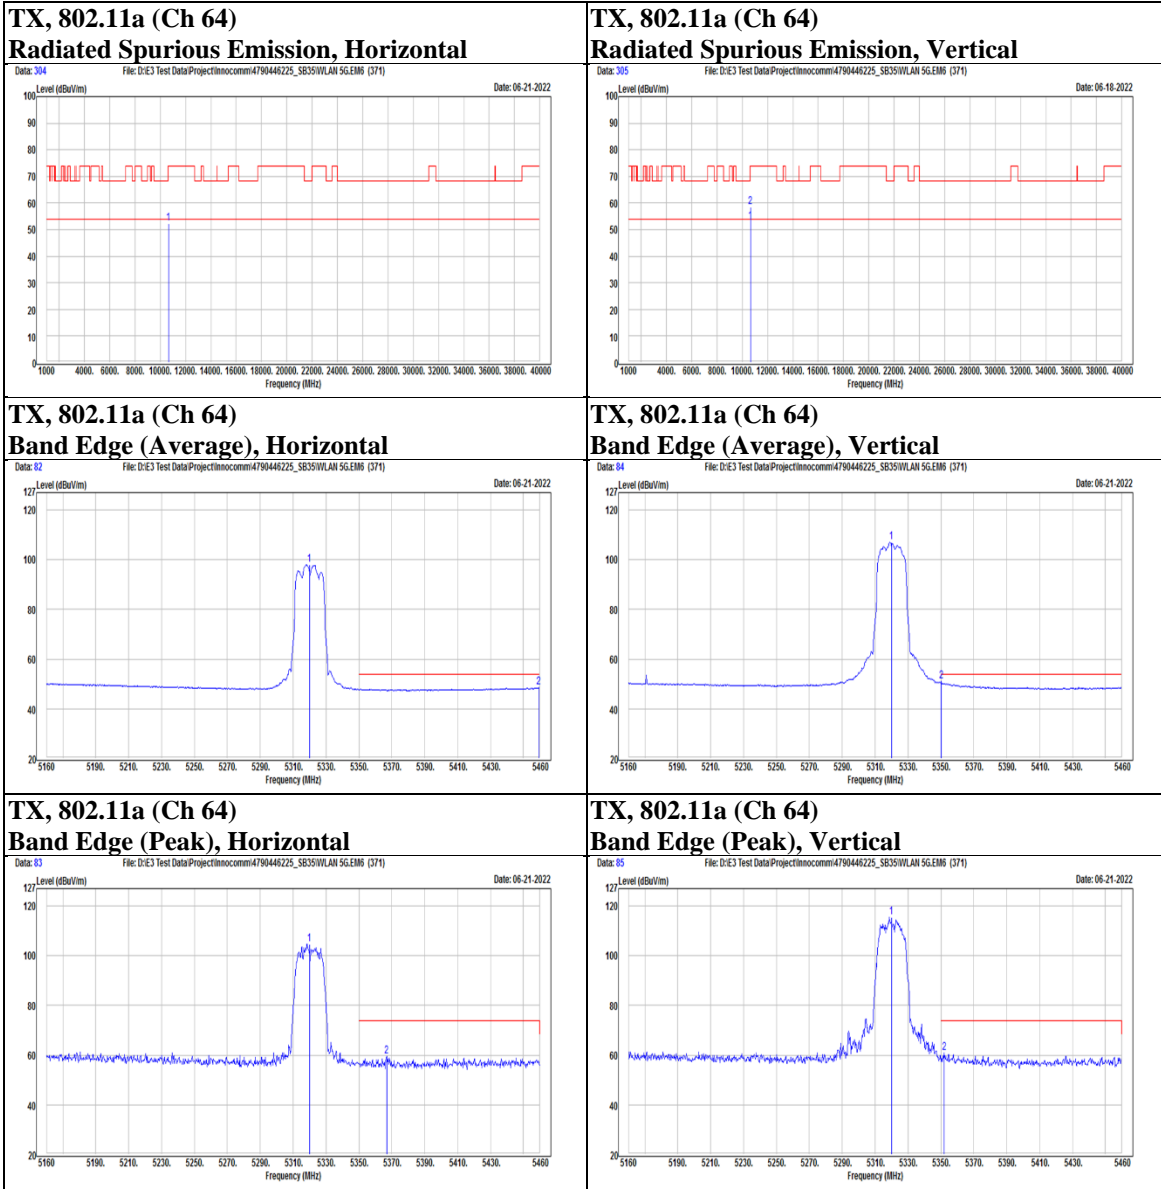

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790446225-US-R1-V0
Page : 104 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	100
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5435	38.93	19.45	58.38	74	-15.62	PK
		5435	28.9	19.45	48.35	54	-5.65	AVG
		5468.6	38.96	19.61	58.57	68.2	-9.63	PK
	@	5500	84.67	19.77	104.44	N/A	N/A	PK
	@	5500	78.43	19.77	98.2	N/A	N/A	AVG
	*	11000	35.12	18.41	53.53	74	-20.47	PK
Vertical		5458.1	42.07	19.56	61.63	74	-12.37	PK
		5458.1	30.2	19.56	49.76	54	-4.24	AVG
		5470	43.69	19.62	63.31	68.2	-4.89	PK
	@	5500	92.35	19.77	112.12	N/A	N/A	PK
	@	5500	86.15	19.77	105.92	N/A	N/A	AVG
		11000	43.97	18.41	62.38	74	-11.62	PK
		11000	34.68	18.41	53.09	54	-0.91	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

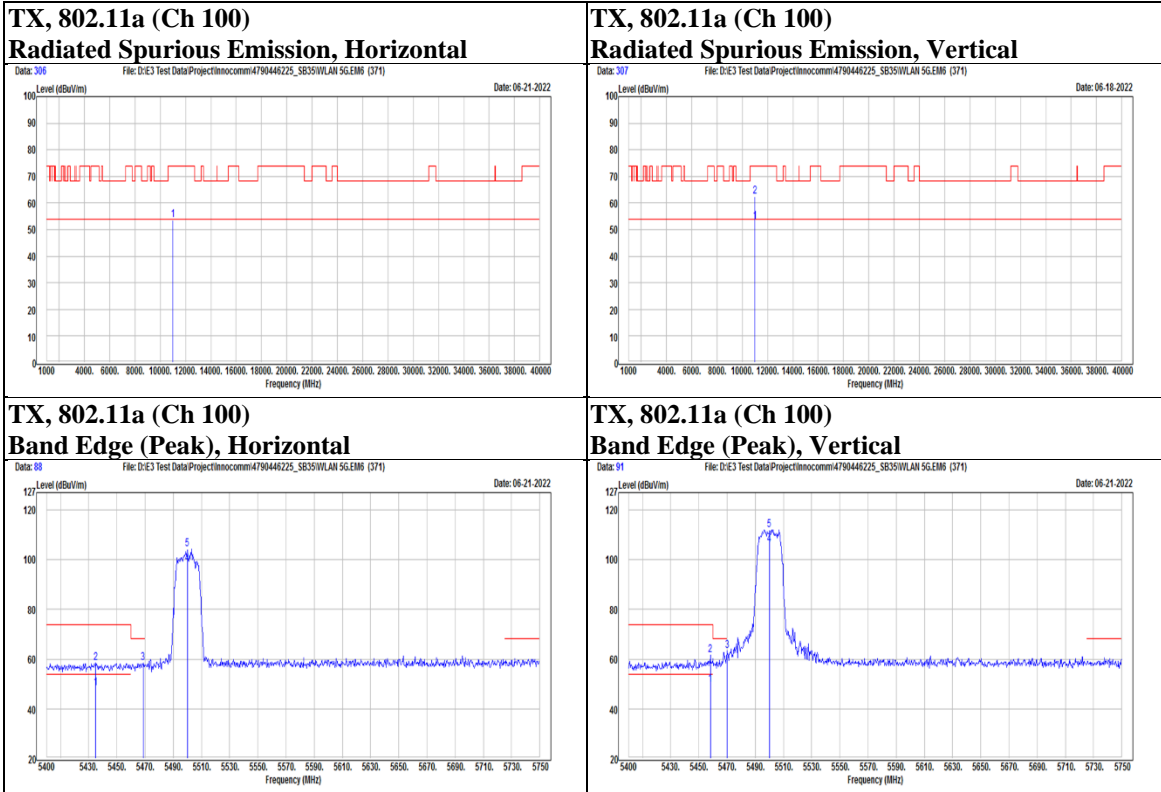

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11a	Channel	116
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5443.05	40.18	19.49	59.67	74	-14.33	PK
		5443.05	28.86	19.49	48.35	54	-5.65	AVG
		5460.9	38.45	19.57	58.02	68.2	-10.18	PK
	@	5580	83.44	19.76	103.2	N/A	N/A	PK
	@	5580	76.45	19.76	96.21	N/A	N/A	AVG
		5742.65	41.07	20.13	61.2	68.2	-7	PK
		11160	35.88	18.47	54.35	74	-19.65	PK
		11160	28.78	18.47	47.25	54	-6.75	AVG
Vertical		5435.35	41.54	19.45	60.99	74	-13.01	PK
		5435.35	29.3	19.45	48.75	54	-5.25	AVG
		5470	39.21	19.62	58.83	68.2	-9.37	PK
	@	5580	92.92	19.76	112.68	N/A	N/A	PK
	@	5580	86.68	19.76	106.44	N/A	N/A	AVG
		5737.4	40.64	20.08	60.72	68.2	-7.48	PK
		11160	42.71	18.47	61.18	74	-12.82	PK
		11160	35.5	18.47	53.97	54	-0.03	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

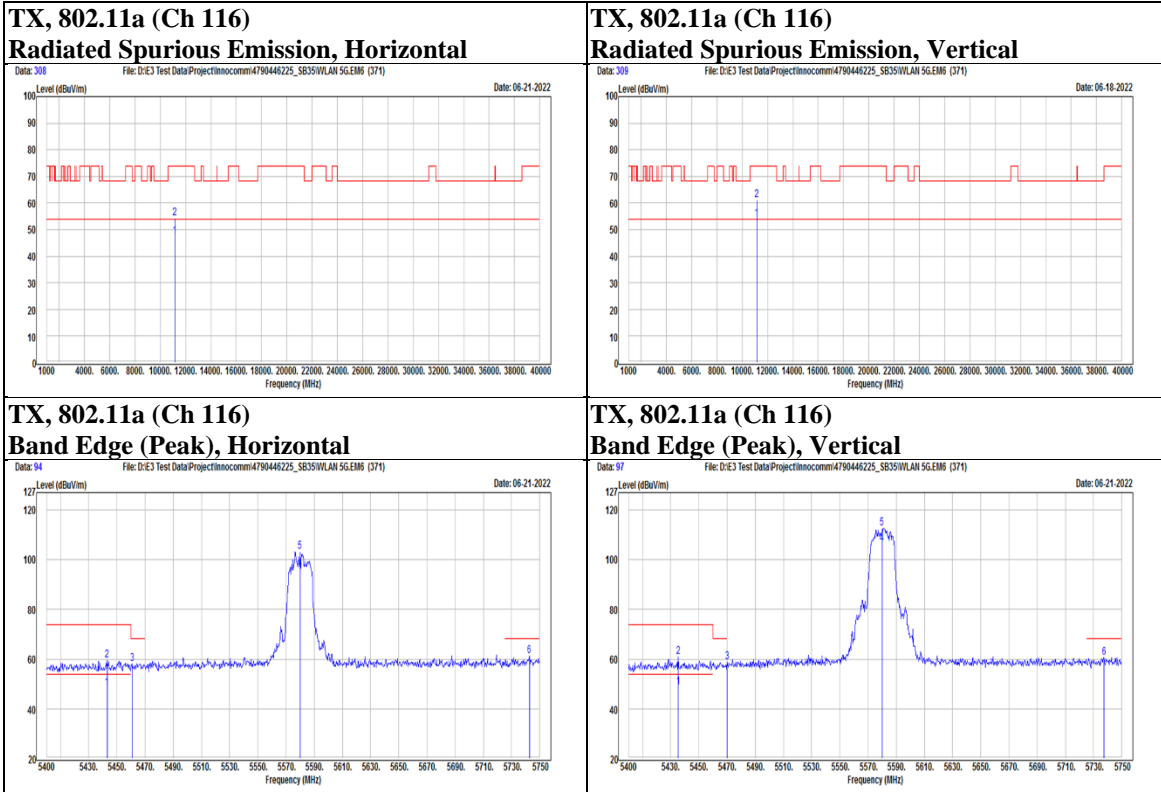

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790446225-US-R1-V0

Page : 108 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11a	Channel	140
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5700	78.5	19.73	98.23	N/A	N/A	PK
	@	5700	71.5	19.73	91.23	N/A	N/A	AVG
		5733.9	40.74	20.05	60.79	68.2	-7.41	PK
	*	11400	34.65	18.85	53.5	74	-20.5	PK
Vertical	@	5700	89.83	19.73	109.56	N/A	N/A	PK
	@	5700	82.96	19.73	102.69	N/A	N/A	AVG
		5745.8	40.89	20.16	61.05	68.2	-7.15	PK
		11400	41.55	18.85	60.4	74	-13.6	PK
		11400	34.55	18.85	53.4	54	-0.6	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

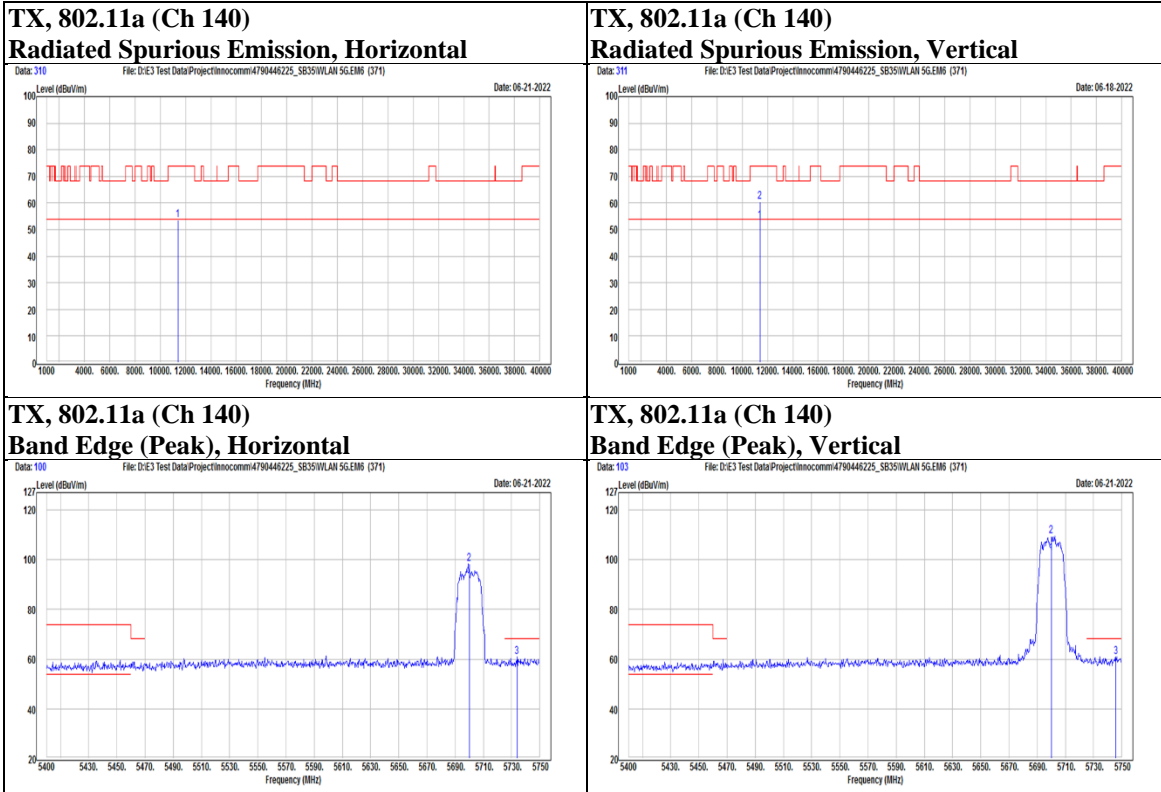

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790446225-US-R1-V0

Page : 110 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5544	40.79	19.82	60.61	68.2	-7.59	PK
		5665.5	40.83	19.69	60.52	79.7	-19.18	PK
	@	5745	79	20.15	99.15	N/A	N/A	PK
		11490	35.73	19.33	55.06	74	-18.94	PK
		11490	28.53	19.33	47.86	54	-6.14	AVG
Vertical		5631.5	41.7	19.68	61.38	68.2	-6.82	PK
		5699.5	40.85	19.73	60.58	104.83	-44.25	PK
	@	5745	89.73	20.15	109.88	N/A	N/A	PK
		11490	41.42	19.33	60.75	74	-13.25	PK
		11490	34.6	19.33	53.93	54	-0.07	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

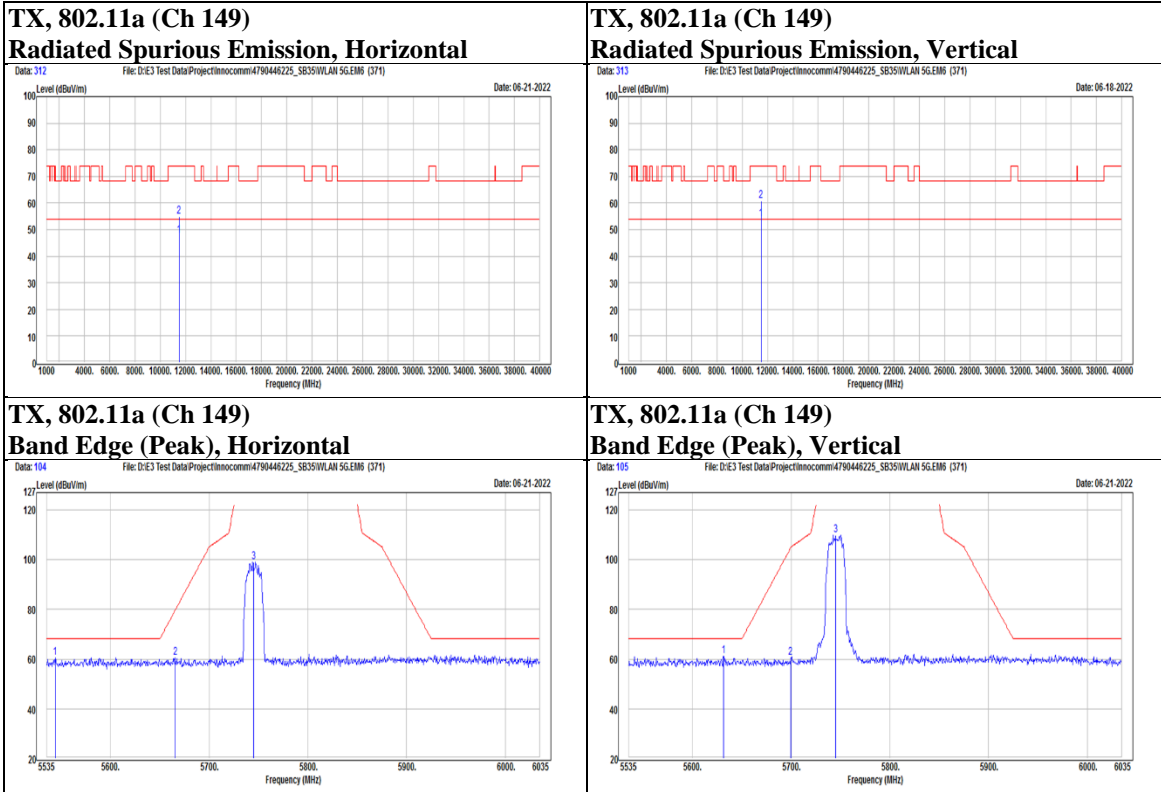

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790446225-US-R1-V0
Page : 112 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5632	41.62	19.68	61.3	68.2	-6.9	PK
		5679	40.72	19.7	60.42	68.2	-29.28	PK
	@	5785	80.09	20.45	100.54	N/A	N/A	PK
		5883.5	40.73	20.86	61.59	68.2	-37.3	PK
		5954	40.6	20.95	61.55	68.2	-6.65	PK
	*	11570	34.45	19.07	53.52	74	-20.48	PK
Vertical		5616.5	41.41	19.69	61.1	68.2	-7.1	PK
		5677	41.4	19.7	61.1	68.2	-27.12	PK
	@	5785	91.74	20.45	112.19	N/A	N/A	PK
		5908.5	40.8	20.97	61.77	68.2	-18.61	PK
		5950	41.8	20.94	62.74	68.2	-5.46	PK
		11570	41.83	19.07	60.9	74	-13.1	PK
		11570	34.61	19.07	53.68	54	-0.32	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

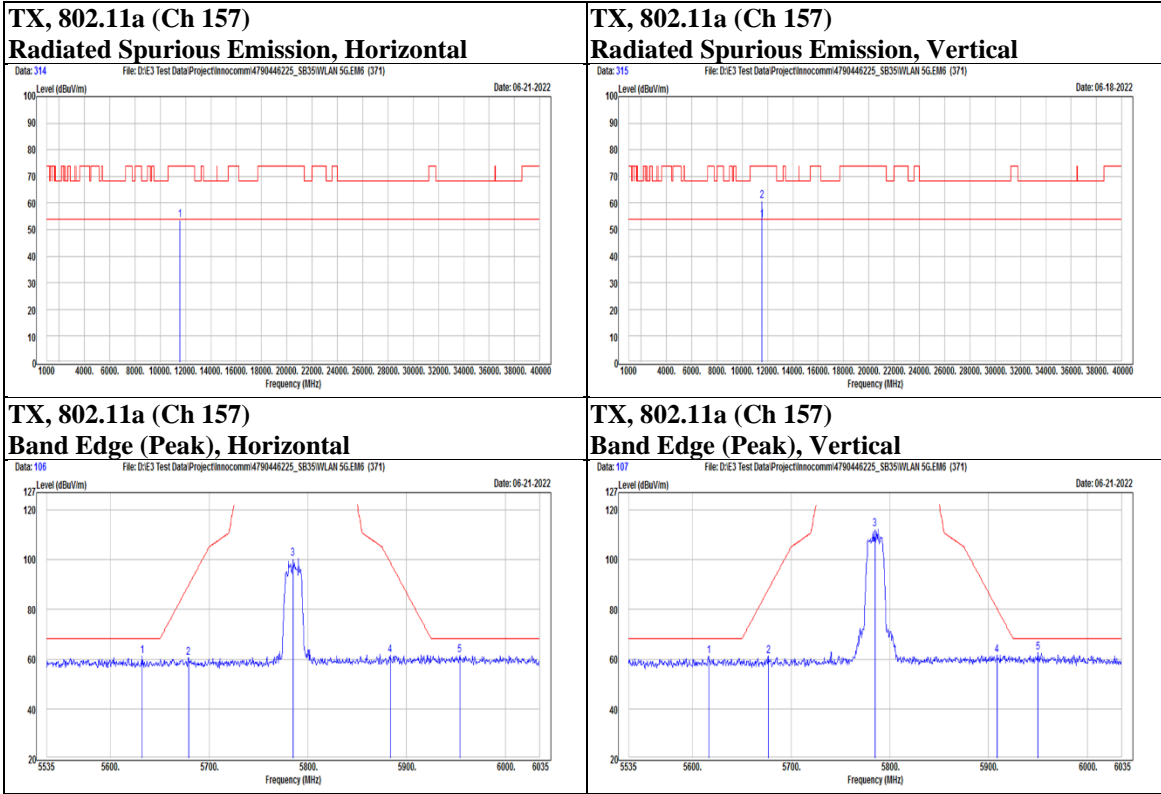

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790446225-US-R1-V0

Page : 114 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	80.06	20.58	100.64	N/A	N/A	PK
		5915.5	41.28	20.97	62.25	75.21	-12.96	PK
		5978	41.06	20.97	62.03	68.2	-6.17	PK
	*	11650	34.62	18.83	53.45	74	-20.55	PK
Vertical	@	5825	91.07	20.58	111.65	N/A	N/A	PK
		5907	40.71	20.97	61.68	81.48	-19.8	PK
		5935.5	41.44	20.95	62.39	68.2	-5.81	PK
		11650	41.31	18.83	60.14	74	-13.86	PK
		11650	34.84	18.83	53.67	54	-0.33	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11a (Ch 165)
Radiated Spurious Emission, Horizontal

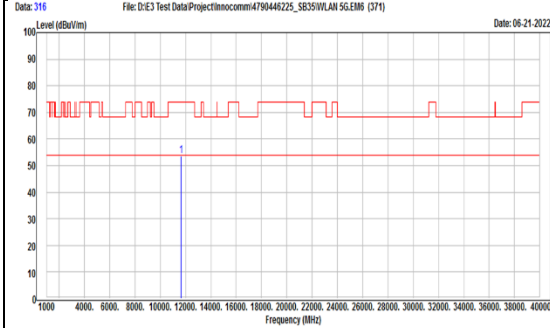


TX, 802.11a (Ch 165)
Radiated Spurious Emission, Vertical

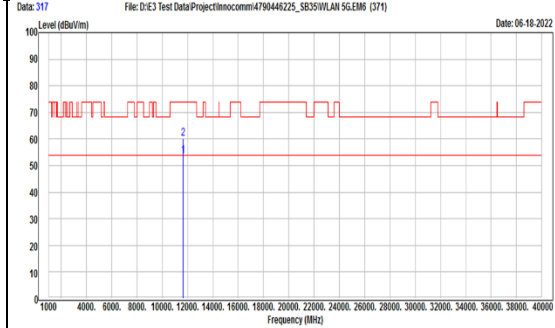

TX, 802.11a (Ch 165)
Band Edge (Peak), Horizontal

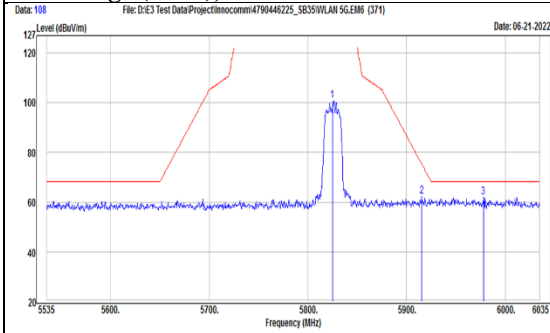

TX, 802.11a (Ch 165)
Band Edge (Peak), Vertical

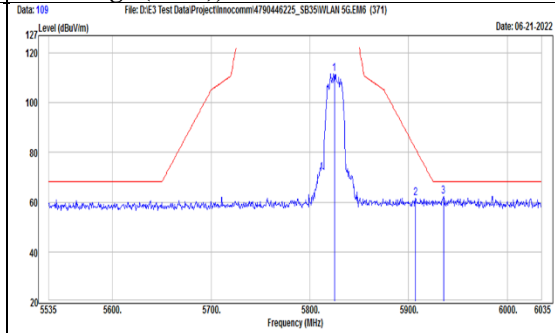



Mode	802.11ac(VHT20)	Channel	36
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5104.3	31.06	19.44	50.5	54	-3.5	AVG
		5149.8	43.14	19.4	62.54	74	-11.46	PK
	@	5180	83.62	19.31	102.93	N/A	N/A	PK
	@	5180	75.41	19.31	94.72	N/A	N/A	AVG
	*	10360	33.51	17.51	51.02	68.2	-17.18	PK
Vertical		5147	43.77	19.41	63.18	74	-10.82	PK
		5148.4	33.83	19.4	53.23	54	-0.77	AVG
	@	5180	94.23	19.31	113.54	N/A	N/A	PK
	@	5180	86.94	19.31	106.25	N/A	N/A	AVG
	*	10360	44.71	17.51	62.22	68.2	-5.98	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT20) (Ch 36)
Radiated Spurious Emission, Horizontal

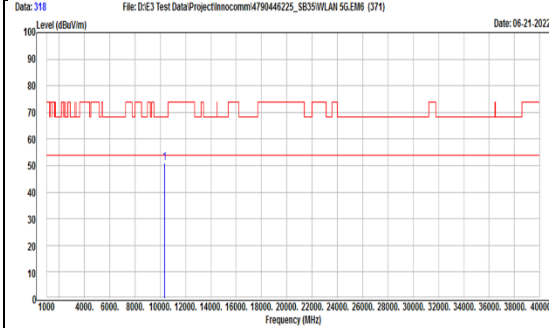


TX, 802.11ac(VHT20) (Ch 36)
Radiated Spurious Emission, Vertical

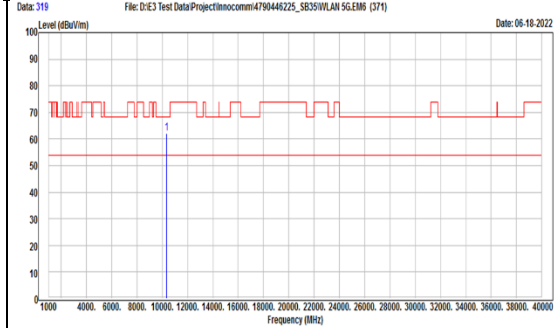


TX, 802.11ac(VHT20) (Ch 36)
Band Edge (Average), Horizontal

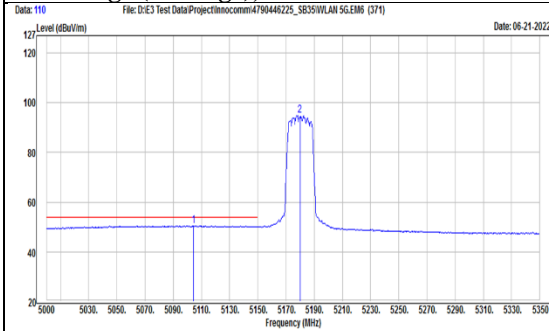


TX, 802.11ac(VHT20) (Ch 36)
Band Edge (Average), Vertical

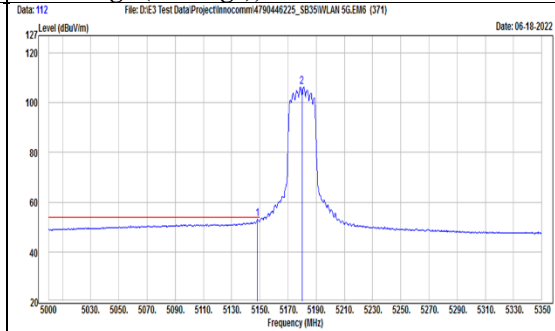

TX, 802.11ac(VHT20) (Ch 36)
Band Edge (Peak), Horizontal

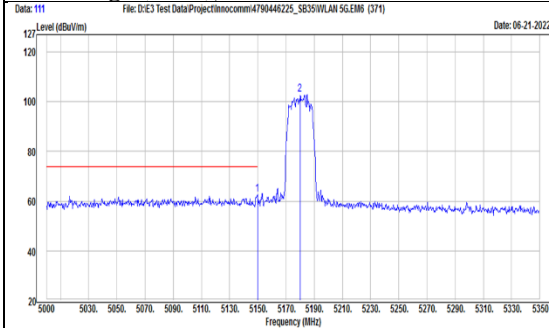

TX, 802.11ac(VHT20) (Ch 36)
Band Edge (Peak), Vertical

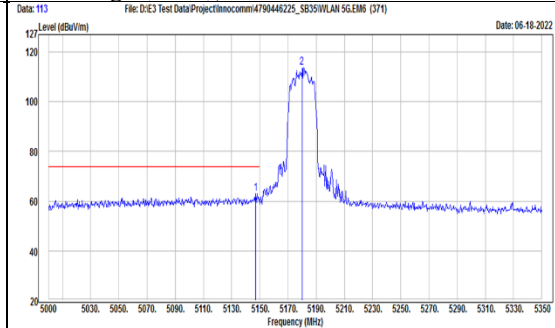



Test report No. : 4790446225-US-R1-V0

Page : 118 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	44
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5056	43.1	19.13	62.23	74	-11.77	PK
		5091.7	30.84	19.38	50.22	54	-3.78	AVG
	@	5220	86.32	19.12	105.44	N/A	N/A	PK
	@	5220	79.41	19.12	98.53	N/A	N/A	AVG
	*	10440	39.52	17.81	57.33	68.2	-10.87	PK
Vertical		5112.7	31.65	19.43	51.08	54	-2.92	AVG
		5116.55	43.44	19.43	62.87	74	-11.13	PK
	@	5220	95.52	19.12	114.64	N/A	N/A	PK
	@	5220	88.16	19.12	107.28	N/A	N/A	AVG
	*	10440	46.87	17.81	64.68	68.2	-3.52	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT20) (Ch 44)
Radiated Spurious Emission, Horizontal

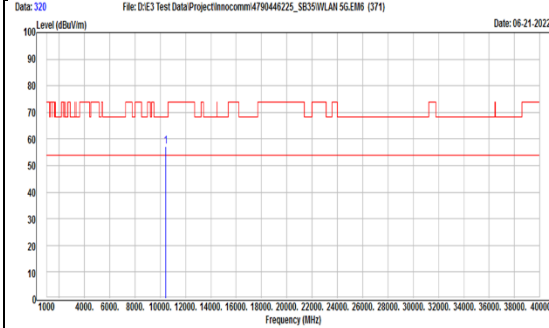


TX, 802.11ac(VHT20) (Ch 44)
Radiated Spurious Emission, Vertical

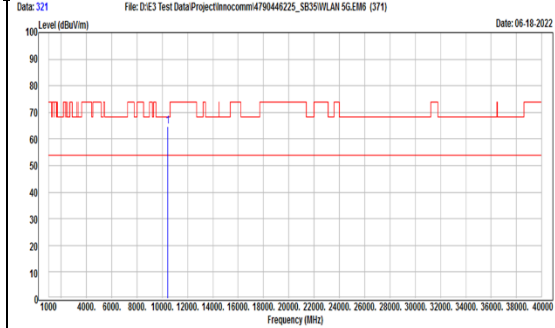


TX, 802.11ac(VHT20) (Ch 44)
Band Edge (Average), Horizontal

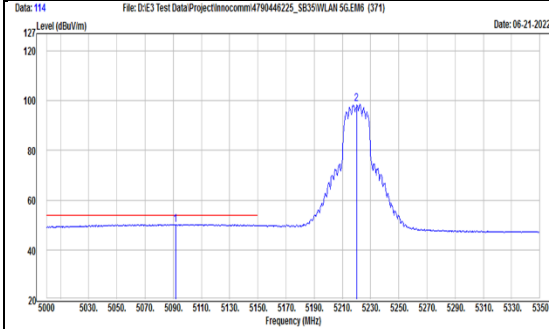


TX, 802.11ac(VHT20) (Ch 44)
Band Edge (Average), Vertical

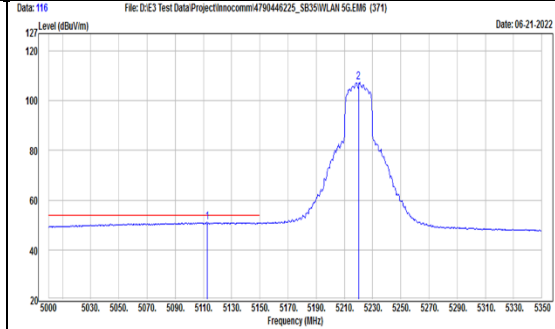

TX, 802.11ac(VHT20) (Ch 44)
Band Edge (Peak), Horizontal

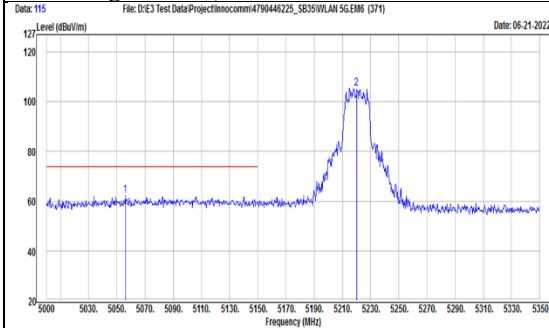

TX, 802.11ac(VHT20) (Ch 44)
Band Edge (Peak), Vertical

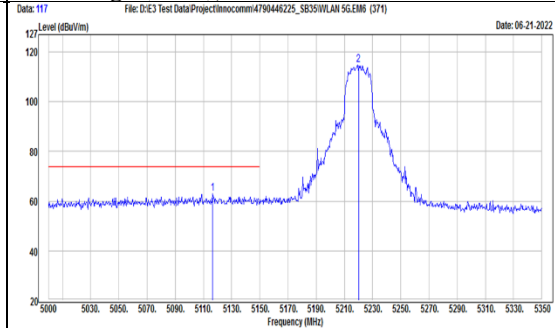

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790446225-US-R1-V0

Page : 120 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	48
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5093.8	30.67	19.39	50.06	54	-3.94	AVG
		5143.5	42.4	19.4	61.8	74	-12.2	PK
	@	5240	87.65	18.97	106.62	N/A	N/A	PK
	@	5240	78.99	18.97	97.96	N/A	N/A	AVG
	*	10480	40.47	17.92	58.39	68.2	-9.81	PK
Vertical		5110.25	43.23	19.44	62.67	74	-11.33	PK
		5120.05	31.1	19.43	50.53	54	-3.47	AVG
	@	5240	97.45	18.97	116.42	N/A	N/A	PK
	@	5240	87.58	18.97	106.55	N/A	N/A	AVG
	*	10480	48.03	17.92	65.95	68.2	-2.25	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT20) (Ch 48)
Radiated Spurious Emission, Horizontal

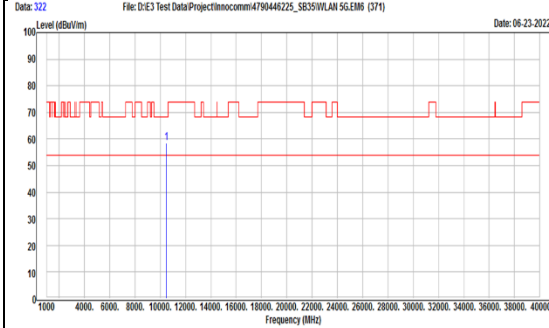


TX, 802.11ac(VHT20) (Ch 48)
Radiated Spurious Emission, Vertical

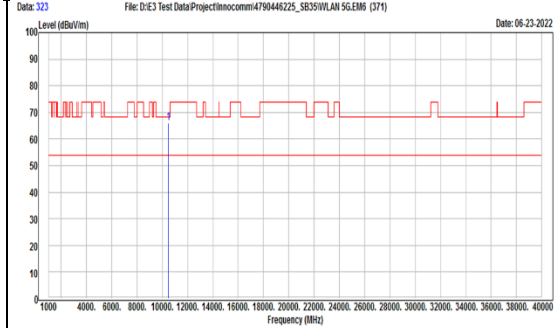


TX, 802.11ac(VHT20) (Ch 48)
Band Edge (Average), Horizontal

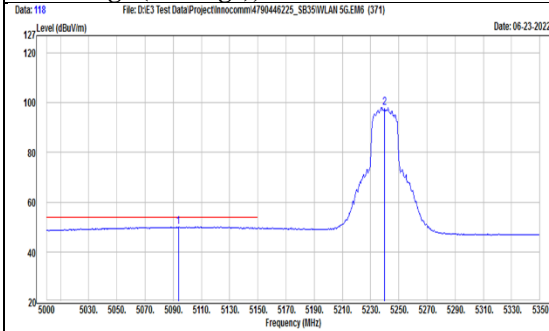


TX, 802.11ac(VHT20) (Ch 48)
Band Edge (Average), Vertical

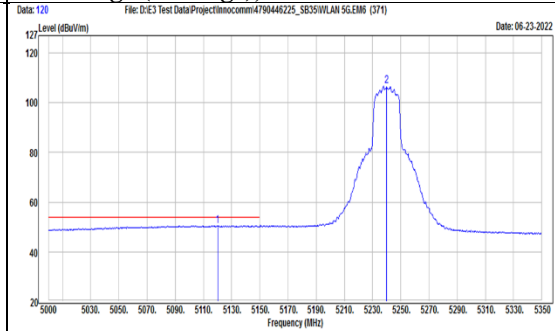

TX, 802.11ac(VHT20) (Ch 48)
Band Edge (Peak), Horizontal

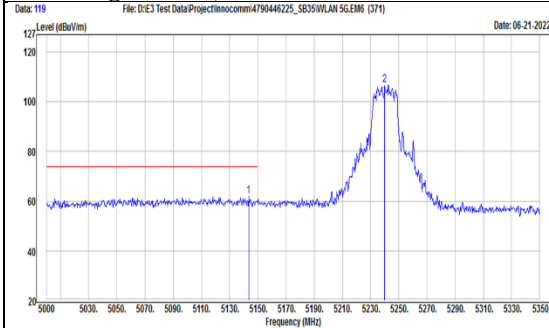

TX, 802.11ac(VHT20) (Ch 48)
Band Edge (Peak), Vertical

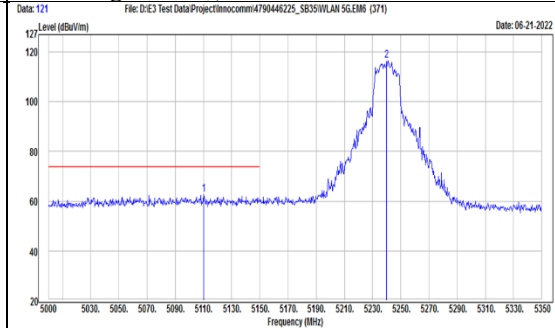



Test report No. : 4790446225-US-R1-V0
Page : 122 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	52
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	87.29	18.88	106.17	N/A	N/A	PK
	@	5260	80.16	18.88	99.04	N/A	N/A	AVG
		5434.2	39.89	19.44	59.33	74	-14.67	PK
		5451.9	28.75	19.53	48.28	54	-5.72	AVG
	*	10520	40.86	17.99	58.85	68.2	-9.35	PK
Vertical	@	5260	97.27	18.88	116.15	N/A	N/A	PK
	@	5260	88.51	18.88	107.39	N/A	N/A	AVG
		5361.3	29.56	19.08	48.64	54	-5.36	AVG
		5457.6	39.55	19.55	59.1	74	-14.9	PK
	*	10520	46.58	17.99	64.57	68.2	-3.63	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT20) (Ch 52)
Radiated Spurious Emission, Horizontal

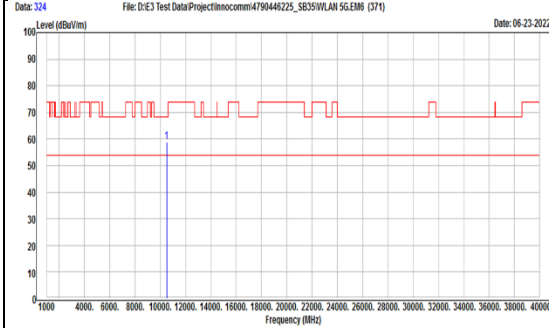


TX, 802.11ac(VHT20) (Ch 52)
Radiated Spurious Emission, Vertical

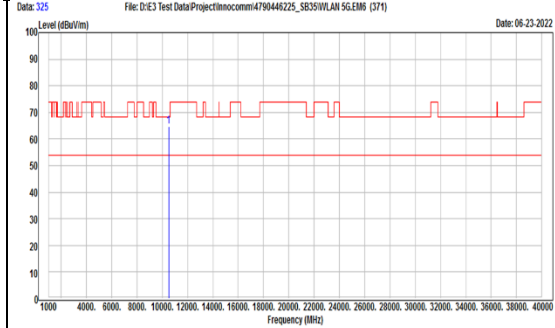


TX, 802.11ac(VHT20) (Ch 52)
Band Edge (Average), Horizontal

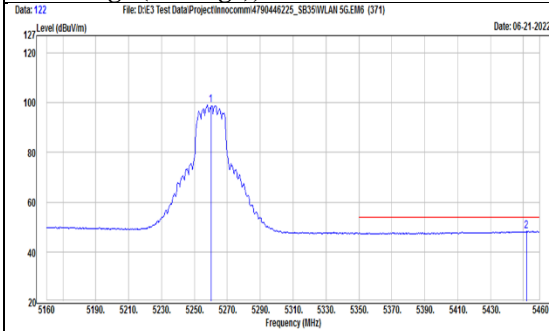


TX, 802.11ac(VHT20) (Ch 52)
Band Edge (Average), Vertical

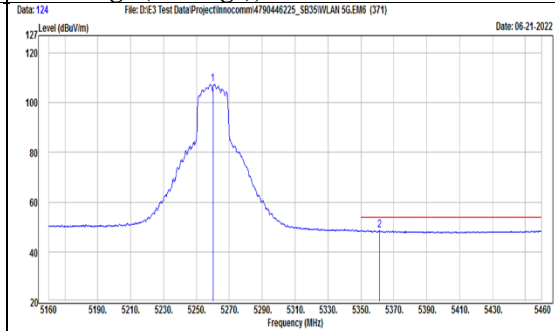

TX, 802.11ac(VHT20) (Ch 52)
Band Edge (Peak), Horizontal

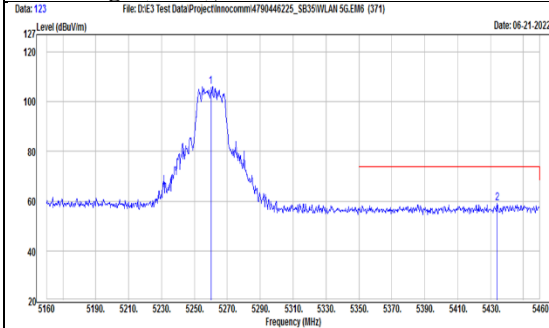

TX, 802.11ac(VHT20) (Ch 52)
Band Edge (Peak), Vertical

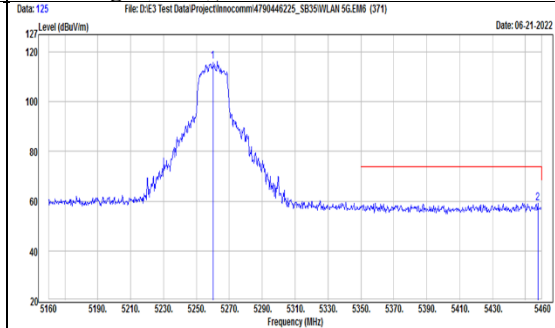



Test report No. : 4790446225-US-R1-V0
Page : 124 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	60
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	85.93	18.77	104.7	N/A	N/A	PK
	@	5300	77.89	18.77	96.66	N/A	N/A	AVG
		5422.2	40.54	19.38	59.92	74	-14.08	PK
		5456.4	28.79	19.55	48.34	54	-5.66	AVG
	*	10600	35.24	18.04	53.28	68.2	-14.92	PK
Vertical	@	5300	95.51	18.77	114.28	N/A	N/A	PK
	@	5300	87.19	18.77	105.96	N/A	N/A	AVG
		5351.7	30.04	19.02	49.06	54	-4.94	AVG
		5429.7	40.62	19.42	60.04	74	-13.96	PK
		10600	45.97	18.04	64.01	68.2	-4.19	PK
		10600	35.93	18.04	53.97	54	-0.03	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT20) (Ch 60)
Radiated Spurious Emission, Horizontal

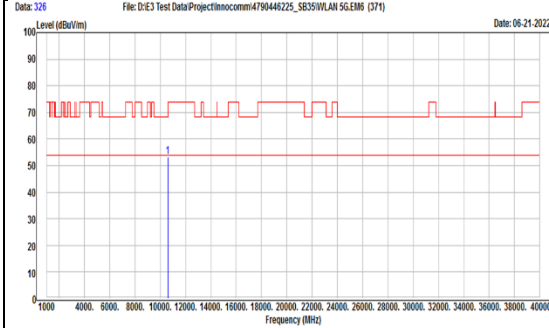


TX, 802.11ac(VHT20) (Ch 60)
Radiated Spurious Emission, Vertical

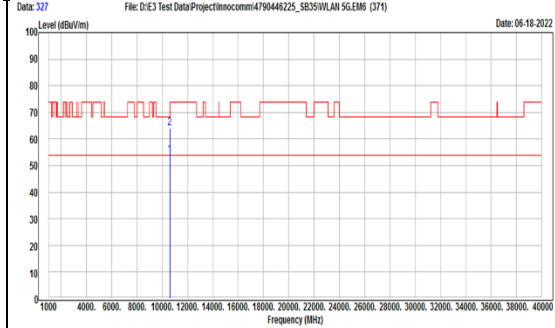


TX, 802.11ac(VHT20) (Ch 60)
Band Edge (Average), Horizontal

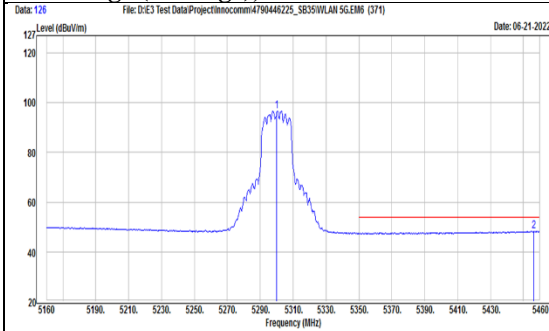


TX, 802.11ac(VHT20) (Ch 60)
Band Edge (Average), Vertical

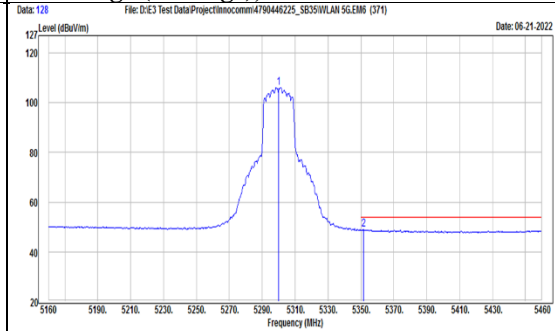

TX, 802.11ac(VHT20) (Ch 60)
Band Edge (Peak), Horizontal

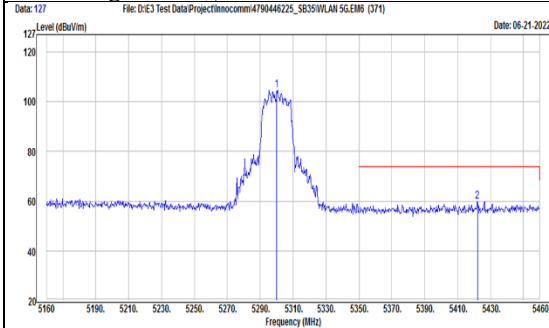

TX, 802.11ac(VHT20) (Ch 60)
Band Edge (Peak), Vertical

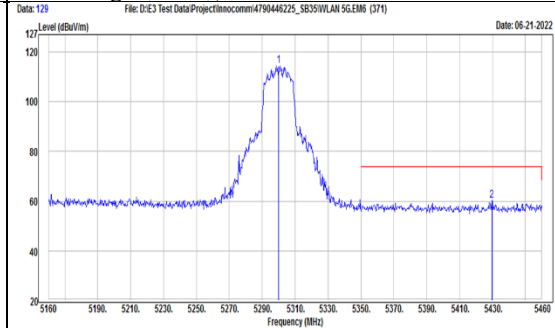



Test report No. : 4790446225-US-R1-V0
Page : 126 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	64
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	86.39	18.86	105.25	N/A	N/A	PK
	@	5320	77.8	18.86	96.66	N/A	N/A	AVG
		5351.1	40.53	19.01	59.54	74	-14.46	PK
		5458.2	28.71	19.56	48.27	54	-5.73	AVG
	*	10640	34.9	18.03	52.93	74	-21.07	PK
Vertical	@	5320	95.14	18.86	114	N/A	N/A	PK
	@	5320	87.14	18.86	106	N/A	N/A	AVG
		5350.2	31.69	19.01	50.7	54	-3.3	AVG
		5353.2	47.13	19.03	66.16	74	-7.84	PK
		10640	46.72	18.03	64.75	74	-9.25	PK
		10640	35.8	18.03	53.83	54	-0.17	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT20) (Ch 64)
Radiated Spurious Emission, Horizontal

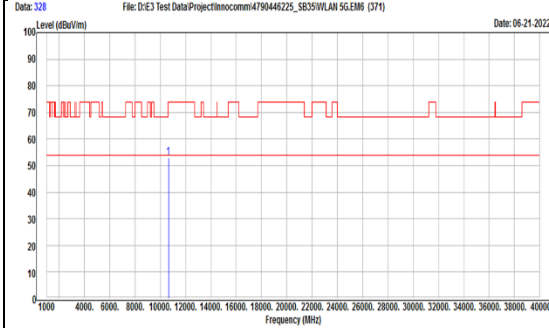


TX, 802.11ac(VHT20) (Ch 64)
Radiated Spurious Emission, Vertical

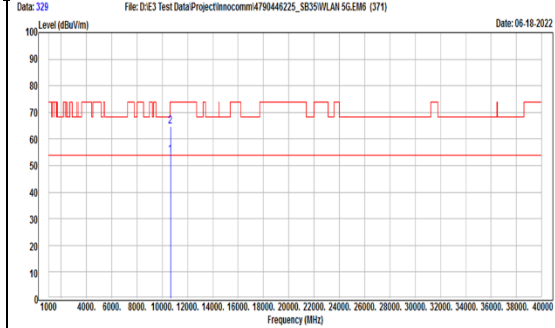


TX, 802.11ac(VHT20) (Ch 64)
Band Edge (Average), Horizontal

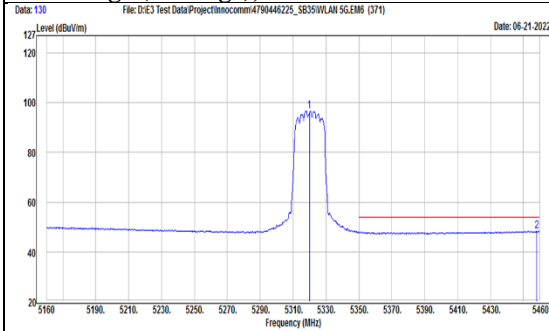


TX, 802.11ac(VHT20) (Ch 64)
Band Edge (Average), Vertical

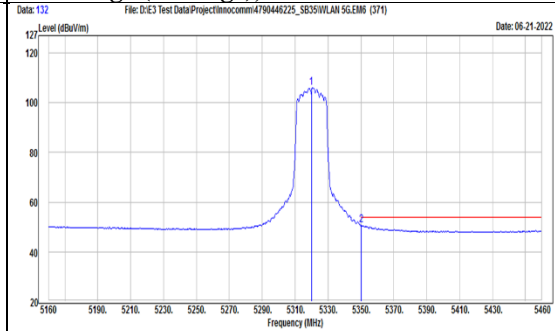

TX, 802.11ac(VHT20) (Ch 64)
Band Edge (Peak), Horizontal

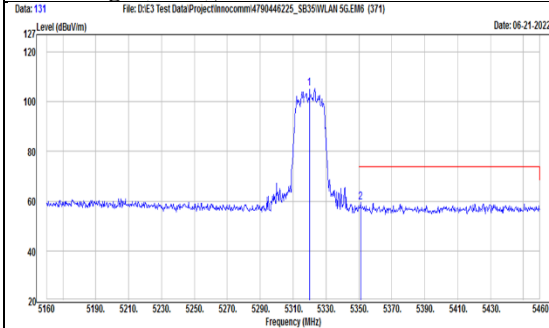

TX, 802.11ac(VHT20) (Ch 64)
Band Edge (Peak), Vertical

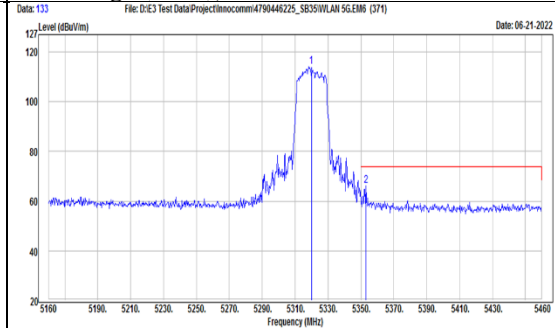



Test report No. : 4790446225-US-R1-V0
Page : 128 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	100
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5430.45	39.87	19.42	59.29	74	-14.71	PK
		5459.85	28.87	19.57	48.44	54	-5.56	AVG
		5462.3	39.6	19.58	59.18	68.2	-9.02	PK
	@	5500	84.89	19.77	104.66	N/A	N/A	PK
	@	5500	76.44	19.77	96.21	N/A	N/A	AVG
	*	11000	33.75	18.41	52.16	74	-21.84	PK
Vertical		5459.85	41	19.57	60.57	74	-13.43	PK
		5459.85	28.83	19.57	48.4	54	-5.6	AVG
		5459.85	29.94	19.57	49.51	54	-4.49	AVG
		5467.2	43.58	19.61	63.19	68.2	-5.01	PK
	@	5500	92.59	19.77	112.36	N/A	N/A	PK
	@	5500	84.77	19.77	104.54	N/A	N/A	AVG
		11000	45.39	18.41	63.8	74	-10.2	PK
		11000	35.56	18.41	53.97	54	-0.03	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

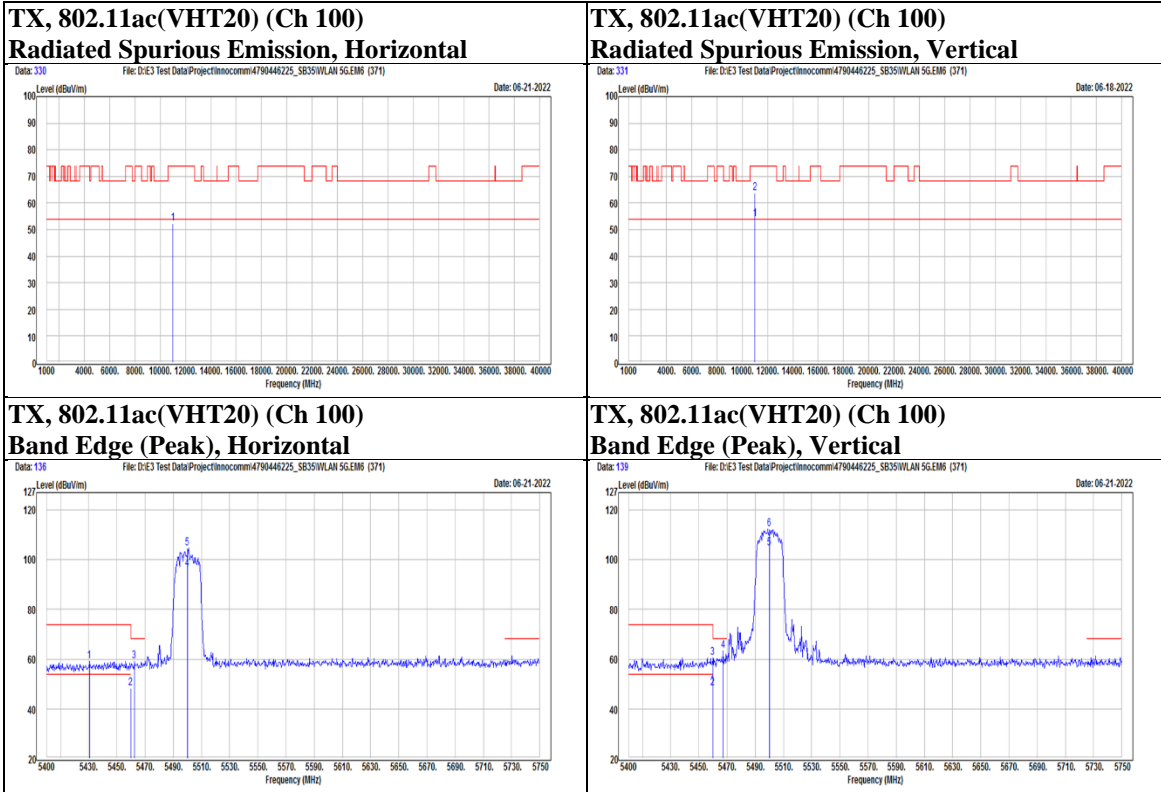

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Mode	802.11ac(VHT20)	Channel	116
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5454.25	40.67	19.54	60.21	74	-13.79	PK
		5454.25	28.63	19.54	48.17	54	-5.83	AVG
		5461.6	39.38	19.58	58.96	68.2	-9.24	PK
	@	5580	83.11	19.76	102.87	N/A	N/A	PK
	@	5580	76.36	19.76	96.12	N/A	N/A	AVG
		5746.85	40.28	20.16	60.44	68.2	-7.76	PK
	*	11160	32.14	18.47	50.61	74	-23.39	PK
Vertical		5413.3	40.46	19.33	59.79	74	-14.21	PK
		5413.3	29.43	19.33	48.76	54	-5.24	AVG
		5466.85	39.15	19.61	58.76	68.2	-9.44	PK
	@	5580	92.88	19.76	112.64	N/A	N/A	PK
	@	5580	85.42	19.76	105.18	N/A	N/A	AVG
		5725.5	41.5	19.96	61.46	68.2	-6.74	PK
		11160	44.43	18.47	62.9	74	-11.1	PK
		11160	35.1	18.47	53.57	54	-0.43	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT20) (Ch 116)
Radiated Spurious Emission, Horizontal

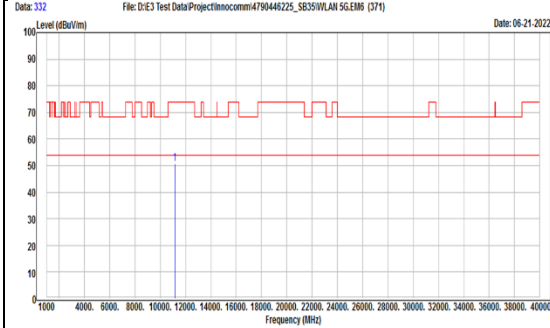


TX, 802.11ac(VHT20) (Ch 116)
Radiated Spurious Emission, Vertical

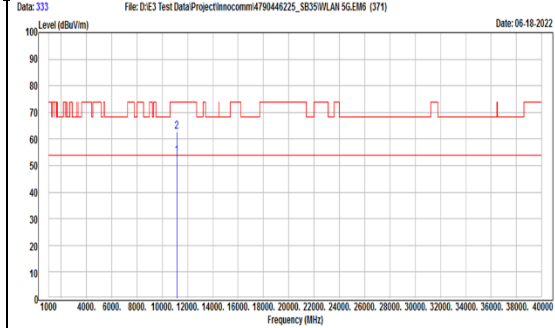

TX, 802.11ac(VHT20) (Ch 116)
Band Edge (Peak), Horizontal

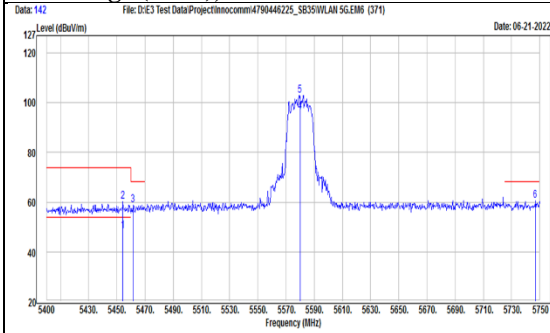

TX, 802.11ac(VHT20) (Ch 116)
Band Edge (Peak), Vertical

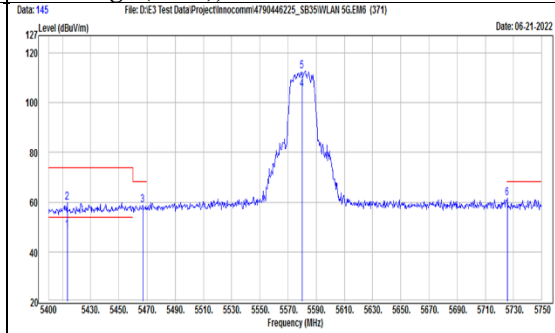



Test report No. : 4790446225-US-R1-V0
Page : 132 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	140
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5700	78.58	19.73	98.31	N/A	N/A	PK
	@	5700	69.92	19.73	89.65	N/A	N/A	AVG
		5743.7	40.73	20.14	60.87	68.2	-7.33	PK
	*	11400	34.72	18.85	53.57	74	-20.43	PK
Vertical	@	5700	89.39	19.73	109.12	N/A	N/A	PK
	@	5700	81.16	19.73	100.89	N/A	N/A	AVG
		5732.15	41.14	20.03	61.17	68.2	-7.03	PK
		11400	46.99	18.85	65.84	74	-8.16	PK
		11400	35	18.85	53.85	54	-0.15	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

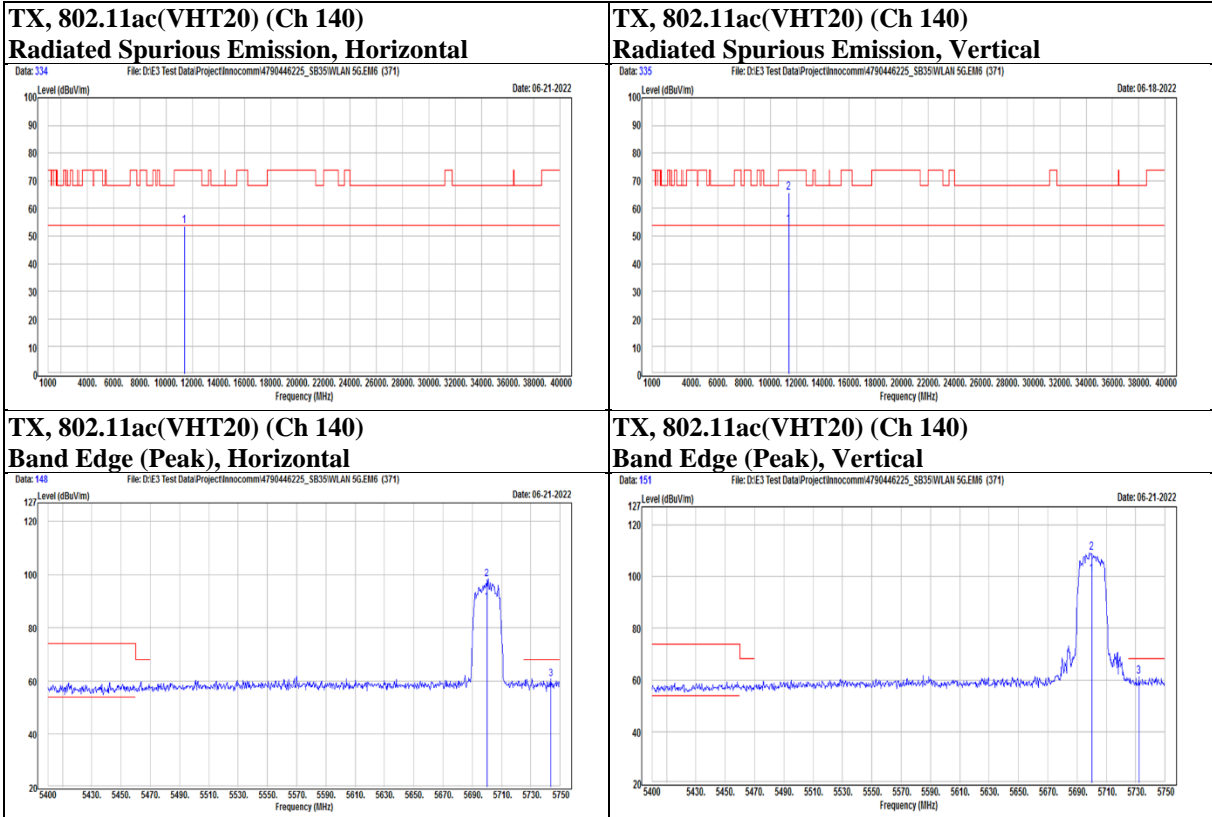



Test report No. : 4790446225-US-R1-V0
Page : 134 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5604	40.59	19.7	60.29	68.2	-7.91	PK
		5692	40.32	19.72	60.04	99.3	-39.26	PK
	@	5745	78.44	20.15	98.59	N/A	N/A	PK
		11490	37.7	19.33	57.03	74	-16.97	PK
		11490	29.9	19.33	49.23	54	-4.77	AVG
Vertical		5636	40.82	19.68	60.5	68.2	-7.7	PK
		5696.5	40.91	19.72	60.63	102.62	-41.99	PK
	@	5745	88.95	20.15	109.1	N/A	N/A	PK
		11490	40.62	19.33	59.95	74	-14.05	PK
		11490	34.5	19.33	53.83	54	-0.17	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT20) (Ch 149)
Radiated Spurious Emission, Horizontal

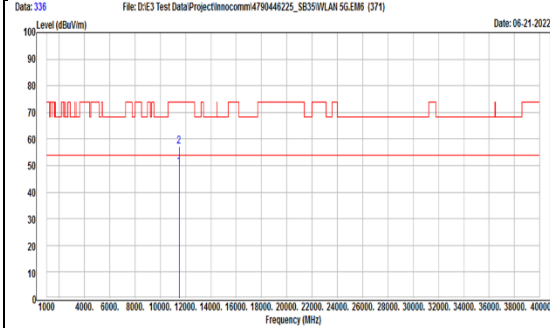


TX, 802.11ac(VHT20) (Ch 149)
Radiated Spurious Emission, Vertical

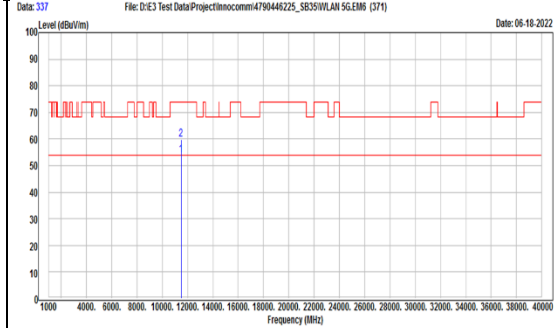

TX, 802.11ac(VHT20) (Ch 149)
Band Edge (Peak), Horizontal

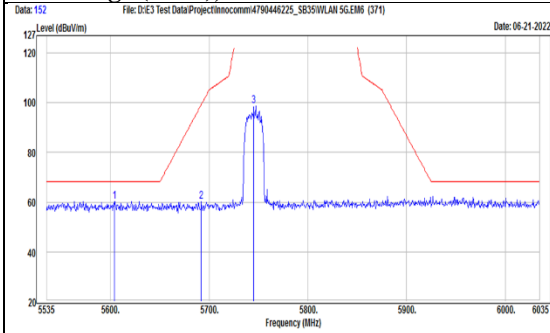

TX, 802.11ac(VHT20) (Ch 149)
Band Edge (Peak), Vertical

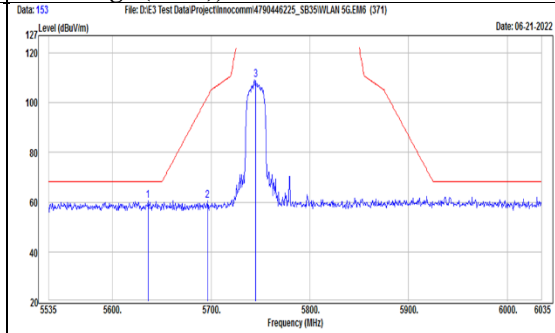



Test report No. : 4790446225-US-R1-V0
Page : 136 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	157
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5590.5	41.55	19.73	61.28	68.2	-6.92	PK
		5675.5	40.67	19.7	60.37	87.11	-26.74	PK
	@	5785	78.76	20.45	99.21	N/A	N/A	PK
		5918	40.9	20.96	61.86	73.36	-11.5	PK
		5925.5	40.51	20.96	61.47	68.2	-6.73	PK
	*	11570	32.89	19.07	51.96	74	-22.04	PK
Vertical		5561	40.52	19.81	60.33	68.2	-7.87	PK
		5699.5	40.33	19.73	60.06	104.83	-44.77	PK
	@	5785	88.32	20.45	108.77	N/A	N/A	PK
		5882.5	40.7	20.85	61.55	99.63	-38.08	PK
		6000	40.72	21	61.72	68.2	-6.48	PK
		11570	41.54	19.07	60.61	74	-13.39	PK
		11570	34.21	19.07	53.28	54	-0.72	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

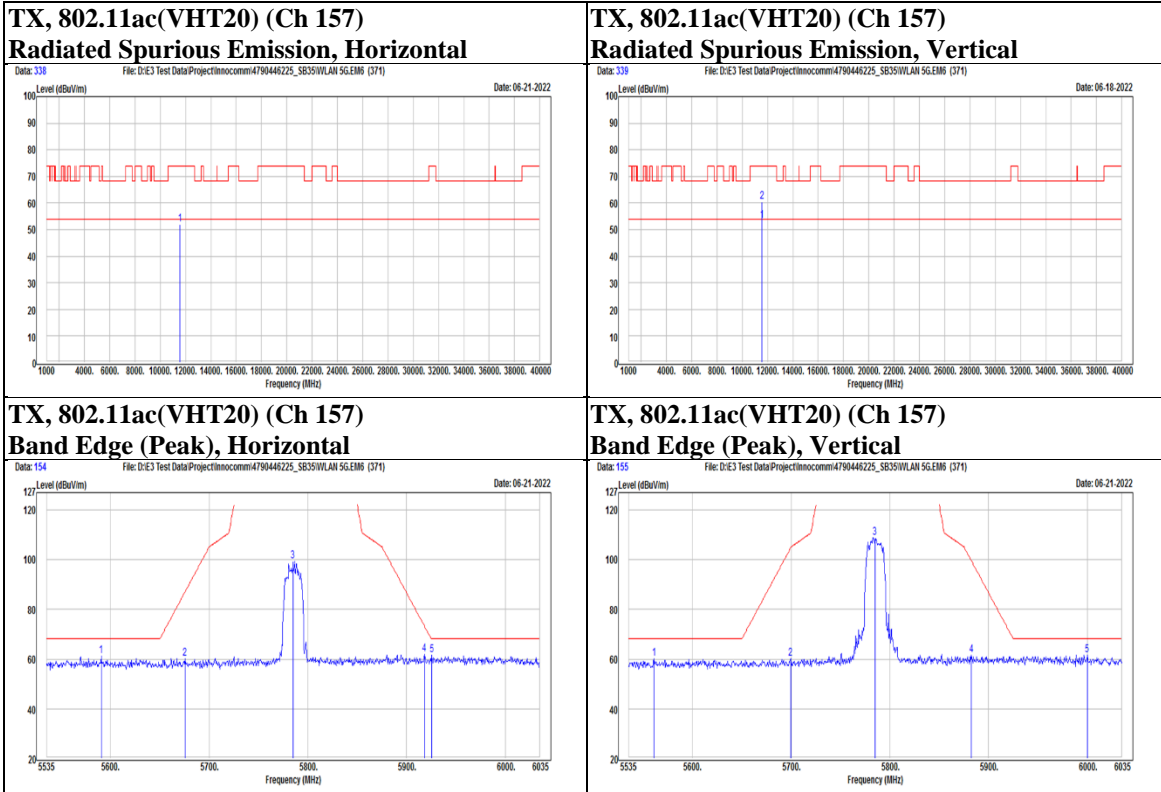

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Test report No. : 4790446225-US-R1-V0

Page : 138 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT20)	Channel	165
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	78.05	20.58	98.63	N/A	N/A	PK
		5907.5	42.03	20.97	63	81.11	-18.11	PK
		5956	40.35	20.95	61.3	68.2	-6.9	PK
	*	11650	34.16	18.83	52.99	74	-21.01	PK
Vertical	@	5825	89.95	20.58	110.53	N/A	N/A	PK
		5924.5	40.64	20.96	61.6	68.57	-6.97	PK
		5964	40.86	20.96	61.82	68.2	-6.38	PK
		11650	39.66	18.83	58.49	74	-15.51	PK
		11650	34.3	18.83	53.13	54	-0.87	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

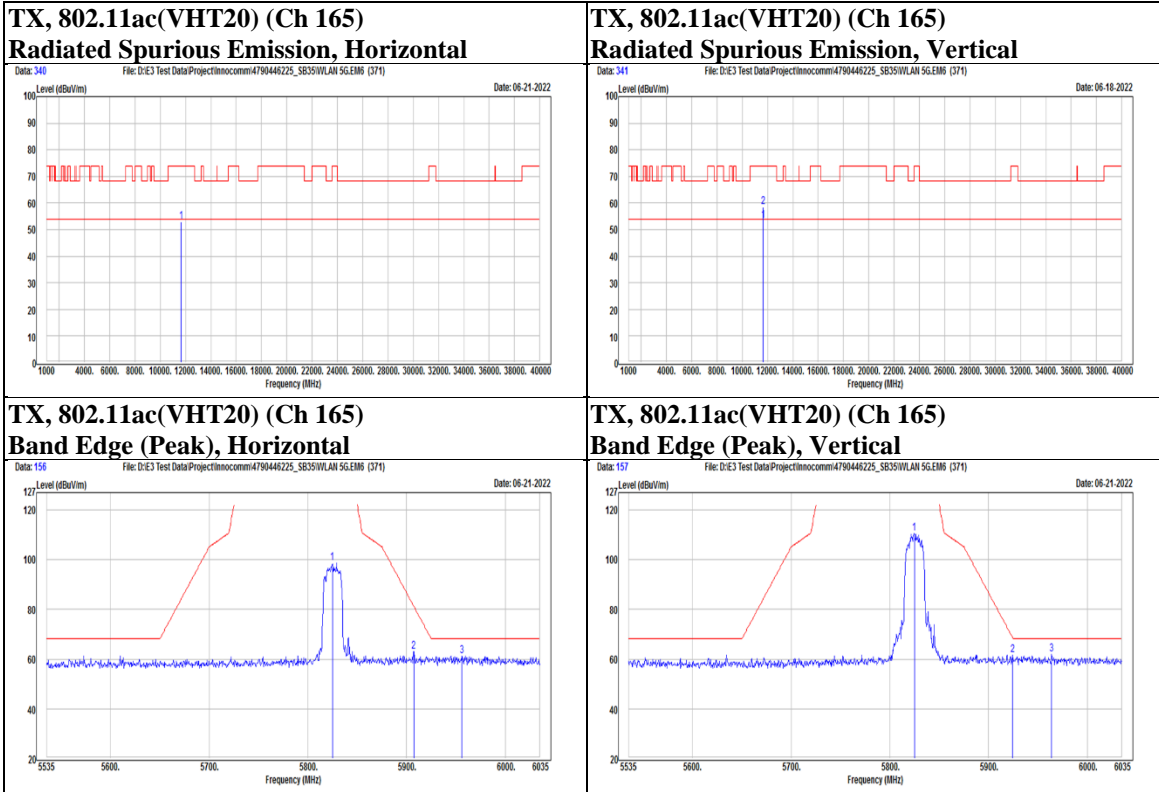



Test report No. : 4790446225-US-R1-V0
Page : 140 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	38
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5145.6	30.63	19.4	50.03	54	-3.97	AVG
		5146.3	42.15	19.41	61.56	74	-12.44	PK
	@	5190	80.65	19.29	99.94	N/A	N/A	PK
	@	5190	71.68	19.29	90.97	N/A	N/A	AVG
	*	10380	31.49	17.61	49.1	68.2	-19.1	PK
Vertical		5148.4	45.68	19.4	65.08	74	-8.92	PK
		5148.4	34.27	19.4	53.67	54	-0.33	AVG
	@	5190	90.47	19.29	109.76	N/A	N/A	PK
	@	5190	83.51	19.29	102.8	N/A	N/A	AVG
	*	10380	35.63	17.61	53.24	68.2	-14.96	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0