






TX, 802.11ac(VHT40) (Ch 38)
Radiated Spurious Emission, Horizontal

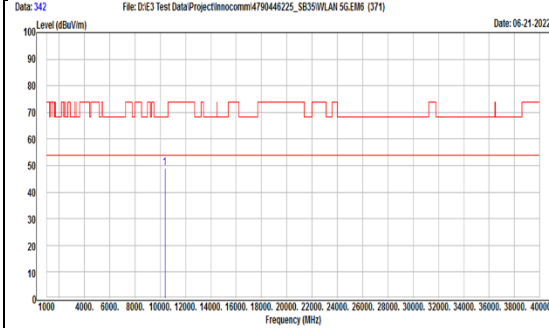


TX, 802.11ac(VHT40) (Ch 38)
Radiated Spurious Emission, Vertical

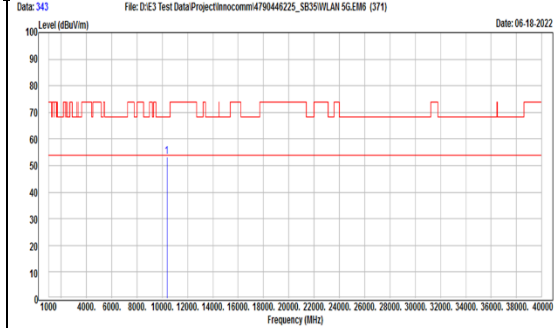


TX, 802.11ac(VHT40) (Ch 38)
Band Edge (Average), Horizontal

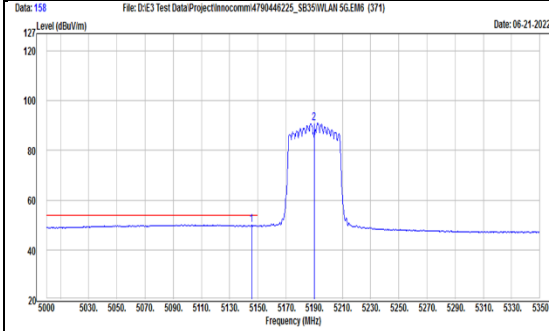


TX, 802.11ac(VHT40) (Ch 38)
Band Edge (Average), Vertical

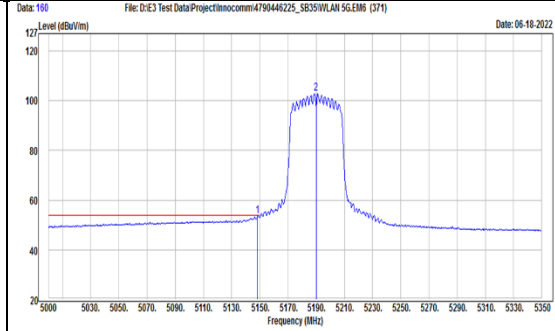

TX, 802.11ac(VHT40) (Ch 38)
Band Edge (Peak), Horizontal

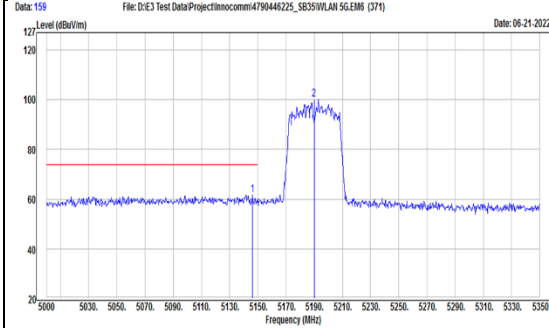

TX, 802.11ac(VHT40) (Ch 38)
Band Edge (Peak), Vertical

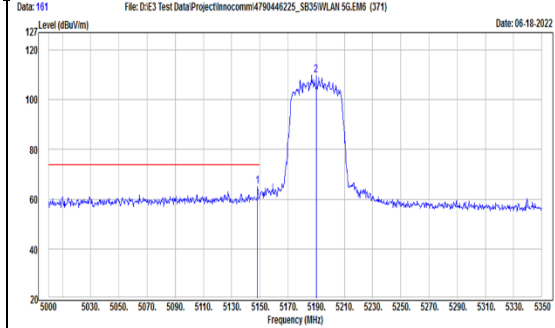



Test report No. : 4790446225-US-R1-V0
Page : 142 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	46
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5099.4	30.54	19.44	49.98	54	-4.02	AVG
		5138.6	42.32	19.41	61.73	74	-12.27	PK
	@	5230	84.64	19.05	103.69	N/A	N/A	PK
	@	5230	75.48	19.05	94.53	N/A	N/A	AVG
	*	10460	33.94	17.87	51.81	68.2	-16.39	PK
Vertical		5143.15	42.68	19.4	62.08	74	-11.92	PK
		5148.4	33.86	19.4	53.26	54	-0.74	AVG
	@	5230	94.73	19.05	113.78	N/A	N/A	PK
	@	5230	87.36	19.05	106.41	N/A	N/A	AVG
	*	10460	43.54	17.87	61.41	68.2	-6.79	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT40) (Ch 46)
Radiated Spurious Emission, Horizontal

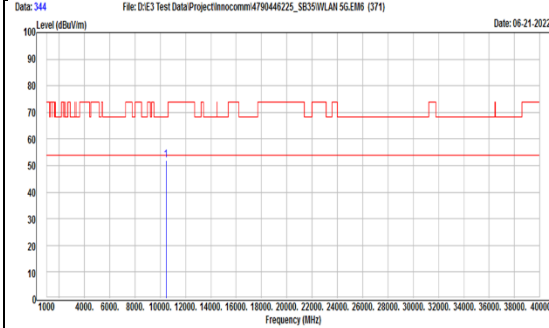


TX, 802.11ac(VHT40) (Ch 46)
Radiated Spurious Emission, Vertical

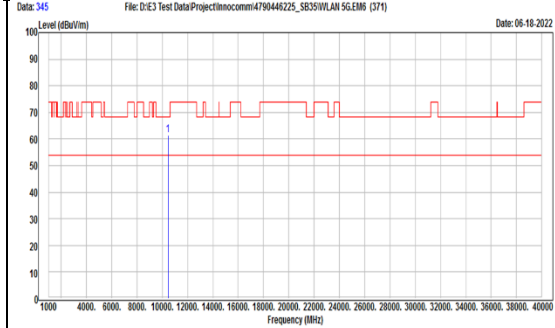


TX, 802.11ac(VHT40) (Ch 46)
Band Edge (Average), Horizontal

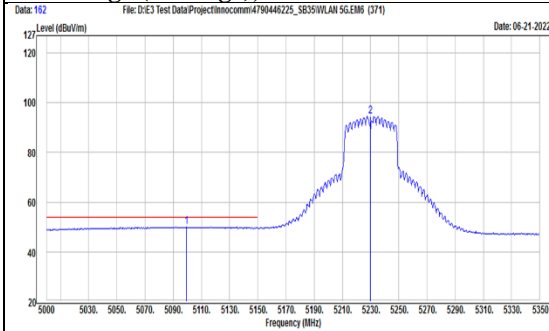


TX, 802.11ac(VHT40) (Ch 46)
Band Edge (Average), Vertical

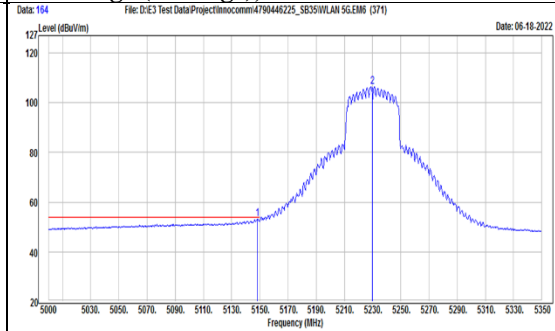

TX, 802.11ac(VHT40) (Ch 46)
Band Edge (Peak), Horizontal

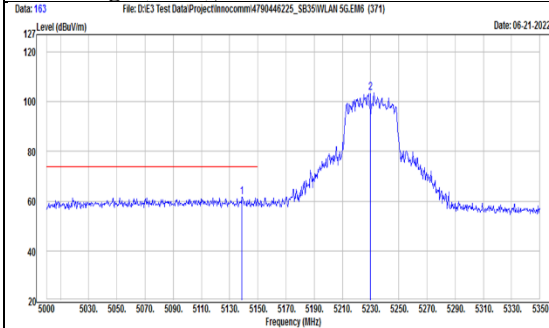

TX, 802.11ac(VHT40) (Ch 46)
Band Edge (Peak), Vertical

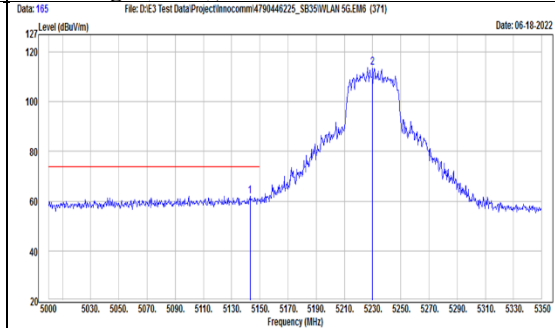



Test report No. : 4790446225-US-R1-V0

Page : 144 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	54
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	86.18	18.85	105.03	N/A	N/A	PK
	@	5270	77.98	18.85	96.83	N/A	N/A	AVG
		5350.2	29.98	19.01	48.99	54	-5.01	AVG
		5437.8	40.2	19.46	59.66	74	-14.34	PK
	*	10540	38.67	18.01	56.68	68.2	-11.52	PK
Vertical	@	5270	95.51	18.85	114.36	N/A	N/A	PK
	@	5270	88.43	18.85	107.28	N/A	N/A	AVG
		5351.7	34.43	19.02	53.45	54	-0.55	AVG
		5353.5	46.56	19.03	65.59	74	-8.41	PK
	*	10540	46.84	18.01	64.85	68.2	-3.35	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT40) (Ch 54)
Radiated Spurious Emission, Horizontal

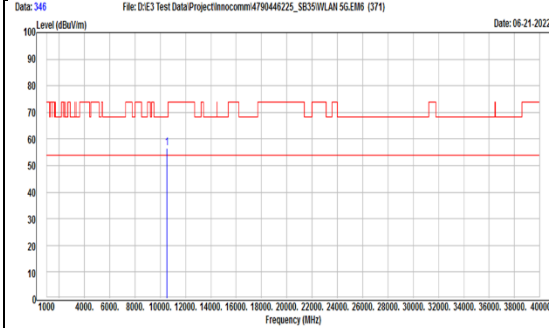


TX, 802.11ac(VHT40) (Ch 54)
Radiated Spurious Emission, Vertical

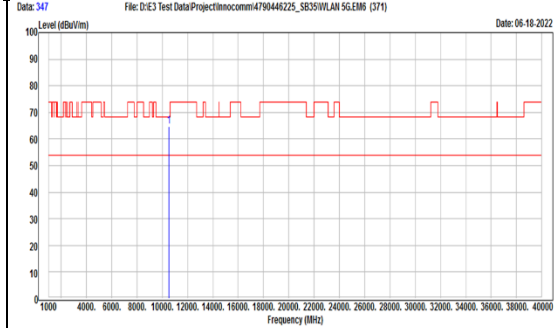


TX, 802.11ac(VHT40) (Ch 54)
Band Edge (Average), Horizontal

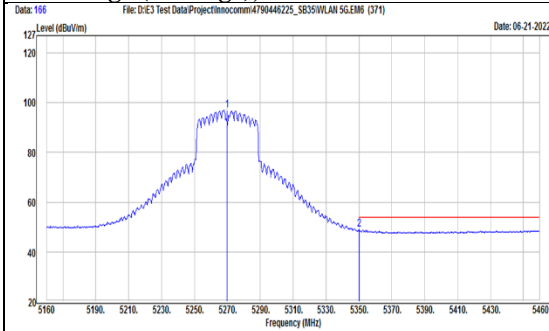


TX, 802.11ac(VHT40) (Ch 54)
Band Edge (Average), Vertical

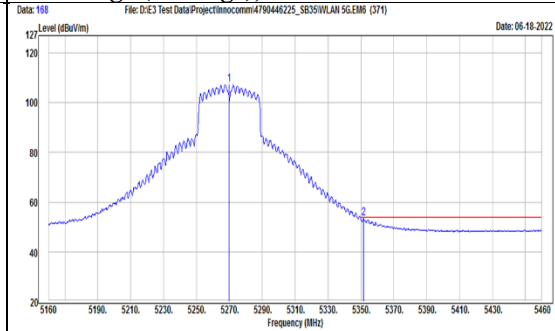

TX, 802.11ac(VHT40) (Ch 54)
Band Edge (Peak), Horizontal

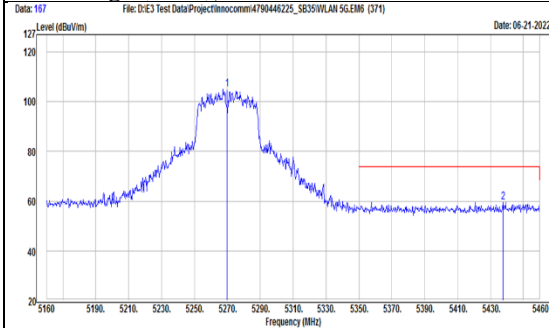

TX, 802.11ac(VHT40) (Ch 54)
Band Edge (Peak), Vertical

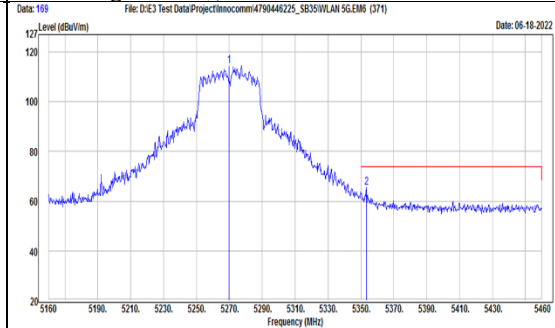



Test report No. : 4790446225-US-R1-V0
Page : 146 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	62
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5310	81.68	18.81	100.49	N/A	N/A	PK
	@	5310	74.38	18.81	93.19	N/A	N/A	AVG
		5448.9	40.54	19.51	60.05	74	-13.95	PK
		5450.4	29.03	19.52	48.55	54	-5.45	AVG
	*	10620	32.33	18.04	50.37	74	-23.63	PK
Vertical	@	5310	92.08	18.81	110.89	N/A	N/A	PK
	@	5310	84.39	18.81	103.2	N/A	N/A	AVG
		5350.5	44.77	19.01	63.78	74	-10.22	PK
		5351.7	34.57	19.02	53.59	54	-0.41	AVG
		10620	42.06	18.04	60.1	74	-13.9	PK
		10620	31.3	18.04	49.34	54	-4.66	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT40) (Ch 62)
Radiated Spurious Emission, Horizontal

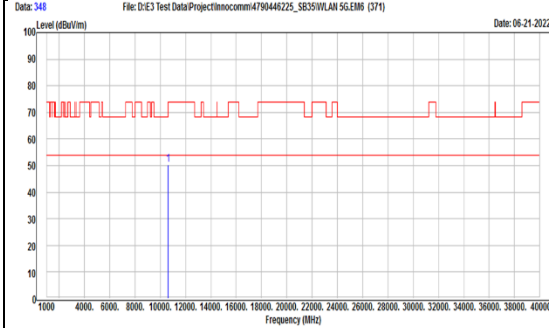


TX, 802.11ac(VHT40) (Ch 62)
Radiated Spurious Emission, Vertical

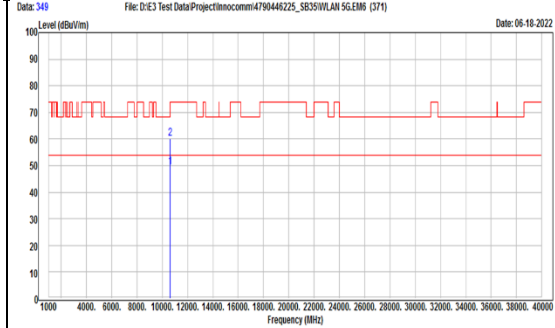


TX, 802.11ac(VHT40) (Ch 62)
Band Edge (Average), Horizontal

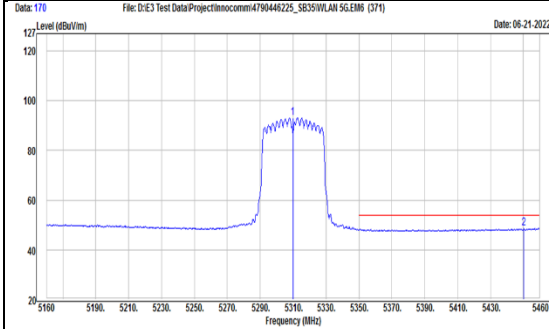


TX, 802.11ac(VHT40) (Ch 62)
Band Edge (Average), Vertical

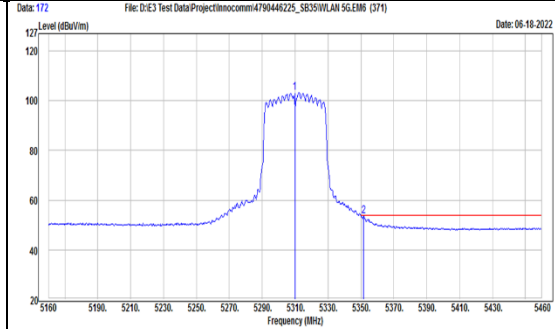

TX, 802.11ac(VHT40) (Ch 62)
Band Edge (Peak), Horizontal

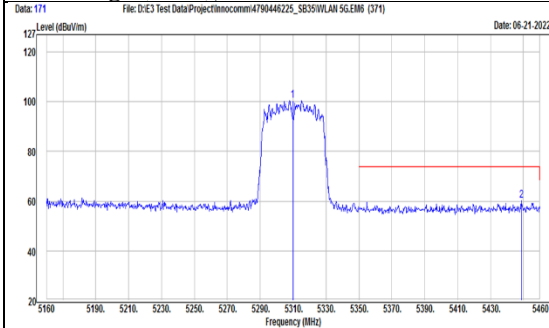

TX, 802.11ac(VHT40) (Ch 62)
Band Edge (Peak), Vertical

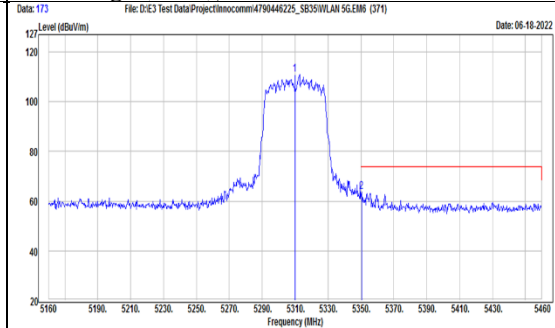



Test report No. : 4790446225-US-R1-V0
Page : 148 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	102
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5453.9	39.96	19.54	59.5	74	-14.5	PK
		5453.9	29.35	19.54	48.89	54	-5.11	AVG
		5462.65	40.98	19.58	60.56	68.2	-7.64	PK
	@	5510	80.95	19.78	100.73	N/A	N/A	PK
	@	5510	73.99	19.78	93.77	N/A	N/A	AVG
	*	11020	32.46	18.42	50.88	74	-23.12	PK
Vertical		5455.3	42.51	19.54	62.05	74	-11.95	PK
		5455.3	31.08	19.54	50.62	54	-3.38	AVG
		5467.55	45.53	19.61	65.14	68.2	-3.06	PK
	@	5510	89.77	19.78	109.55	N/A	N/A	PK
	@	5510	81.52	19.78	101.3	N/A	N/A	AVG
		11020	40.73	18.42	59.15	74	-14.85	PK
		11020	35.2	18.42	53.62	54	-0.38	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT40) (Ch 102)
Radiated Spurious Emission, Horizontal

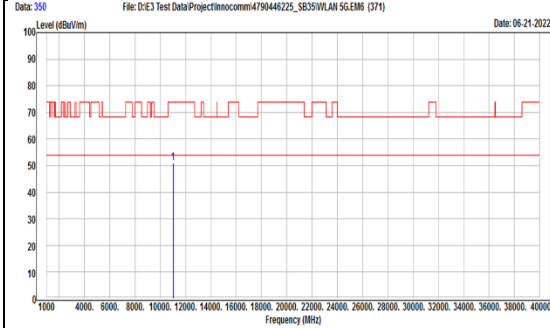


TX, 802.11ac(VHT40) (Ch 102)
Radiated Spurious Emission, Vertical

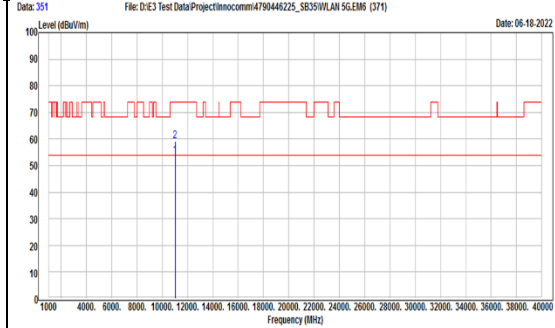

TX, 802.11ac(VHT40) (Ch 102)
Band Edge (Peak), Horizontal

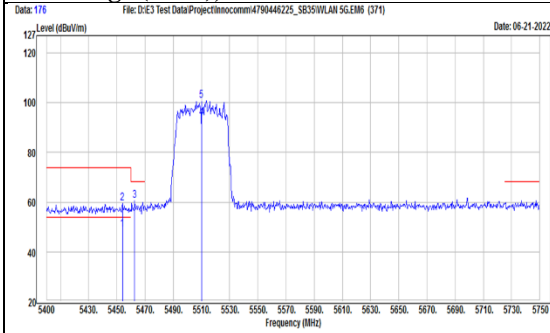

TX, 802.11ac(VHT40) (Ch 102)
Band Edge (Peak), Vertical

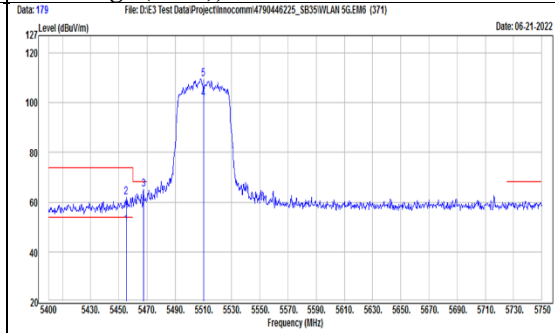

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11ac(VHT40)	Channel	110
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5407.7	40.38	19.31	59.69	74	-14.31	PK
		5407.7	29.43	19.31	48.74	54	-5.26	AVG
		5463.7	39.46	19.58	59.04	68.2	-9.16	PK
	@	5550	82.91	19.83	102.74	N/A	N/A	PK
	@	5550	75.07	19.83	94.9	N/A	N/A	AVG
		5747.55	40	20.17	60.17	68.2	-8.03	PK
	*	11100	32.95	18.45	51.4	74	-22.6	PK
Vertical		5459.85	40.61	19.57	60.18	74	-13.82	PK
		5459.85	30.03	19.57	49.6	54	-4.4	AVG
		5467.55	41.07	19.61	60.68	68.2	-7.52	PK
	@	5550	91.96	19.83	111.79	N/A	N/A	PK
	@	5550	84.25	19.83	104.08	N/A	N/A	AVG
		5735.65	39.96	20.07	60.03	68.2	-8.17	PK
		11100	42.99	18.45	61.44	74	-12.56	PK
		11100	35.04	18.45	53.49	54	-0.51	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

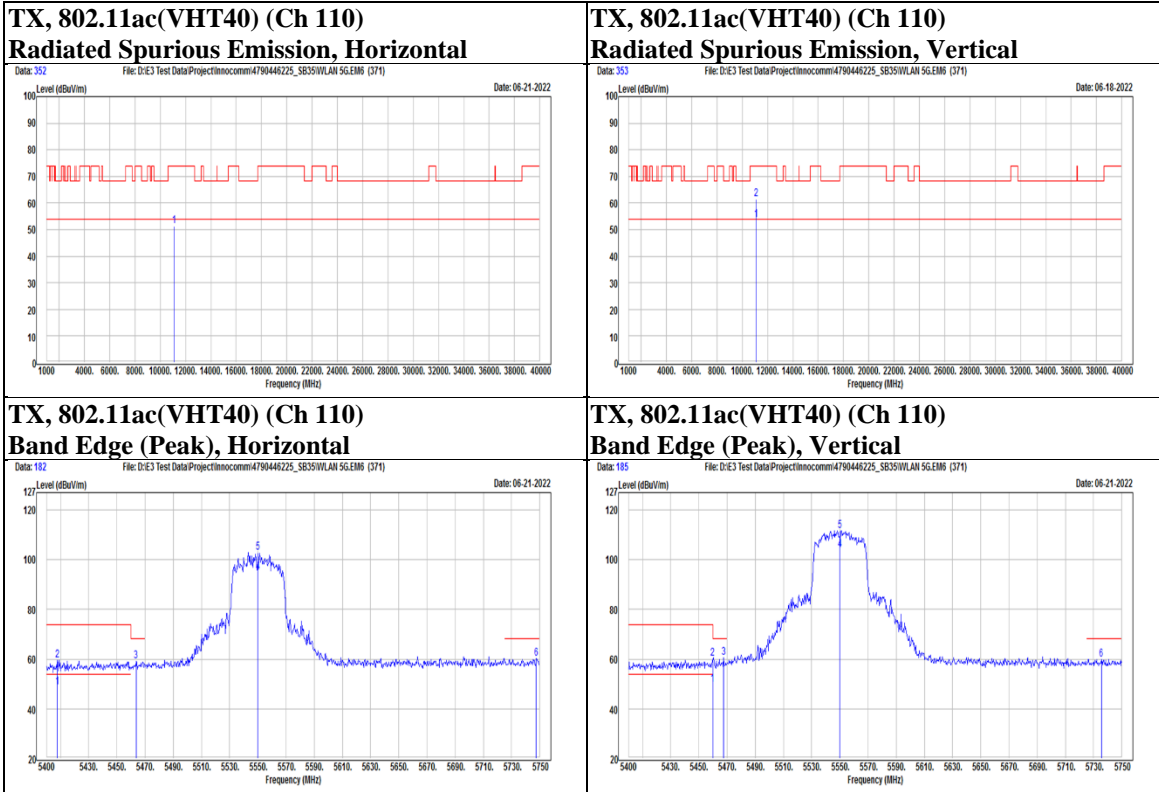

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790446225-US-R1-V0

Page : 152 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	134
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5670	80	19.69	99.69	N/A	N/A	PK
	@	5670	72.1	19.69	91.79	N/A	N/A	AVG
		5725.5	40.92	19.96	60.88	68.2	-7.32	PK
	*	11340	33.31	18.58	51.89	74	-22.11	PK
Vertical	@	5670	92.09	19.69	111.78	N/A	N/A	PK
	@	5670	83.83	19.69	103.52	N/A	N/A	AVG
		5734.6	43.56	20.06	63.62	68.2	-4.58	PK
		11340	42.53	18.58	61.11	74	-12.89	PK
		11340	34.91	18.58	53.49	54	-0.51	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

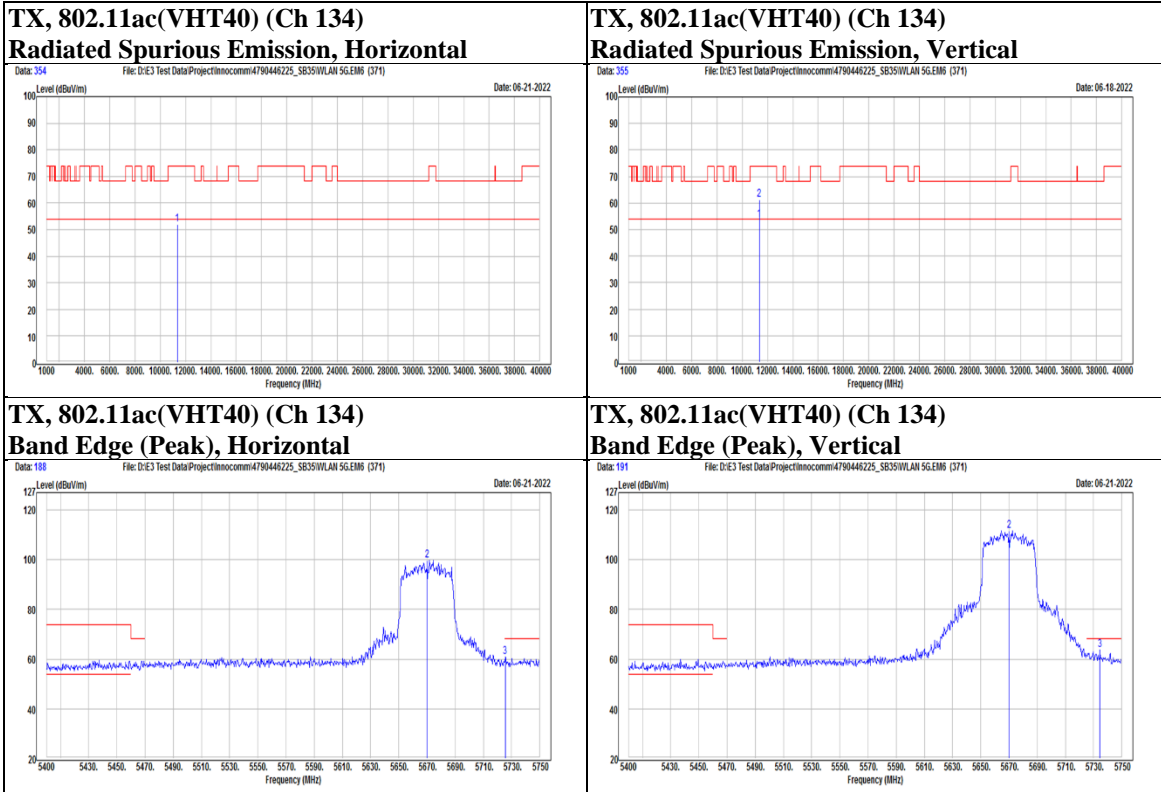



Test report No. : 4790446225-US-R1-V0

Page : 154 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	151
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5551	41.3	19.83	61.13	68.2	-7.07	PK
		5674.5	41.75	19.7	61.45	86.37	-24.92	PK
	@	5755	75.79	20.22	96.01	N/A	N/A	PK
	*	11510	34.12	19.34	53.46	74	-20.54	PK
Vertical		5641	41.9	19.67	61.57	68.2	-6.63	PK
		5678	41.36	19.71	61.07	88.96	-27.89	PK
	@	5755	87.03	20.22	107.25	N/A	N/A	PK
		11510	40.78	19.34	60.12	74	-13.88	PK
		11510	34.2	19.34	53.54	54	-0.46	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT40) (Ch 151)
Radiated Spurious Emission, Horizontal

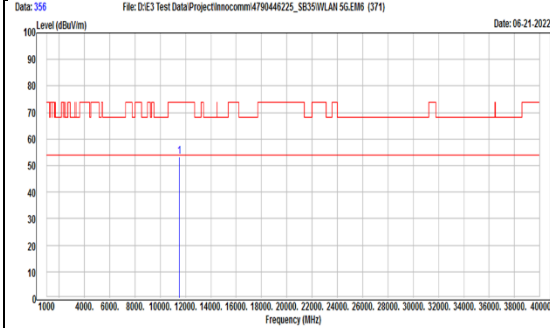


TX, 802.11ac(VHT40) (Ch 151)
Radiated Spurious Emission, Vertical

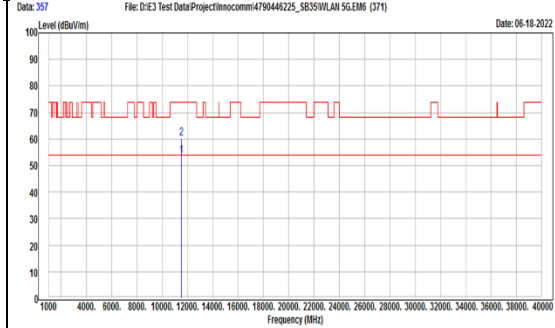

TX, 802.11ac(VHT40) (Ch 151)
Band Edge (Peak), Horizontal

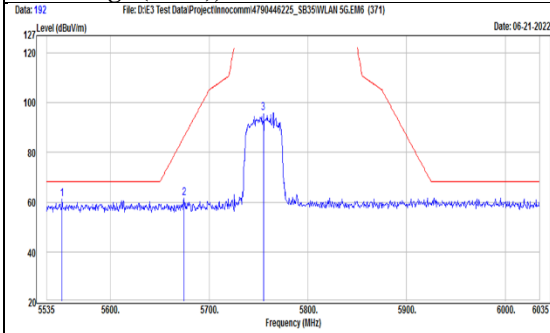

TX, 802.11ac(VHT40) (Ch 151)
Band Edge (Peak), Vertical

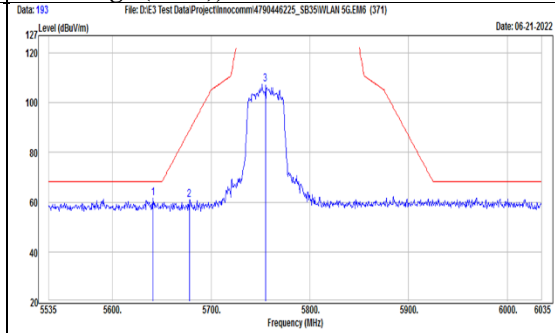



Test report No. : 4790446225-US-R1-V0
Page : 156 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT40)	Channel	159
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5795	75.94	20.52	96.46	N/A	N/A	PK
		5880.5	40.7	20.84	61.54	101.11	-39.57	PK
		5929	41.42	20.95	62.37	68.2	-5.83	PK
	*	11590	34.49	18.99	53.48	74	-20.52	PK
Vertical	@	5795	86.5	20.52	107.02	N/A	N/A	PK
		5890.5	40.87	20.91	61.78	93.7	-31.92	PK
		5991.5	41.78	20.99	62.77	68.2	-5.43	PK
		11590	40.32	18.99	59.31	74	-14.69	PK
		11590	34.25	18.99	53.24	54	-0.76	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT40) (Ch 159)
Radiated Spurious Emission, Horizontal

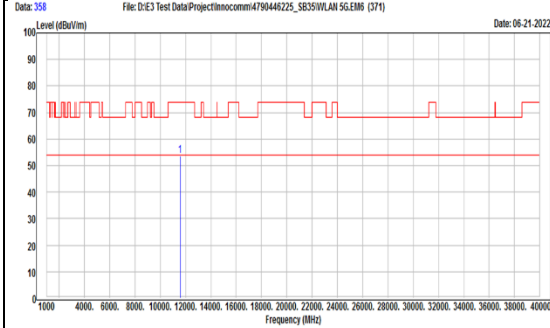


TX, 802.11ac(VHT40) (Ch 159)
Radiated Spurious Emission, Vertical

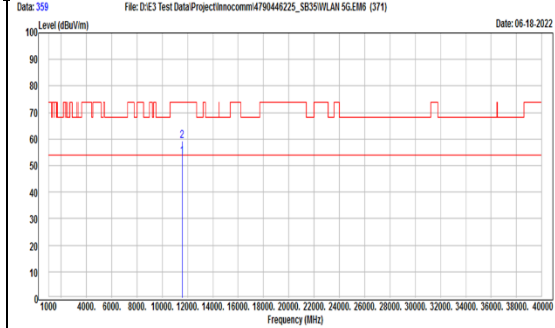

TX, 802.11ac(VHT40) (Ch 159)
Band Edge (Peak), Horizontal

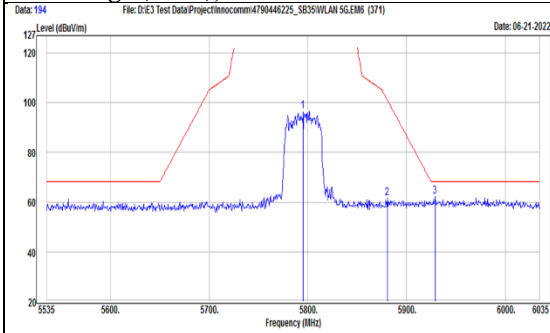

TX, 802.11ac(VHT40) (Ch 159)
Band Edge (Peak), Vertical

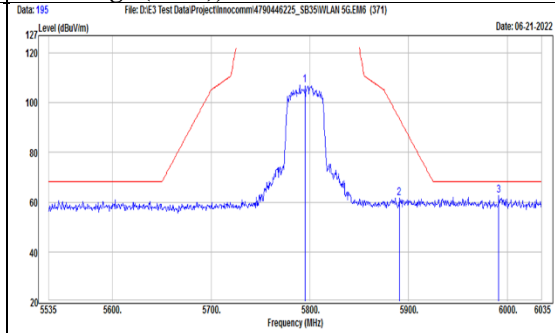

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790446225-US-R1-V0
Page : 158 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	42
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5114.45	32	19.43	51.43	54	-2.57	AVG
		5135.8	43.73	19.41	63.14	74	-10.86	PK
	@	5210	74.39	19.18	93.57	N/A	N/A	PK
	@	5210	65.64	19.18	84.82	N/A	N/A	AVG
	*	10420	31.27	17.76	49.03	68.2	-19.17	PK
Vertical		5143.5	34.28	19.4	53.68	54	-0.32	AVG
		5144.9	42.99	19.4	62.39	74	-11.61	PK
	@	5210	83.62	19.18	102.8	N/A	N/A	PK
	@	5210	77.62	19.18	96.8	N/A	N/A	AVG
	*	10420	31.35	17.76	49.11	68.2	-19.09	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT80) (Ch 42)
Radiated Spurious Emission, Horizontal

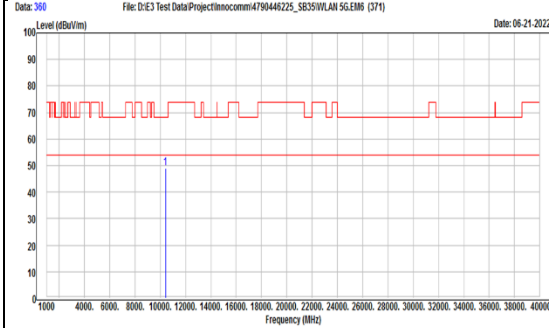


TX, 802.11ac(VHT80) (Ch 42)
Radiated Spurious Emission, Vertical

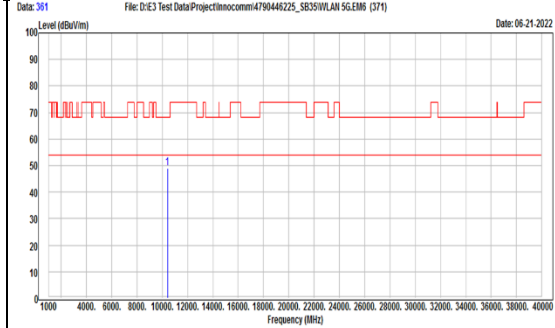


TX, 802.11ac(VHT80) (Ch 42)
Band Edge (Average), Horizontal

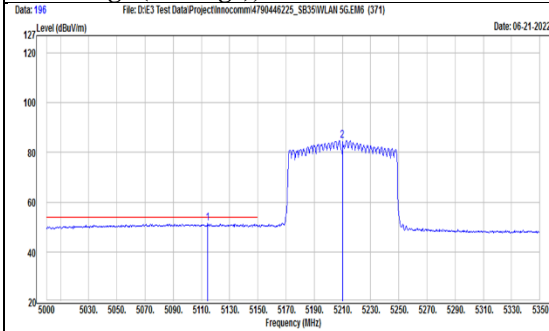


TX, 802.11ac(VHT80) (Ch 42)
Band Edge (Average), Vertical

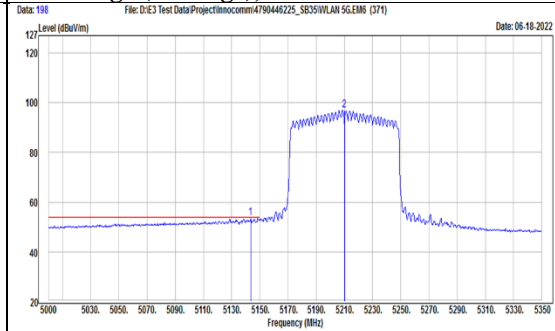

TX, 802.11ac(VHT80) (Ch 42)
Band Edge (Peak), Horizontal

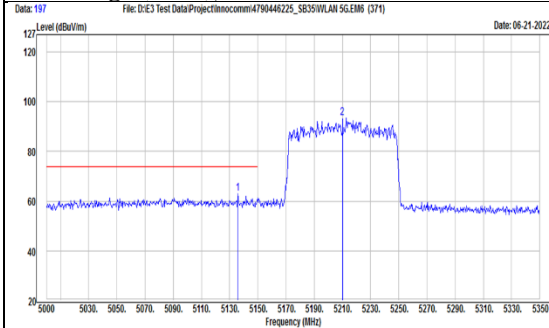

TX, 802.11ac(VHT80) (Ch 42)
Band Edge (Peak), Vertical

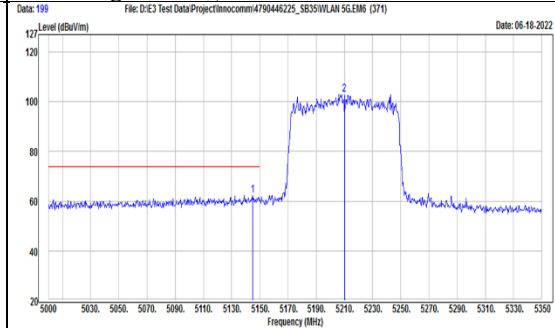



Test report No. : 4790446225-US-R1-V0
Page : 160 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	58
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5290	77.11	18.79	95.9	N/A	N/A	PK
	@	5290	68.35	18.79	87.14	N/A	N/A	AVG
		5357.7	30.05	19.05	49.1	54	-4.9	AVG
		5358.6	40.67	19.05	59.72	74	-14.28	PK
	*	10580	31.78	18.04	49.82	68.2	-18.38	PK
Vertical	@	5290	85.82	18.79	104.61	N/A	N/A	PK
	@	5290	78.64	18.79	97.43	N/A	N/A	AVG
		5354.7	34.67	19.04	53.71	54	-0.29	AVG
		5363.4	42.99	19.08	62.07	74	-11.93	PK
	*	10580	31.23	18.04	49.27	68.2	-18.93	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0878 / 6.0




TX, 802.11ac(VHT80) (Ch 58)
Radiated Spurious Emission, Horizontal

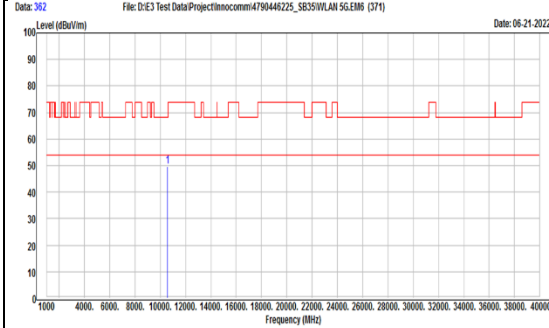


TX, 802.11ac(VHT80) (Ch 58)
Radiated Spurious Emission, Vertical

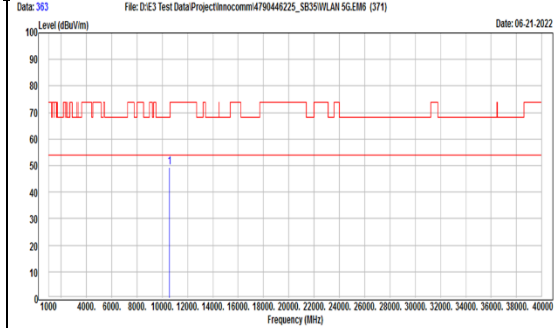


TX, 802.11ac(VHT80) (Ch 58)
Band Edge (Average), Horizontal

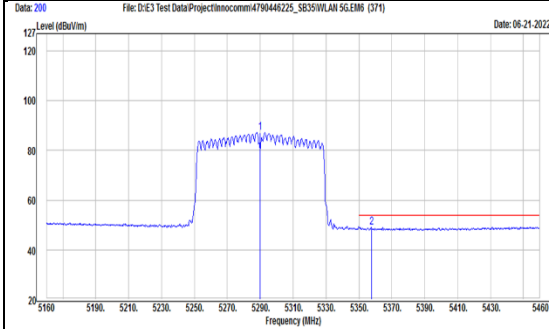


TX, 802.11ac(VHT80) (Ch 58)
Band Edge (Average), Vertical

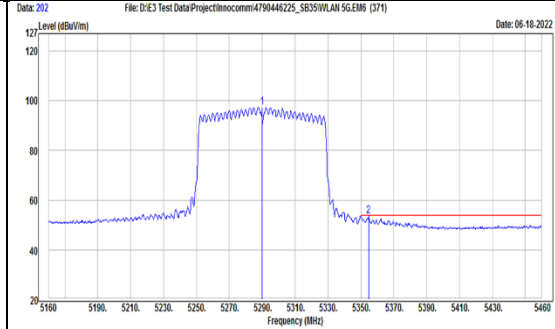

TX, 802.11ac(VHT80) (Ch 58)
Band Edge (Peak), Horizontal

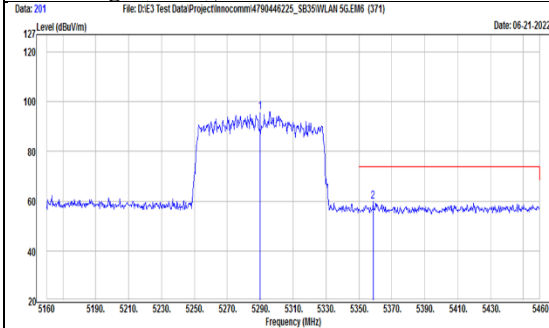

TX, 802.11ac(VHT80) (Ch 58)
Band Edge (Peak), Vertical

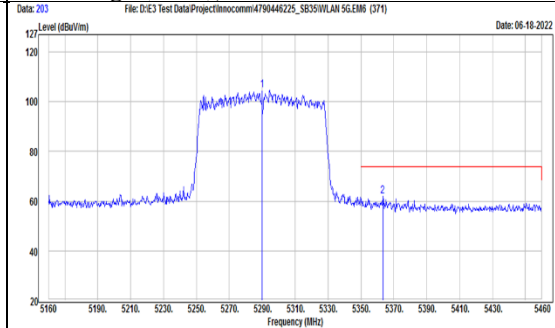



Test report No. : 4790446225-US-R1-V0
Page : 162 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	106
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5449.35	40.04	19.51	59.55	74	-14.45	PK
		5449.35	30.33	19.51	49.84	54	-4.16	AVG
		5466.15	41.87	19.6	61.47	68.2	-6.73	PK
	@	5530	76.48	19.81	96.29	N/A	N/A	PK
	@	5530	68.35	19.81	88.16	N/A	N/A	AVG
	*	11060	31.11	18.44	49.55	74	-24.45	PK
Vertical		5459.85	43.83	19.57	63.4	74	-10.6	PK
		5459.85	34	19.57	53.57	54	-0.43	AVG
		5469.65	42.66	19.62	62.28	68.2	-5.92	PK
	@	5530	85.56	19.81	105.37	N/A	N/A	PK
	@	5530	76.92	19.81	96.73	N/A	N/A	AVG
	*	11060	32.8	18.44	51.24	74	-22.76	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

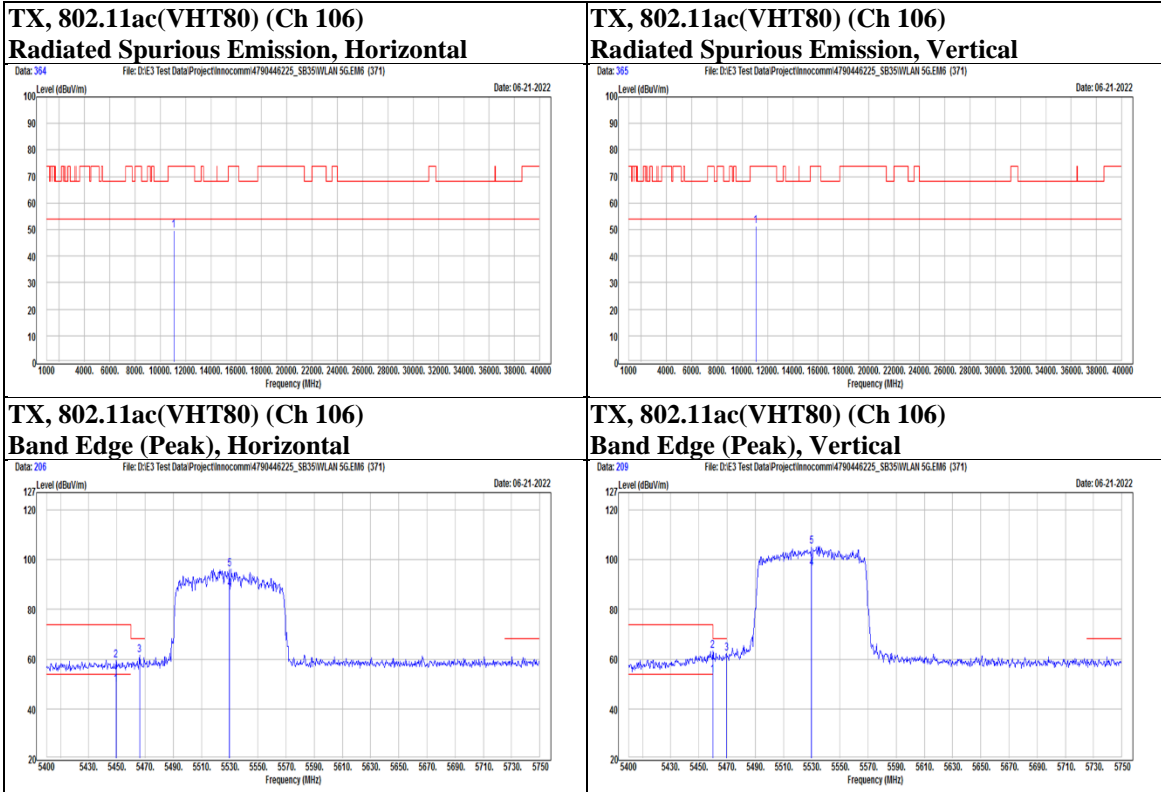

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790446225-US-R1-V0
Page : 164 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	122
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5448.3	40.98	19.5	60.48	74	-13.52	PK
		5448.3	30.88	19.5	50.38	54	-3.62	AVG
		5468.95	39.47	19.62	59.09	68.2	-9.11	PK
	@	5610	79.64	19.69	99.33	N/A	N/A	PK
	@	5610	73.24	19.69	92.93	N/A	N/A	AVG
		5737.4	40.36	20.08	60.44	68.2	-7.76	PK
		11220	36.88	18.47	55.35	74	-18.65	PK
		11220	26.58	18.47	45.05	54	-8.95	AVG
Vertical		5455.65	32.52	19.54	52.06	54	-1.94	AVG
		5459.5	44.8	19.57	64.37	74	-9.63	PK
		5464.05	43.98	19.59	63.57	68.2	-4.63	PK
	@	5610	90.44	19.69	110.13	N/A	N/A	PK
	@	5610	82.55	19.69	102.24	N/A	N/A	AVG
		5727.25	46.94	19.99	66.93	68.2	-1.27	PK
		11220	45.46	18.47	63.93	74	-10.07	PK
		11220	34.87	18.47	53.34	54	-0.66	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

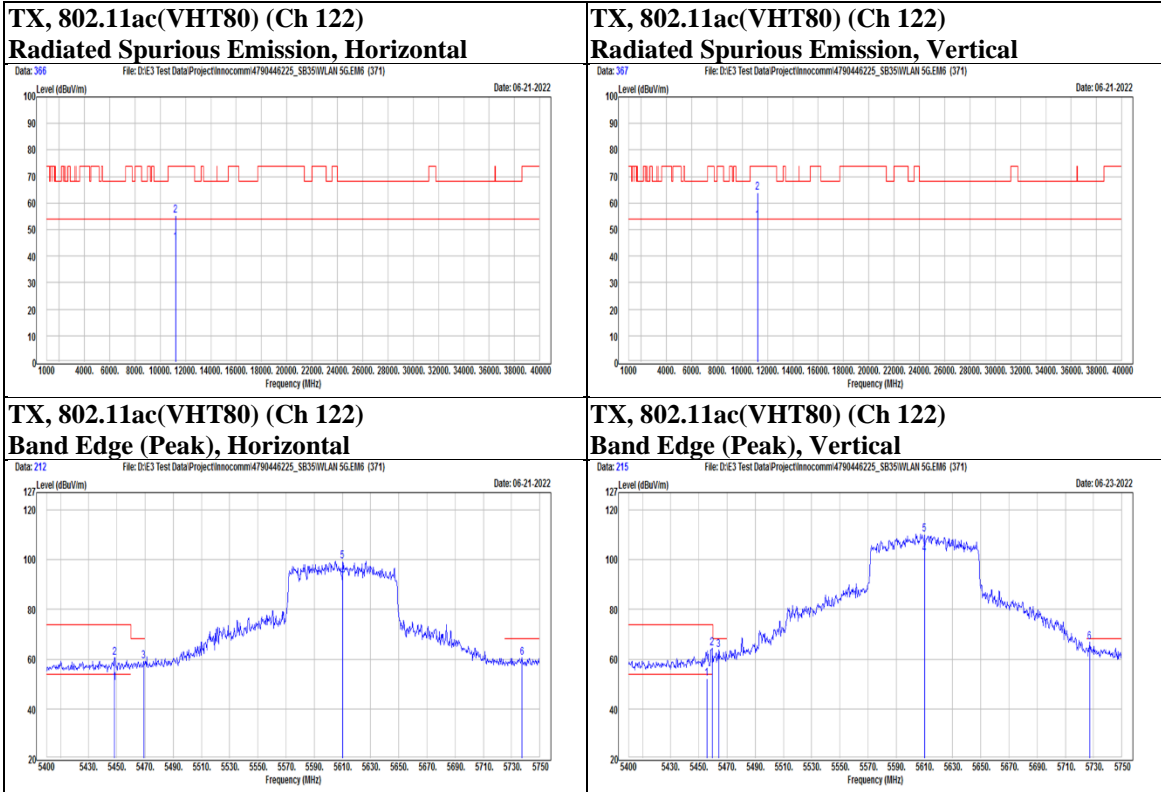

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Test report No. : 4790446225-US-R1-V0
Page : 166 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11ac(VHT80)	Channel	155
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5621	40.76	19.69	60.45	68.2	-7.75	PK
		5696.5	40.8	19.72	60.52	102.62	-42.1	PK
	@	5775	75.28	20.37	95.65	N/A	N/A	PK
		5919.5	40.36	20.96	61.32	72.25	-10.93	PK
		5998	40.69	21	61.69	68.2	-6.51	PK
		11590	33	18.99	51.99	74	-22.01	PK
Vertical		5563	40.66	19.8	60.46	68.2	-7.74	PK
		5696	50.15	19.72	69.87	102.25	-32.38	PK
	@	5775	85.44	20.37	105.81	N/A	N/A	PK
		5886	42.07	20.89	62.96	97.03	-34.07	PK
		5984	42.54	20.98	63.52	68.2	-4.68	PK
		11550	42.27	19.16	61.43	74	-12.57	PK
		11550	34.6	19.16	53.76	54	-0.24	AVG


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

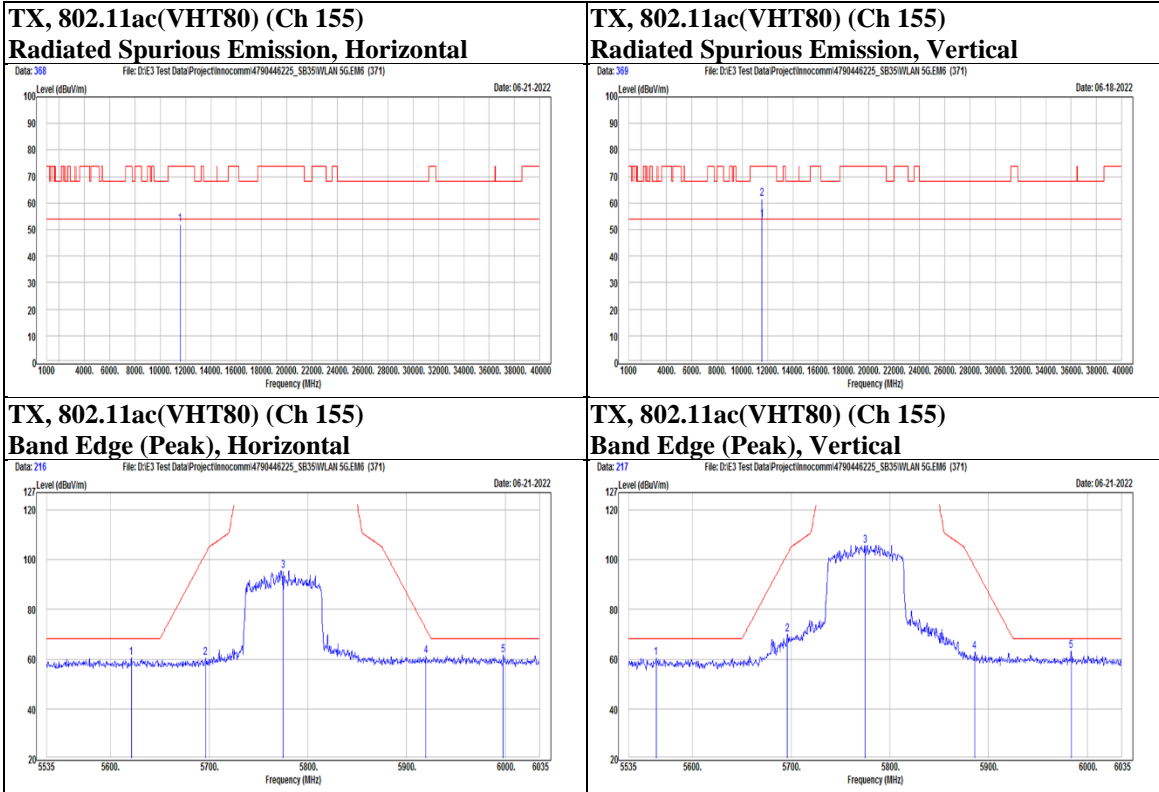

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948



Below 1 GHz

Mode	802.11ac(VHT80)	Channel	122
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		148.34	39.68	-11.57	28.11	43.5	-15.39	PK
		201.69	41.09	-13.96	27.13	43.5	-16.37	PK
		233.7	44.22	-12.37	31.85	46	-14.15	PK
		263.77	42.5	-11.27	31.23	46	-14.77	PK
		311.3	37.92	-9.75	28.17	46	-17.83	PK
		359.8	37.51	-8.3	29.21	46	-16.79	PK
Vertical		67.83	40.08	-13.53	26.55	40	-13.45	PK
		148.34	39.77	-11.57	28.2	43.5	-15.3	PK
		159.98	36.41	-11.11	25.3	43.5	-18.2	PK
		296.75	38.58	-10.13	28.45	46	-17.55	PK
		327.79	38.53	-9.13	29.4	46	-16.6	PK
		359.8	36.67	-8.3	28.37	46	-17.63	PK

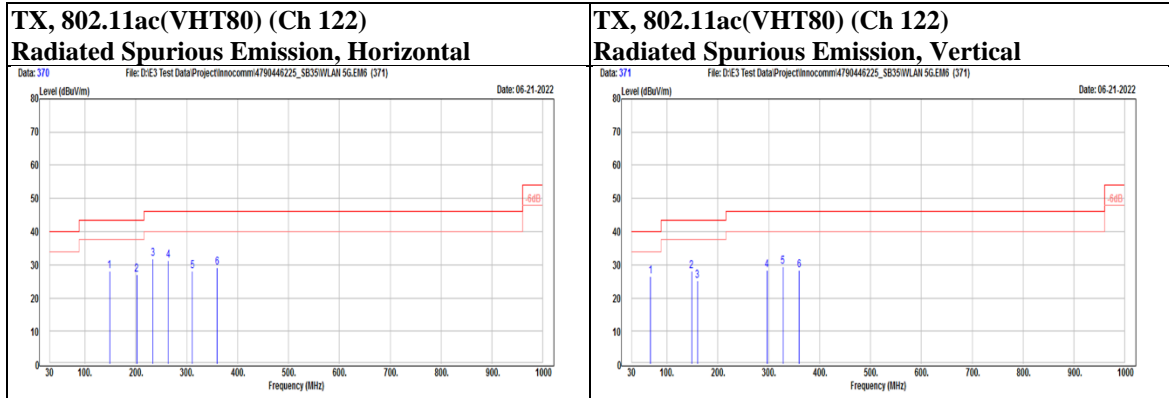

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



PCB Antenna

Above 1 GHz

Mode	802.11a	Channel	36
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5088.55	42.31	19.37	61.68	74	-12.32	PK
		5149.45	31.4	19.4	50.8	54	-3.2	AVG
	@	5180	94.09	19.31	113.4	N/A	N/A	PK
	@	5180	85.94	19.31	105.25	N/A	N/A	AVG
	*	10360	31.12	17.51	48.63	68.2	-19.57	PK
Vertical		5015.4	42.64	18.77	61.41	74	-12.59	PK
		5101.15	30.58	19.44	50.02	54	-3.98	AVG
	@	5180	81.97	19.31	101.28	N/A	N/A	PK
	@	5180	76.47	19.31	95.78	N/A	N/A	AVG
	*	10360	36.1	17.51	53.61	68.2	-14.59	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

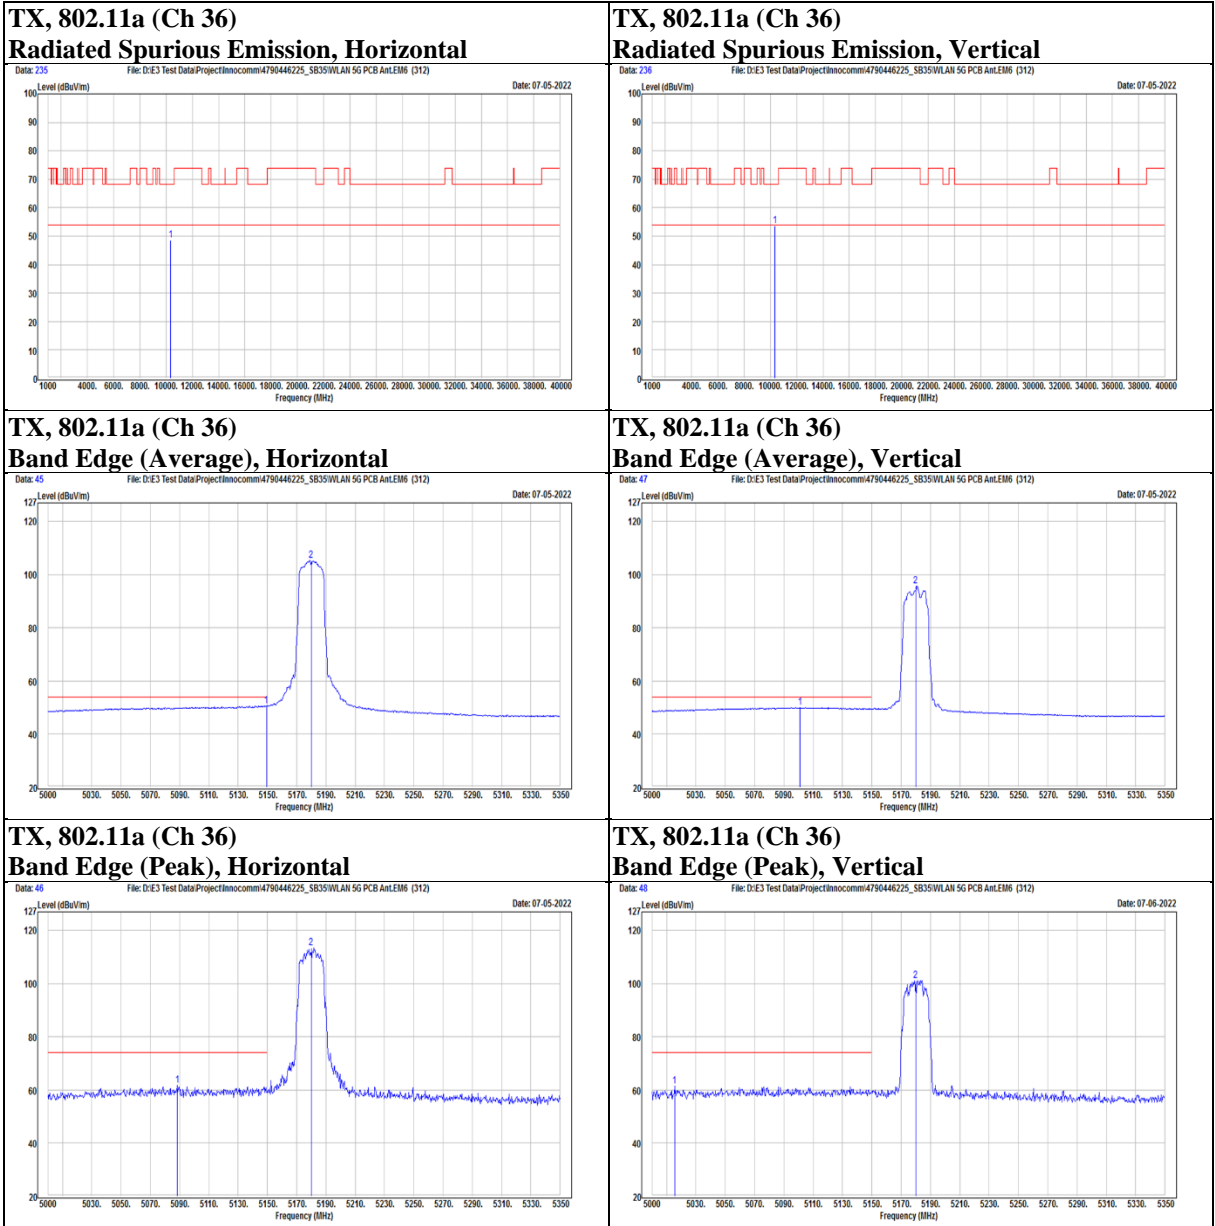



Test report No. : 4790446225-US-R1-V0

Page : 171 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11a	Channel	44
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5140	42.02	19.41	61.43	74	-12.57	PK
		5147.35	31.36	19.41	50.77	54	-3.23	AVG
	@	5220	96.93	19.12	116.05	N/A	N/A	PK
	@	5220	90.34	19.12	109.46	N/A	N/A	AVG
	*	10440	31.52	17.81	49.33	68.2	-18.87	PK
Vertical		5105.35	30.6	19.44	50.04	54	-3.96	AVG
		5111.3	42.41	19.44	61.85	74	-12.15	PK
	@	5220	85.69	19.12	104.81	N/A	N/A	PK
	@	5220	78.45	19.12	97.57	N/A	N/A	AVG
	*	10440	38.54	17.81	56.35	68.2	-11.85	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

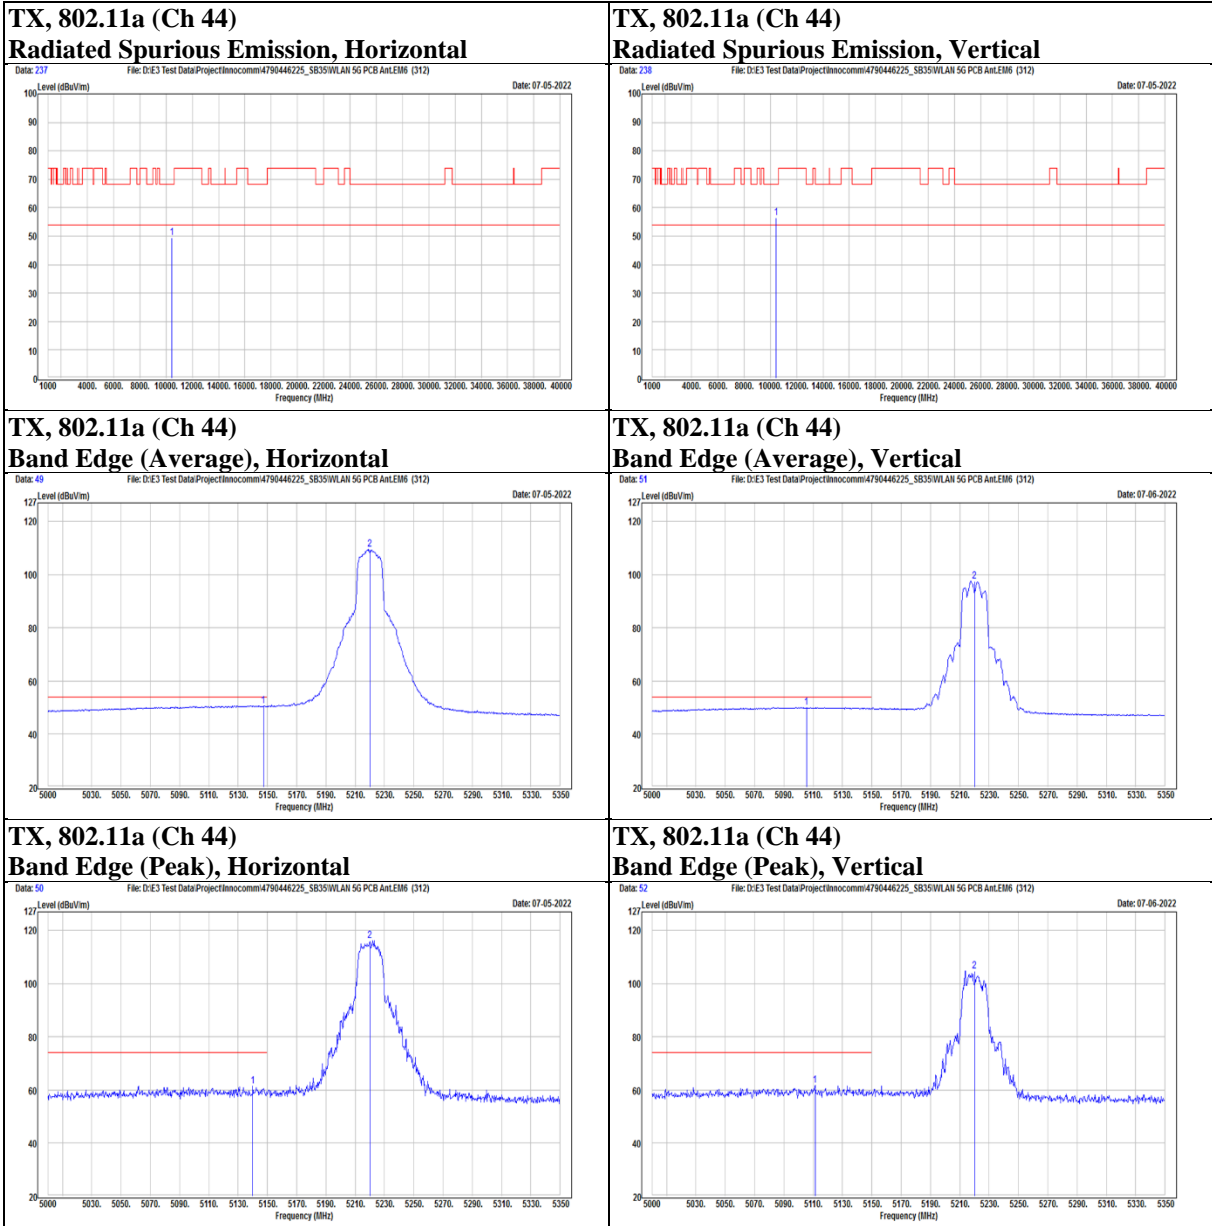



Test report No. : 4790446225-US-R1-V0
Page : 173 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	48
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5094.5	42.3	19.4	61.7	74	-12.3	PK
		5120.05	31.23	19.43	50.66	54	-3.34	AVG
	@	5240	98.27	18.97	117.24	N/A	N/A	PK
	@	5240	90.49	18.97	109.46	N/A	N/A	AVG
	*	10480	33.36	17.92	51.28	68.2	-16.92	PK
Vertical		5086.8	42.66	19.35	62.01	74	-11.99	PK
		5097.3	30.64	19.42	50.06	54	-3.94	AVG
	@	5240	85.34	18.97	104.31	N/A	N/A	PK
	@	5240	78.17	18.97	97.14	N/A	N/A	AVG
	*	10480	40.27	17.92	58.19	68.2	-10.01	PK







Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

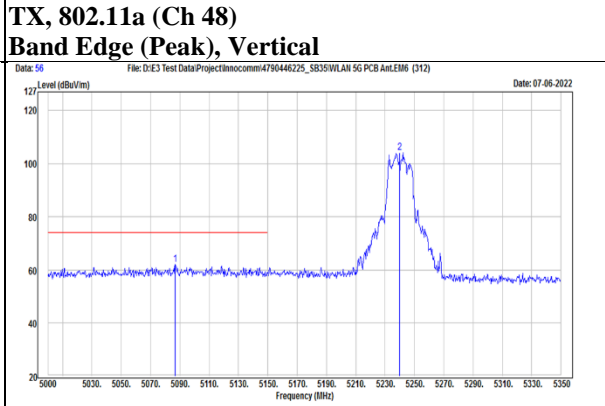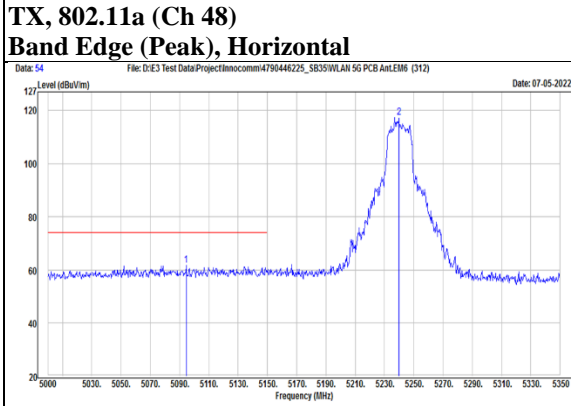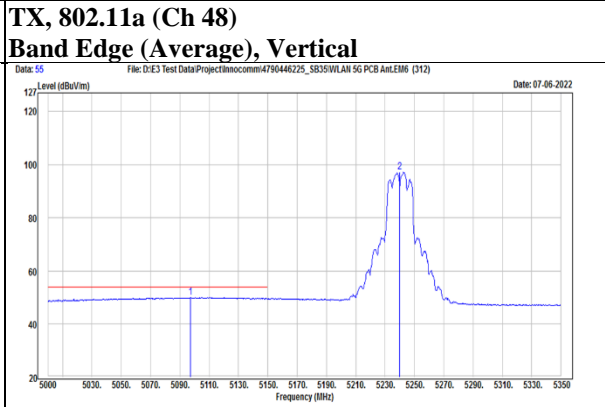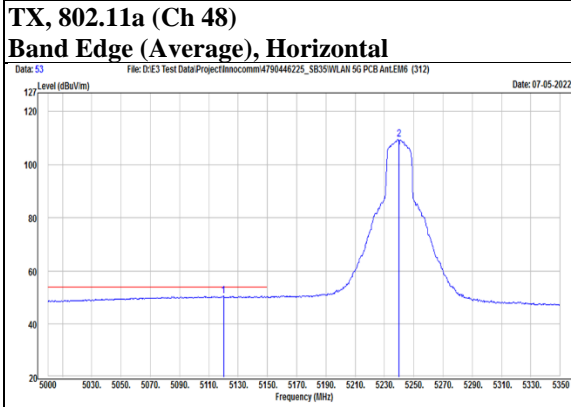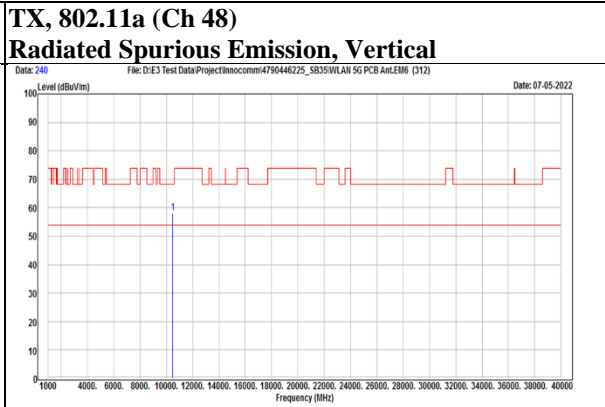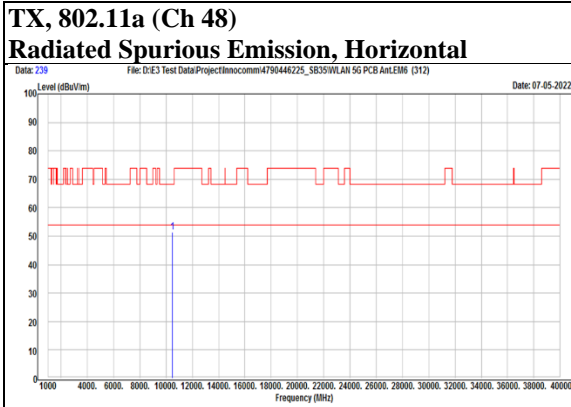



Test report No. : 4790446225-US-R1-V0
Page : 175 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	52
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5259.9	95.96	18.88	114.84	N/A	N/A	PK
		5261.4	90.09	18.87	108.96	N/A	N/A	AVG
		5364.3	29.07	19.09	48.16	54	-5.84	AVG
		5451	40.69	19.52	60.21	74	-13.79	PK
	*	10520	33.14	17.99	51.13	68.2	-17.07	PK
Vertical	@	5260	83.74	18.88	102.62	N/A	N/A	PK
	@	5260	76.67	18.88	95.55	N/A	N/A	AVG
		5373.9	40.6	19.14	59.74	74	-14.26	PK
		5455.8	28.82	19.54	48.36	54	-5.64	AVG
		*	10520	37.98	17.99	55.97	68.2	-12.23


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

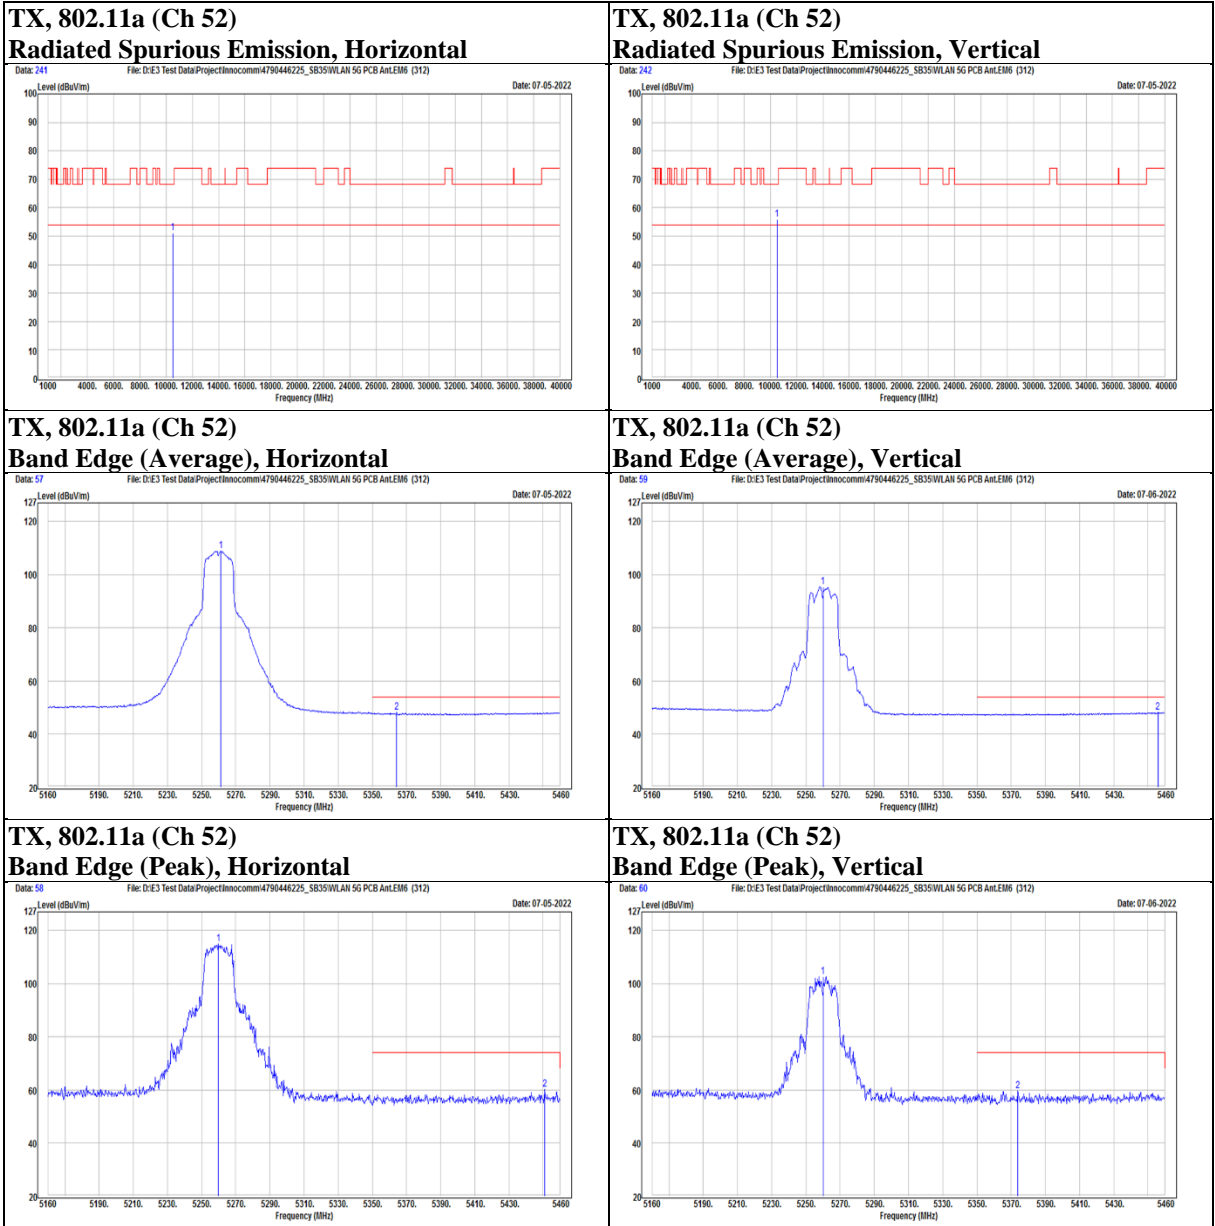



Test report No. : 4790446225-US-R1-V0

Page : 177 of 250

Issued date : 2022/8/9

FCC ID : YAISB35

Mode	802.11a	Channel	60
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5299.2	87.34	18.76	106.1	N/A	N/A	AVG
	@	5300	93.99	18.77	112.76	N/A	N/A	PK
		5356.5	29.16	19.05	48.21	54	-5.79	AVG
		5456.1	40.22	19.54	59.76	74	-14.24	PK
	*	10600	29.38	18.04	47.42	68.2	-20.78	PK
Vertical	@	5300	82.82	18.77	101.59	N/A	N/A	PK
	@	5300	76.2	18.77	94.97	N/A	N/A	AVG
		5424.9	28.9	19.39	48.29	54	-5.71	AVG
		5432.7	40.47	19.43	59.9	74	-14.1	PK
	*	10600	36.82	18.04	54.86	68.2	-13.34	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

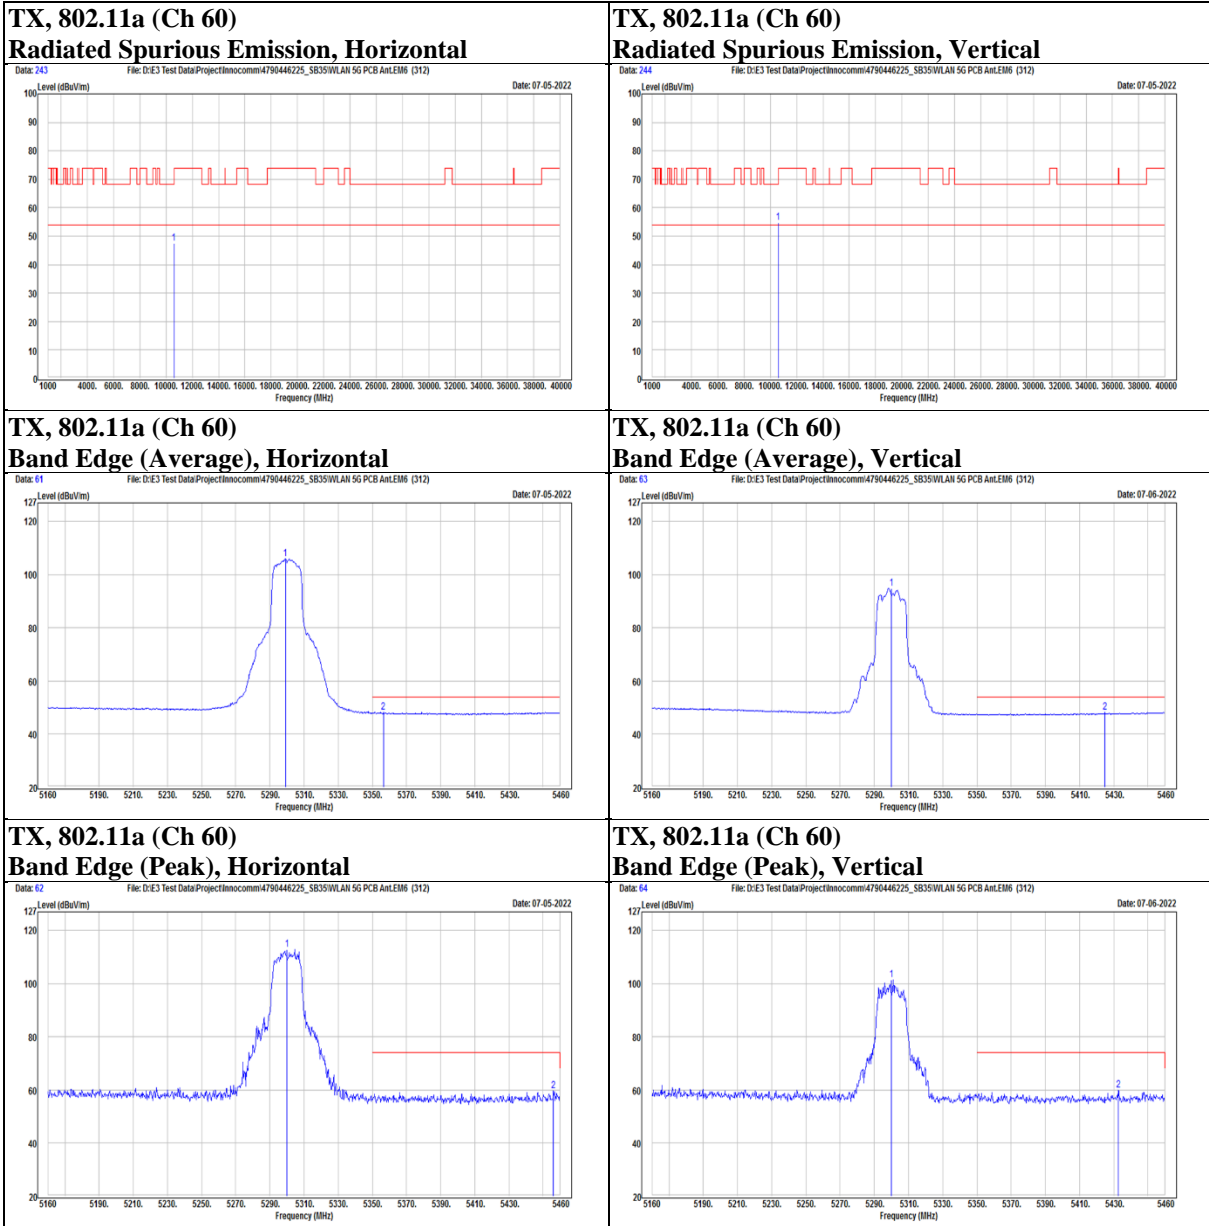



Test report No. : 4790446225-US-R1-V0
Page : 179 of 250
Issued date : 2022/8/9
FCC ID : YAISB35

Mode	802.11a	Channel	64
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	94.78	18.86	113.64	N/A	N/A	PK
	@	5320	86.78	18.86	105.64	N/A	N/A	AVG
		5350.5	40.61	19.01	59.62	74	-14.38	PK
		5350.5	30.75	19.01	49.76	54	-4.24	AVG
	*	10640	29.35	18.03	47.38	74	-26.62	PK
Vertical	@	5320	85.63	18.86	104.49	N/A	N/A	PK
	@	5320	75.47	18.86	94.33	N/A	N/A	AVG
		5372.7	40.13	19.13	59.26	74	-14.74	PK
		5456.1	28.61	19.54	48.15	54	-5.85	AVG
		10640	37.3	18.03	55.33	74	-18.67	PK
		10640	33	18.03	51.03	54	-2.97	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0