



Report No.: 0511938
AUX mode
AC Mains


Tested By:Hong, Report No.:0511938

Scan Settings (1 Range)

Frequencies				Receiver Settings				
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
150k	30M	5k	10k	PK+AV	10ms	AUTO	LN OFF	60dB

Final Measurement: x QP / + AV
Meas Time: 1 s
Subranges: 16
Acc Margin: 20dB

Transducer No.	Start	Stop	Name
21	9k	30M	EW0698

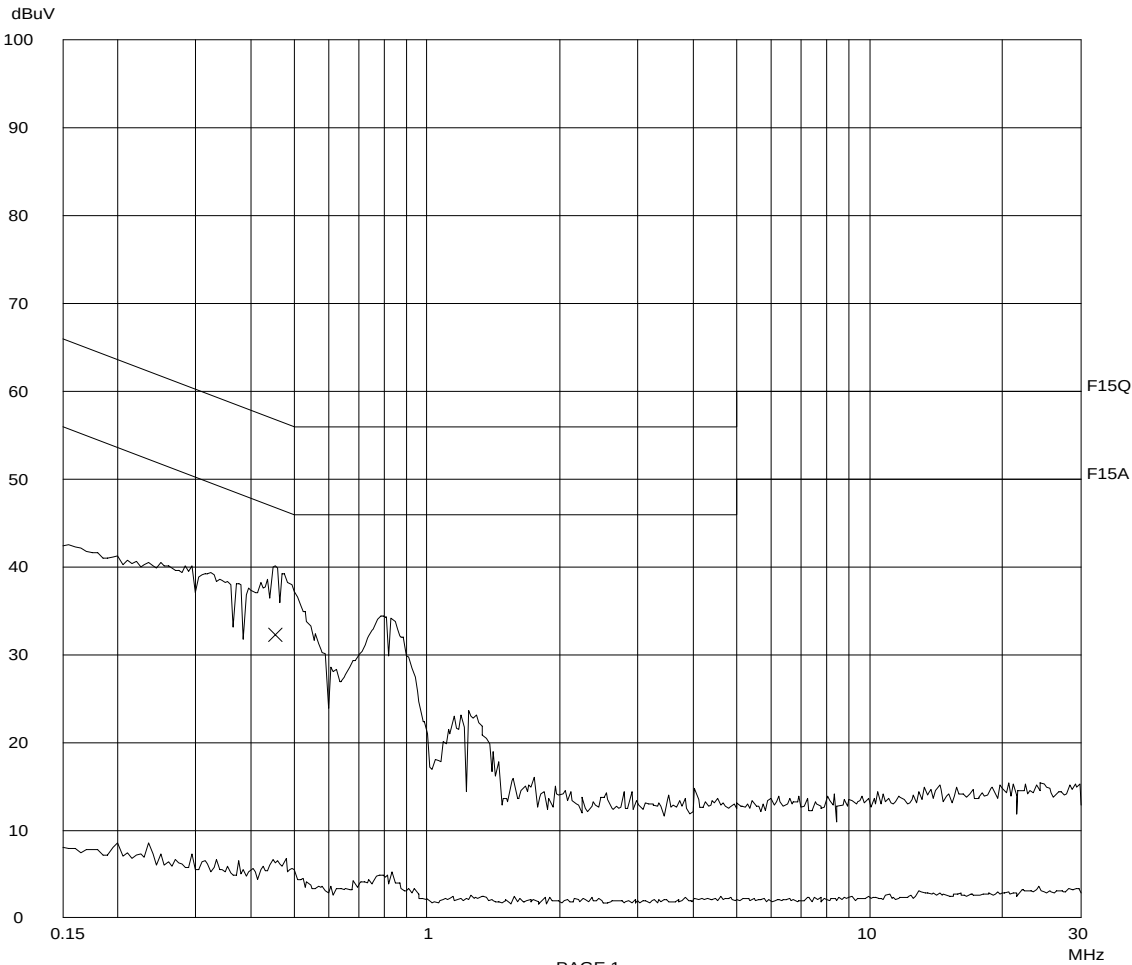

Report No.: 0511938
AUX mode
AC Mains

Tested By:Hong, Report No.:0511938

Scan Settings (1 Range)

Frequencies			Receiver Settings					
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
150k	30M	5k	10k	PK+AV	10ms	AUTO	LN OFF	60dB

Final Measurement Results:

Frequency	QP Level	QP Limit
MHz	dBuV	dBuV

0.45500	32.2	56.8
---------	------	------

Frequency	AV Level	AV Limit
MHz	dBuV	dBuV

no Results

* limit exceeded



Report No.: 0511938
TV mode
AC Mains


Tested By:Hong, Report No.:0511938

Scan Settings (1 Range)

Frequencies				Receiver Settings				
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
150k	30M	5k	10k	PK+AV	10ms	AUTO	LN OFF	60dB

Final Measurement: x QP / + AV
Meas Time: 1 s
Subranges: 16
Acc Margin: 20dB

Transducer No. Start Stop Name
21 9k 30M EW0698

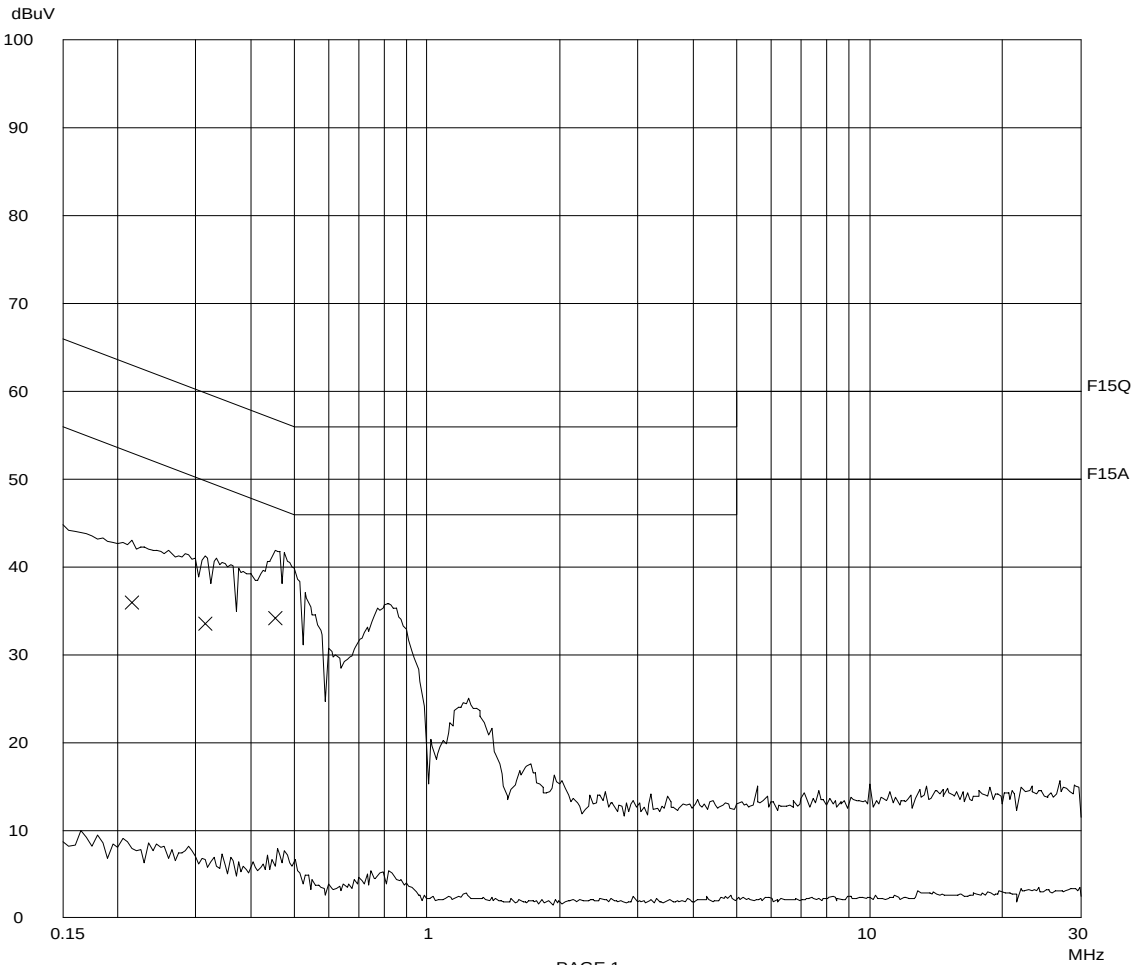

Report No.: 0511938
TV mode
AC Mains

Tested By:Hong, Report No.:0511938

Scan Settings (1 Range)

|----- Frequencies -----||----- Receiver Settings -----|

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
150k	30M	5k	10k	PK+AV	10ms	AUTO	LN OFF	60dB

Final Measurement Results:

Frequency	QP Level	QP Limit
-----------	----------	----------

MHz	dBuV	dBuV
-----	------	------

0.21500	35.8	63.0
---------	------	------

0.31500	33.5	59.8
---------	------	------

0.45500	34.2	56.8
---------	------	------

Frequency	AV Level	AV Limit
-----------	----------	----------

MHz	dBuV	dBuV
-----	------	------

no Results

* limit