




2DH1_Ant1_Low_2402

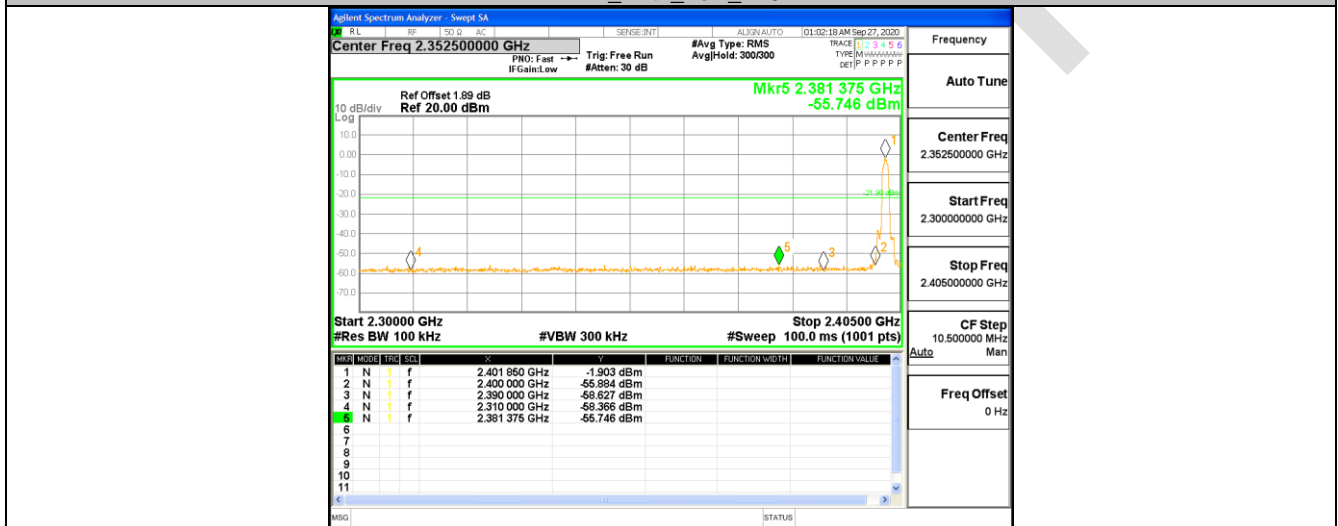


2DH1_Ant1_High_2402

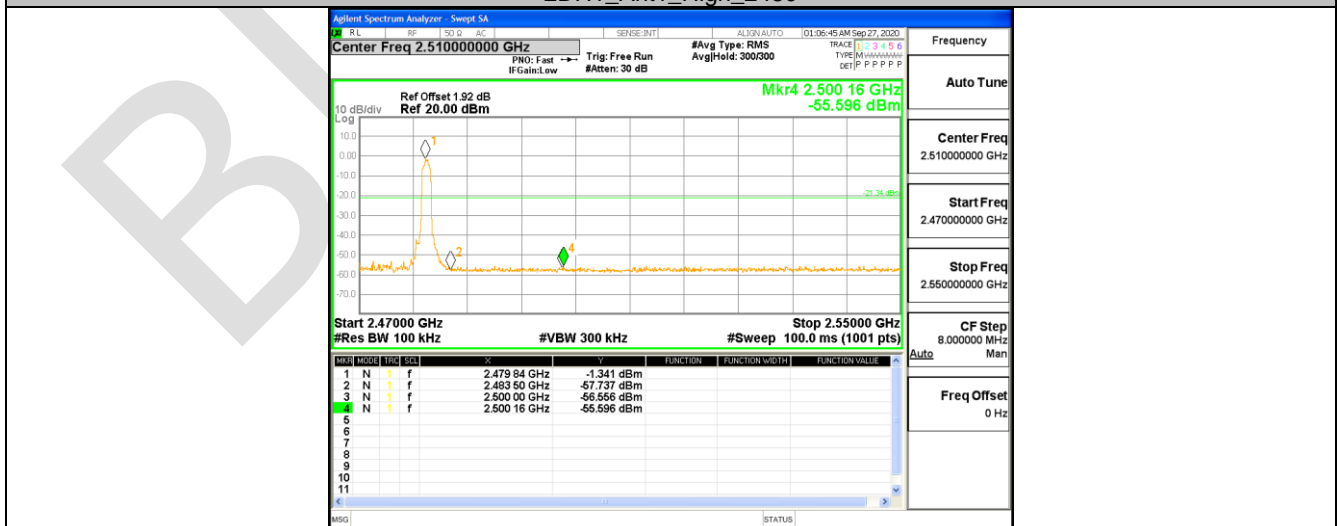


2DH1_Ant1_Low_Hop_2402

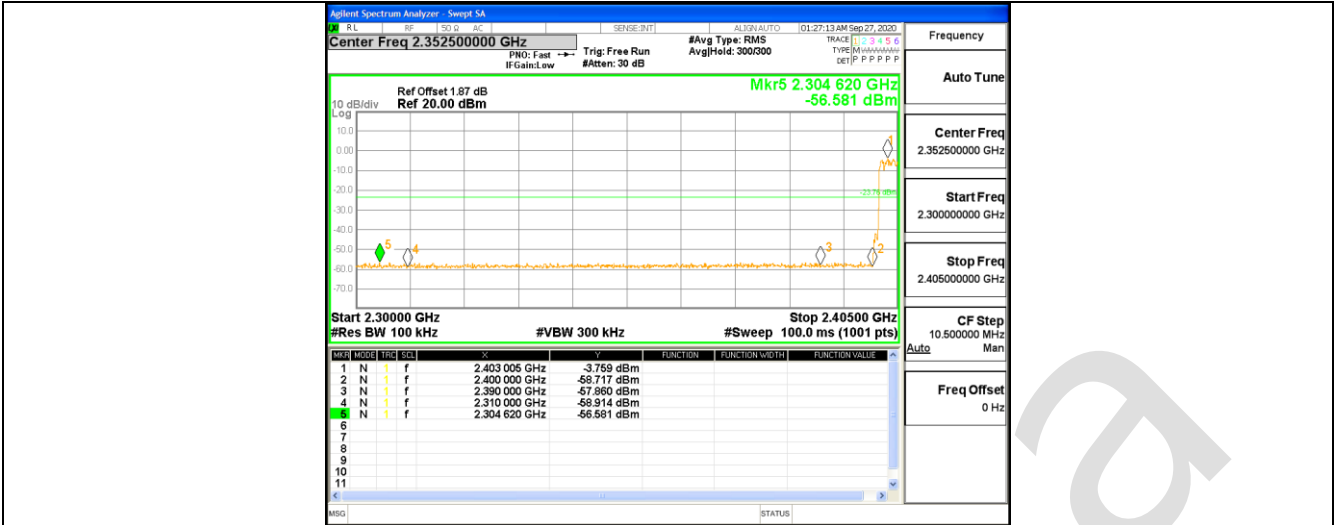


2DH1_Ant1_High_Hop_2480

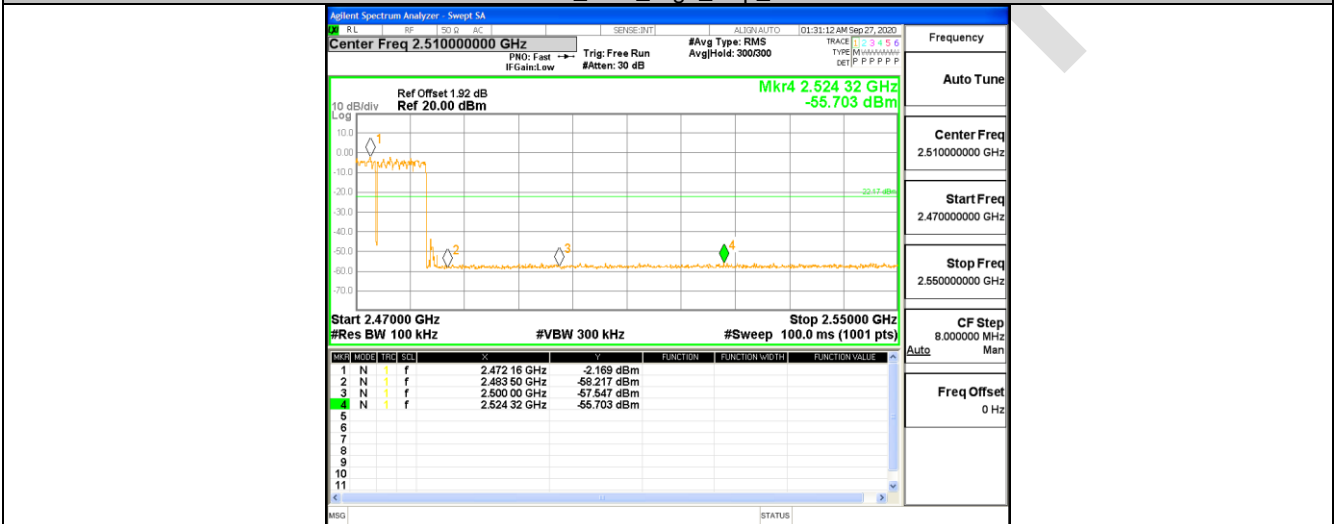


3DH1_Ant1_Low_2480

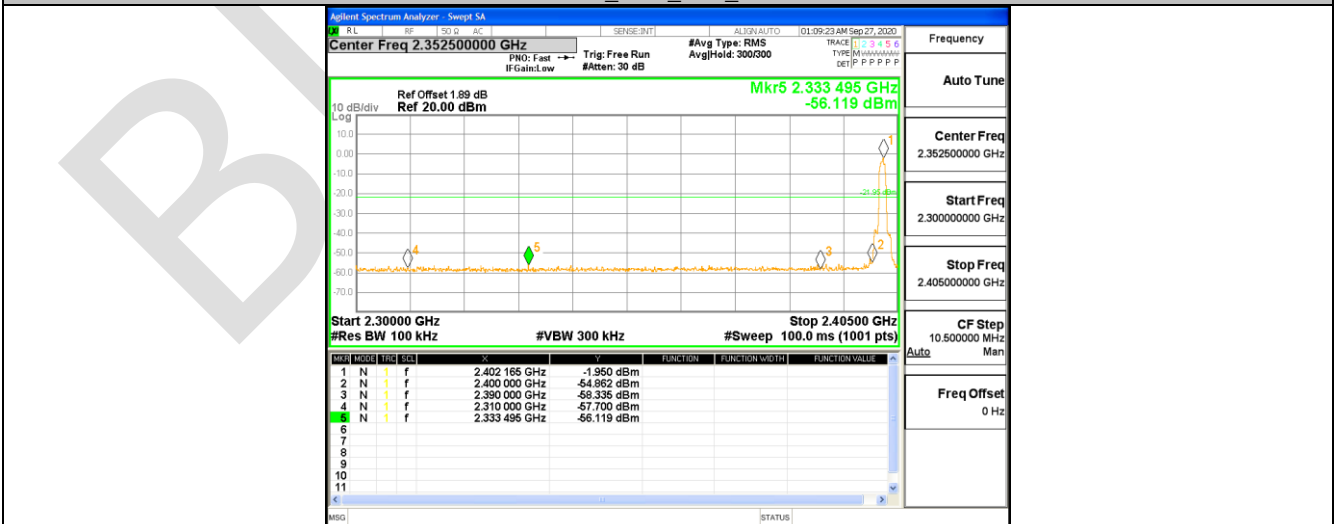


3DH1_Ant1_High_2480

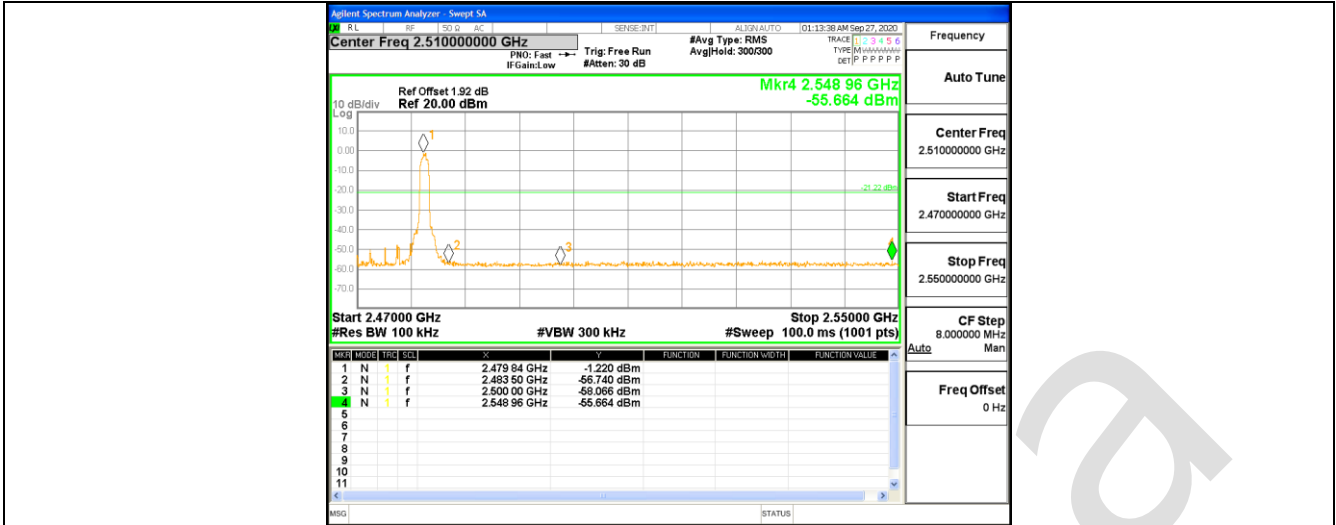

3DH1_Ant1_Low_Hop_2402

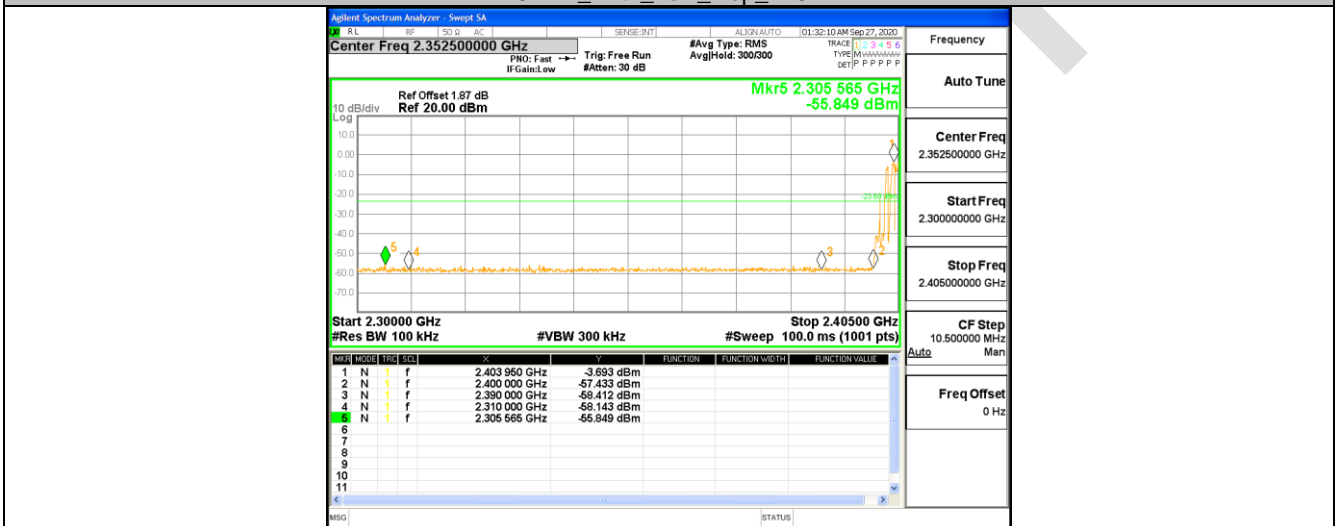

3DH1_Ant1_High_Hop_2480

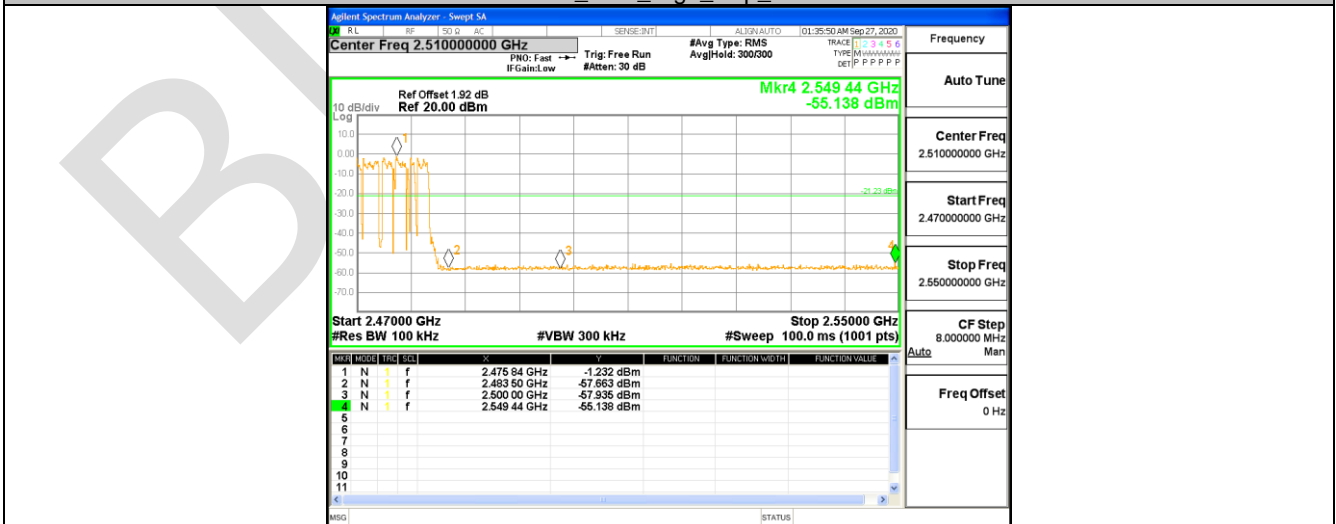


10.7 APPENDIX: CONDUCTED SPURIOUS EMISSION
Test Result


TestMode	Antenna	Channel	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH1	Ant1	2402	Reference	0.83	0.83	---	PASS
			30~1000	30~1000	-67.683	<=-19.168	PASS
			1000~26500	1000~26500	-28.815	<=-19.168	PASS
		2441	Reference	0.96	0.96	---	PASS
			30~1000	30~1000	-68.448	<=-19.04	PASS
			1000~26500	1000~26500	-30.841	<=-19.04	PASS
		2480	Reference	1.35	1.35	---	PASS
			30~1000	30~1000	-48.561	<=-18.649	PASS
			1000~26500	1000~26500	-29.309	<=-18.649	PASS
2DH1	Ant1	2402	Reference	-1.90	-1.90	---	PASS
			30~1000	30~1000	-42.186	<=-21.895	PASS
			1000~26500	1000~26500	-29.65	<=-21.895	PASS
		2441	Reference	-2.63	-2.63	---	PASS
			30~1000	30~1000	-68.179	<=-22.632	PASS
			1000~26500	1000~26500	-32.255	<=-22.632	PASS
		2480	Reference	-2.46	-2.46	---	PASS
			30~1000	30~1000	-68.456	<=-22.458	PASS
			1000~26500	1000~26500	-32.67	<=-22.458	PASS
3DH1	Ant1	2402	Reference	-2.02	-2.02	---	PASS
			30~1000	30~1000	-35.065	<=-22.019	PASS
			1000~26500	1000~26500	-31.786	<=-22.019	PASS
		2441	Reference	-1.50	-1.50	---	PASS
			30~1000	30~1000	-36.797	<=-21.495	PASS
			1000~26500	1000~26500	-29.094	<=-21.495	PASS
		2480	Reference	-1.88	-1.88	---	PASS
			30~1000	30~1000	-67.579	<=-21.88	PASS
			1000~26500	1000~26500	-33.983	<=-21.88	PASS

Test Graphs




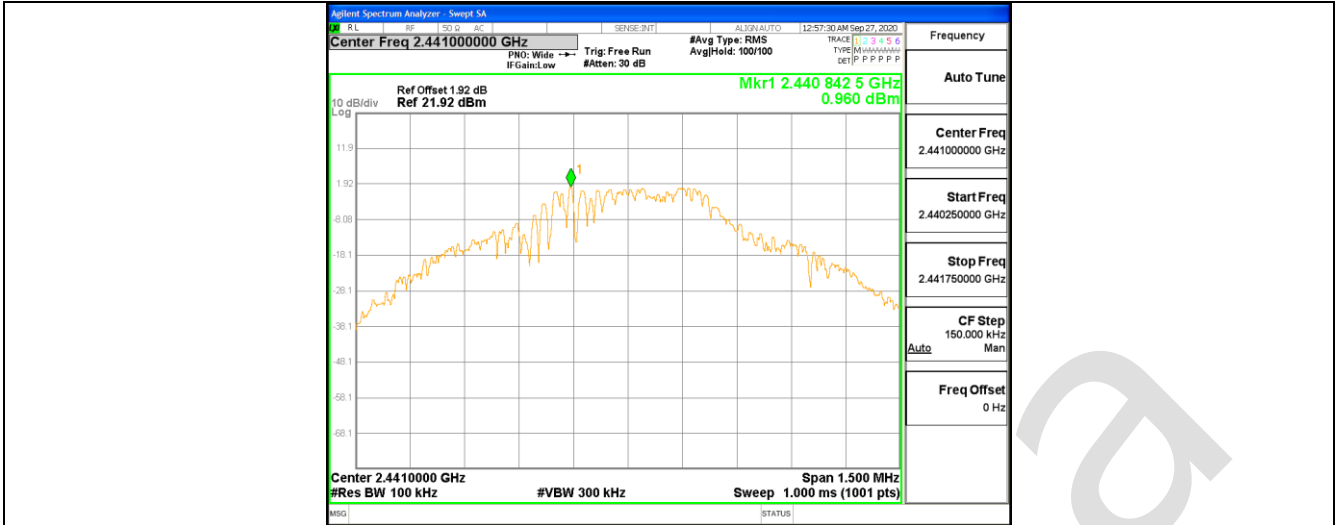


DH1_Ant1_2441_30~1000

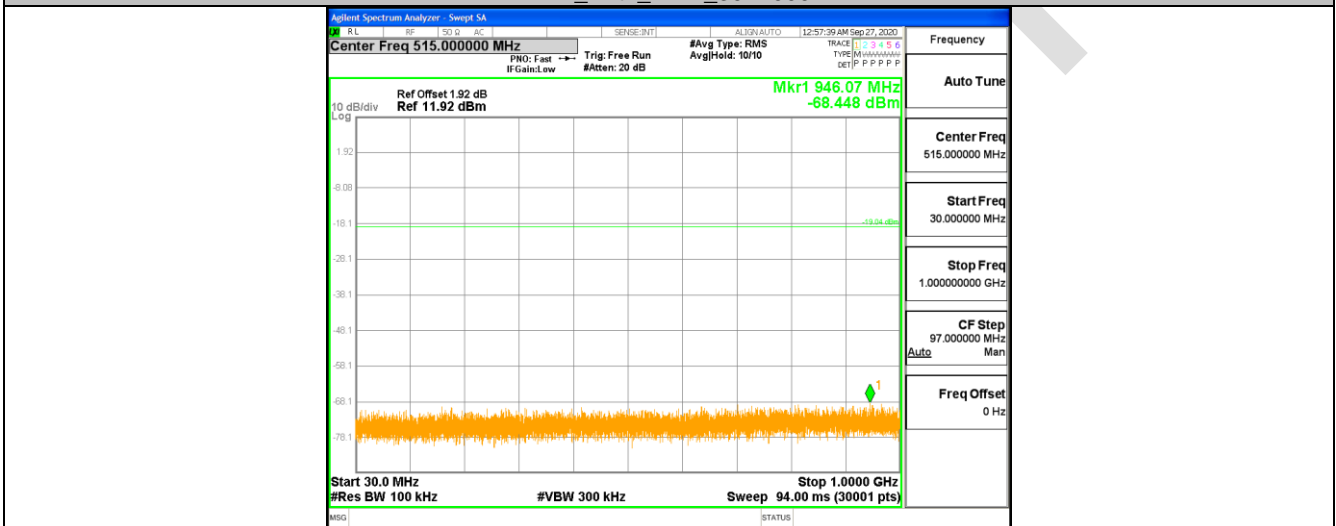


DH1_Ant1_2441_1000~26500

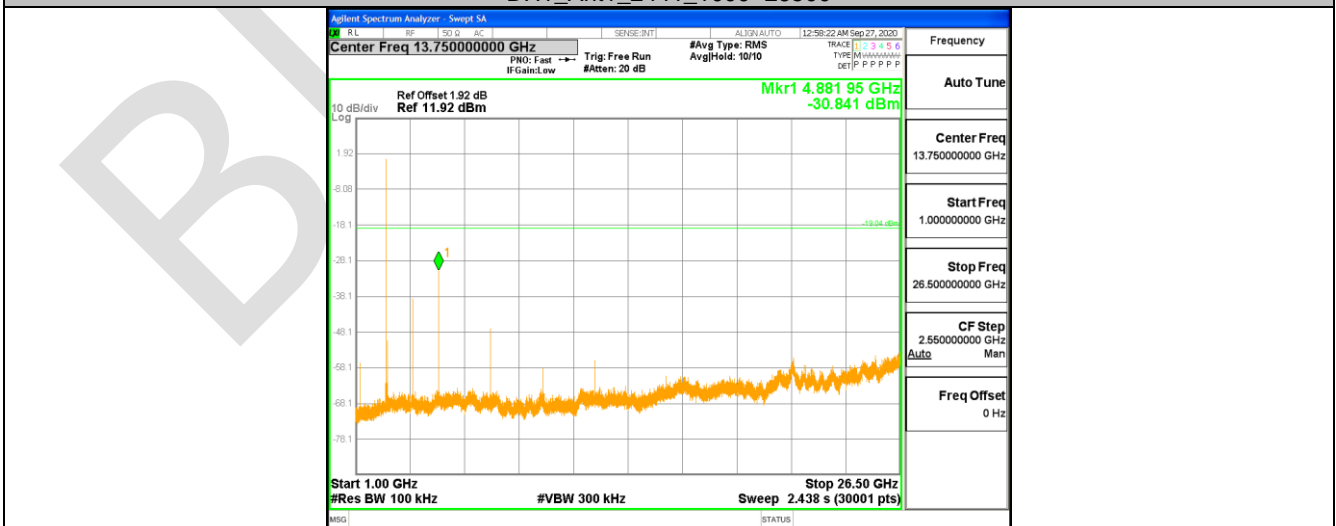


DH1_Ant1_2480_0~Reference

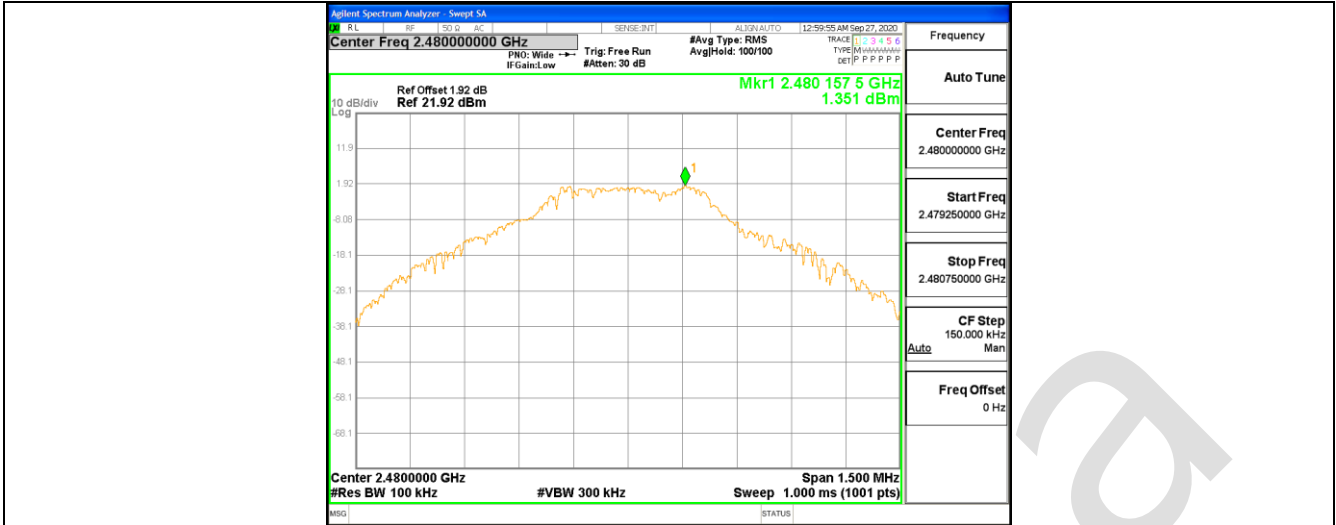


DH1_Ant1_2480_30~1000

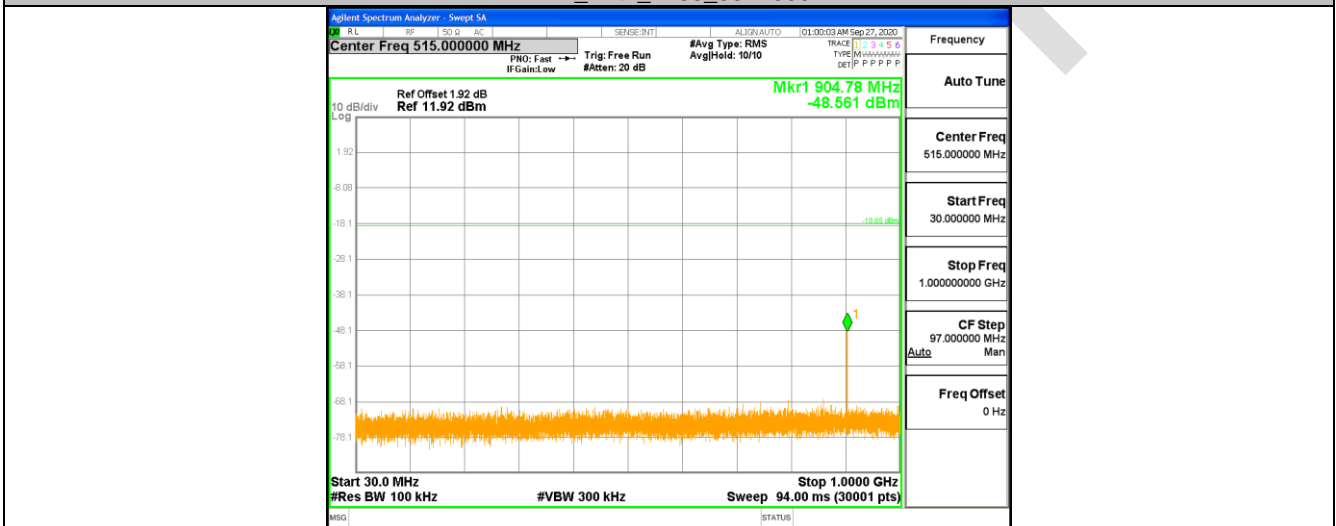


DH1_Ant1_2480_1000~26500

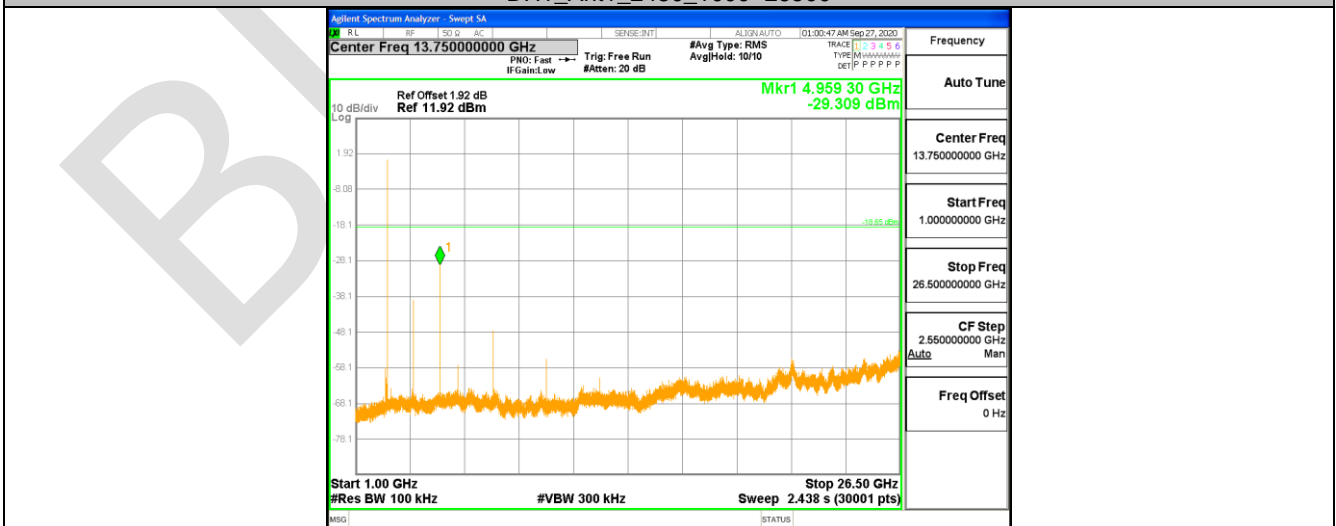


2DH1_Ant1_2402_0~Reference

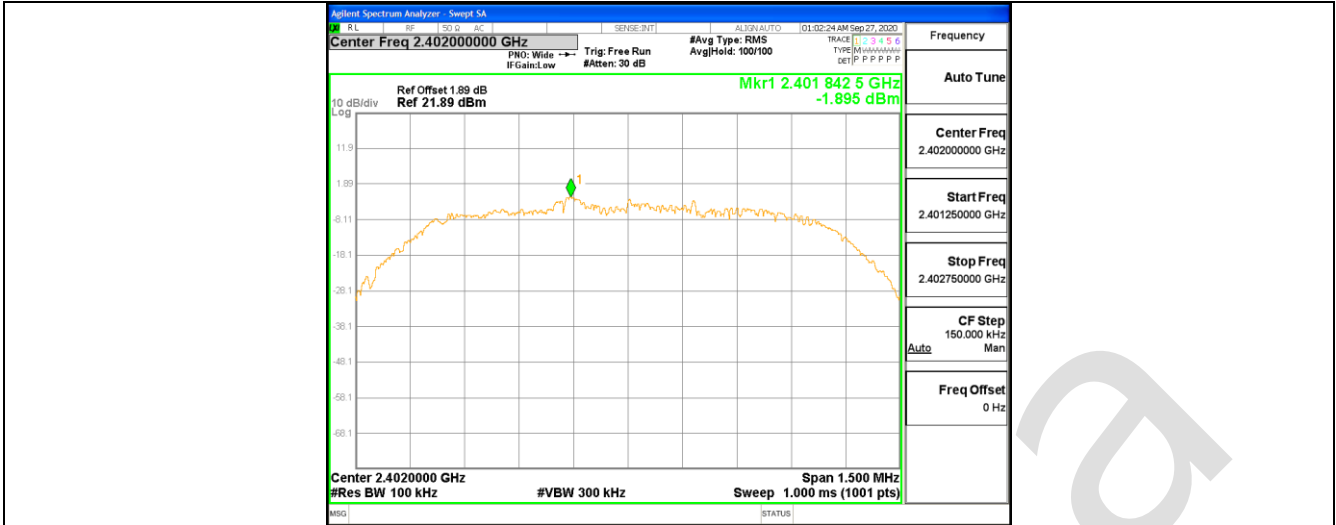




2DH1_Ant1_2402_30~1000



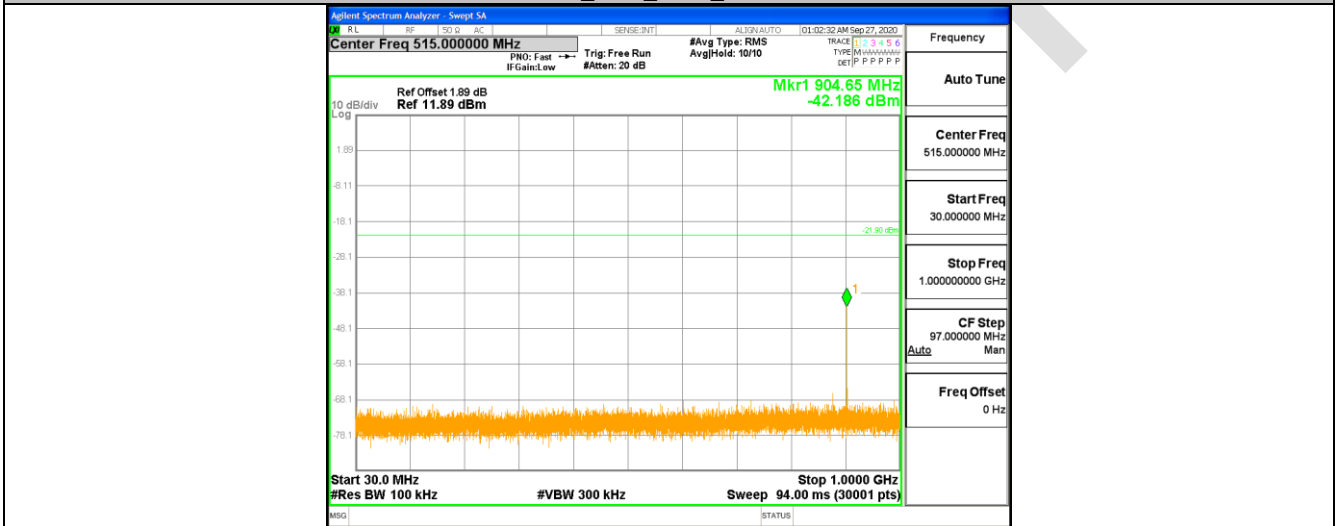



2DH1_Ant1_2402_1000~26500

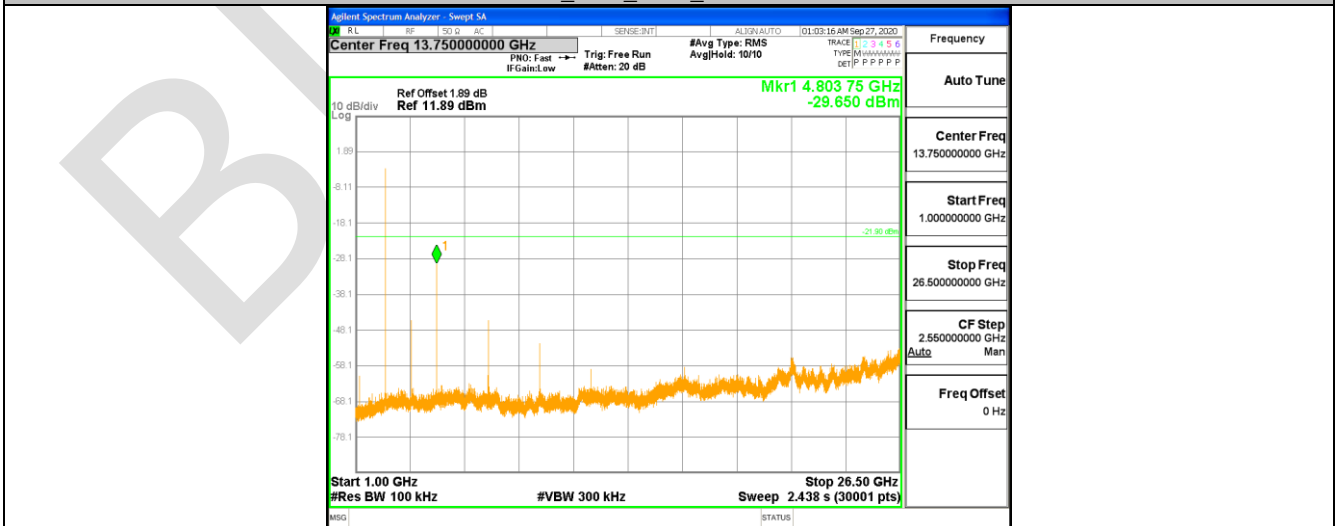


2DH1_Ant1_2441_0~Reference

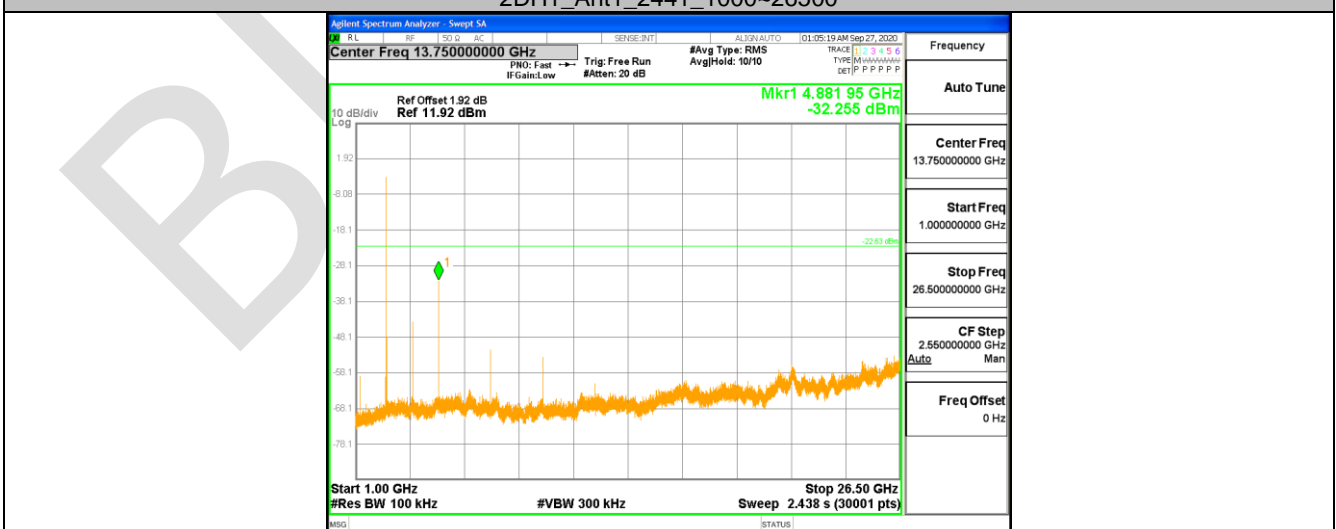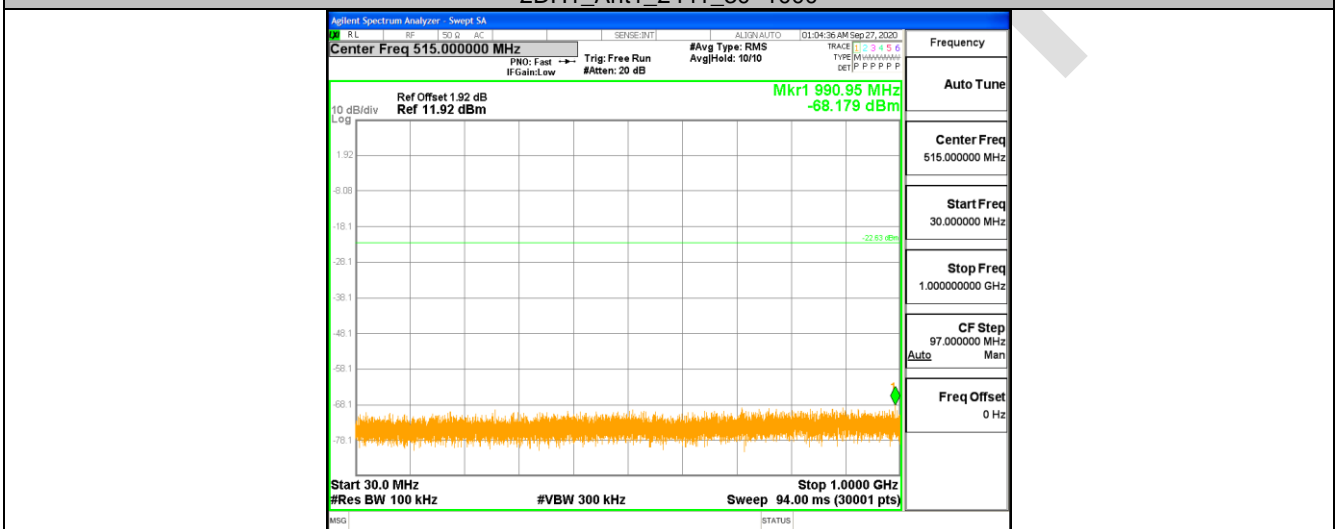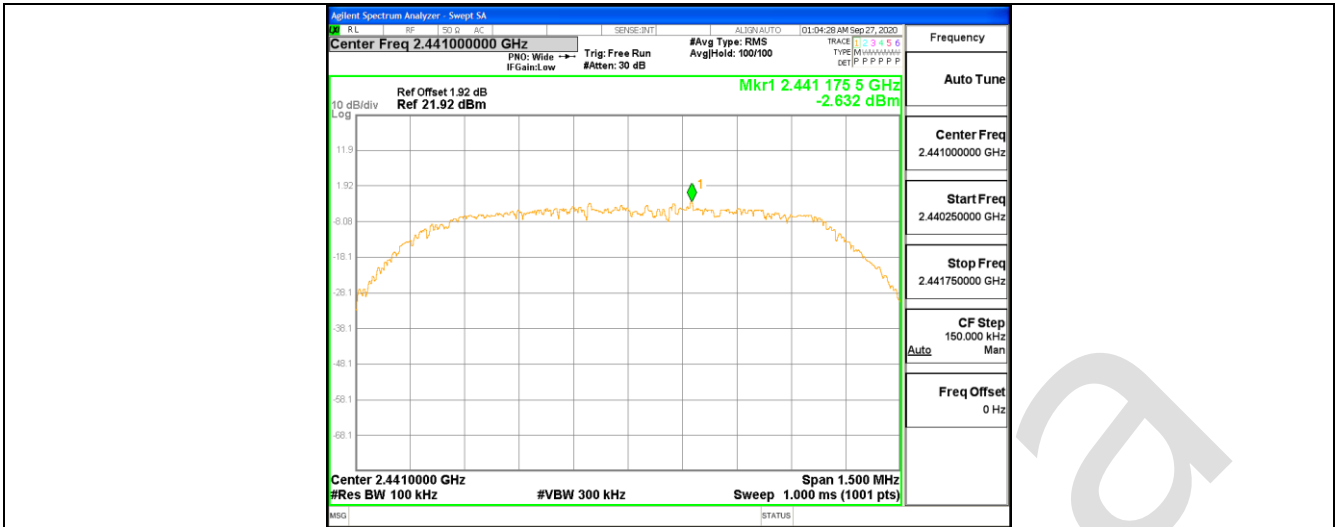

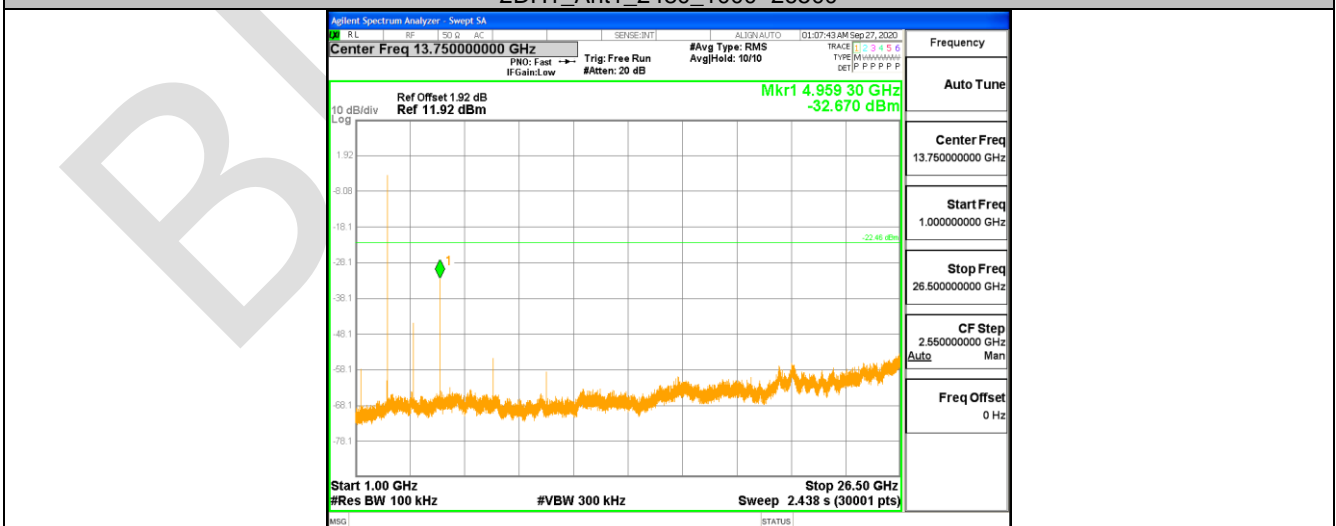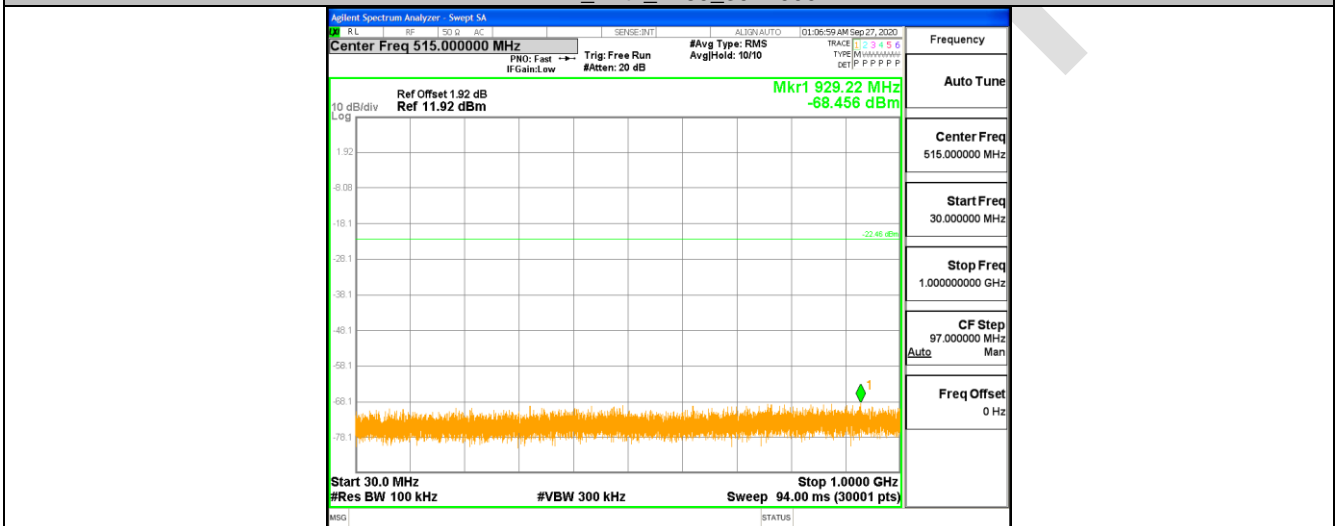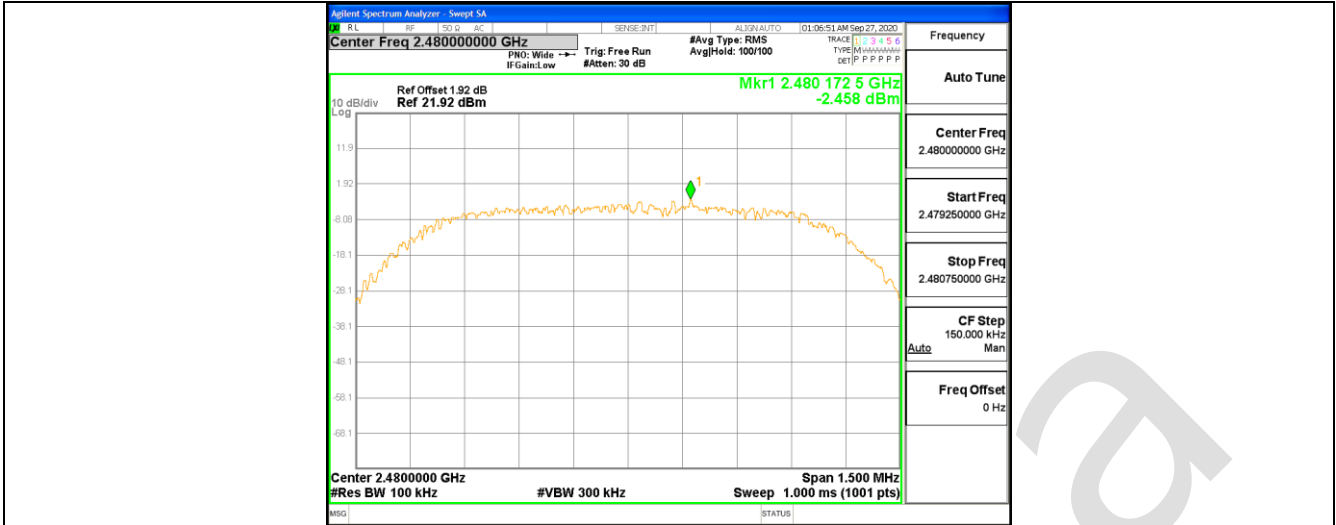


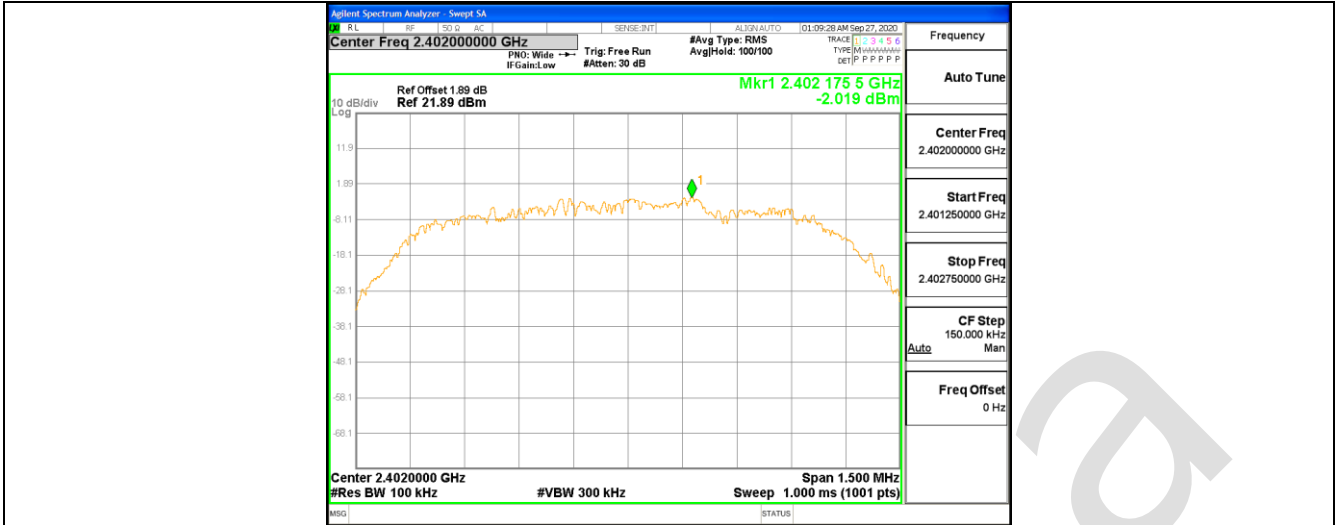


3DH1_Ant1_2402_30~1000

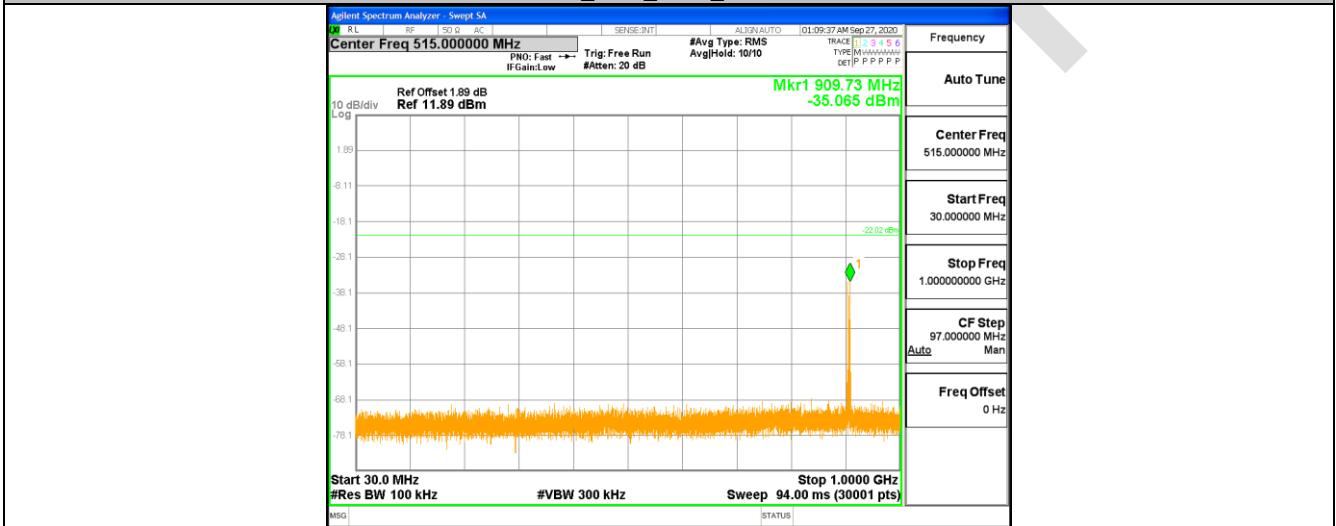


3DH1_Ant1_2402_1000~26500

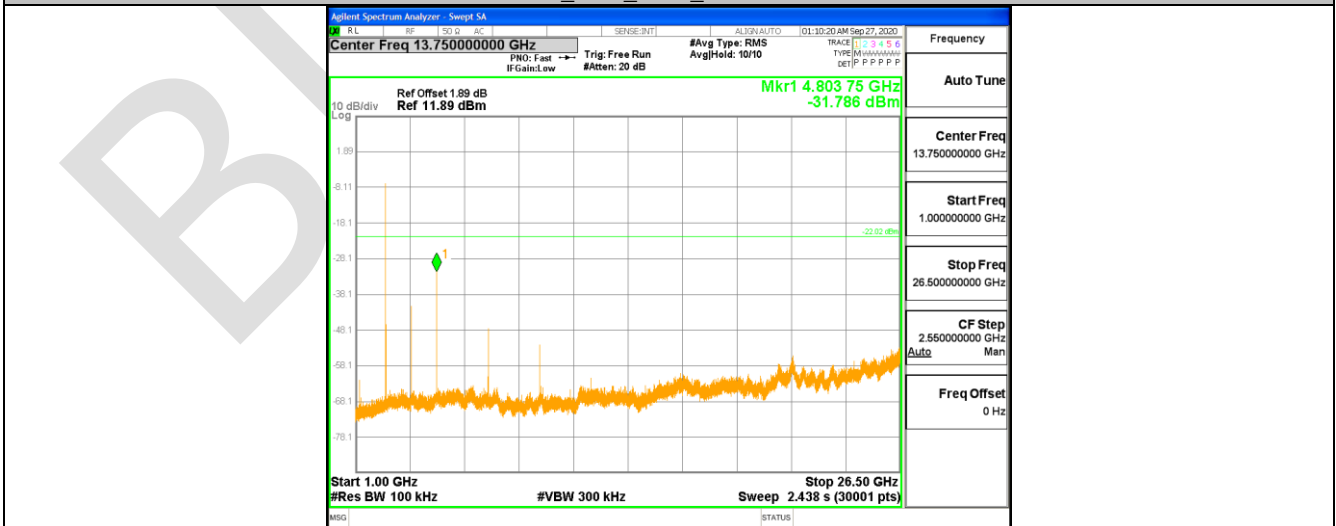


3DH1_Ant1_2441_0~Reference

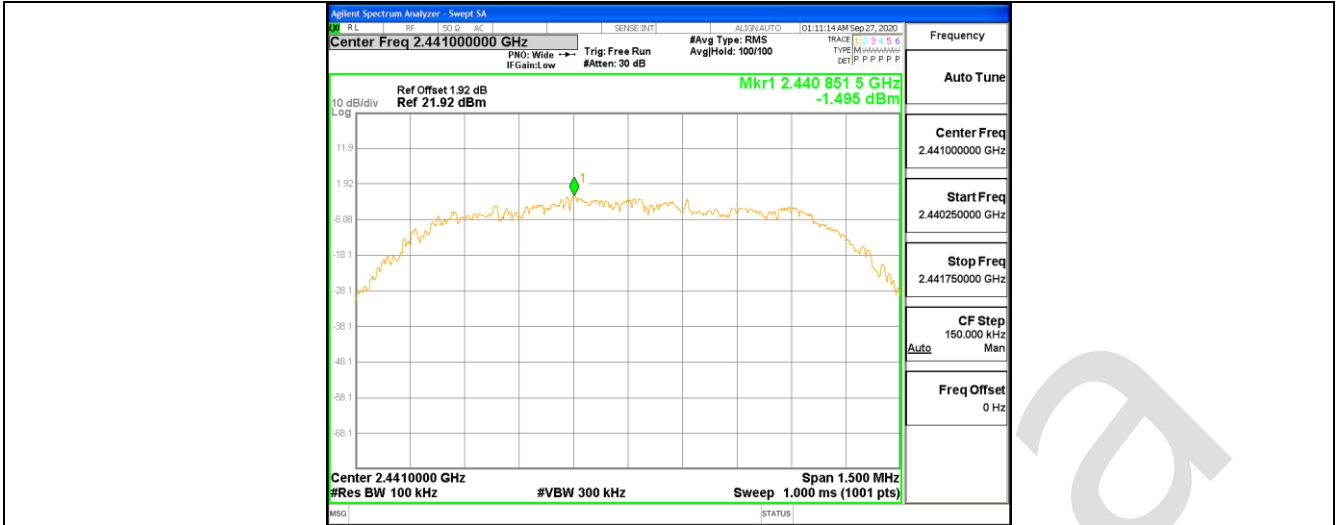




3DH1_Ant1_2441_30~1000

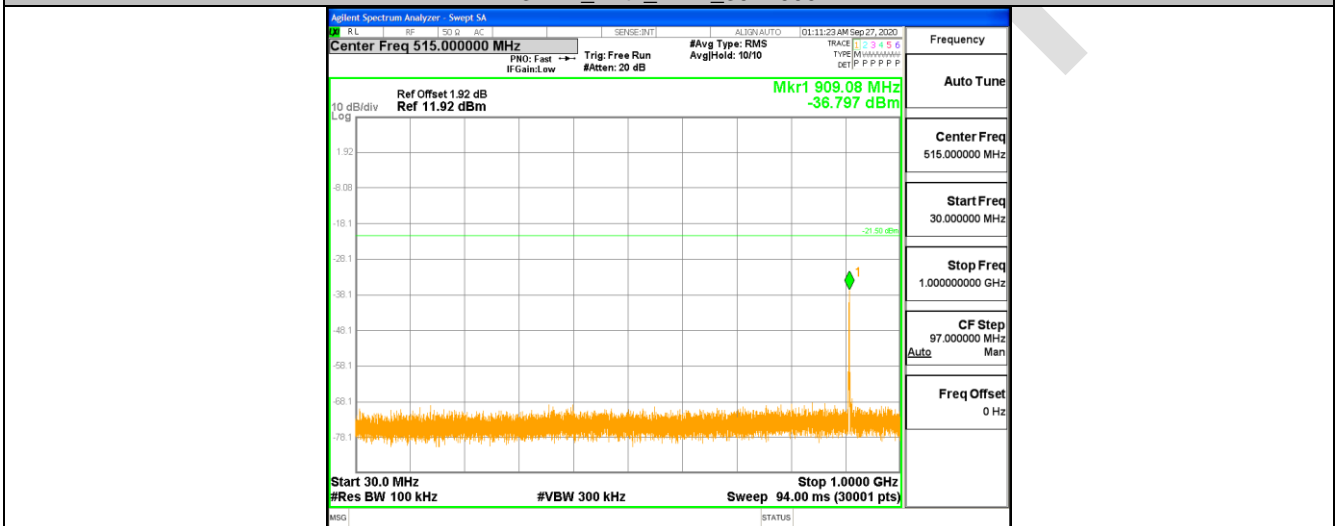

3DH1_Ant1_2441_1000~26500

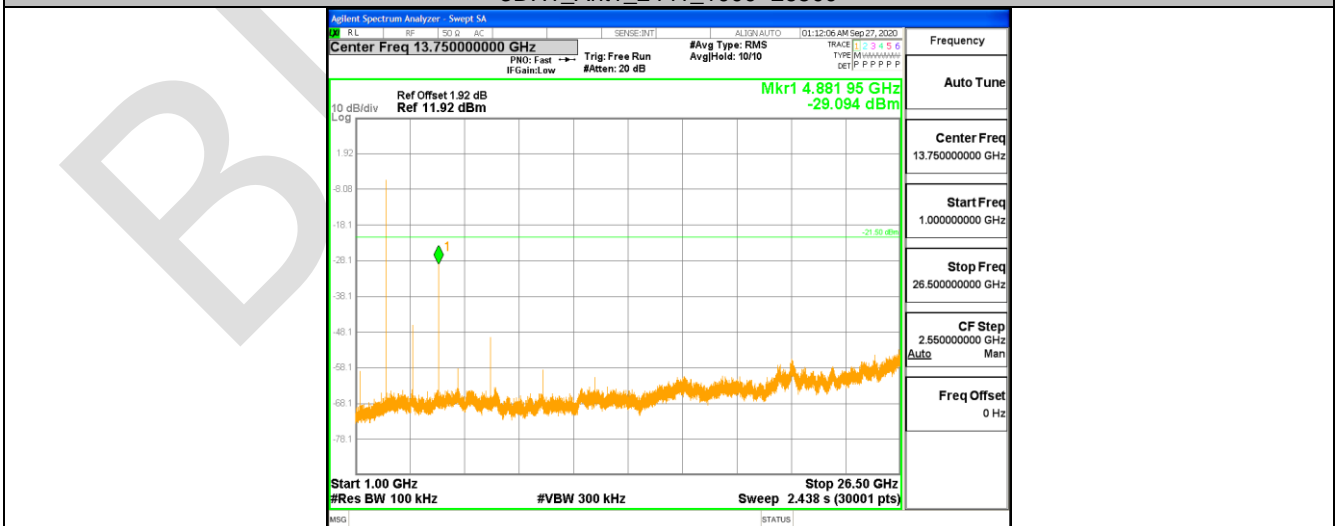


3DH1_Ant1_2480_0~Reference

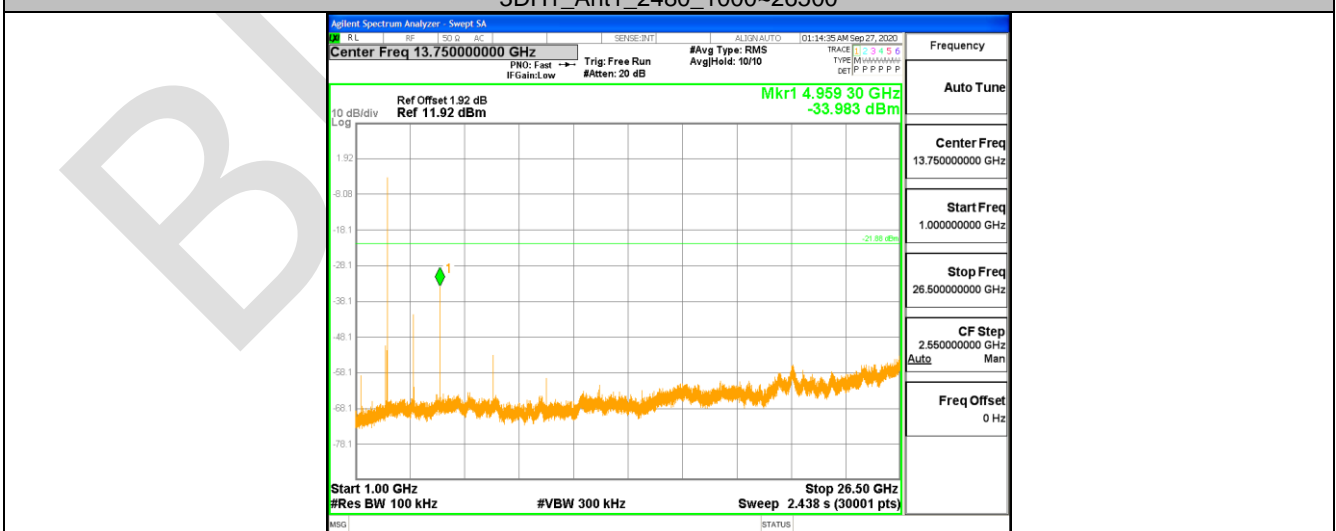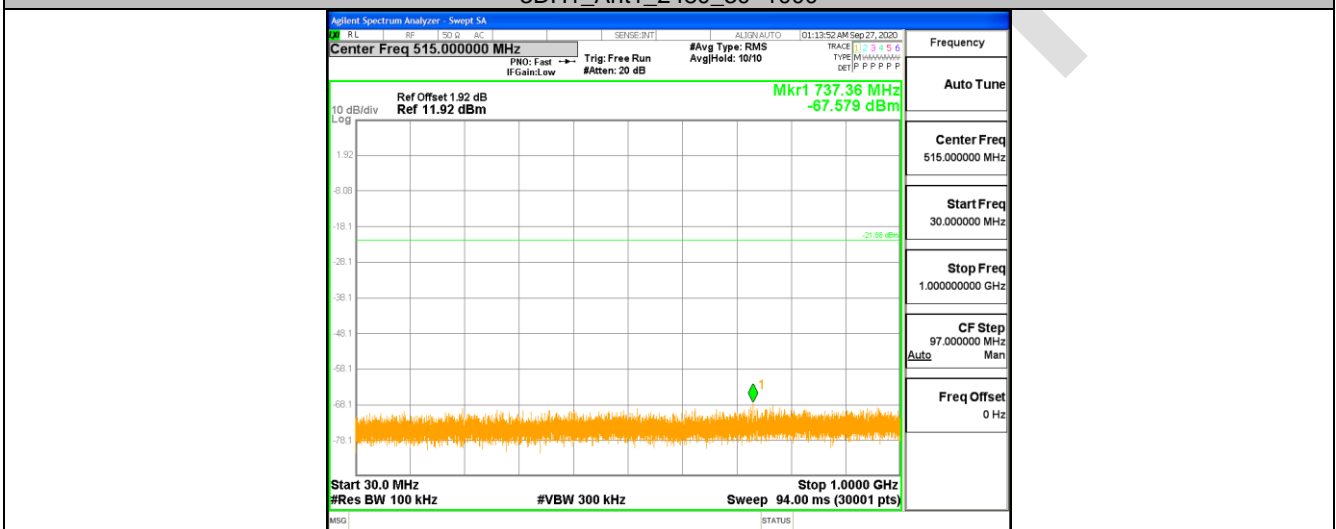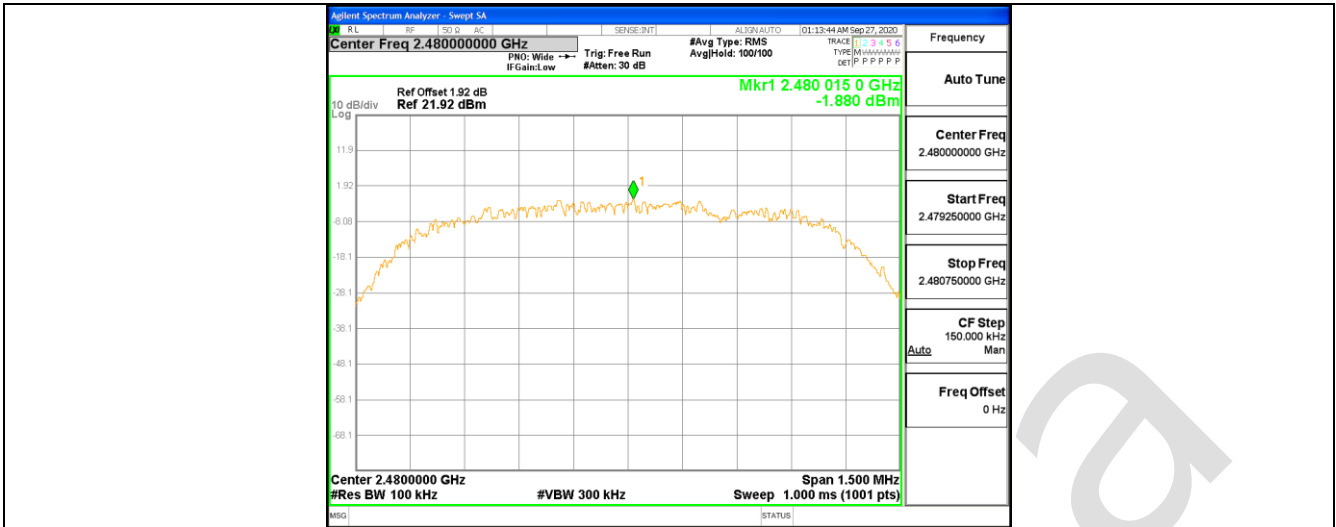

APPENDIX A: PHOTOGRAPHS OF TEST SETUP


Antenna Requirement

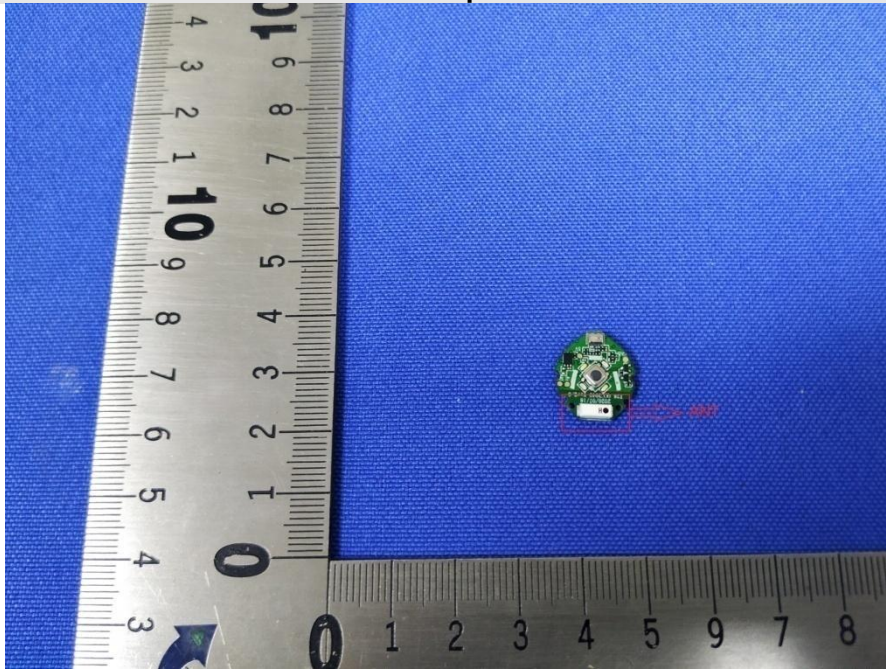

Conducted Emissions at AC Power Line (150kHz-30MHz)



Radiated Spurious Emissions

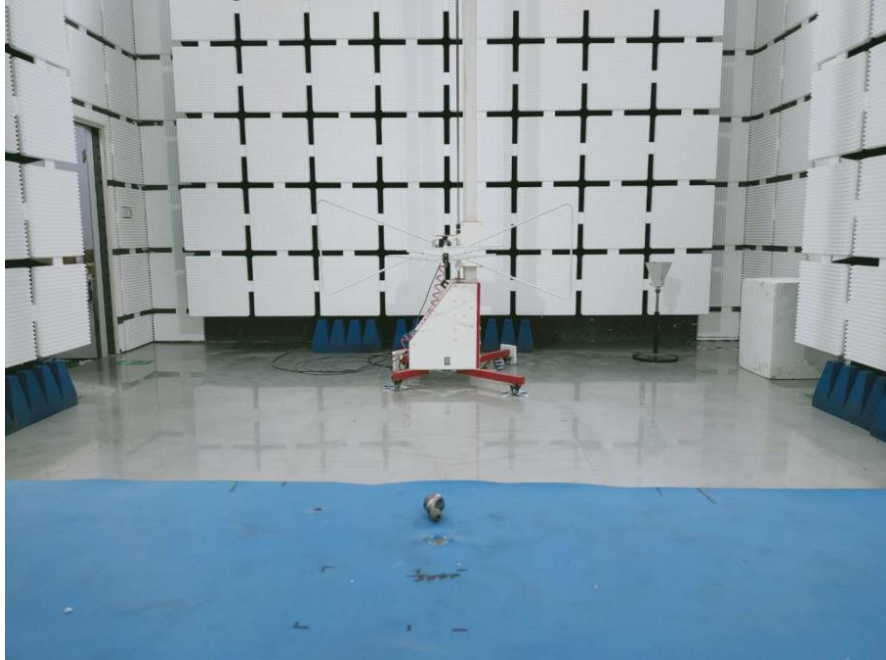

APPENDIX B: PHOTOGRAPHS OF EUT



