





Audix Technology Corp.
 No. 53-11, Dingfu, Linkou, Dist.,
 New Taipei City 244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

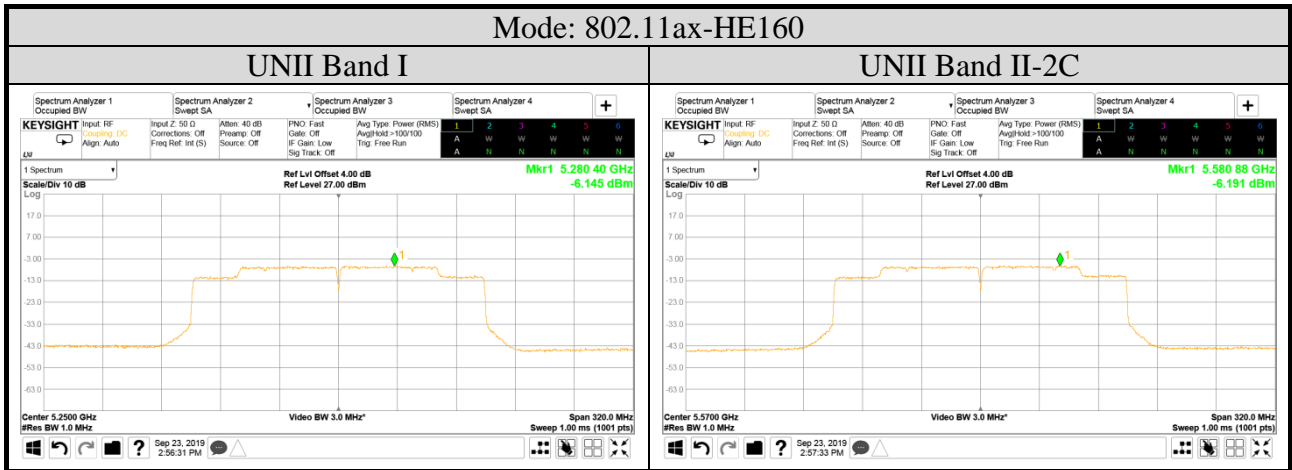

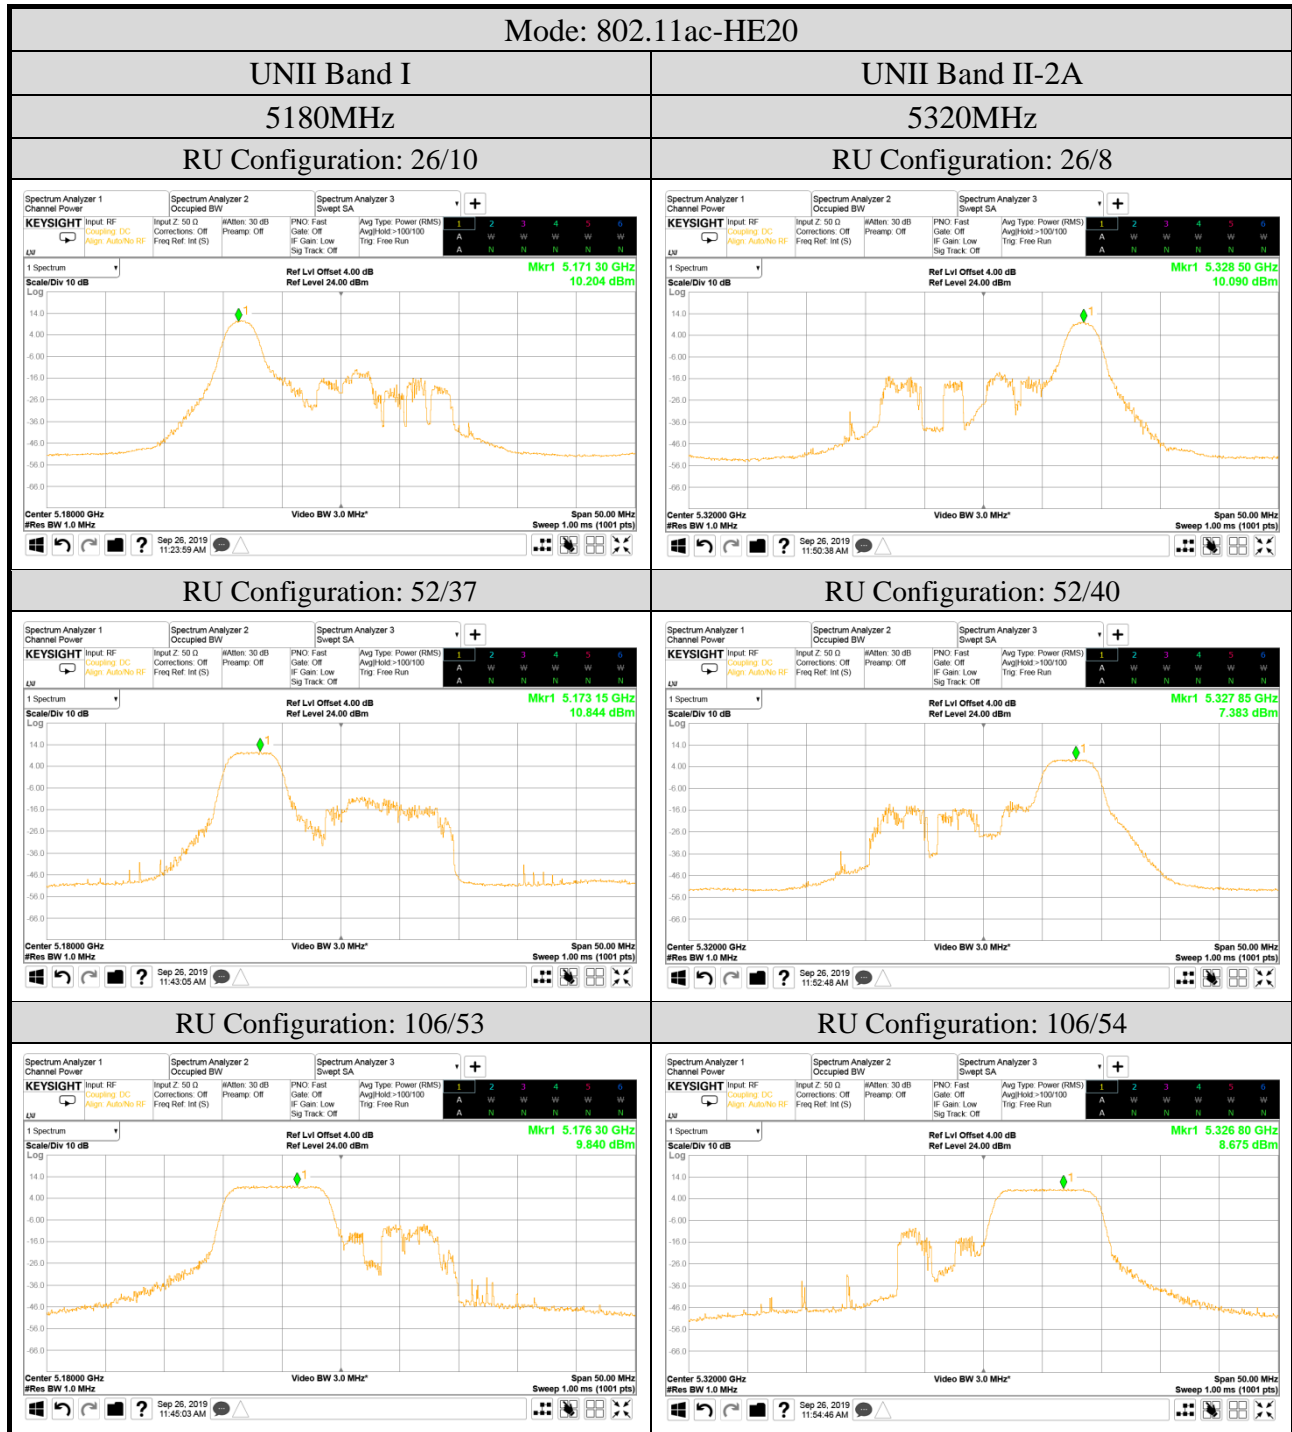


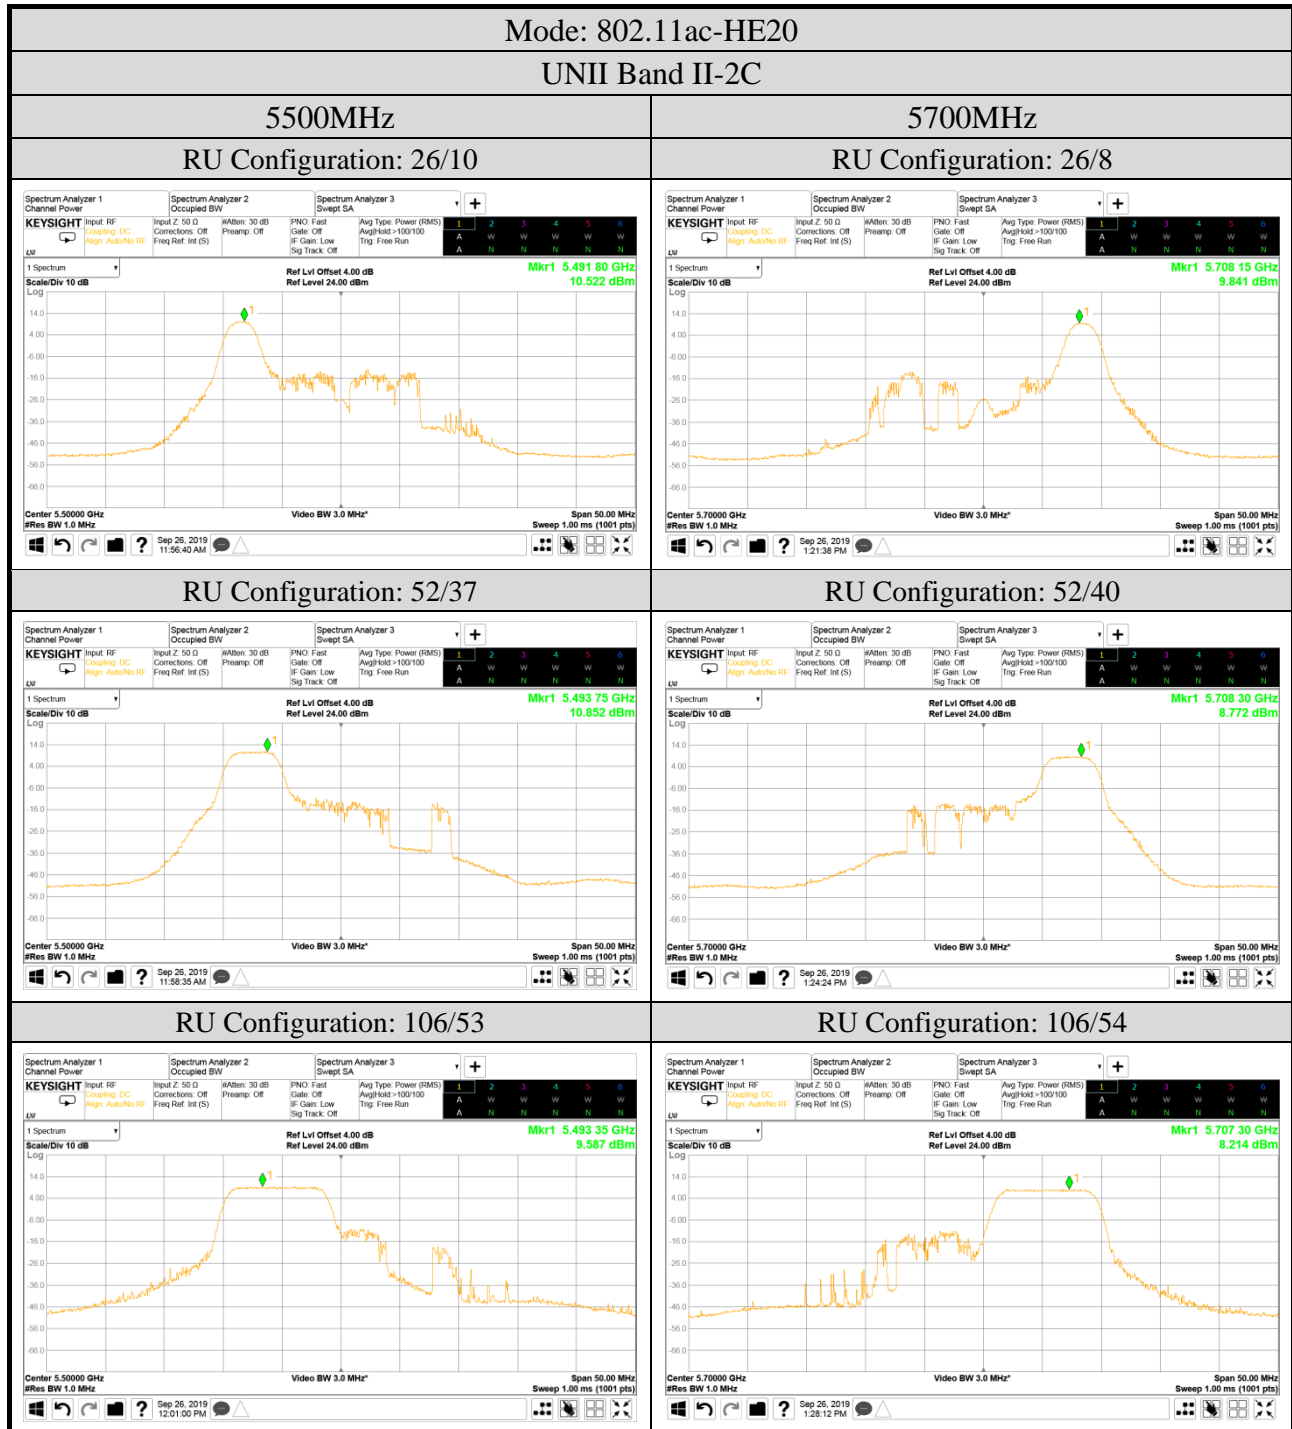


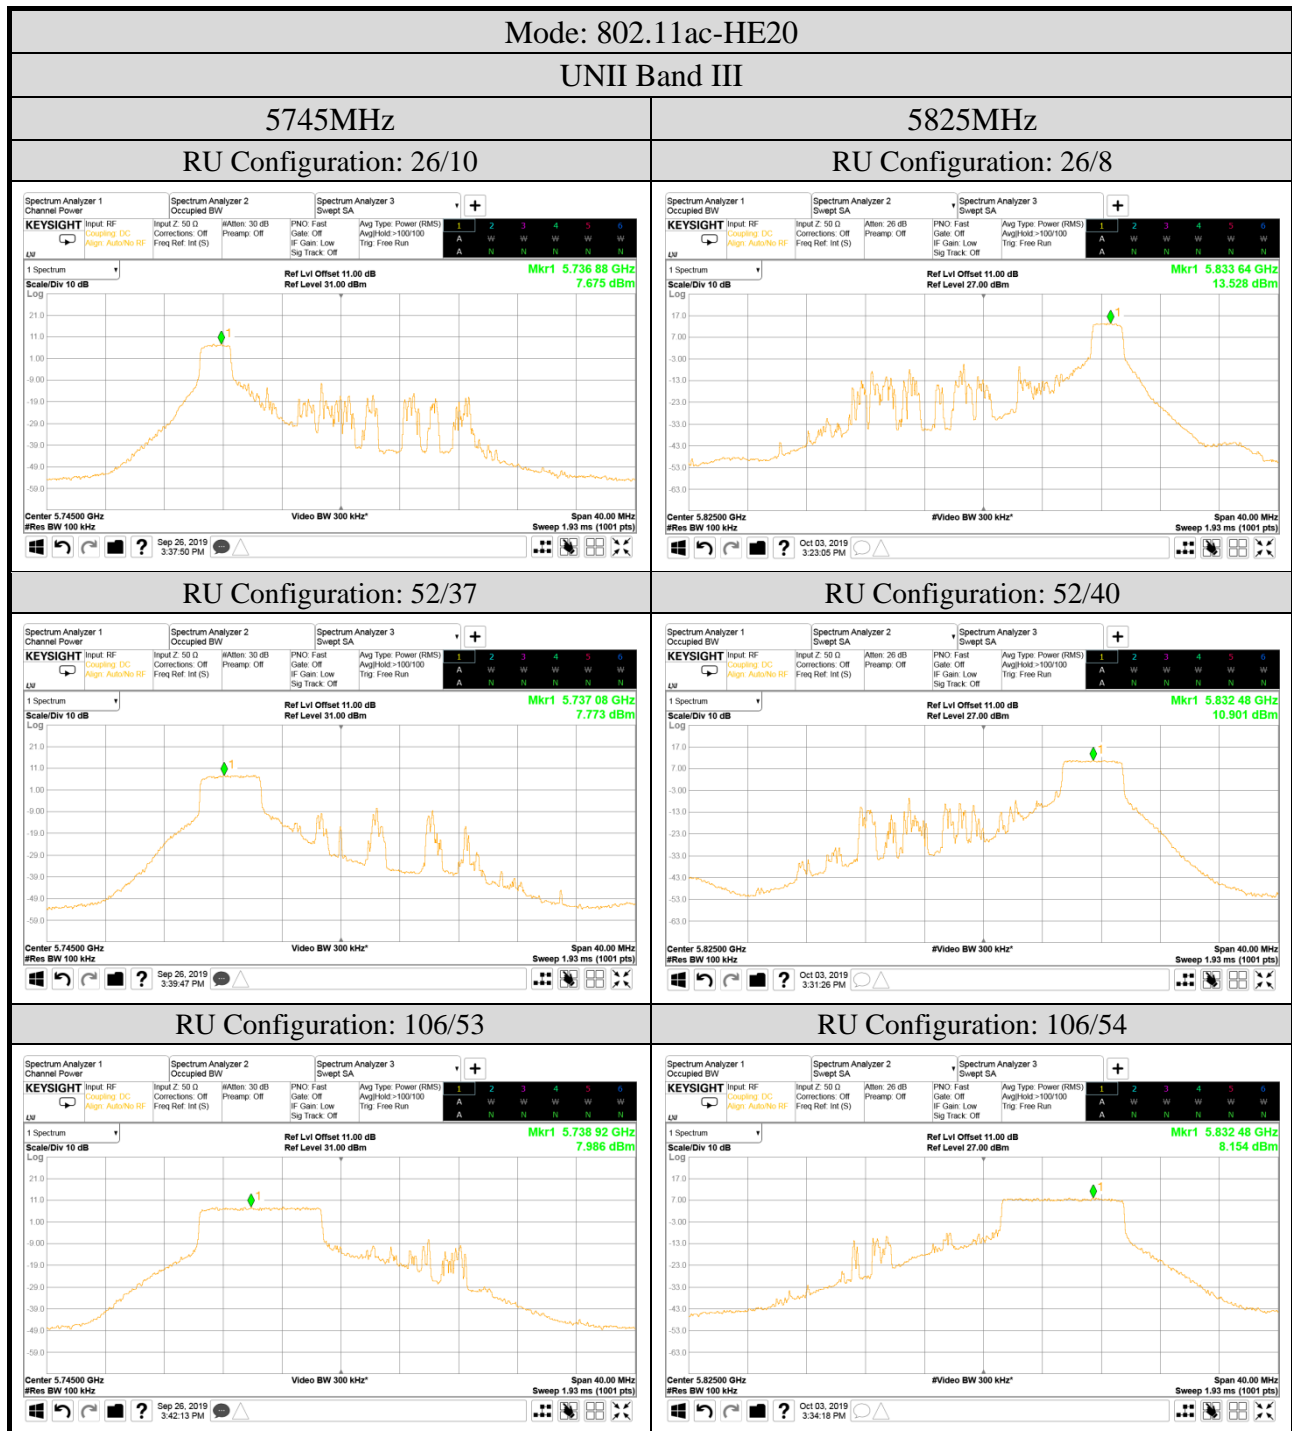


Audix Technology Corp.
 No. 53-11, Dingfu, Linkou, Dist.,
 New Taipei City 244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

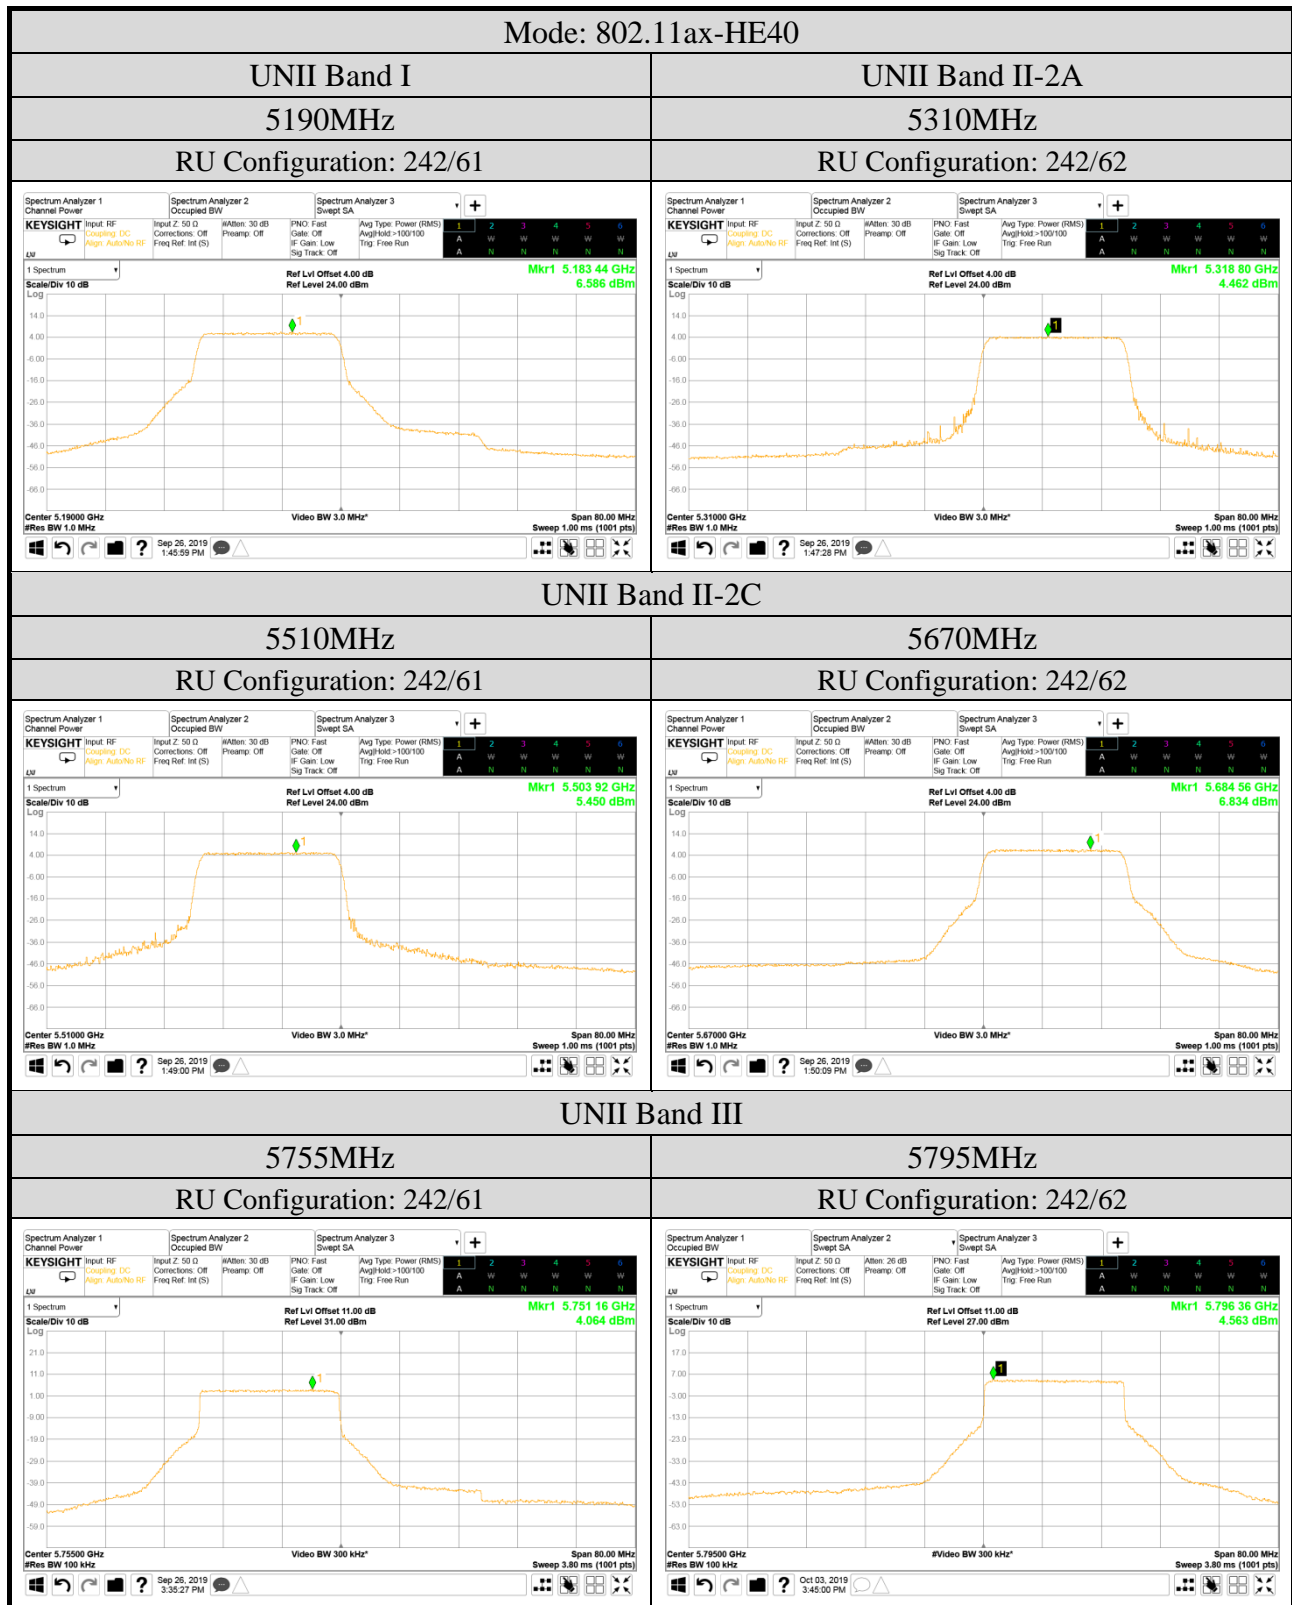

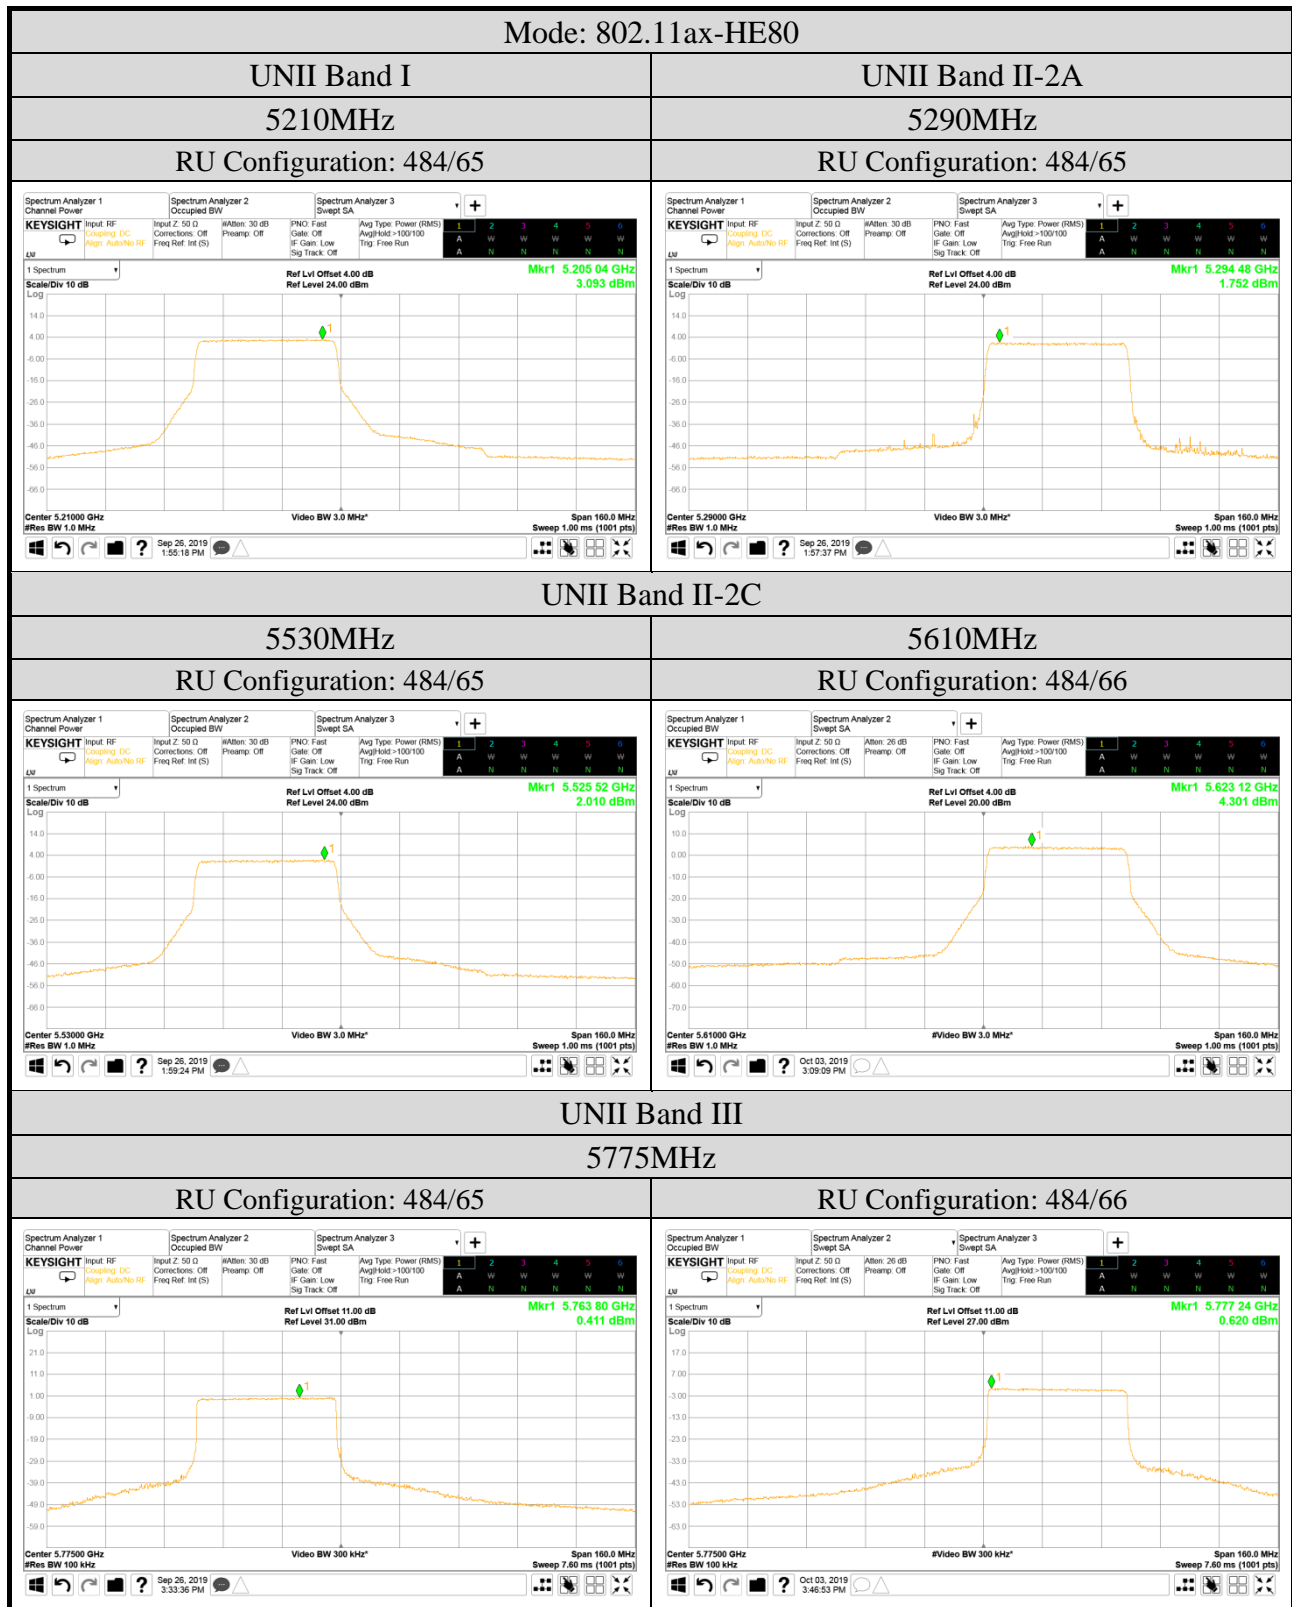

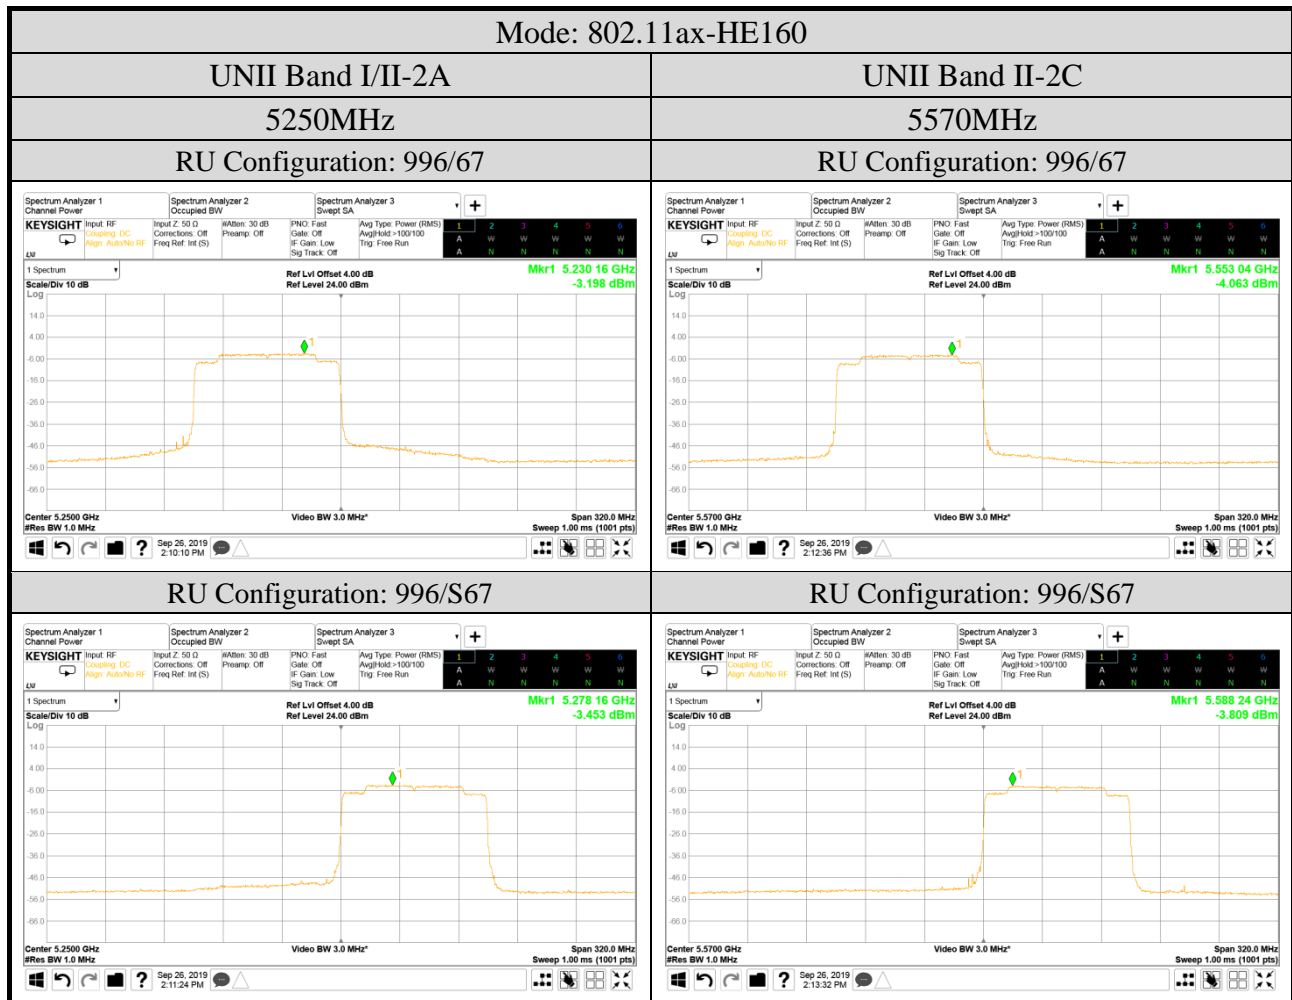

A.7 FREQUENCY STABILITY

Test Date	2019/10/14	Temp./Hum.	26°C/64%
Cable Loss	---	Test Voltage	AC 120V 60Hz (Via AC Adapter)

A.7.1 Frequency stability Result

Temperature (°C)	Voltage (Vac)	Centre Frequency (MHz)	Measurement Value (MHz)	Frequency Stability (ppm)
25	120	5180	5180.002	0.386
-30	102		5179.952	-9.266
	138		5179.959	-7.915
-20	102		5179.967	-6.371
	138		5179.975	-4.826
-10	102		5179.974	-5.019
	138		5179.981	-3.668
0	102		5179.98	-3.861
	138		5179.985	-2.896
10	102		5179.989	-2.124
	138		5179.996	-0.772
20	102		5180.004	0.772
	138		5180.007	1.351
30	102		5180.011	2.124
	138		5180.018	3.475
40	102		5180.016	3.089
	138		5180.024	4.633
50	102		5180.025	4.826
	138		5180.032	6.178



Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City 244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

APPDNDIX B

TEST PHOTOGRAPHS

(Model: 17Z995)