


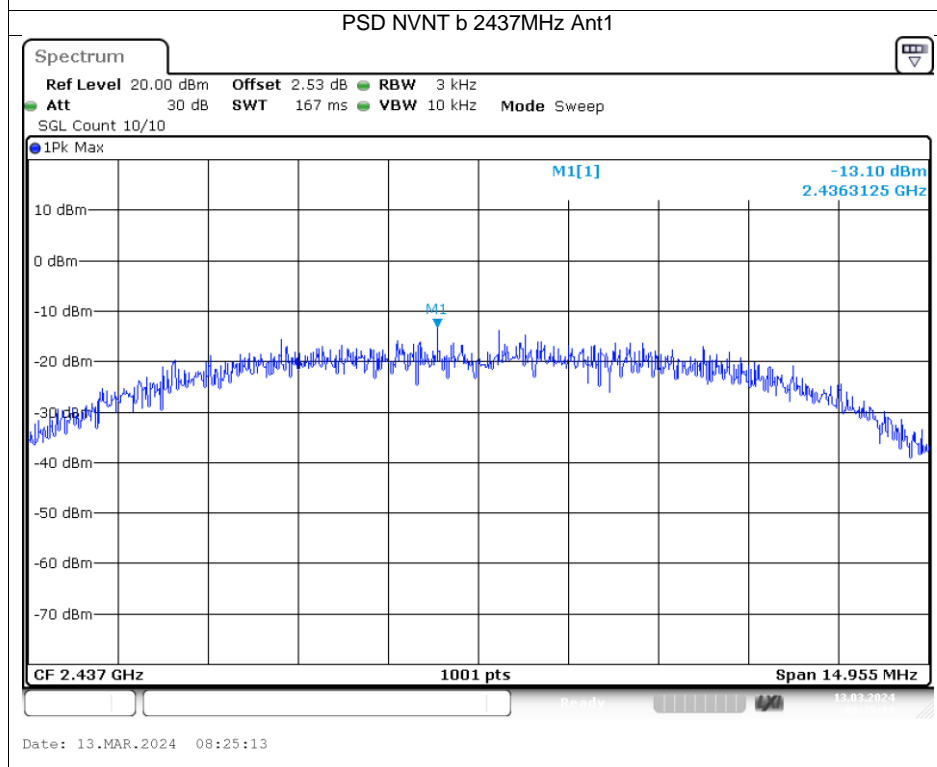
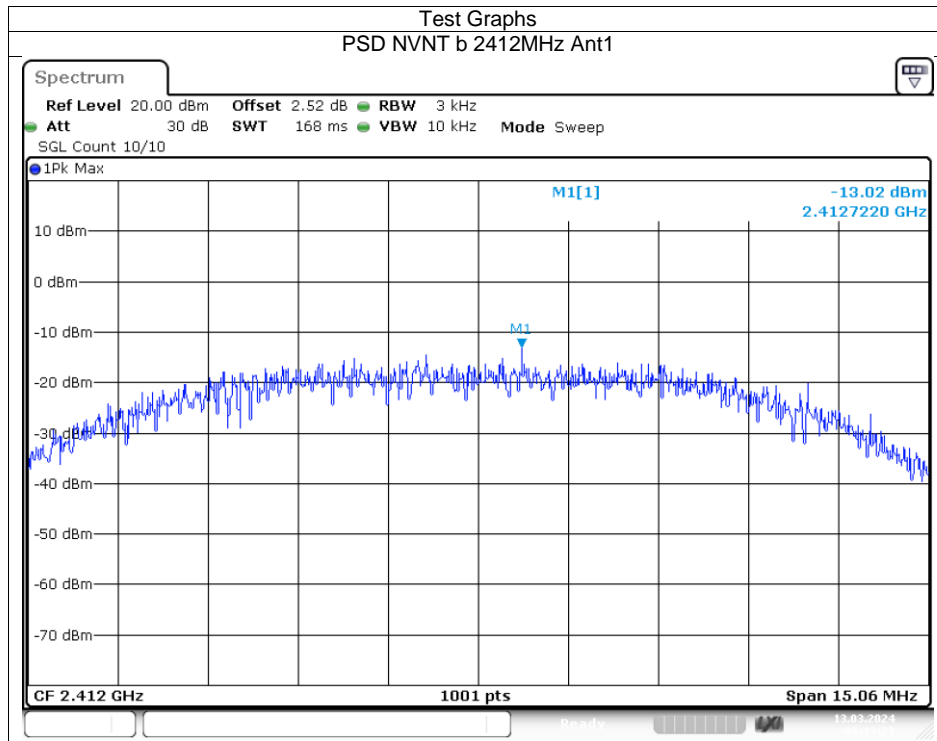
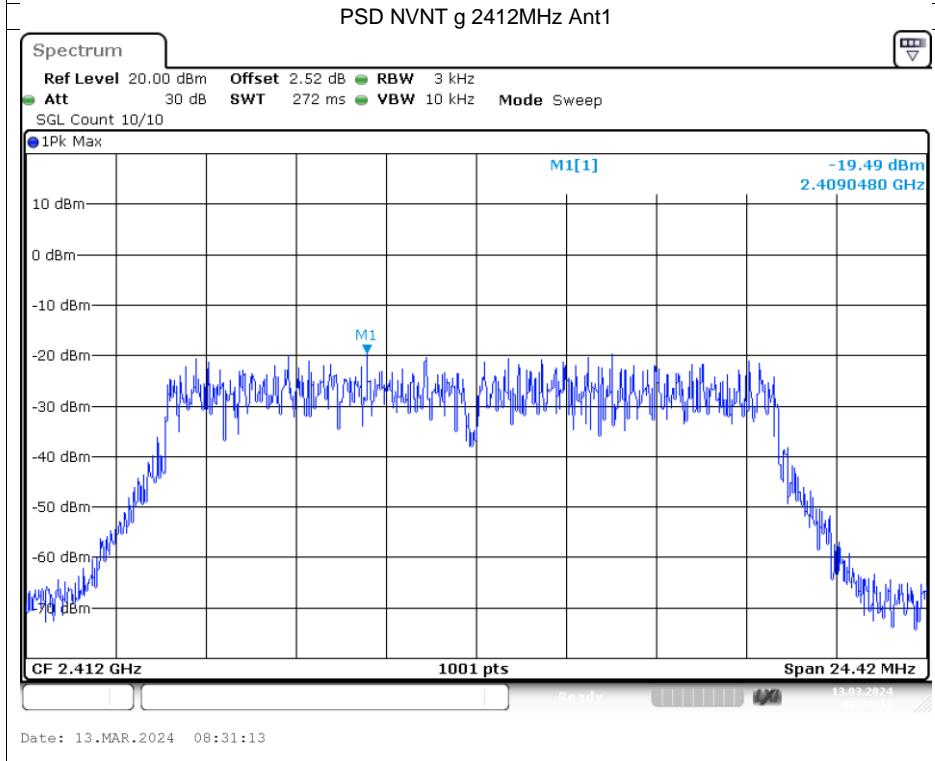




Maximum Power Spectral Density Level


Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/3kHz)	Limit (dBm/3kHz)	Verdict
NVNT	b	2412	Ant1	-13.02	8	Pass
NVNT	b	2437	Ant1	-13.1	8	Pass
NVNT	b	2462	Ant1	-12.2	8	Pass
NVNT	g	2412	Ant1	-19.49	8	Pass
NVNT	g	2437	Ant1	-19.65	8	Pass
NVNT	g	2462	Ant1	-18.98	8	Pass
NVNT	n20	2412	Ant1	-21.22	8	Pass
NVNT	n20	2437	Ant1	-21.75	8	Pass
NVNT	n20	2462	Ant1	-20.99	8	Pass

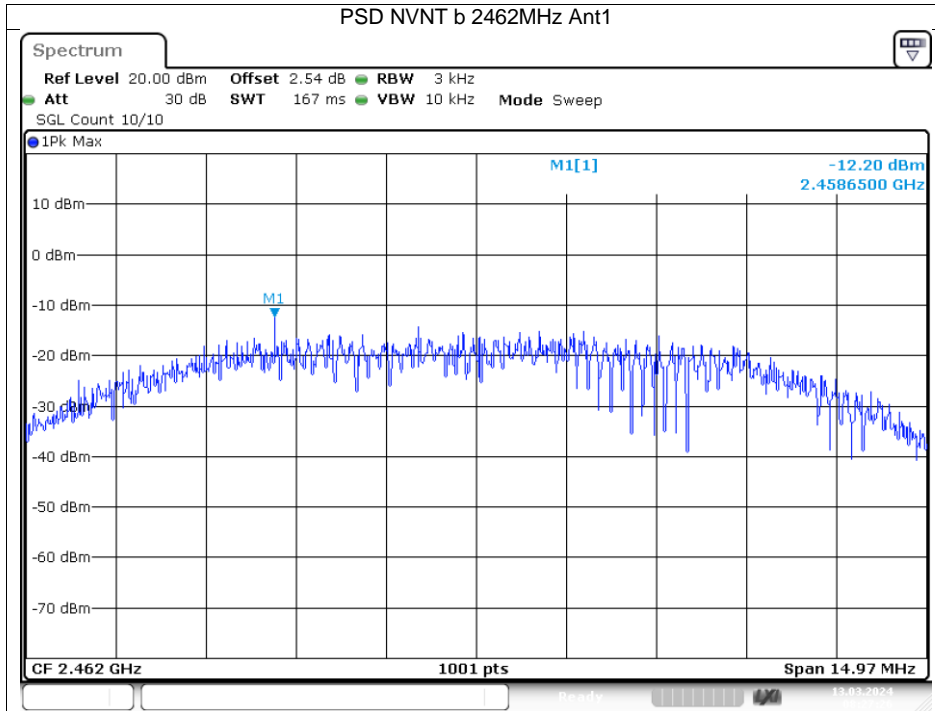

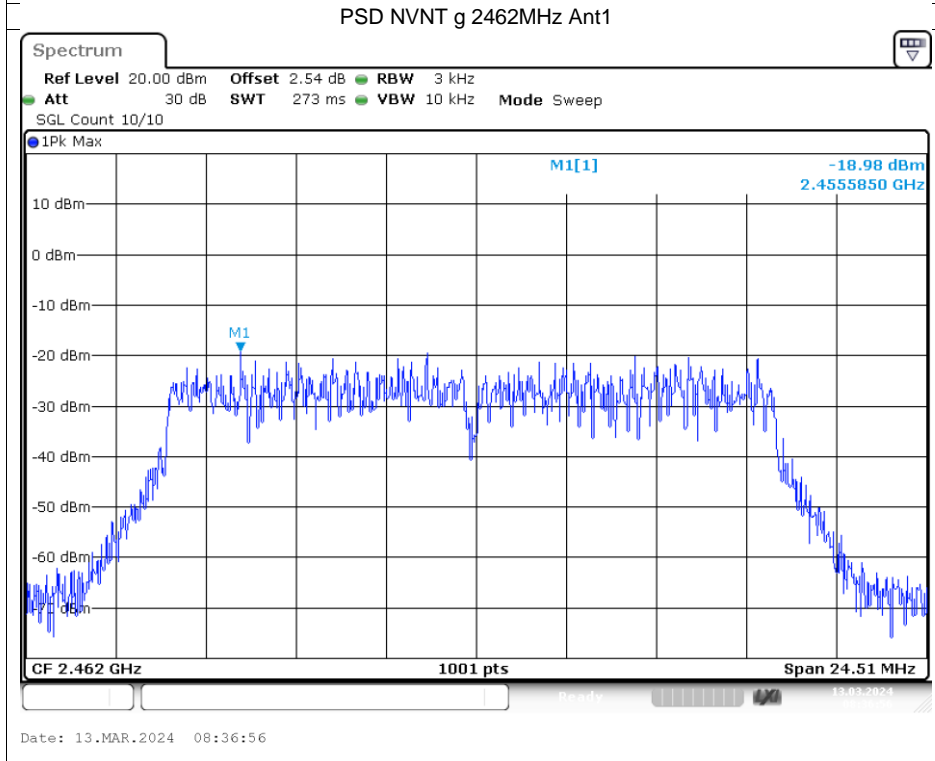

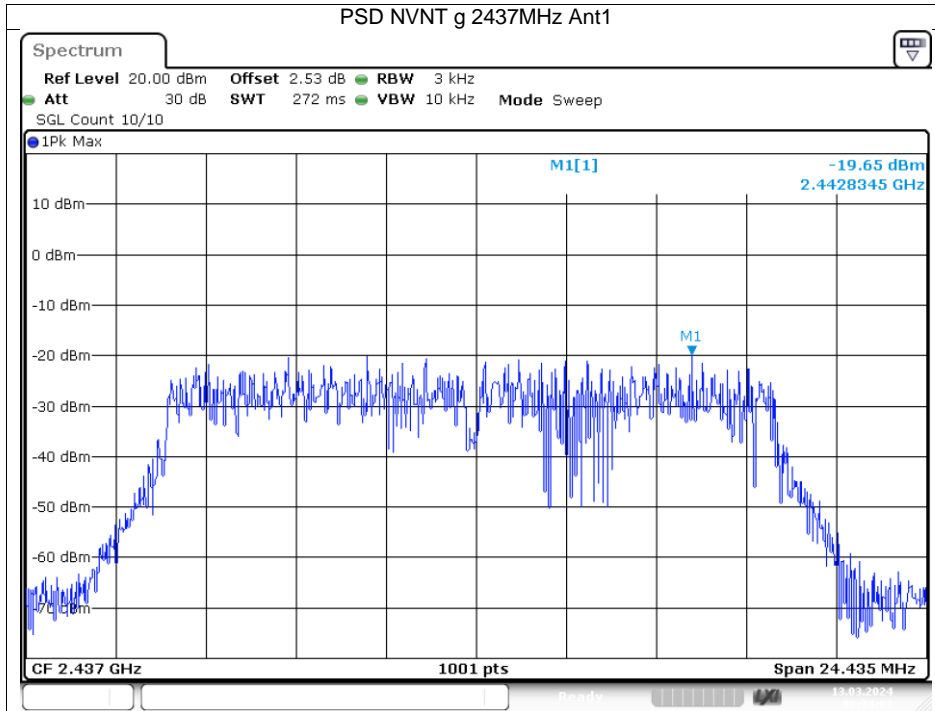


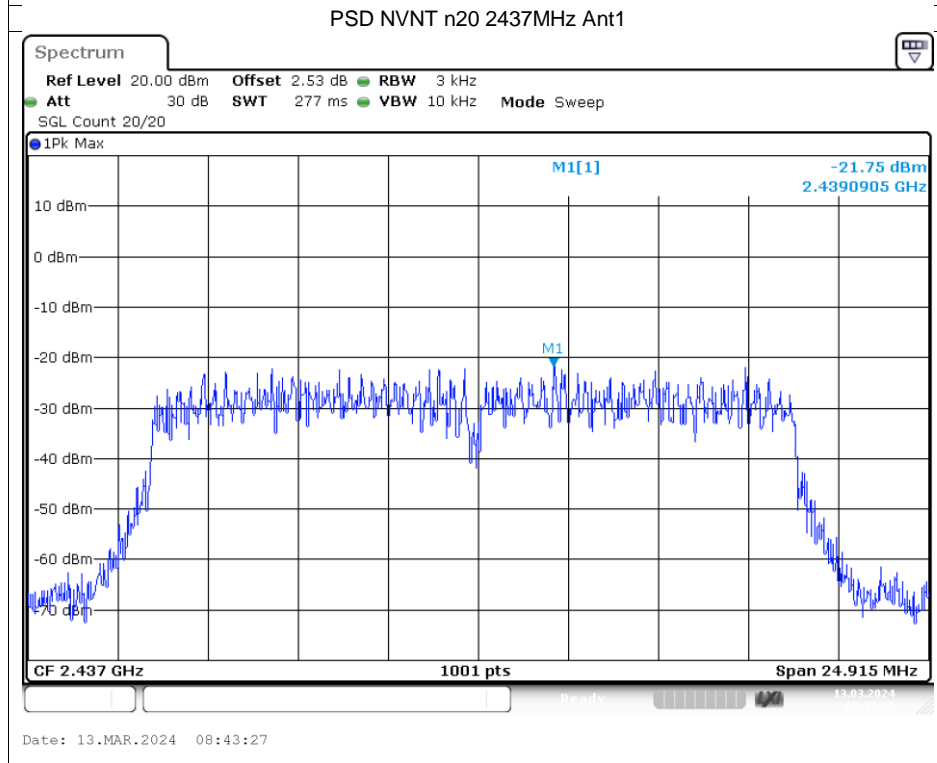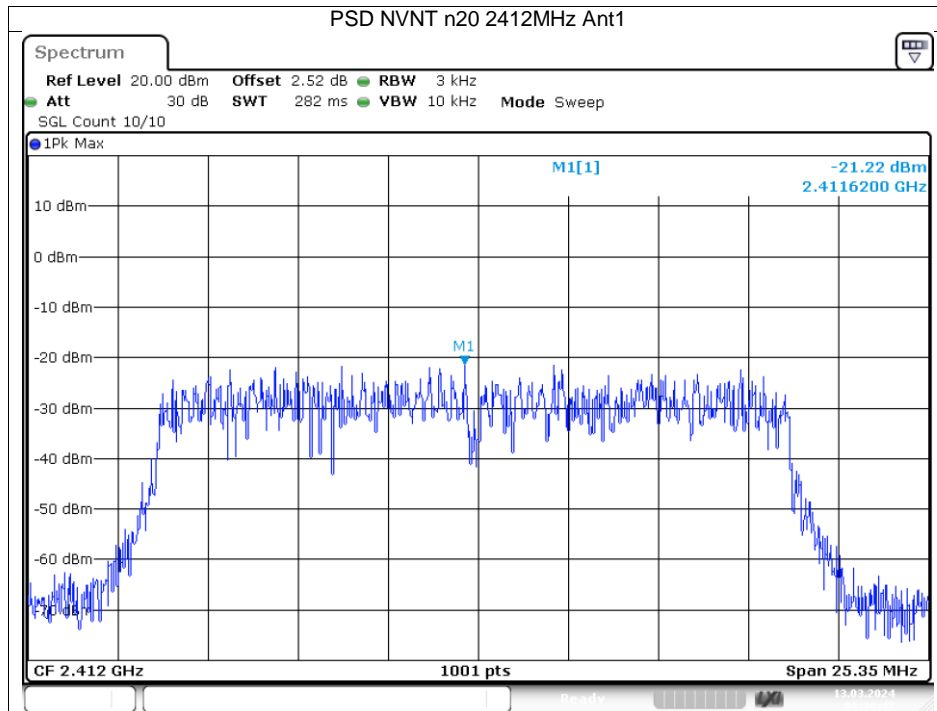

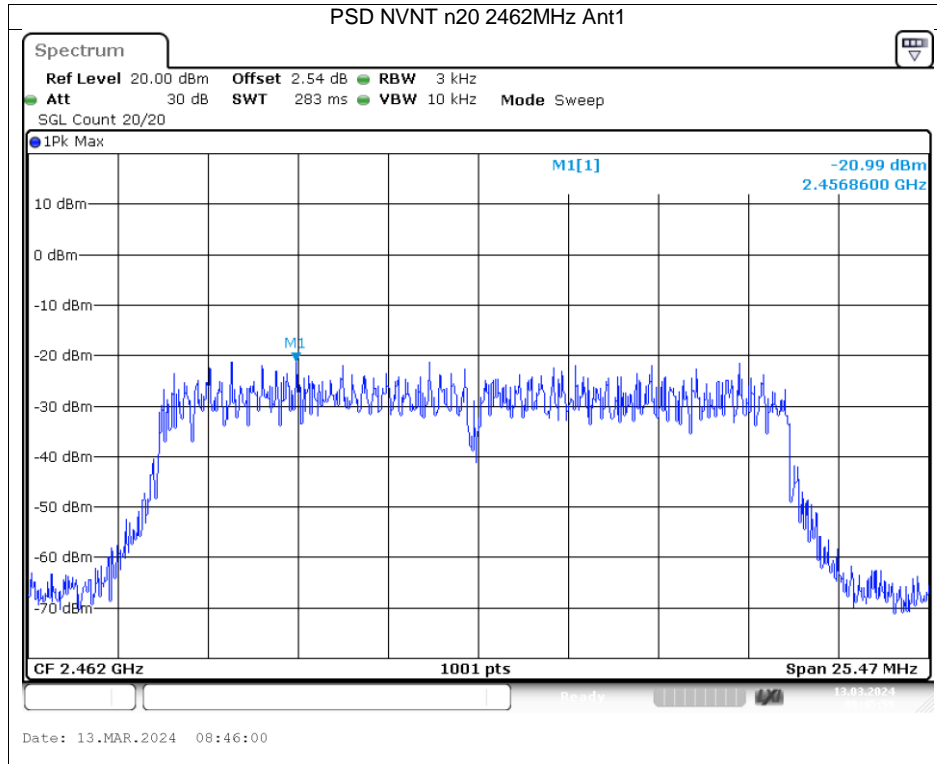


Band Edge


Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	b	2412	Ant1	-45.66	-20	Pass
NVNT	b	2462	Ant1	-48.13	-20	Pass
NVNT	g	2412	Ant1	-43.86	-20	Pass
NVNT	g	2462	Ant1	-48.43	-20	Pass
NVNT	n20	2412	Ant1	-42.36	-20	Pass
NVNT	n20	2462	Ant1	-48.02	-20	Pass

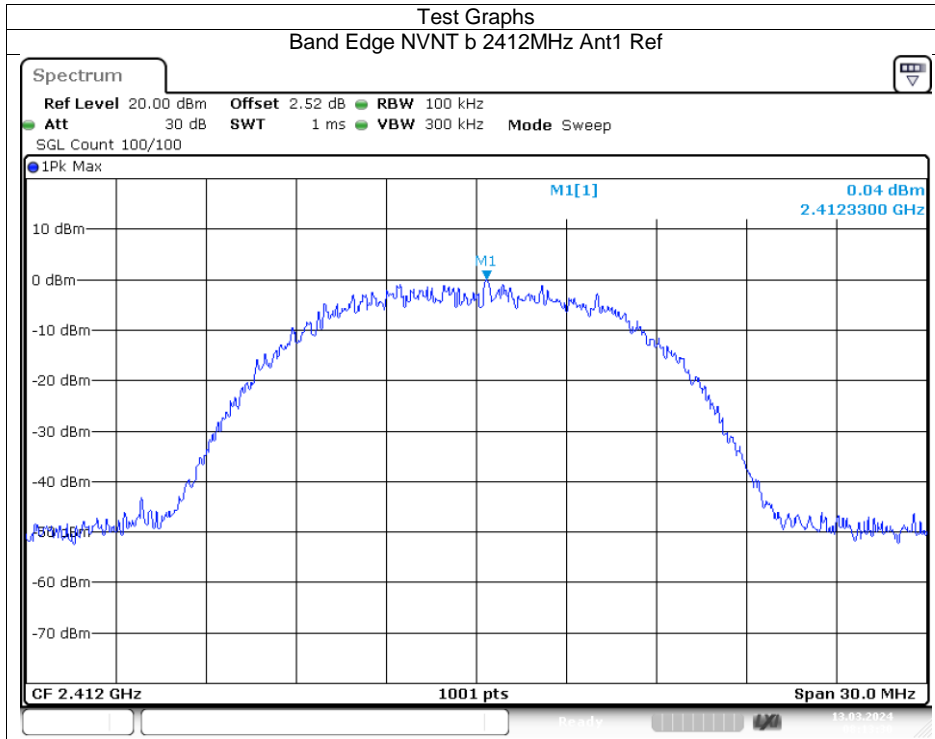


Date: 13.MAR.2024 08:13:29

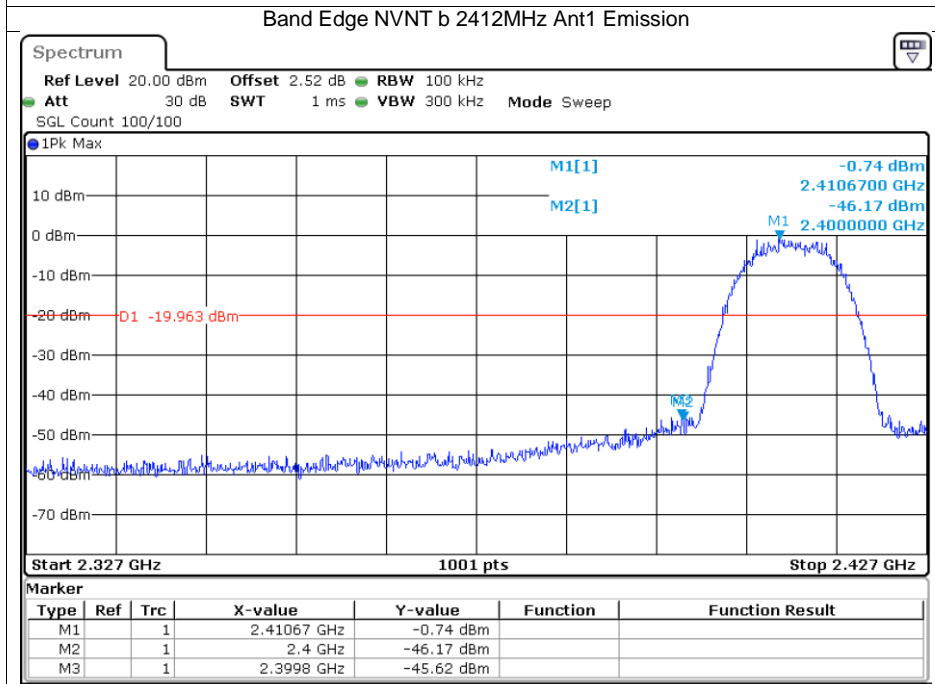



Date: 13.MAR.2024 08:13:33

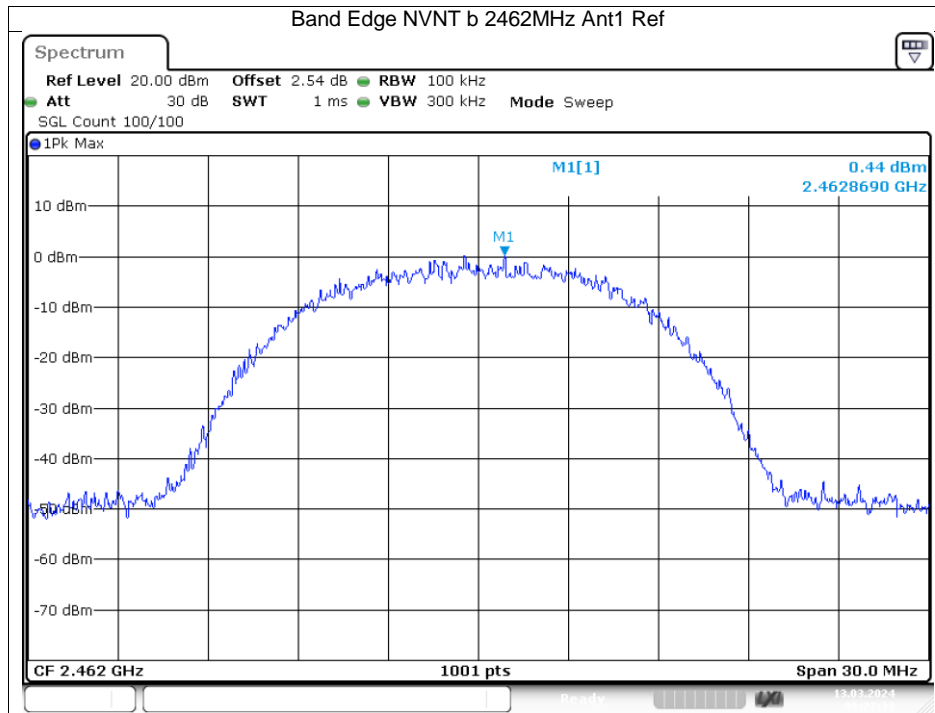


Date: 13.MAR.2024 08:27:33

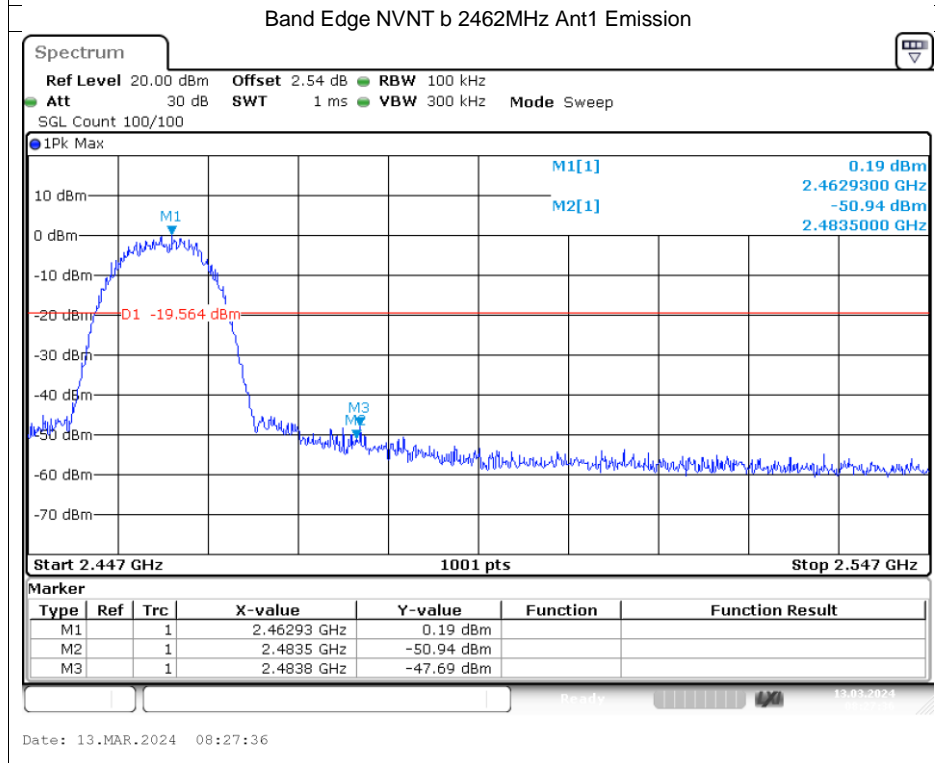


Date: 13.MAR.2024 08:27:36

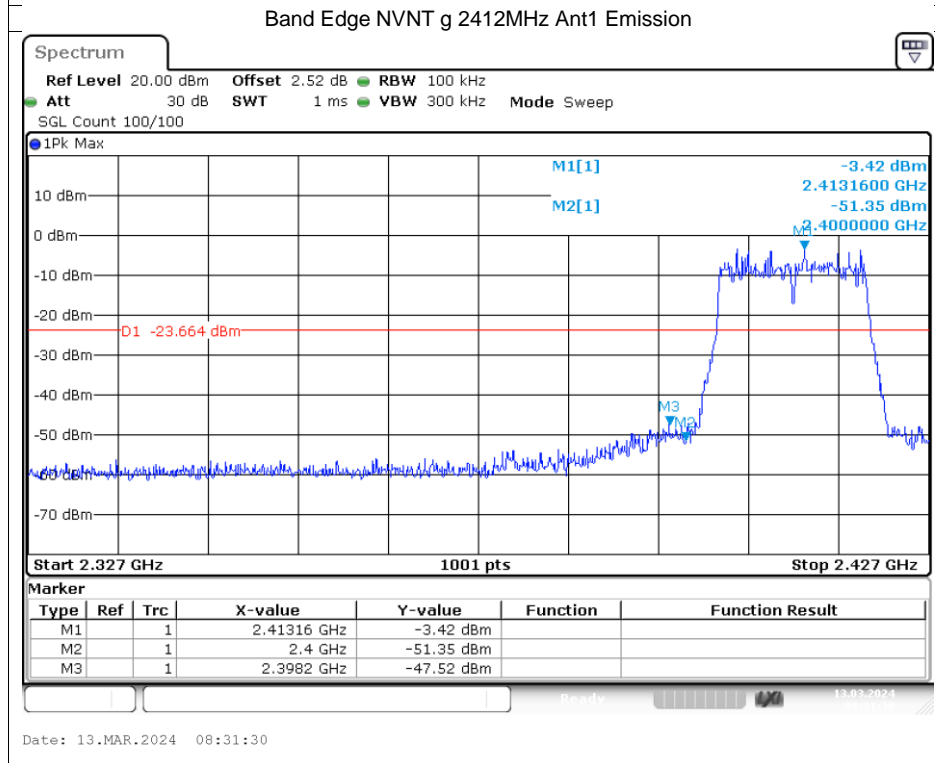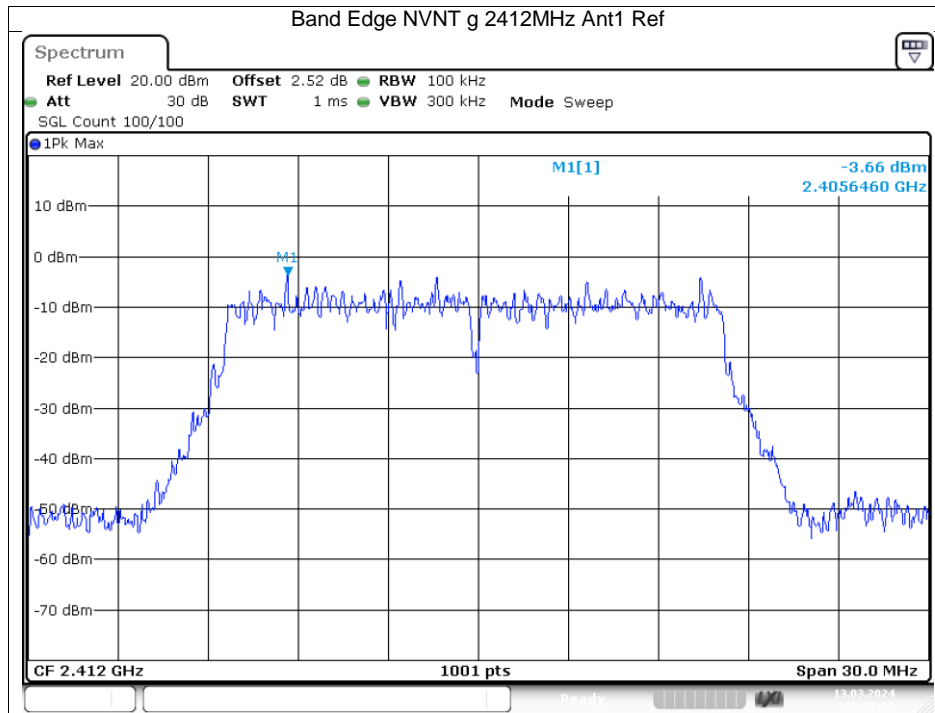


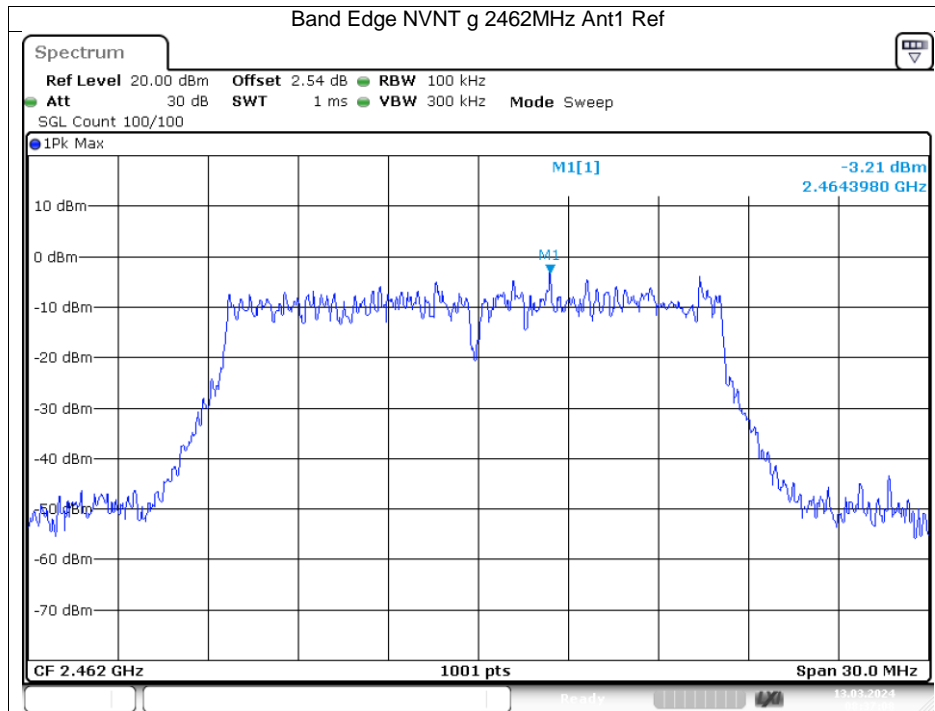


Date: 13.MAR.2024 08:37:08

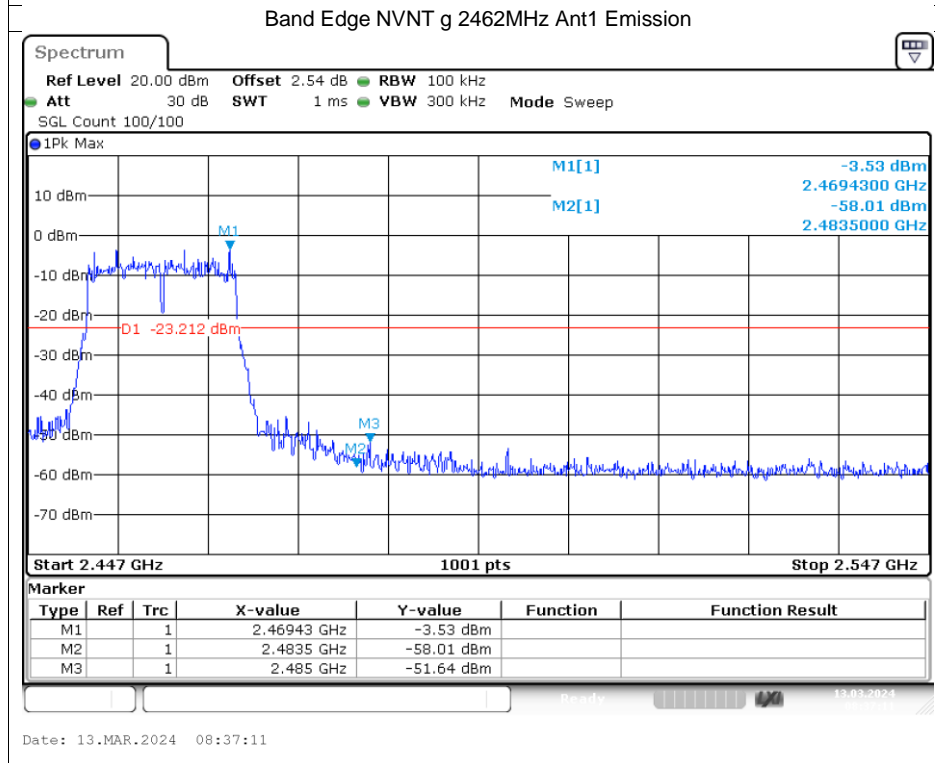



Date: 13.MAR.2024 08:37:11

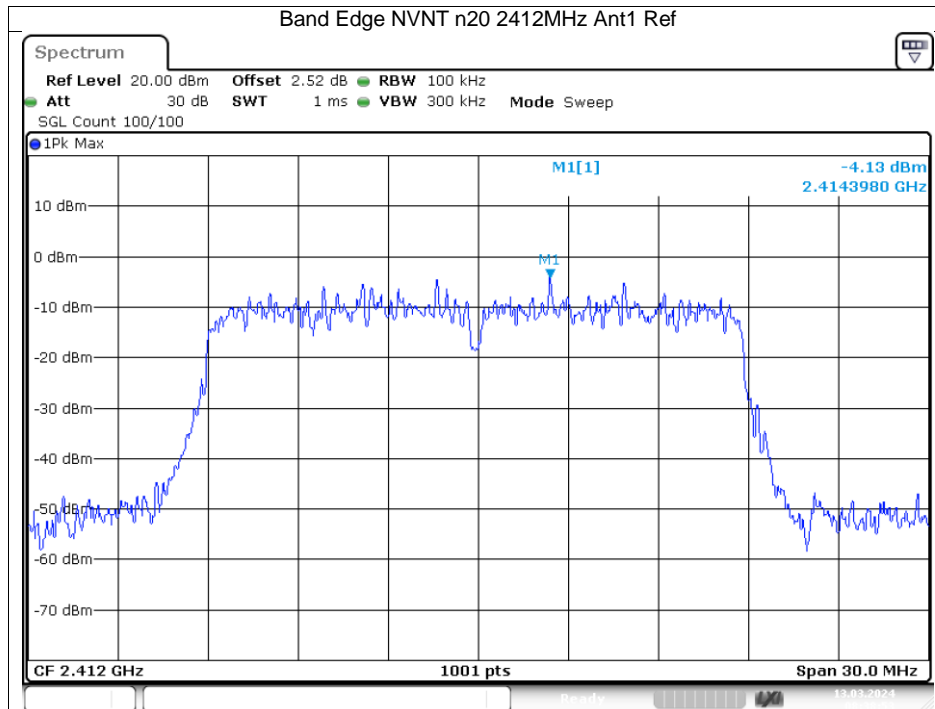

Date: 13.MAR.2024 08:38:54


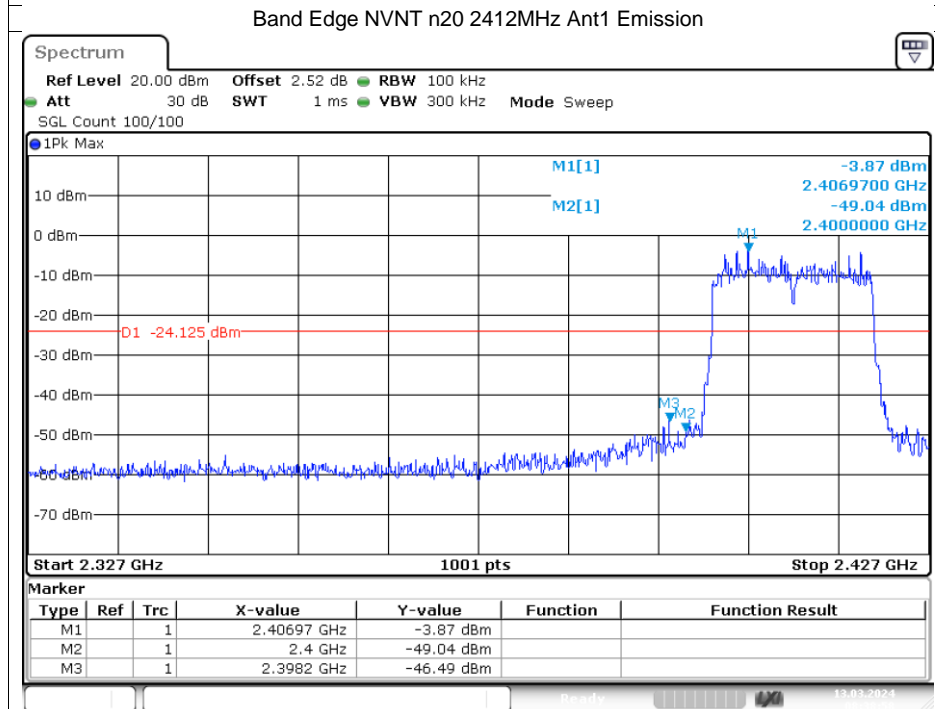




Date: 13.MAR.2024 08:38:57

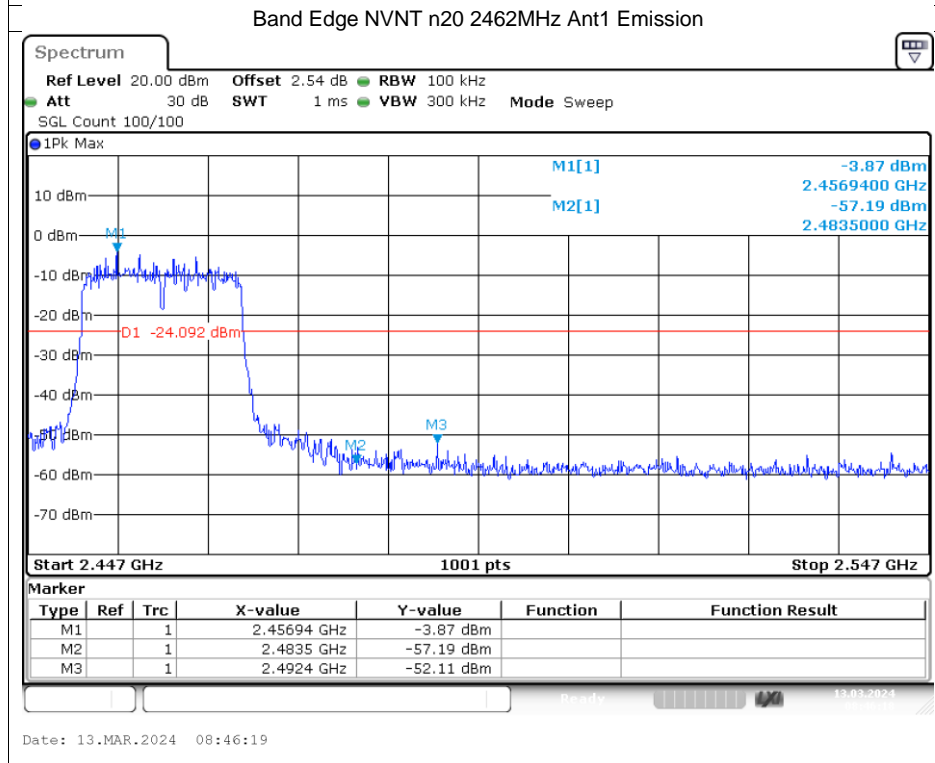
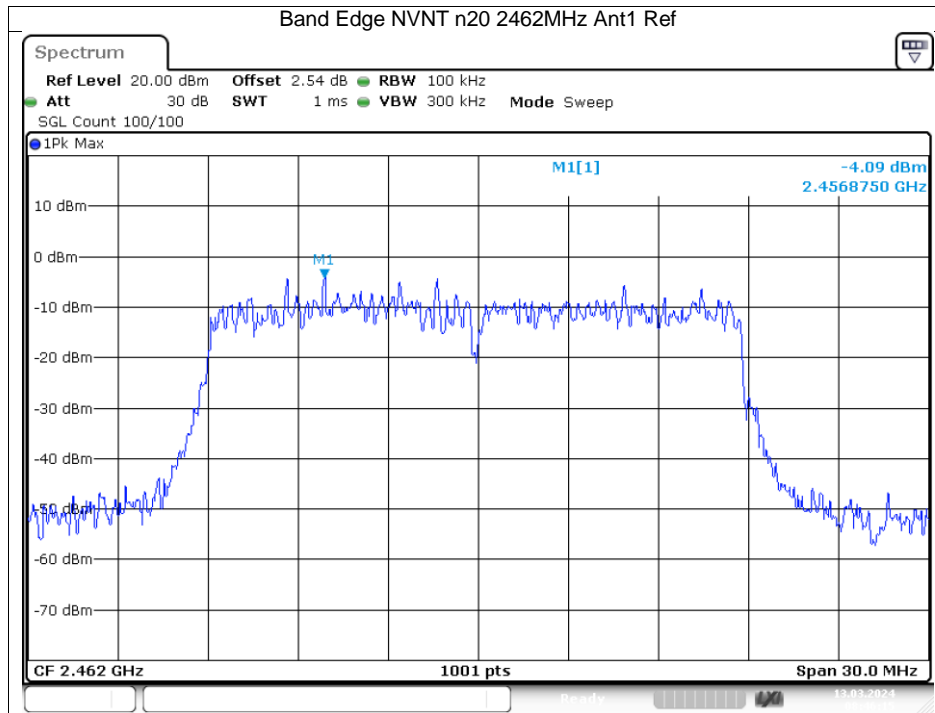




Conducted RF Spurious Emission



Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	b	2412	Ant1	-49.94	-20	Pass
NVNT	b	2437	Ant1	-47.55	-20	Pass
NVNT	b	2462	Ant1	-48.93	-20	Pass
NVNT	g	2412	Ant1	-47.27	-20	Pass
NVNT	g	2437	Ant1	-46.53	-20	Pass
NVNT	g	2462	Ant1	-46.67	-20	Pass
NVNT	n20	2412	Ant1	-46.35	-20	Pass
NVNT	n20	2437	Ant1	-44.24	-20	Pass
NVNT	n20	2462	Ant1	-45.84	-20	Pass

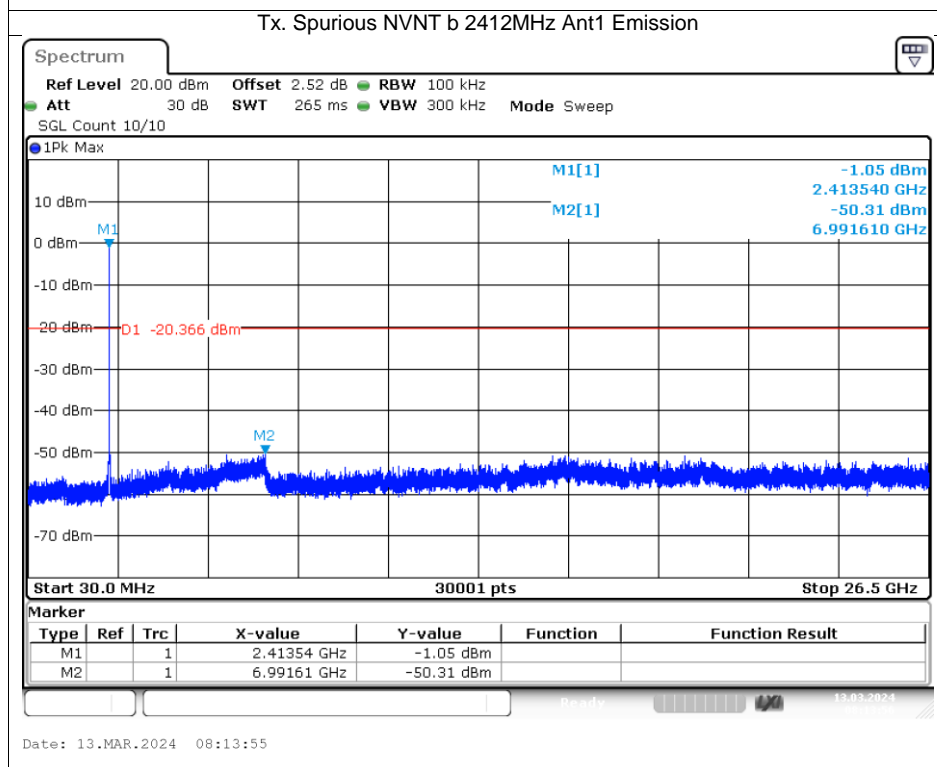
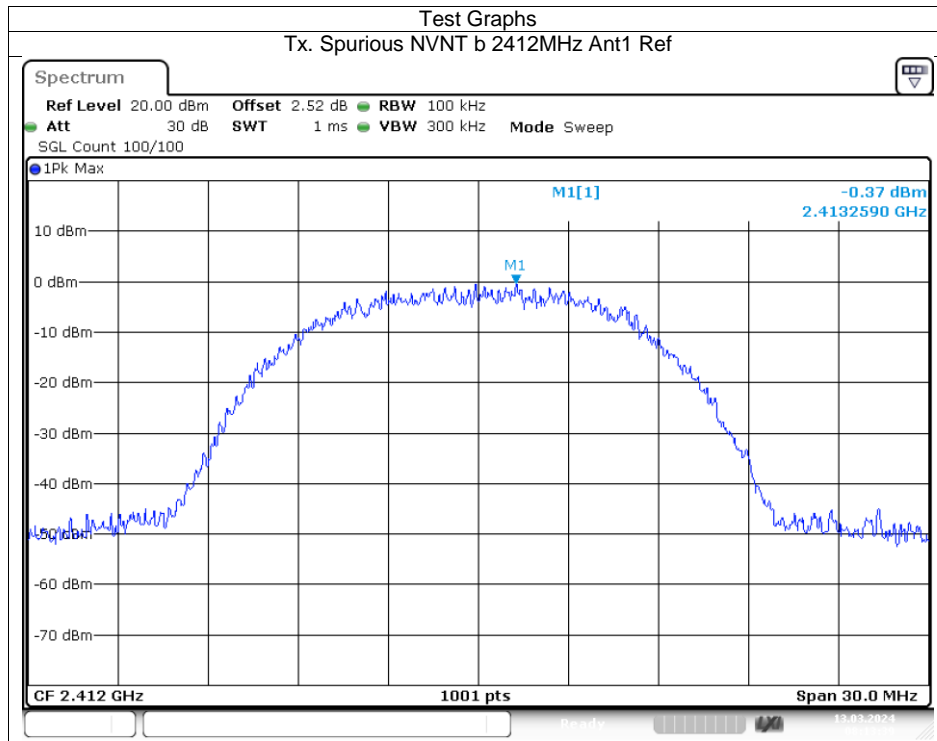


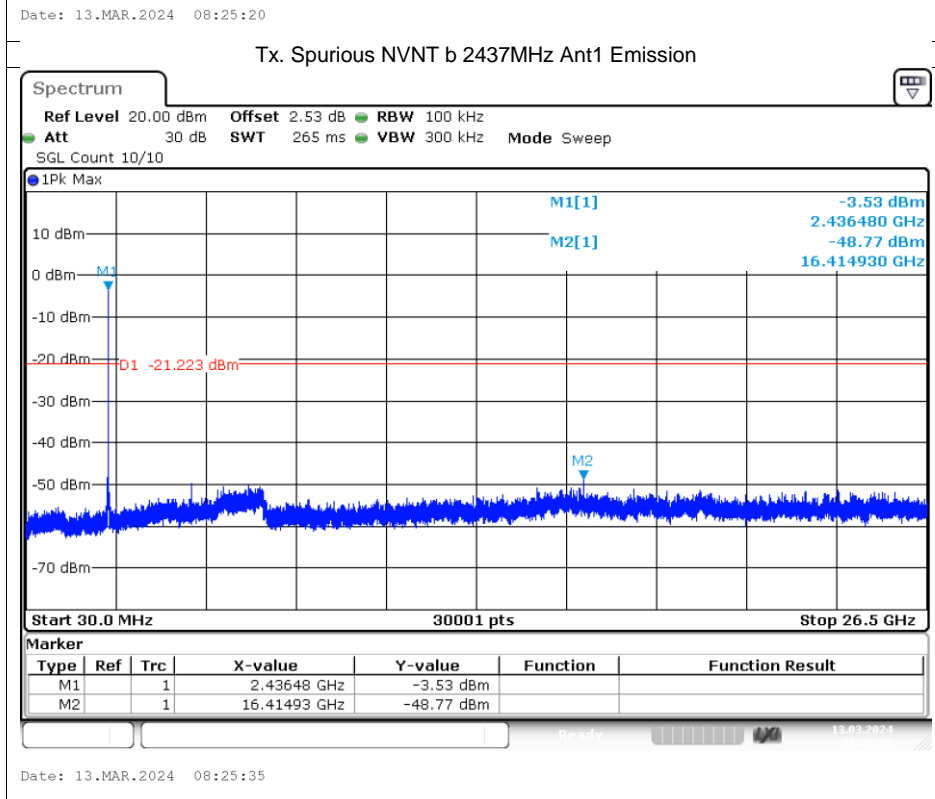
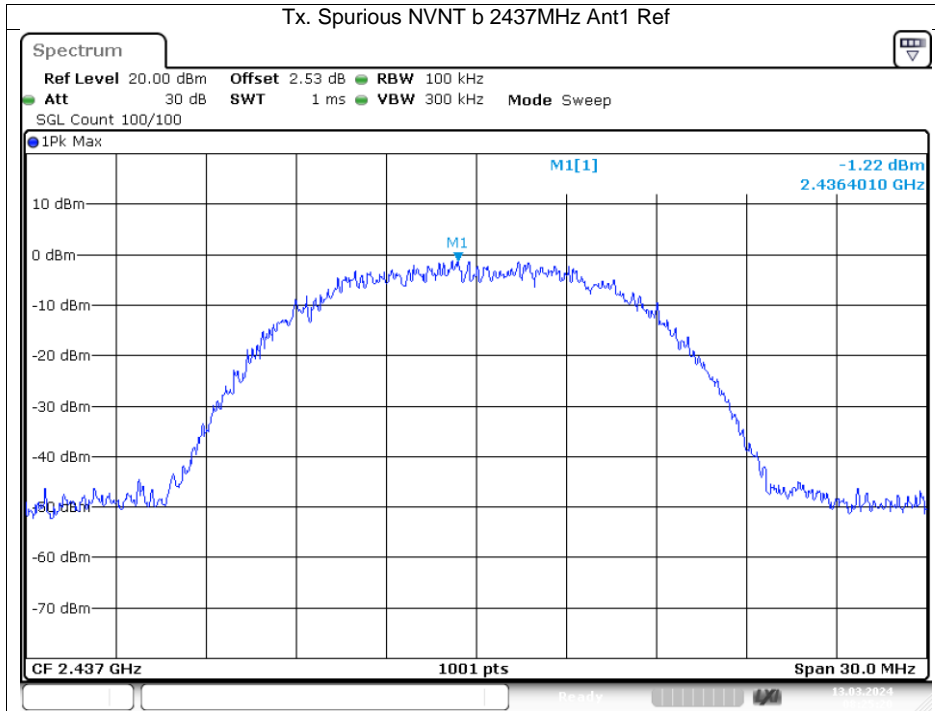


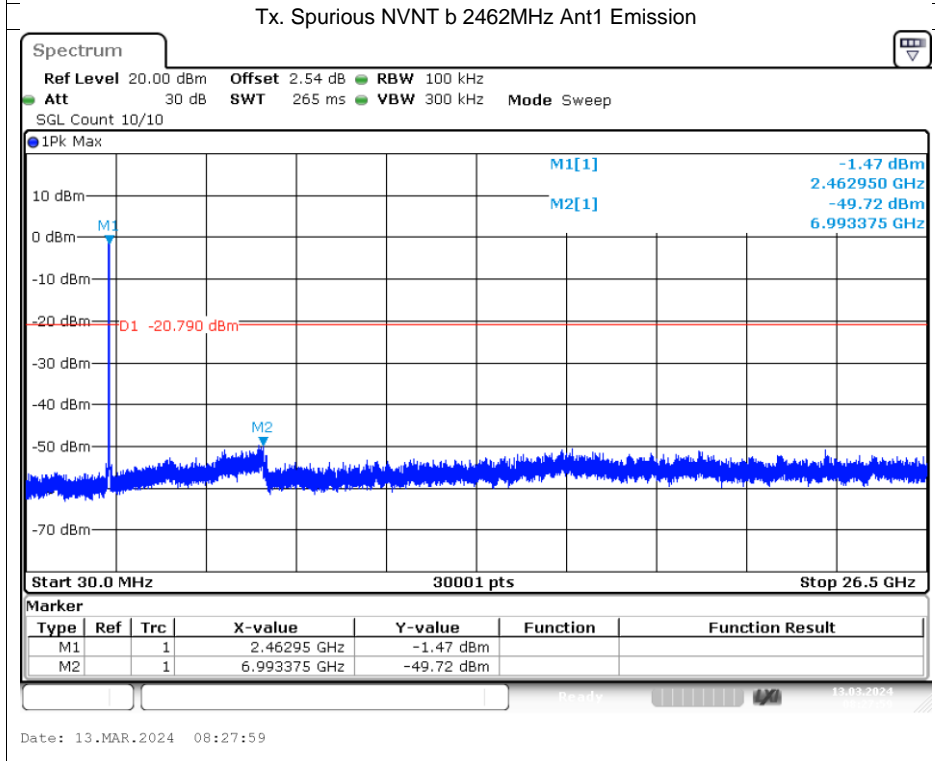
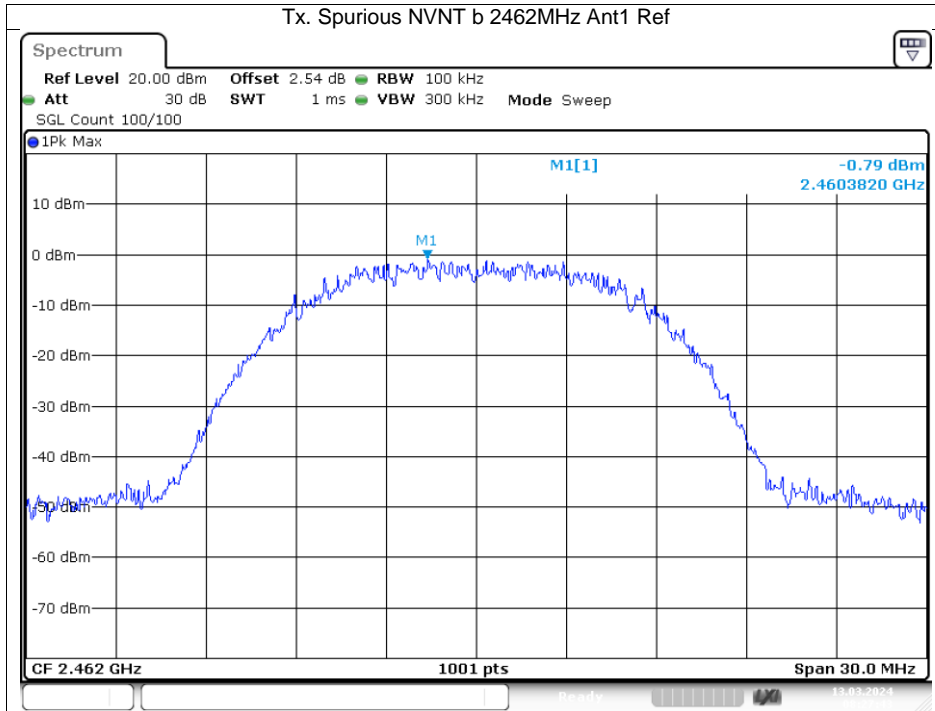


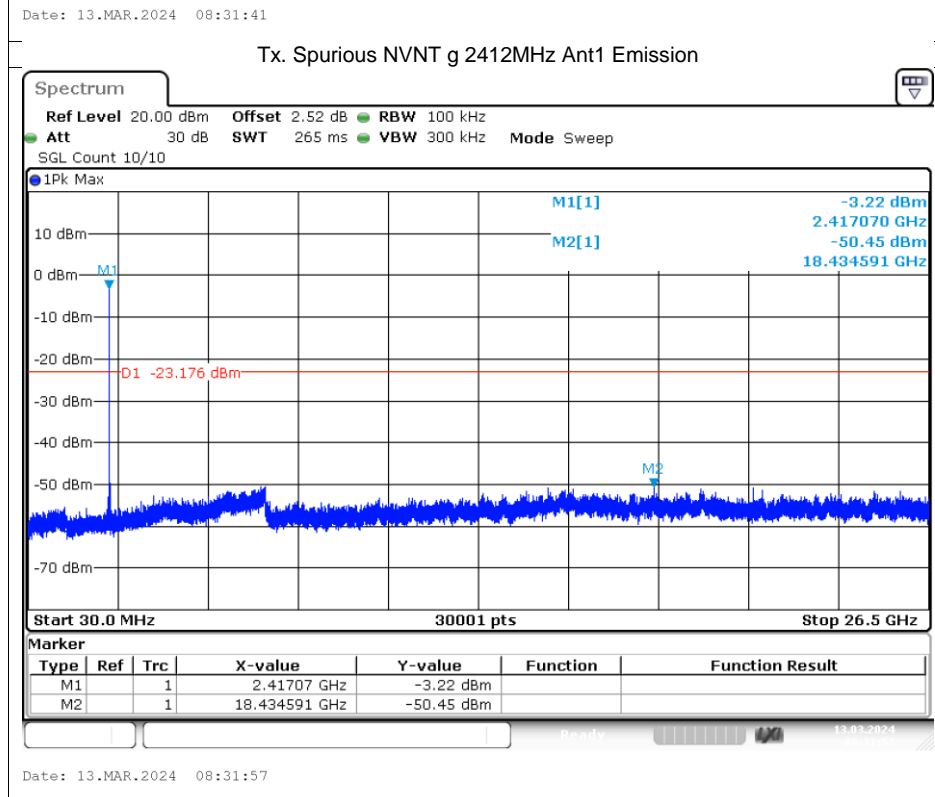
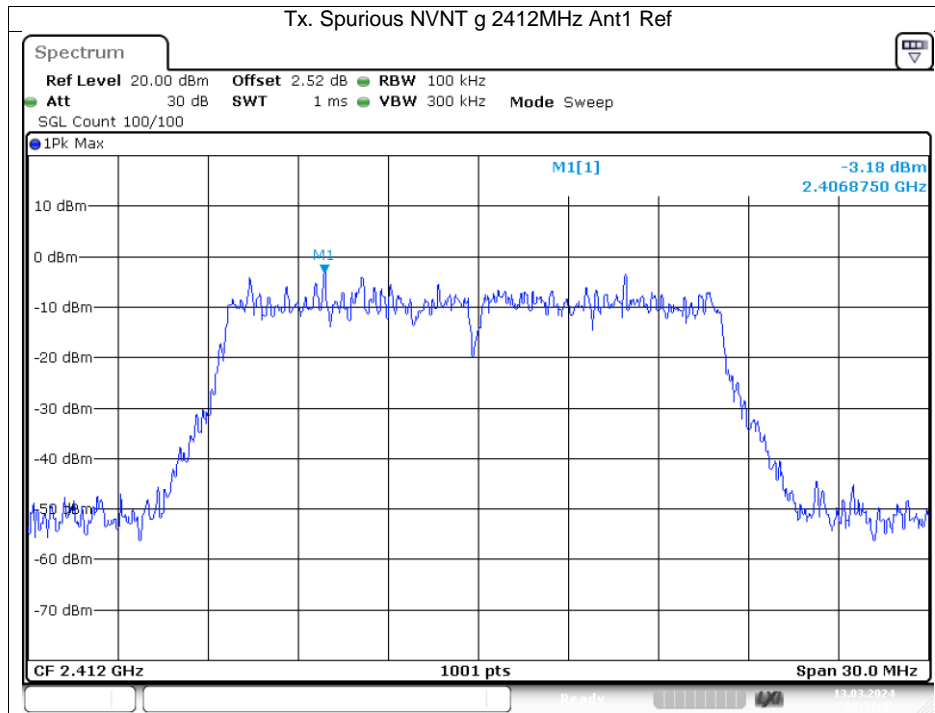


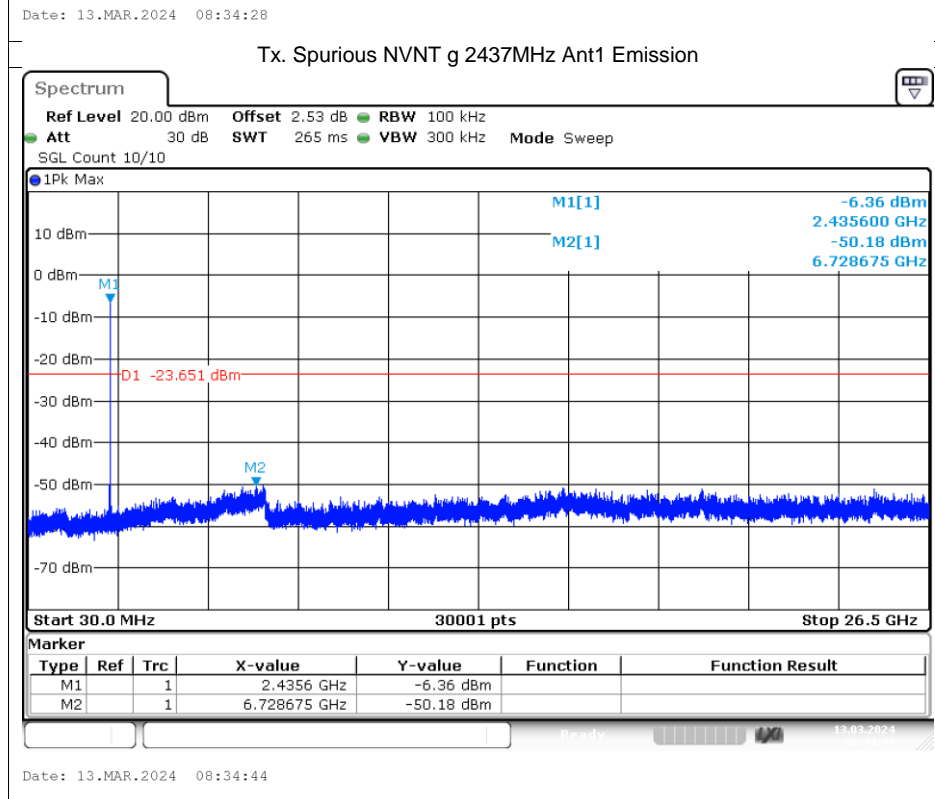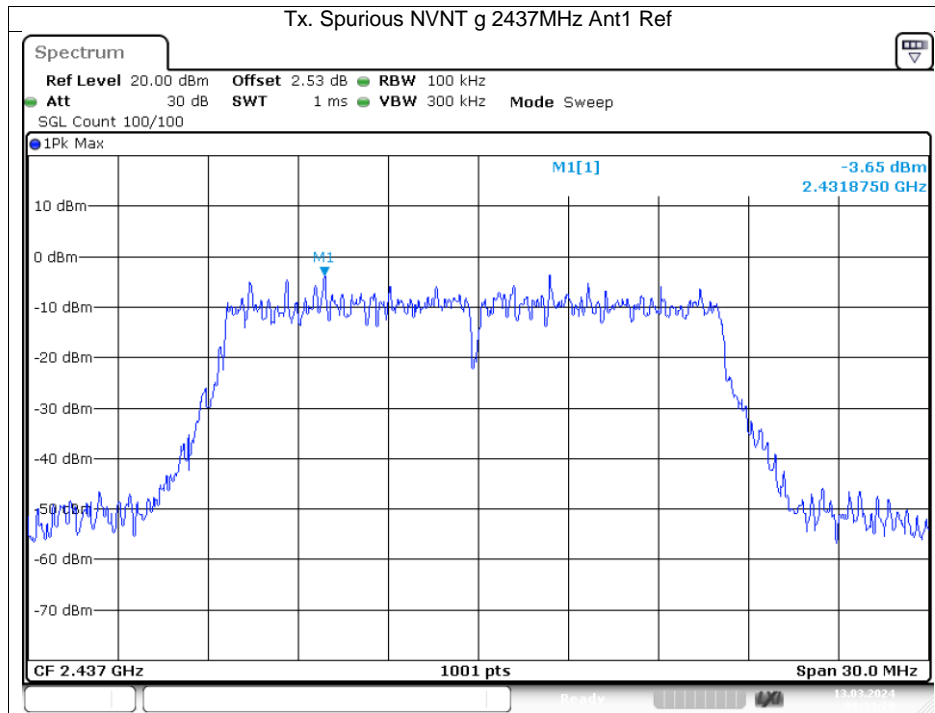

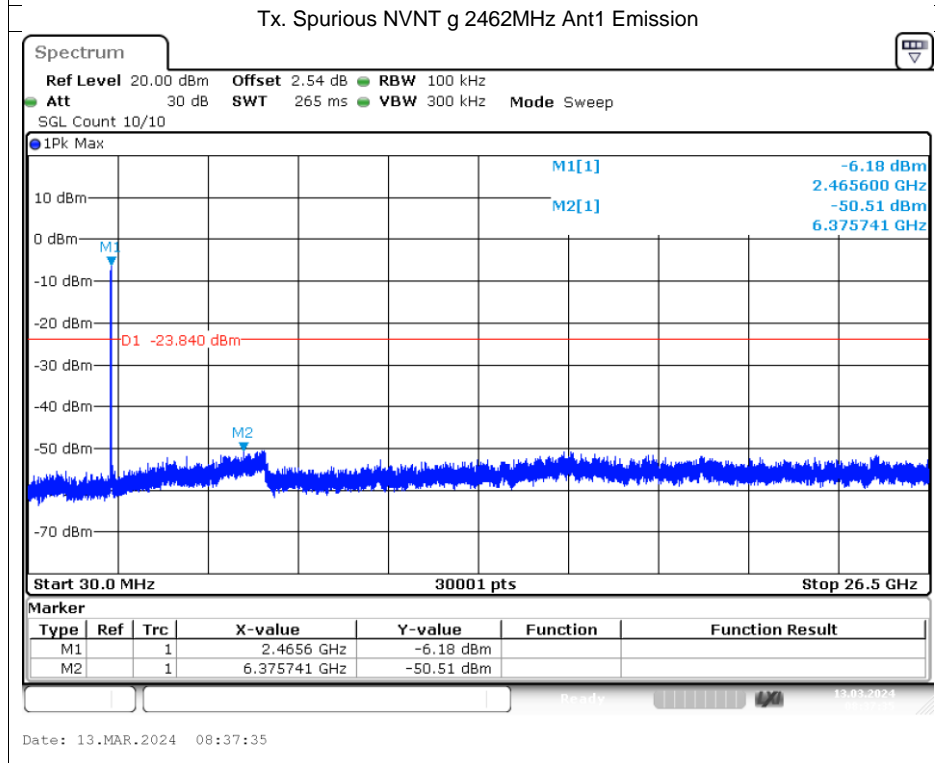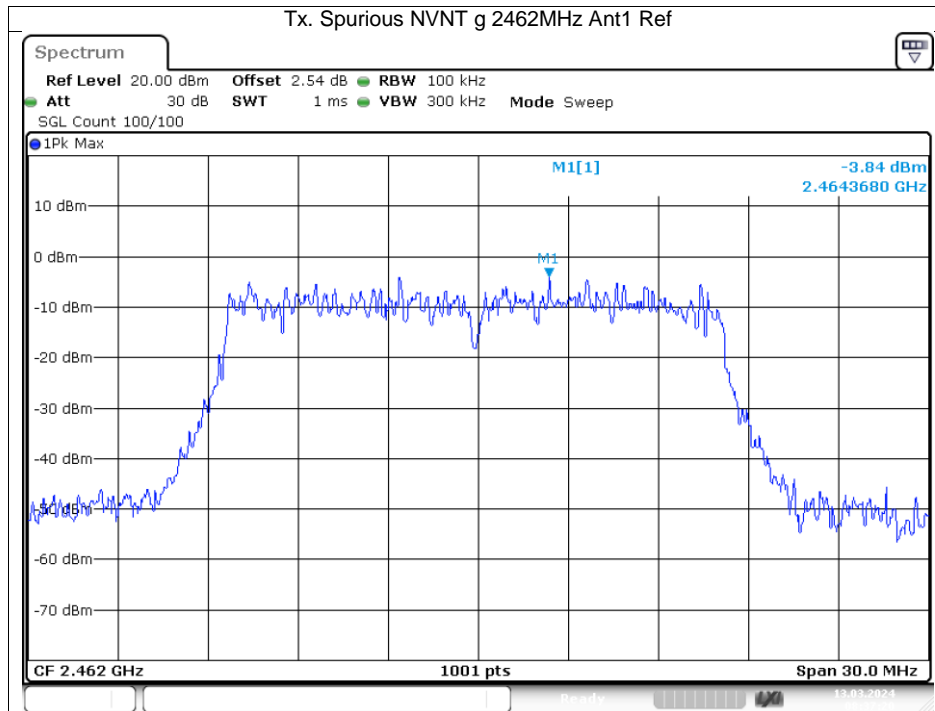

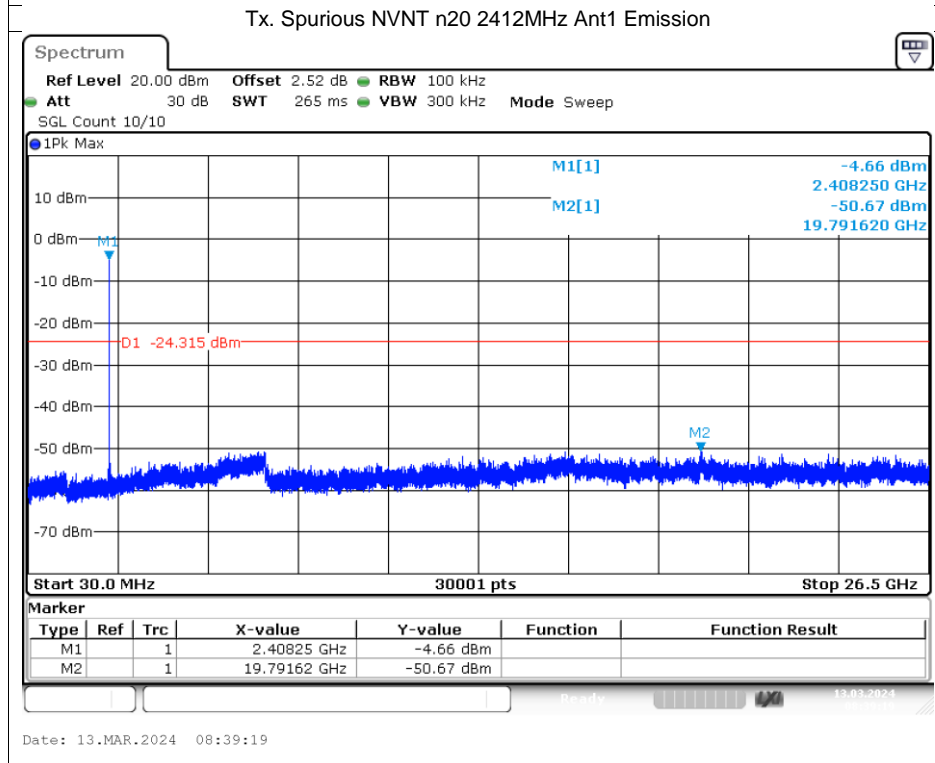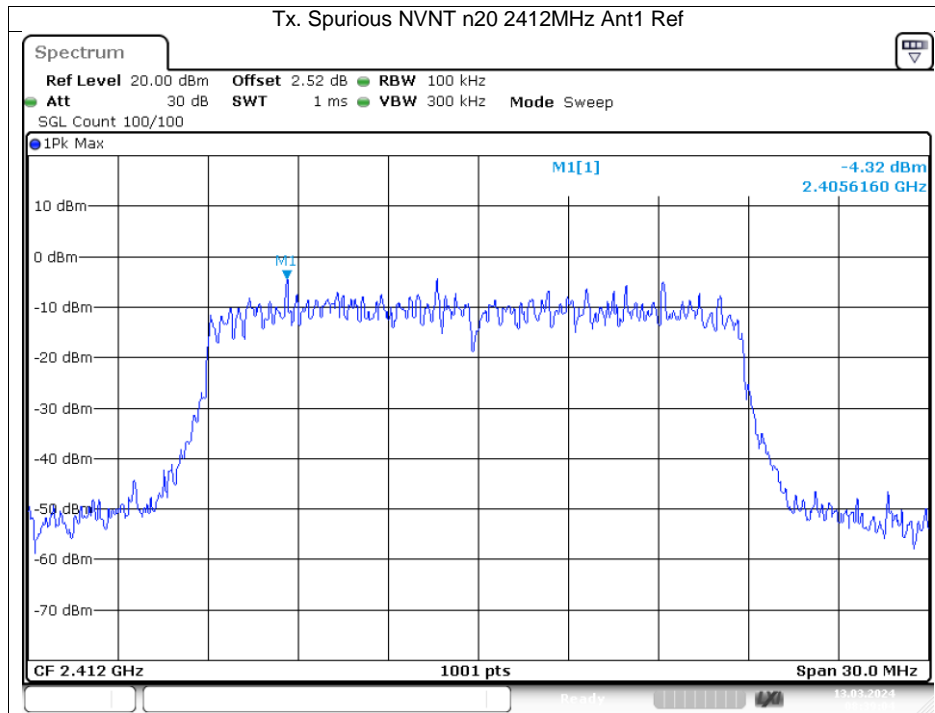

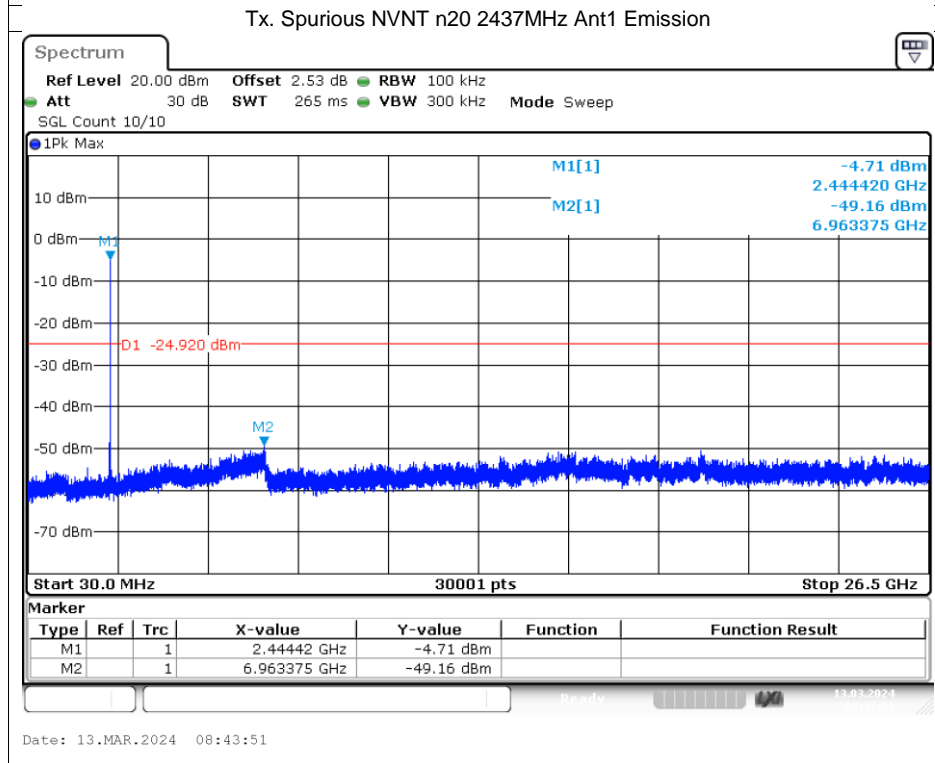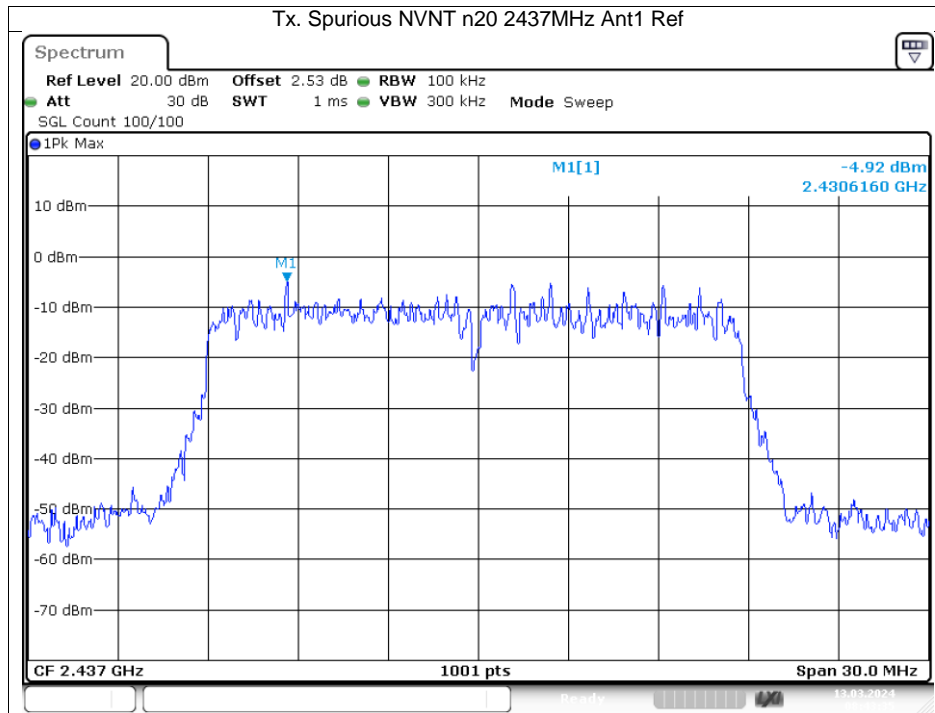

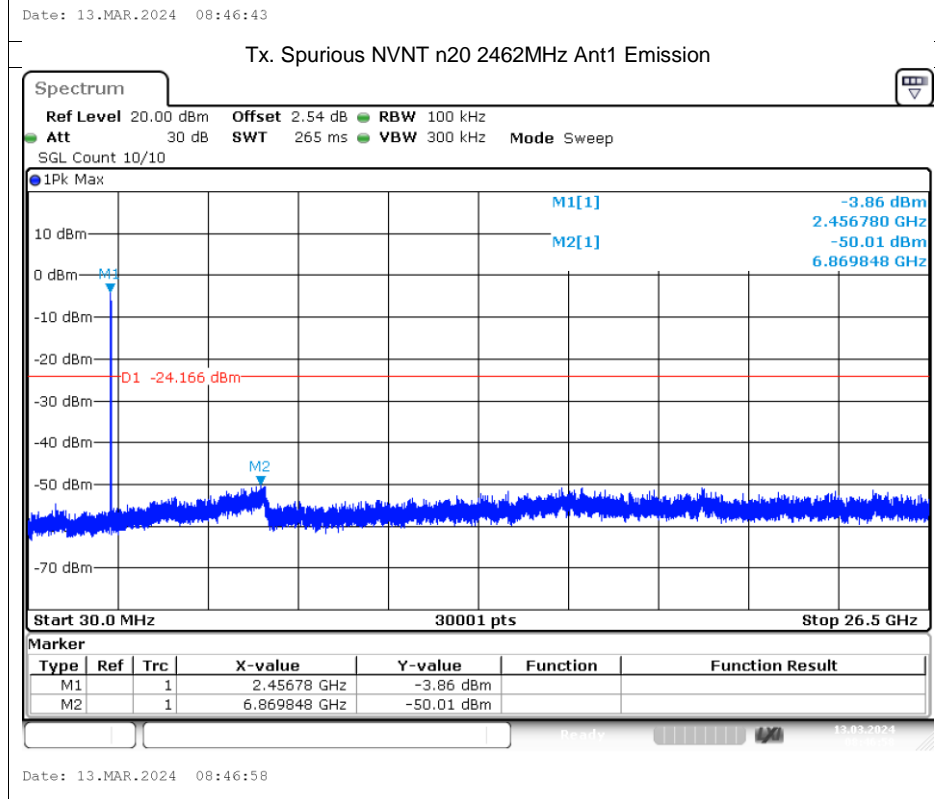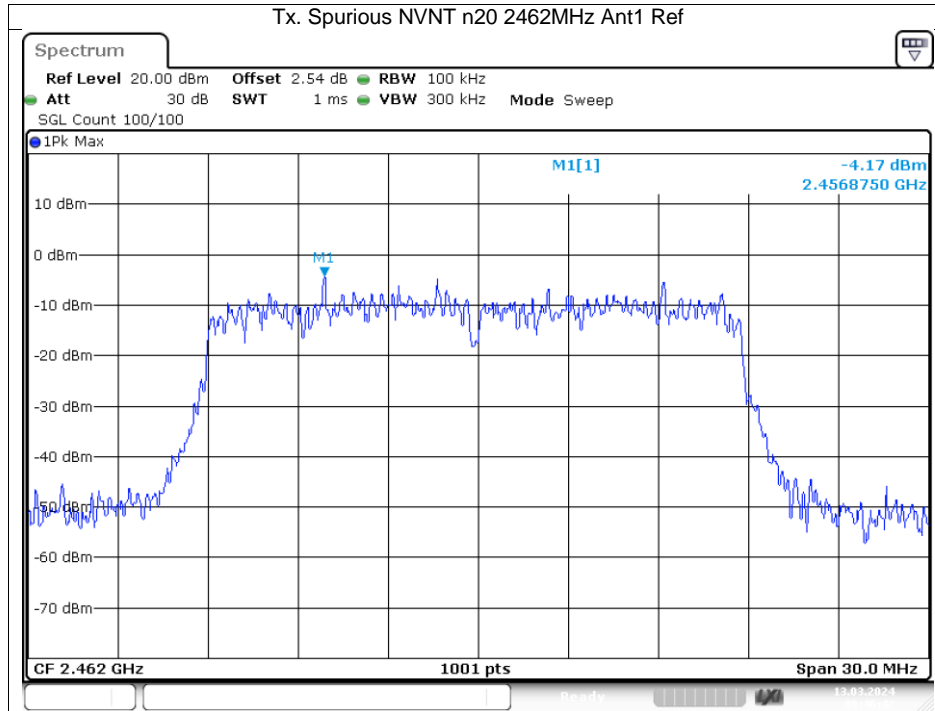



APPENDIX: PHOTOGRAPHS OF TEST CONFIGURATION

AC Power Line Conducted Emission



Radiated Band edge and Spurious Emission

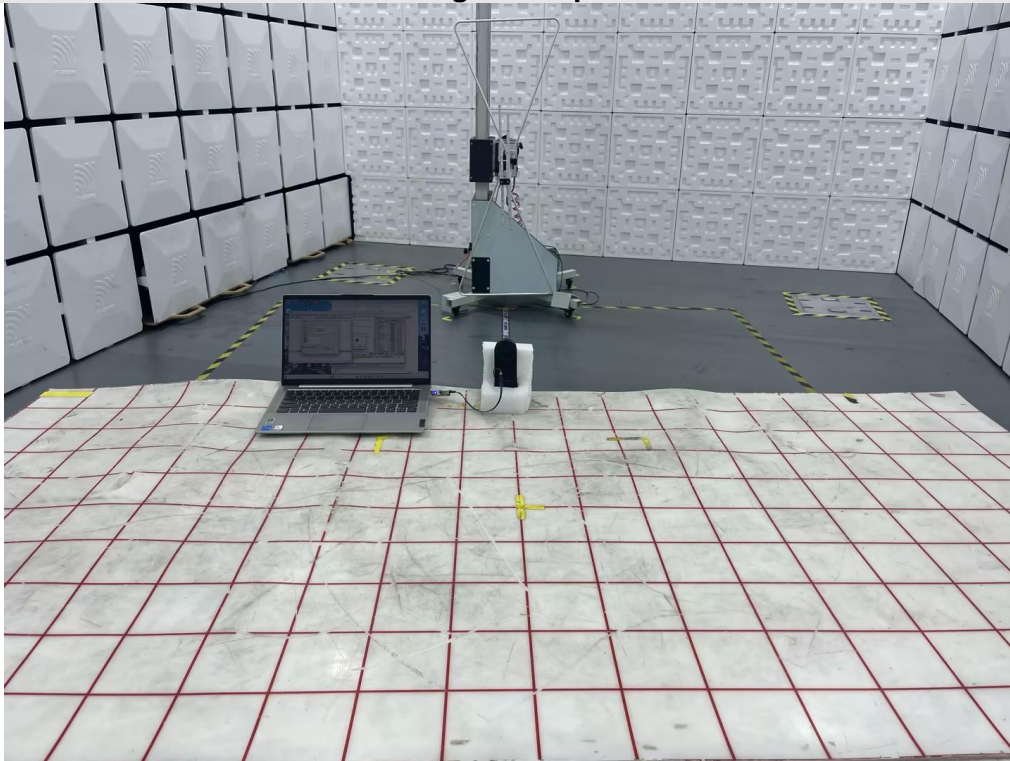

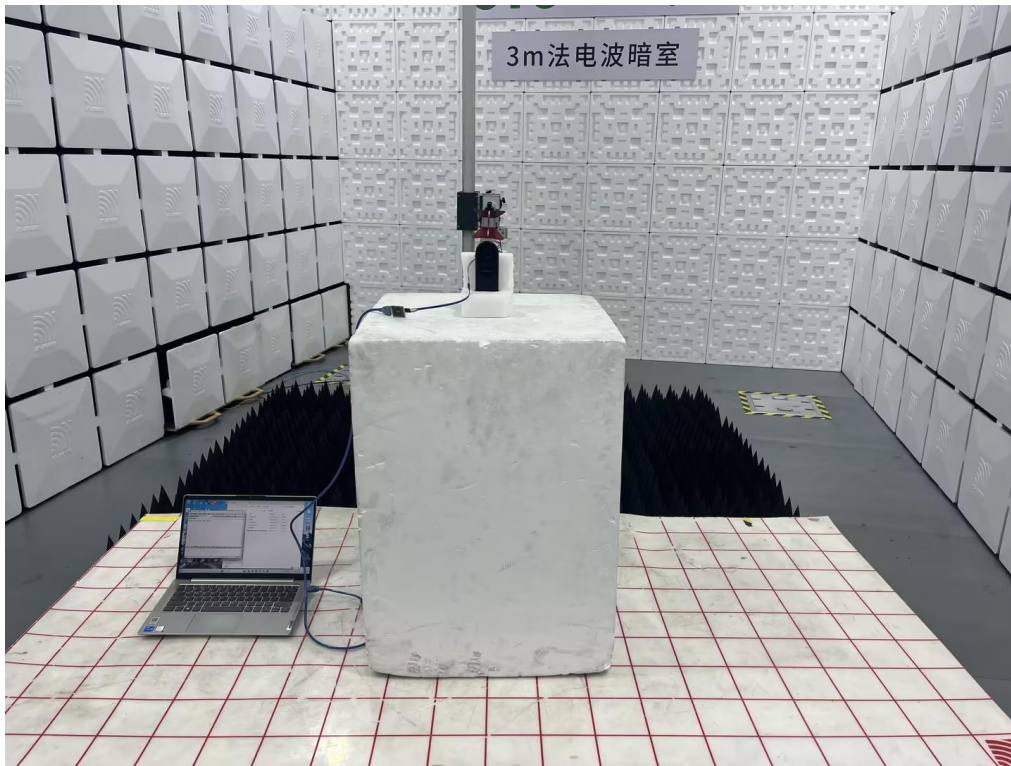

END OF REPORT